



**FINAL
PHASE I ENVIRONMENTAL SITE ASSESSMENT
OF**

**414 WEST 155TH STREET
NEW YORK, NY 10032**

ATC PROJECT NO. 015.26789.0002

MARCH 21, 2008

Prepared by:
ATC Associates Inc.
104 East 25th Street
New York, New York 10010
Phone: (212) 353-8280
Fax: (212) 979-8447

Prepared for:
Broadway Housing Communities
583 Riverside Drive, 7th Floor
New York, New York 10031
Attn: Mary Ann Villari

TABLE OF CONTENTS

1.0	EXECUTIVE SUMMARY.....	1
1.1	General Information.....	1
1.2	Findings and Conclusions Summary.....	2
1.3	Significant Data Gap Summary	4
1.4	Recommendations.....	4
2.0	INTRODUCTION.....	6
2.1	Purpose.....	6
2.2	Scope.....	6
2.3	Significant Assumption.....	7
2.4	Limitations and Exceptions.....	8
2.5	Special Terms and Conditions (User Reliance)	10
3.0	SITE DESCRIPTION.....	11
3.1	Location and Legal Description	11
3.2	Surrounding Area General Characteristics.....	11
3.3	Current Use of the Site.....	11
3.4	Description of Site Improvements	11
3.5	Current Uses of Adjoining Properties	12
4.0	USER PROVIDED INFORMATION	13
4.1	Title Records.....	13
4.2	Environmental Liens or Activity and Use Limitations (AULs).....	13
4.3	Specialized Knowledge.....	13
4.4	Significant Valuation Reduction for Environmental Issues.....	13
4.5	Owner, Site Manager and Occupant Information	13
4.6	Reason for Performing Phase I ESA.....	13
4.7	Other User Provided Documents	13
5.0	RECORDS REVIEW	14
5.1	Standard Environmental Records.....	14
5.1.1	Federal Agency Database Findings.....	15
5.1.2	State and Tribal Database Findings	15
5.1.3	Local Environmental Records Sources	18
5.2	Physical Setting Sources	20
5.2.1	Topography	20
5.2.2	Geology.....	20
5.2.3	Soils	20
5.2.4	Hydrology	20
5.2.5	Other Physical Setting Sources.....	20
5.3	Historical Records Sources	21
5.3.1	Aerial Photographs.....	23
5.3.2	Fire Insurance Maps.....	23
5.3.3	Site Tax Files	24
5.3.4	Recorded Land Title Records	25
5.3.5	Historical USGS Topographic Quadrangles	25
5.3.6	City Directories.....	25
5.3.7	Building Department Records.....	25

5.3.8	Zoning/Land Use Records	25
5.3.9	Prior Reports	25
5.3.10	Other Historical Sources	25
6.0	SITE RECONNAISSANCE	26
6.1	Methodology and Limiting Conditions.....	26
6.2	Hazardous Substance Use, Storage, and Disposal	26
6.3	Underground Storage Tanks (USTs).....	26
6.4	Aboveground Storage Tanks (ASTs).....	26
6.5	Other Petroleum Products	27
6.6	Polychlorinated Biphenyls (PCBs)	27
6.7	Unidentified Substance Containers.....	27
6.8	Non-hazardous Solid Waste.....	27
6.9	Wastewater.....	27
6.10	Waste Pits, Ponds and Lagoons	27
6.11	Sumps.....	27
6.12	Septic Systems	27
6.13	Stormwater Management System	28
6.14	Wells	28
7.0	INTERVIEWS.....	29
8.0	OTHER ENVIRONMENTAL CONDITIONS	30
8.1	Asbestos-Containing Material (ACM).....	30
8.2	Radon	30
8.3	Lead in Drinking Water	30
8.4	Lead-Based Paint (LBP)	31
8.5	Mold Screening Survey.....	31
8.6	Additional User Requested Conditions.....	31
9.0	REFERENCES.....	32
10.0	APPENDICES.....	33
	APPENDIX A SITE VICINITY MAP	
	APPENDIX B SITE PLAN	
	APPENDIX C SITE PHOTOGRAPHS	
	APPENDIX D USER PROVIDED DOCUMENTATION	
	APPENDIX E REGULATORY DATABASE REPORT	
	APPENDIX F AERIAL PHOTOGRAPHS (NOT USED)	
	APPENDIX G HISTORICAL RESEARCH DOCUMENTATION	
	APPENDIX H PRIOR REPORTS (NONE PROVIDED)	
	APPENDIX I RESUMES	
	APPENDIX J RECORDS OF COMMUNICATION	
	APPENDIX K LABORATORY REPORTS (NOT USED)	
	APPENDIX L OTHER SUPPORTING DOCUMENTATION	
	APPENDIX M TERMINOLOGY	

1.0 EXECUTIVE SUMMARY

1.1 General Information

Project Information:

Consultant Information:

ATC Associates Inc.
104 East 25th Street
New York, New York 10010

Telephone: 212-353 8280

Fax: 212-979 8447

Reconnaissance Date: 11/13/2007

Site Assessor: Bedia Saray

Senior Reviewer: Matthew Mankovich

Environmental Professional: Matthew Mankovich

Site Information:

414 West 155th Street
New York, New York 10032
New York County

Site Access Contact:

Ms. Mary Ann Villari
Broadway Housing Communities

Client Information:

Broadway Housing Communities
Ms. Mary Ann Villari
583 Riverside Drive, 7th Floor


New York, NY 10031

Ph. (212) 568-2030

Fax (212) 690-4874

Environmental Professional Statement:

I declare that, to the best of my professional knowledge and belief, I meet the definition of *Environmental Professional* as defined in § 312.10 part of 40 CFR 312. We have the specific qualifications based on education, training and experience to assess a property of the nature, history and setting of the subject property. We have developed and performed the all appropriate inquiries in conformance with the standards and practices set forth in 40 CFR Part 312.

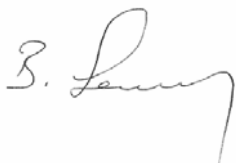

Project Manager



Matthew Mankovich
Senior Project Manager/Environmental Professional

1.2 Findings and Conclusions Summary

ATC Associates Inc. (ATC) has performed this Phase I Environmental Site Assessment (ESA) in conformance with the scope and limitations of ASTM Standard Practice E 1527-05 of the property located at 414 West 155th Street, New York, New York (hereinafter referred to as the "Site"). Any exceptions to, or deletions from, this practice are described in Section 2.0 of this report. This assessment has revealed evidence of *recognized environmental conditions* (RECs) and/or areas of environmental concern in connection with the Site.

FINDINGS AND CONCLUSIONS SUMMARY							
Report Section		Further Action?	De Minimis Condition	Recognized Environmental Condition (REC)	Historical REC	ASTM Non-Scope Condition	Description
4.0	User Provided Information	No					
5.1.1	Federal Database Findings	No					
5.1.2	State and Tribal Database Findings	Yes		X			Refer to note (1) below
5.1.3	Local Environmental Record Sources	No					
5.3	Historical Records Sources	Yes		X			Refer to note (1) below
6.2	Hazardous Substance Use, Storage and Disposal	Yes					Refer to note (2) below
6.3	Underground Storage Tanks	Yes		X			Refer to note (3) below
6.4	Aboveground Storage Tanks	Yes					Refer to note (4) below
6.5	Other Petroleum Products	No					
6.6	Polychlorinated Biphenyls (PCBs)	No					
6.7	Unidentified Substance Containers	No					
6.8	Non-hazardous Solid Waste	No					
6.9	Wastewater	No					
6.10	Waste Pits, Ponds and Lagoons	No					
6.11	Sumps	No					
6.12	Septic Systems	No					
6.13	Stormwater Management System	No					
6.14	Wells	No					

FINDINGS AND CONCLUSIONS SUMMARY							
Report Section		Further Action?	De Minimis Condition	Recognized Environmental Condition (REC)	Historical REC	ASTM Non-Scope Condition	Description
7.0	Interviews	No					
8.1	Asbestos-Containing Material (ACM)	Yes				X	Refer to note (5) below
8.2	Radon	No					
8.3	Lead in Drinking Water	No					
8.4	Lead-Based Paint (LBP)	Yes				X	Refer to note (6) below
8.5	Mold Screening	No					
8.6	Additional User Requested Conditions	No					

(1) The current and historical use of the Site for auto related operations, use of the eastern adjacent property as a gasoline filling station and auto repair shop and the southwestern adjacent property as a garage represent a *recognized environmental condition* for the Site. Please refer to the sections 5.1.2 and 5.3.2 of this report for more information.

(2) ATC observed suspect petroleum staining on the floor (approximately 12'x18') in the east-northeastern portion of the cellar along the eastern wall by the door. ATC reviewed a drawing of proposed modification of the building prepared by the U.S. Post Office Department dated June 25, 1969. This drawing indicated the presence of two (2) 275-gallon lube oil tank location in the east-northeastern portion of the cellar, where suspect petroleum staining was observed. Based on the observed conditions, ATC concludes that this condition represents an environmental concern for the Site.

(3) ATC did not observe evidence of underground storage tanks (USTs) on the Site. However, the historical Sanborn maps revealed the presence of four (4) 550-gallon gasoline USTs at the Site from at least 1939 through 1996. The Site was not identified as a LTANKS facility, New York PBS tank facility, or New York Spill site. Furthermore, the U. S. Post Office Department drawing dated June 25, 1969 indicated the presence a fill port in the vicinity of the ramp in the cellar that might be associated with potential USTs. Based on the potential presence of these USTs at the Site and the lack of current information regarding these USTs, ATC concludes that they represent a *recognized environmental condition*.

(4) At the time of the Site reconnaissance, ATC observed the presence of an out-of service approximately 550-gallon aboveground storage tank (AST) located underneath the second floor ramp on the eastern side of the first floor. ATC observed an inactive fuel oil fill port on the second floor right above the tank and an inactive vent pipe associated with this tank. ATC also observed the presence of an inactive small AST located underneath the staircase in the south-southwestern portion of the cellar. No evidence of spills or leaks was observed in the vicinity of the ASTs at the time of the Site reconnaissance. Furthermore, the U. S. Post Office Department drawing indicated the presence of a waste oil tank location and an associated fill port in the vicinity of the ramp on the first floor. The drawing also indicated the presence of two (2) 275-gallon lube oil tank location in

the east-northeastern portion of the cellar, where suspect petroleum staining on the floor (approximately 12'x18') was observed by ATC during the Site reconnaissance. The Site was not identified as a LTANKS facility, New York PBS tank facility, or New York Spill site.

(5) ATC conducted a limited visual assessment within the accessible areas of the Site building for suspect asbestos containing materials (ACM). Based on the construction date (1929), it is likely that asbestos is present within the Site building materials. ATC observed suspect ACM, including floor tiles and mastic (in the northeast portion of second floor), plaster walls and roofing materials within the accessible areas of the Site building. These materials were generally observed in good condition with the exception of some damaged floor tiles in the northeastern portion of the second floor of the Site building. In the event that the suspect ACM is to be disturbed by future renovation or demolition work, a thorough inspection and proper asbestos abatement procedures should be implemented prior to the commencement of such work. ACM is outside of the Scope of ASTM Practice E 1527-05 and, therefore, the potential presence of ACM is not considered a *recognized environmental condition*.

(6) Based on the construction date (1929), LBP is presumed to be present at the Site. During the course of ATC's inspection, painted surfaces within accessible areas were generally observed in fair condition with the exception of peeling paint observed in the bathroom on the first floor. LBP is outside of the Scope of ASTM Practice E 1527-05 and, therefore, the potential presence of LBP is not considered a *recognized environmental condition*.

1.3 Significant Data Gap Summary

The following is a summary of *significant data gaps* identified in this report.

SIGNIFICANT DATA GAP SUMMARY		
	Report Section	Description
3.5	Current Uses of Adjoining Properties	No <i>significant data gap</i> identified.
4.2	Environmental Liens or Activity and Use Limitations (AULs)	No <i>significant data gap</i> identified.
5.1	Standard Environmental Records	No <i>significant data gap</i> identified.
5.2	Physical Setting Sources	No <i>significant data gap</i> identified.
5.3	Historical Records Sources	No <i>significant data gap</i> identified.
6.1	Methodology and Limiting Conditions	No <i>significant data gap</i> identified.
7.0	Interviews	No <i>significant data gap</i> identified.

1.4 Recommendations

Based on information collected from the Phase I ESA, ATC offers the following recommendations for further action:

- ATC recommends that a Phase II Environmental Site Investigation (ESI) be performed to determine whether current and historical use of the Site for auto related operations, use of the eastern adjacent property as a gasoline filling station and auto repair shop and historical use of the southwestern adjacent property as a garage have adversely impacted subsurface conditions beneath the Site. The Phase II ESI would also cover the area of concern identified in the east-northeastern portion of the cellar of the Site building. The Phase II ESI may consist of soil and groundwater collection and analyses.

- ATC recommends the performance of ground penetration radar (GPR) survey as part of the phase II ESI in order to determine if historical 550-gallon gasoline tanks identified on the Sanborn maps are present beneath the Site.
- ATC recommends that if the ASTs are not going to remain in use that they be decommissioned in accordance with all New York State and local laws by a licensed contractor.
- Prior to initiating any renovation or demolition activities at the Site, ATC recommends conducting a pre-demolition survey for the presence of suspect asbestos containing materials (ACMs) in accordance with applicable federal, state, and local regulations.
- ATC recommends conducting all appropriate and required investigations for lead-based paint prior to initiating any renovation or demolition activities at the Site.

2.0 INTRODUCTION

2.1 Purpose

The purpose of this Phase I ESA was to identify *recognized environmental conditions* and certain potential environmental conditions outside the scope of ASTM Standard Practice E 1527-05 in connection with the property at the time of the site reconnaissance. This report documents the findings, opinions and conclusions of the Phase I ESA.

2.2 Scope

This Phase I ESA was conducted in general accordance with the ASTM Standard Practice E 1527-05, consistent with a level of care and skill ordinarily practiced by the environmental consulting profession currently providing similar services under similar circumstances. Significant additions, deletions or exceptions to ASTM Standard Practice E 1527-05 are noted below or in the corresponding sections of this report. The scope of this assessment included an evaluation of the following:

- Physical setting characteristics of the Site through a review of referenced sources such as topographic maps and geologic, soils and hydrologic reports.
- Usage of the Site, adjoining properties and surrounding area through a review of referenced historical sources such as land title records, fire insurance maps, city directories, aerial photographs, prior reports and interviews.
- Observations and interviews regarding current Site usage and conditions including: the use, treatment, storage, disposal or generation of hazardous substances, petroleum products, hazardous wastes, non-hazardous solid wastes and wastewater.
- Usage of adjoining and surrounding area properties and the likely impact of known or suspected releases of hazardous substances or petroleum products from those properties on the Site.
- Information in referenced environmental agency databases and local environmental records, within the specified approximate minimum search distance from the Site.

The scope of the assessment also included consideration of the following environmental issues or conditions that are beyond the scope of ASTM Standard Practice E 1527-05:

- Mold Screening to report the findings of a baseline survey of readily observable mold and conditions conducive to mold on the Site identified by limited interview, document review and physical observation and to provide an opinion on whether an identified condition warrants further action. The scope of work for the Mold Screening was intended to be consistent with ASTM Standard Practice E 2418-06: *Standard Guide for Readily Observable Mold and Conditions Conducive to Mold in Commercial Buildings: Baseline Survey Process*. The scope of work, including potential deviations from the Standard Guide, is described as follows. The interview was limited to one knowledgeable person from Site management or engineering staff. The document review was limited to only those relevant documents made readily available to ATC in a timely manner. The physical observations were limited to certain Heating, Ventilation and Air Conditioning (HVAC) system areas and other readily accessible building areas likely to become subject to water damage, plumbing leaks, and flooding. Unless noted otherwise herein,

ATC observed the HVAC equipment room(s) and readily accessible mechanical rooms and, in buildings with package units in the ceiling, at least one unit per floor. Also, unless noted otherwise, ATC observed readily accessible areas of the basement (or lowest level), the top floor, the roof (including any penthouse areas) and at least one mid-level floor (if applicable). For multi-story buildings, the total number of floors observed (inclusive of those already mentioned) was intended to be up to 10% of the total number of floors (if readily accessible). For hotel and multi-family buildings, ATC targeted the lowest and highest levels and roof as described above and up to 10% of units, including one per floor if readily accessible. The Mold Screening did not include destructive methods of observation. No sampling or laboratory analyses were conducted. The Mold Screening service as described herein was limited in scope and by the time and cost considerations typically associated with performing a Phase I ESA. No method can guarantee that a hazard will be discovered if evidence of the hazard is not encountered within the performance of the Mold Screening as authorized and that opinions and conclusions must, out of necessity, be extrapolated from limited information and discrete, non-continuous data points. Unidentified mold or other microbial conditions may exist on the Site.

- Visual observation of suspect ACM, consisting of providing an opinion on the condition of suspect ACM on the Site based upon visual observation during the Site reconnaissance.
- Radon document review, consisting of the review of published radon data with regard to the potential for elevated levels of radon gas in the surrounding area of the Site.
- Lead in drinking water data review, consisting of contacting the water supplier for information regarding whether or not the potable water provided to the Site meets or exceeds drinking water standards for lead.
- Visual observation of Lead-based paint (LBP), consisting of providing an opinion on the potential for LBP based on the construction date of the Site building and visual observation of the condition of suspect LBP.
- Wetlands document review, consisting of a review of a current National Wetlands Inventory map of the surrounding area to note if the Site is identified as having a wetland.
- Flood plain document review, consisting of a review of a reasonably ascertainable flood plain map of the surrounding area to note if the Site is identified as being located within a flood plain

2.3 Significant Assumption

Any assumptions in this report were not considered as having significant impact on the determination of *recognized environmental conditions* associated with the Site.

2.4 Limitations and Exceptions

ATC has prepared this Phase I ESA report using reasonable efforts to identify *recognized environmental conditions* associated with hazardous substances or petroleum products at the property. Findings contained within this report are based on information collected from observations made on the day(s) of the site reconnaissance and from reasonably ascertainable information obtained from certain public agencies and other referenced sources.

The ASTM Standard Practice E 1527-05 recognizes inherent limitations for Phase I ESAs, including, but not limited to:

- *Uncertainty Not Eliminated* – A Phase I ESA cannot completely eliminate uncertainty regarding the potential for *recognized environmental conditions* in connection with any property.
- *Not Exhaustive* – A Phase I ESA is not an exhaustive investigation of the property and environmental conditions on such property.
- *Past Uses of the Property* – Phase I requirements only require review of standard historical sources at five year intervals. Therefore, past uses of property at less than five year intervals may not be discovered.

Users of this report may refer to ASTM Standard Practice E 1527-05 for further information regarding these and other limitations. This report is not definitive and should not be assumed to be a complete and/or specific definition of all conditions above or below grade. Current subsurface conditions may differ from the conditions determined by surface observations, interviews and reviews of historical sources. The most reliable method of evaluating subsurface conditions is through intrusive techniques, which are beyond the scope of this report. Information in this report is not intended to be used as a construction document and should not be used for demolition, renovation, or other property construction purposes. Any use of this report by any party, beyond the scope and intent of the original parties, shall be at the sole risk and expense of such user.

ATC makes no representation or warranty that the past or current operations at the property are, or have been, in compliance with all applicable federal, state and local laws, regulations and codes. This report does not warrant against future operations or conditions, nor does it warrant against operations or conditions present of a type or at a location not investigated. Regardless of the findings stated in this report, ATC is not responsible for consequences or conditions arising from facts not fully disclosed to ATC during the assessment.

An independent data research company provided the government agency database referenced in this report. Information on surrounding area properties was requested for approximate minimum search distances and is assumed to be correct and complete unless obviously contradicted by ATC's observations or other credible referenced sources reviewed during the assessment. ATC shall not be liable for any such database firm's failure to make relevant files or documents properly available, to properly index files, or otherwise to fail to maintain or produce accurate or complete records.

ATC used reasonable efforts to identify evidence of aboveground and underground storage tanks and ancillary equipment on the property during the assessment. "Reasonable efforts" were limited to observation of accessible areas, review of referenced public records and interviews. These reasonable

efforts may not identify subsurface equipment or evidence hidden from view by things including, but not limited to, snow cover, paving, construction activities, stored materials and landscaping.

Any estimates of costs or quantities in this report are approximations for commercial real estate transaction due diligence purposes and are based on the findings, opinions and conclusions of this assessment, which are limited by the scope of the assessment, schedule demands, cost constraints, accessibility limitations and other factors associated with performing the Phase I ESA. Subsequent determinations of costs or quantities may vary from the estimates in this report. The estimated costs or quantities in this report are not intended to be used for financial disclosure related to the Financial Accounting Standards Board (FASB) Statement No. 143, FASB Interpretation No. 47, Sarbanes/Oxley Act or any United States Securities and Exchange Commission reporting obligations, and may not be used for such purposes in any form without the express written permission of ATC.

ATC is not a professional title insurance or land surveyor firm and makes no guarantee, express or implied, that any land title records acquired or reviewed in this report, or any physical descriptions or depictions of the property in this report, represent a comprehensive definition or precise delineation of property ownership or boundaries.

The Environmental Professional Statement in Section 1.1 of this report does not “certify” the findings contained in this report and is not a legal opinion of such *Environmental Professional*. The *Environmental Professional* Statement is intended to document ATC’s opinion that an individual meeting the qualifications of an Environmental Professional was involved in the performance of the assessment and that the activities performed by, or under the supervision of, the *Environmental Professional* were performed in conformance with the standards and practices set forth in 40 CFR Part 312 per the methodology in ASTM Standard Practice E 1527-05 and the scope of work for this assessment.

Per ASTM Standard Practice E 1527-05, Section 6, User Responsibilities, the User of this assessment has specific obligations for performing tasks during this assessment that will help identify the possibility of *recognized environmental conditions* in connection with the property. Failure by the User to fully comply with the requirements may impact their ability to use this report to help qualify for *Landowner Liability Protections* (LLPs) under Comprehensive Environmental Response, Compensation, and Liability Act (CERCLA). ATC makes no representations or warranties regarding a User’s qualification for protection under any federal, state or local laws, rules or regulations.

In accordance with the ASTM Standard Practice E 1527-05, this report is presumed to be valid for a six month period. If the report is older than six months, the following information must be updated in order for the report to be valid: (1) regulatory review, (2) site visit, (3) interviews, (4) specialized knowledge and (5) environmental liens search. Reports older than one year may not meet the ASTM Standard Practice 1527-05 and therefore, the entire report must be updated to reflect current conditions and property-specific information.

Other limitations and exceptions that are specific to the scope of this report may be found in corresponding sections.

2.5 Special Terms and Conditions (User Reliance)

This report is for the use and benefit of, and may be relied upon by Broadway Housing Communities, the lender(s) in connection with financing for the Site and their respective successors and assigns and other third parties authorized in writing by Broadway Housing Communities, and ATC. Any third party agrees by accepting this report that any use or reliance on this report shall be limited by the exceptions and limitations in this report, and with the acknowledgment that actual Property conditions may change with time, and that hidden conditions may exist at the Property that were not discovered within the authorized scope of the assessment.

ATC makes no other representation to any third party except that it has used the degree of care and skill ordinarily exercised by environmental consultants in the preparation of the report and in the assembling of data and information related thereto. No other warranties are made to any third party, either expressed or implied. Unless otherwise agreed upon in writing by ATC and a third party, ATC's liability to any third party authorized to use or rely on this report with respect to any acts or omissions shall be limited to a maximum of \$100,000.

3.0 SITE DESCRIPTION

3.1 Location and Legal Description

The Site is located at 414 West 155th Street in New York, New York County, New York. Alternative address is 400-414 West 155th Street. The Site is located on the south side of West 155th Street between St. Nicholas Avenue and St. Nicholas Place. According to information obtained from the New York City Department of Buildings website, the Site is identified as Block 2069, Lot 21. According to the New York City Department of City Planning Zoning Map 3B, the Site is currently zoned as “C8-3”, which designates commercial use. The current owner is identified as “Garage Estates Company.” A Site Vicinity Map is provided in Appendix A and a Site Plan is provided in Appendix B.

3.2 Surrounding Area General Characteristics

The Site is located within an urban area that is primarily characterized by residential, commercial, retail, and institutional buildings, recreational properties, and a gasoline station with an auto repair shop.

3.3 Current Use of the Site

The Site is developed with a two-story building with a cellar that is utilized as a parking garage. The Site consists of an approximately 21,685 square feet lot. The Site building encompasses approximately 65,070 square feet, and based on our review of historical research, the Site building was constructed in 1929.

3.4 Description of Site Improvements

The following table provides general descriptions of the Site improvements.

SITE IMPROVEMENTS	
Size of Site (approximate)	21,685 square feet
General Topography of Site	General topography of the Site slopes downward to the east
Adjoining and/or Access/Egress Roads	Access to the Site is available through West 155 th Street
Paved or Concrete Areas (including parking)	City sidewalks are paved with concrete
Unimproved Areas	None
Landscaped Areas	None
Surface Water	None
Potable Water Source	City of New York
Sanitary Sewer Utility	City of New York
Storm Sewer Utility	City of New York
Electrical Utility	Consolidated Edison (Con Ed)
Natural Gas Utility	Con Ed
Current Occupancy Status	100%
Unoccupied Buildings/Spaces/Structures	None
Number of Occupied Buildings	1
General Building Description	Two-story building with a cellar used as a parking garage
Number of Floors	3
Total Square Feet of Space (approximate)	65,070 square feet
Construction Completion Date (year)	1929

SITE IMPROVEMENTS	
Construction Type	Stone foundation and steel frame
Interior Finishes Description	Concrete and ceramic and vinyl floor tiles, concrete ceiling and walls
Exterior Finishes Description	Brick and concrete
Cooling System Type	None
Heating System Type	None
Emergency Power	None

3.5 Current Uses of Adjoining Properties

Current uses of the adjoining properties were observed to be as follows:

Direction from Site	Address	Occupant(s) Name	Current Use	Potential Environmental Conditions
North	1921 Amsterdam Avenue, 900 St. Nicholas Avenue, 483 Edgecombe Avenue and Parks	3-story public school, 2-story store, vacant lot and parks followed by West 155 th Street	Educational facility, retail, undeveloped and recreational	None
South	882-888 St Nicholas Ave and 87 St Nicholas Place	2-story bldg occupied by Department of Environmental Protection and 6-story residential	Utility and residential	Please see section 5.1.2
East	89-97 St Nicholas Place and 425 Edgecombe Avenue	1-story gasoline station and 2-story store followed by St. Nicholas Place	Commercial and retail	Please see section 5.1.2
West	416 West 155 th Street	2-story bldg occupied by Department of Environmental Protection. Further to the west is St. Nicholas Avenue followed by low-rise residential buildings	Utility and residential	Please see section 5.1.2

Several listings for the surrounding properties were identified on the federal and state regulatory databases (See Section 5.1).

4.0 USER PROVIDED INFORMATION

The following section summarizes information provided by Broadway Housing Communities with regard to the Phase I ESA. Documentation may be found in Appendix D or where referenced in this report.

4.1 Title Records

Broadway Housing Communities provided no title records information.

4.2 Environmental Liens or Activity and Use Limitations (AULs)

Broadway Housing Communities provided no information regarding site environmental liens or activity and use limitations. Broadway Housing Communities requested that ATC conduct an environmental lien and AULs search. ATC ordered an Environmental Lien search through Ameristar.

According to the Environmental Lien Search Report, included in Appendix L, no records of environmental liens against the Site were found. The Environmental Lien Search Report further states that no records of AULs in place at the Site were found.

4.3 Specialized Knowledge

Broadway Housing Communities provided no specialized knowledge regarding *recognized environmental conditions* associated with the Site.

4.4 Significant Valuation Reduction for Environmental Issues

Broadway Housing Communities provided no information regarding a significant valuation reduction for environmental issues associated with the Site.

4.5 Owner, Site Manager and Occupant Information

Broadway Housing Communities indicated that the Site is developed with a two-story building utilized as a parking garage.

4.6 Reason for Performing Phase I ESA

Broadway Housing Communities has indicated that the reason for performing this Phase I ESA is related to a financial transaction.

4.7 Other User Provided Documents

No other user provided documentation was obtained for review.

5.0 RECORDS REVIEW

5.1 Standard Environmental Records

The regulatory agency database report discussed in this section, provided by EDR of Milford, Connecticut, was reviewed for information regarding reported releases of hazardous substances and petroleum products on or near the property. ATC also reviewed the “unmappable” (also referred to as “orphan”) listings within the database report, cross-referencing available address information and facility names. Unmappable sites are listings that could not be plotted with confidence, but are potentially in the general area of the property based on the partial street address, city, or zip code. Any unmappable site that was identified by ATC as a being within the approximate minimum search distance from the property based on the site reconnaissance and/or cross-referencing to mapped listings, is included in the discussion within this section. Due to the dense urban nature of the property area and in accordance with ASTM, the search radius for LTANKS has been reduced from ½ mile to ¼ mile. The complete regulatory agency database report may be found in Appendix E.

The following is a summary of the findings of the database review.

SUMMARY OF FEDERAL, STATE AND TRIBAL DATABASE FINDINGS			
Regulatory Database	Approx. Minimum Search Distance	Site Listed?	# Properties Listed
Federal National Priority (NPL)	1 mile	No	0
Federal Delisted NPL	½ mile	No	0
Federal Comprehensive Environmental Response, Compensation, and Liability Information System (CERCLIS) list	½ mile	No	0
Federal CERCLIS No Further Remedial Action Planned (NFRAP)	½ mile	No	0
Federal Resource Conservation and Recovery Act (RCRA), Corrective Action facilities (CORRACTS)	1 mile	No	0
Federal RCRIS non- CORRACTS Treatment, Storage, and Disposal Facilities (TSD)	½ mile	No	0
Federal RCRA Generators	Site & Adjoining	No	1
Federal Institutional Control/Engineering Control Registry	Site	No	0
Federal Emergency Response Notification System (ERNS) list	Site	No	0
State and Tribal NPL	1 mile	No	0
State and Tribal CERCLIS	½ mile	No	0
State and Tribal Landfill or Solid Waste Disposal Sites	½ mile	No	0
State and Tribal Leaking Underground Storage Tanks (LTANKS)	¼ mile	No	23
State and Tribal Petroleum Bulk Storage (PBS) (UST/AST)	Site & Adjoining	No	2
New York State Spills (NY Spills) Site	Site & Adjoining	No	0
State and Tribal Institutional Control/Engineering Control Registry	Site	No	0
State and Tribal Voluntary Cleanup Site	½ mile	No	0
State and Tribal Brownfield Sites	½ mile	No	0

5.1.1 Federal Agency Database Findings

The Site was not identified on any federal agency databases reviewed within the prescribed search radius. The following is a summary of information regarding the listings identified in the federal agency databases reviewed within the search distance.

Federal RCRA Small Quantity Generators (SQGs)

Getty Petroleum Corp
89-91 St Nicholas Place
New York, NY

Databases: RCRA-SQG

Approximate Distance from the Site: Adjacent to the east

Assumed Groundwater Gradient: Downgradient

Discussion: According to the regulatory database report, 165 gallons and 90 gallons of waste identified as “D001-non-listed ignitable waste” was removed from this facility in 1995 and 2001 respectively. There are no reported violations for this facility in the database report. Based on the lack of reported violations, this RCRA-SQG listing is not considered to represent a *recognized environmental condition* to the Site.

Based on distance, topography, assumed groundwater gradient, current regulatory status, and/or the absence of reported releases, none of the other listings in the Federal agency databases are considered to represent a likely past, present or material threat of release on the Site.

5.1.2 State and Tribal Database Findings

The Site was not identified on any state agency databases reviewed within the prescribed search radius. The following is a summary of information regarding the listings identified in the state agency databases reviewed within the search distance.

New York State Registered Petroleum Bulk Storage (PBS) Underground and Aboveground Storage Tanks (USTs/ASTs)

Getty Petroleum Corp
89-91 St Nicholas Place
New York, NY

Databases: UST, AST and LTANKS

Approximate Distance from the Site: Adjacent to the east

Assumed Groundwater Gradient: Downgradient

Discussion: According to the regulatory database report, this adjoining property is listed on the UST database (PBS #: 2-291935) with twelve (12) inactive 550-gallon gasoline USTs (closed – removed in 1995), one (1) inactive 550-gallon waste oil/used oil UST (closed – removed in 2004), one (1) inactive 4,000-gallon gasoline UST (closed – removed in 1995), one (1) inactive 550-gallon empty UST (closed in place in 2001), and four (4) active 4,000-gallon double-walled fiberglass reinforced plastic gasoline USTs (installed in 1995 and tested in 2004). This gasoline station facility is also listed on the AST database with one (1) inactive 240-gallon #2 fuel oil AST (closed – removed in 1996), one (1) inactive 180-gallon #2 fuel oil AST (closed – removed in 2004), one (1) inactive 180-gallon waste oil/used oil AST (closed – removed in 1996), one (1)

active 280-gallon lube oil AST (installed in 1995), one (1) active 240-gallon #2 fuel oil AST (installed in 2004), and one (1) active 240-gallon waste oil/used oil AST (installed in 2004).

This facility is also identified on the LTANKS database with one (1) closed and one (1) open listings. The first listing (LTANKS ID: 8805013) was reported at this gasoline station facility on September 8, 1988 due to tank test failure. According to the database report, a 4,000-gallon on-site tank failed petro-tite testing. This spill case received a "Case Closed" status with the NYSDEC on July 16, 1992 indicating the completion of satisfactory remediation and requiring no further investigation. No further information was available regarding this listing in the database report.

The other LTANKS listing (LTANKS ID: 9503535) was reported at this gasoline station facility on June 22, 1995. This spill incident was initially entered into the database under a wrong address (87 St Nicholas) and was changed to Getty, 89-91 St Nicholas Pl on April 30, 2004. According to the database report, a tank closure report performed by Tyree indicated that twelve (12) 550-gallon and one (1) 4,000-gallon gasoline USTs were removed as part of rebuilding the gasoline station in 1995. Tank upgrade included the installation of four (4) 4,000-gallon gasoline USTs in existing excavation. Visual evidence and petroleum odors were detected during excavation and 1,040 tons of soil was removed from the site. The NYSDEC required five (5) geoprobe borings be performed resulting in collection of six soil samples and two groundwater samples. Soil sample analytical results reportedly showed high concentrations of trimethylbenzene, xylene, naphthalene, benzene, toluene and groundwater sample analytical results reportedly showed high concentrations of benzene and Methyl Tertiary Butyl Ether (MTBE). During installation of monitoring wells in March 2001, two (2) 550-gallon gasoline USTs were identified at the site. These tanks were removed from the site in 2001. External corrosion and a small hole were identified in one of the tanks.

Three monitoring wells were installed at the site and quarterly monitoring was conducted from August 2002 through March 2003. Groundwater flow direction was identified to flow to the east at a depth of 14'-16'. Groundwater analytical results reportedly showed high concentration of benzene, toluene MTBE, xylene, and free product and soil analytical results showed high benzene, toluene, and naphthalene. In May 2004, the NYSDEC required "Stipulation Agreement" with delineation of soil and groundwater. As per the Stipulation Agreement, four monitoring wells (two onsite wells and two offsite wells) were installed. Soil analytical results reportedly showed high concentrations of benzene and minor PAH exceedences. Groundwater analytical results showed high benzene, toluene, ethylbenzene, xylene, and MTBE. Groundwater monitoring was conducted from July 2004 through March 2005 from seven monitoring wells.

In February 2005, Tyree proposed a remedial action plan of the use of in-situ passive bailers to collect product from wells W-1 and W-3. Bailers will be utilized until a permanent remedial alternative is in place. In June 2005, two (2) saturated zone piezometer wells (P1 and P2), three (3) vadose zone piezometer wells, and one (1) extraction well were installed on the southeast of the site. High acetone was detected in P1, P2 and EW1.

In October 2005, Dual Phase Extraction System design that requires installation of four (4) extraction wells was approved to cover the area of concern. The Dual Phase System was installed in September 2006. Seven (7) monitoring wells and four (4) Dual Phase extraction wells are at the site as of April 2007 and groundwater sample analytical results showed 60,260 ppb BTEX and 1,050 ppb in W-1, 274 ppb BTEX and 243 ppb MTBE in W-3, 148 ppb BTEX in W-4, 601

ppb BTEX and 786 ppb MTBE in W-6. This LTANKS listing remains open with the NYSDEC. Based on the reported soil and groundwater contamination and proximity to the Site, ATC concludes that this open listing at the eastern adjacent property could have the potential to impact soil and groundwater beneath the Site and represents a *recognized environmental condition* for the Site.

North Manhattan Shop
886 St Nicholas Avenue
New York, NY

Databases: UST and LTANKS

Approximate Distance from the Site: Adjacent to the southwest

Assumed Groundwater Gradient: Upgradient/crossgradient

Discussion: According to the regulatory database report, this adjoining property is listed on the UST database (PBS #: 2-456357) with one (1) inactive 5,000-gallon gasoline UST (closed – removed in 1996) and one (1) inactive 5,000-gallon #2 fuel oil UST (closed – removed in 1996). This property is also identified on the LTANKS database with one (1) closed and one (1) open listings. The first listing (LTANKS ID: 9710796) was reported as a result of tank failure on December 23, 1997. Reportedly, tank closure boring soil samples showed semi-volatile organic compounds (SVOCs) at this site. An additional investigation indicated that residual contamination is not likely to impact groundwater. Soil contamination is in an enclosed area surrounded on three sides by concrete walls, underlain by concrete over bedrock and covered by concrete patio. Local water table is assumed to be well below concrete/bedrock interface. It is stated that the soil contains levels of carcinogenic SVOCs that could pose a threat to human health if ingested or inhaled. In the event of any construction or demolition work that would involve contact with soil, appropriate precautions should be taken to prevent ingestion/inhalation of soil particles by workers. This listing has received a “Case Closed” status with the NYSDEC on April 20, 2001 indicating the completion of satisfactory remediation and requiring no further investigation.

The other listing (LTANKS ID: 9504500) involving an unidentified amount of #2 fuel oil release caused by tank failure was reported at this property on July 14, 1995. According to the database report, a tank was found on the abandoned lot, which is the northern portion of the property along West 155th Street and St Nicholas Avenue. The tank was covered with soil. Reportedly, this site was to be excavated in a few months at that time. No further information was available regarding this listing. However, the first listing described above indicates that the two on-site USTs were removed from this property in 1996. This listing remains open with the NYSDEC. Based on the reported soil contamination mentioned earlier on this property, assumed upgradient/crossgradient hydraulic position and proximity to the Site, ATC concludes that these listings represent a *recognized environmental condition* for the Site.

New York State Leaking Storage Tank Incident Reports (LTANKS)

According to the regulatory database report, twenty-three (23) LTANKS were identified within a one-quarter mile radius of the Site. Of the twenty-three (23) listings, twenty (20) have received a “Case Closed” status with the NYSDEC indicating the completion of satisfactory remediation and requiring no further investigation and therefore not considered to represent an environmental concern to the Site. The three (3) remaining LTANKS listings remain open with the NYSDEC. One of these listings (49 St Nicholas Place) is located at least 550 feet away from the Site at an assumed downgradient hydraulic

position relative to the Site and therefore does not appear to represent a *recognized environmental condition* to the Site.

The second listing (886 St Nicholas Avenue) is located adjacent to the southwest of the Site at an assumed upgradient/crossgradient hydraulic position relative to the Site. The last listing is located adjacent to the east of the Site (89-91 St Nicholas Place) at an assumed downgradient hydraulic position relative to the Site. Please refer to the PBS UST section above for more details regarding these two last listings.

5.1.3 Local Environmental Records Sources

New York City Department of Health and Mental Hygiene (NYCDOHMH)

The NYCDOHMH maintains files of health-related environmental incidents in the City of New York. These incidents may include spills of hazardous chemicals, citizen complaints regarding asbestos issues, lead-based paint violations, or reports of chemical odors or fumes. NYCDOHMH information concerning the Site was requested in a Freedom of Information letter (FOIL). As of the writing of this report, ATC had not yet received a response from the NYCDOHMH. Should a response change the conclusions of this report, ATC will notify the Client.

New York City Department of Environmental Protection (NYCDEP)

NYCDEP information concerning the property was requested in a FOIL request. NYCDEP information may include spill records, remediation, hazardous materials, sewer discharge violations, water, and sewer records. As of the writing of this report, ATC had not yet received a response from the NYCDEP. Should a response change the conclusions of this report, ATC will notify the Client.

New York City Fire Department (FDNY)

The FDNY, Bureau of Fire Prevention maintains information pertaining to gasoline and petroleum bulk storage tanks. FDNY information concerning the property was requested in a Record Search Request Application. As of the writing of this report, ATC had not yet received a response from the FDNY. Should a response change the conclusions of this report, ATC will notify the Client.

New York State Department of Environmental Conservation (NYSDEC)

The NYSDEC maintains files of incidents involving environmentally regulated materials. The records maintained by the NYSDEC include reports of spills of hazardous chemicals and citizen's complaints on environmental issues. NYSDEC information concerning the Site and the adjoining properties was requested in a FOIL. As of the writing of this report, ATC had not yet received a response from the NYSDEC. Should a response change the conclusions of this report, ATC will notify the Client.

New York City Department of City Planning (NYCDCP)

ATC reviewed the NYCDCP Zoning Map from the NYCDCP website (<http://www.nyc.gov/html/dcp/home.html>), which indicated that the Site is located in an area that is currently zoned as C8-3 – “Commercial”. The Site was not identified as having a City Environmental Quality Review (CEQR) Declaration (also known as a Little “E” designation). A Little “E” designation is assigned to certain blocks or lots by a New York City agency (i.e., New York City Department of

Environmental Protection, New York City Department of City Planning) as a result of an environmental assessment performed in conjunction with a zoning map amendment.

New York City Department of Buildings (NYCDOB)

ATC reviewed available building department information, provided by the NYCDOB via the on-line Building Information System website (<http://a810-bisweb.nyc.gov/bisweb/bsqpm01.jsp>). The Site is designated as Block 2069, Lot 21. One (1) open Department of Building (DOB) and one (1) open Environmental Control Board (ECB) violations were identified at the Site. The open violations are associated with construction related issues and do not appear to relate to environmental issues. Based on the nature of these violations, ATC concludes that they do not represent an environmental concern for the Site.

New York City Department of Finance

ATC reviewed available tax files at the New York City Department of Finance website (<http://www.nyc.gov/html/dof/html/home/home.shtml>) for information on the Site. The current owner was identified as “Garage Estates Company.” The review of tax files did not identify conditions indicating *recognized environmental conditions* at the Site or surrounding area.

Water Utility

Within the City of New York, potable water is supplied to Manhattan primarily from upstate New York reservoirs. ATC reviewed New York City’s most recent Drinking Water Supply and Quality Report made available through the NYCDEP website (<http://www.nyc.gov/html/dep/home.html>) for the year 2006. Review of the analytical data provided in the report confirmed that the municipally supplied water meets all drinking water standards established by the United States Environmental Protection Agency Safe Water Drinking Act, including those for lead. No drinking water supply wells appear to exist at the Site.

Sewer Utility

The NYCDEP is responsible for the municipal combined sanitary and stormwater sewer system. This system is operational in all five boroughs of New York City, with the exception of certain remote areas of the City, namely Queens and Staten Island, which have separate operating systems for sewage and stormwater. The New York City sewer infrastructure consists of a 6,000-mile grid of sewers beneath the streets, from which a daily 1.3-billion gallon wastewater effluent travels to 14 separate water pollution control plants (WPCPs) throughout the City to be processed. This system enables the City’s sewage and stormwater, pursuant to various municipal, state and federal regulations, to be treated to near drinking water-quality standards.

Electrical and Natural Gas Utility Companies

The local utility, Consolidated Edison, provides electric service to the Site.

Other Local Environmental Records Sources

No additional local environmental records sources were reviewed.

5.2 Physical Setting Sources

5.2.1 Topography

ATC reviewed the United States Geological Survey (USGS) 7.5 Minute Series *Central Park, NY* Quadrangle produced in 1995 as provided in the EDR regulatory database report. According to the topographic map, the elevation of the Site is approximately 110 feet above mean sea level. The area surrounding the Site slopes to the east. No water bodies are evident on the Site. A copy of the topographic map is included in Appendix A.

5.2.2 Geology

According to the New York Department of Environmental Conservation, Water Power and Control Commission report titled *Ground Water in Bronx, New York, and Richmond Counties, with Summary Data on Kings and Queens Counties, New York City, New York*, the Project Area is located in a southern extension of an upland area that covers a large part of New England. Manhattan has been extensively eroded by pre-glacial stream action, modified by later glacial erosion and deposition. A layer of unconsolidated glacial and glaciofluvial deposits is present beneath the section of Manhattan in which the site is located. The sediments are underlain by high-grade metamorphic schists.

5.2.3 Soils

According to EDR, soils beneath the Site are classified as Urban Land, with variable soil textures. Urban Land refers to soils that have been altered by urban development such as buildings and streets, where at least 85 percent of the surface is covered with asphalt, concrete or other impervious building material. Typically, these soils have been mixed with other materials, such as brick and concrete, and characteristics can only be determined by on-site investigation.

5.2.4 Hydrology

For the purposes of this report, the Site's proximity to the Harlem River and the surface topography has been used to estimate groundwater flow direction. Generally, groundwater contour lines mimic the surface topography and groundwater flow direction is perpendicular to these contour lines flowing from higher to lower elevation. In addition, groundwater will also tend flow towards nearby bodies of water. Based on this information, groundwater at the Site is expected to flow in an easterly direction towards the Harlem River, which is located approximately one-half mile away from the Site. According to information reviewed in the database report, groundwater flows easterly and was encountered 13'-24' feet and at the property located to the east. ATC observed no indicators of active or inactive water supply wells at the Site.

Estimated groundwater levels and/or flow directions may vary due to seasonal fluctuations in precipitation, local usage demands, geology, underground structures, or dewatering operations.

5.2.5 Other Physical Setting Sources

Flood Plain Map

ATC reviewed a Flood Insurance Rate Map (FIRM) depicted in the EDR Radius Map regulatory agency database report. According to FIRM map – Community Panel # 3604970015B, the Site is not located

within either a 100- and 500-year floodplain zone. A copy of the flood plain map is available for review in the EDR Radius Map report included in Appendix E.

Wetlands Map

According to the U.S. Department of the Interior, Fish & Wildlife Service's National Wetland Inventory (NWI) Map for *Central Park, NY*, designated wetlands are not illustrated on or adjacent to the Site. A copy of the wetlands map is included in Appendix E.

5.3 Historical Records Sources

The following table summarizes the findings of the research presented below pertaining to historical Site and surrounding area uses.

HISTORICAL USE SUMMARY				
Period	Identified Historical Uses		Source(s)	Intervals/Comments
	Site	Surrounding Area		
Prior to 1940	Vacant lots, a small garage with a dwelling and the existing Site building built in 1929 occupied by a garage with four (4) 550-gallon USTs	Low-rise dwellings, vacant lots, a gasoline station with twelve (12) 550-gallon USTs and auto repair shop, commercial properties, and park	Topographic Map, Sanborn Maps and City Directories	First Sanborn Map dated 1909; First City Directory dated 1920. Data gaps exist between 1909 and 1920, 1920 and 1927, 1939 and 1950. <i>Recognized environmental conditions</i> identified. Based on the historic use of the Site for auto-related operations and use of the eastern adjoining property as a gasoline station, ATC recommends further investigation of the subsurface of the Site that may have been impacted.

PHASE I ENVIRONMENTAL SITE ASSESSMENT
414 West 155th Street
New York, NY 10032

HISTORICAL USE SUMMARY				
Period	Identified Historical Uses		Source(s)	Intervals/Comments
	Site	Surrounding Area		
1940-1960	Existing Site building built in 1929 occupied by a garage with four (4) 550-gallon USTs. Additionally, an auto repair was identified at the Site	Relatively unchanged from the previous period	Topographic Map, Sanborn Maps and City Directories	Data gaps exist between 1939 and 1950, 1956 and 1968. <i>Recognized environmental conditions</i> identified. Based on the historic use of the Site for auto-related operations and use of the eastern adjoining property as a gasoline station, ATC recommends further investigation of the subsurface of the Site that may have been impacted.
1961-1980	Relatively unchanged from the previous period	Relatively unchanged from the previous period with the exception of a garage depicted to the southwest of the Site	Topographic Maps, Sanborn Maps and City Directories	No significant data gaps. <i>Recognized environmental conditions</i> identified. Based on the historic use of the Site for auto-related operations and use of the eastern adjoining property as a gasoline station and the southwestern adjacent property as a garage, ATC recommends further investigation of the subsurface of the Site that may have been impacted.

HISTORICAL USE SUMMARY				
Period	Identified Historical Uses		Source(s)	Intervals/Comments
	Site	Surrounding Area		
1981 to present	Relatively unchanged from the previous period	Relatively unchanged from the previous period	Topographic Map, Sanborn Maps, City Directories, Interviews, and Municipal Research	No significant data gaps. <i>Recognized environmental conditions identified. Based on the historic use of the Site for auto-related operations and use of the eastern adjoining property as a gasoline station and the southwestern adjacent property as a garage, ATC recommends further investigation of the subsurface of the Site that may have been impacted.</i>

In accordance with ASTM standards, ATC attempted to review the historical uses of the Site back to obvious first development, or back to 1940, whichever is earlier. Despite the data gaps noted in the Historical Use Summary table, the Site usage appeared unchanged over the period in which the gaps were identified. Historical information sources researched in this assessment allowed uses of the Site to be traced from the present back to 1909. This does not predate the Site's obvious first developed use, per ASTM Standard Practice E 1527-05 § 8.3.2., and therefore constitutes historical data failure. Despite the data gaps noted in the Historical Use Summary table, the property usage appeared unchanged over the period in which the gaps were identified. These data gaps do not significantly impact the findings of this report. As such, the requirements of ASTM Standard Practice E 1527-05 §8.3.2.1 §8.3.2.2 have been satisfied and, as stated in ASTM Standard Practice E 1527-05 §8.3.2.3, the historical research is considered complete.

5.3.1 Aerial Photographs

ATC did not review aerial photographs as part of this assessment. Based on ATC's experience, little useful information was expected from a review of aerial photographs due to the urban density and long-term development of the Site and surrounding area.

5.3.2 Fire Insurance Maps

ATC reviewed available historical Sanborn fire insurance maps of the Site and surrounding areas in order to identify historical land use that may have involved hazardous substances and petroleum products. Historical fire insurance maps from the years 1909 through 1996 were reviewed to determine historical uses of the Site. The following are descriptions and interpretations from the fire insurance map reviews:

FIRE INSURANCE MAP SUMMARY	
Year	Comments
1909	Site: The Site is depicted with a garage with a dwelling on the second story and vacant lots. Surrounding Area: The adjacent properties in all directions are depicted with low-rise dwellings and vacant lots.
1939	Site: The Site is depicted with the existing building built in 1929 and labeled as a garage with four (4) 550-gallon gasoline USTs. Surrounding Area: The adjoining property to the east is depicted with a gasoline filling station with twelve (12) 550-gallon gasoline USTs, an auto service station, and an office. Adjacent properties to the south are depicted with dwellings and vacant lots. Surrounding properties to the north are identified with a park, commercial retail, and dwellings. Surrounding properties to the west are depicted with a vacant lot followed by St Nicholas Avenue. Further to the west is depicted with commercial retail and low-rise dwellings.
1950	Site: The Site appears relatively unchanged from the 1939 Sanborn map. Surrounding Area: Surrounding properties remain relatively unchanged from the 1939 Sanborn map. However, further to the west across St Nicholas Avenue is depicted with a parking lot and a used car sale.
1968-1986	Site: The Site appears relatively unchanged from the 1950 Sanborn map, with the exception of auto repair now being identified on-Site. Surrounding Area: Adjacent properties to the southwest are depicted with a garage, storage, and a building labeled as “Department of Water Supply Gas & Electricity.” Adjoining properties to the north and east are relatively unchanged from the 1950 Sanborn map, with the exception of a school to the north. Surrounding properties to the west are relatively unchanged from the 1950 Sanborn map, with the exception of the auto sales lot no longer present.
1991-1996	Site: The Site remains relatively unchanged from the previous maps. Surrounding Area: The surrounding properties remain relatively unchanged from the previous maps. However, the parking lot formerly occupying a western adjacent property is now labeled as “Prince Hall.”

ATC’s review of historical Sanborn maps identified the Site as being developed with the existing Site building built in 1929, which was occupied by a garage with four (4) 550-gallon USTs from at least 1939 to 1996. Additionally, auto repair was identified at the Site from at least 1968 to 1996. Prior to the construction of the current Site building, the Site was developed with a smaller garage with a dwelling on the second story and vacant lots. The adjoining property to the east has been developed with a gasoline filling station with twelve (12) 550-gallon gasoline USTs, an auto service station, and an office from at least 1939 to 1996. Of note, this adjoining property is currently occupied by Getty gasoline station with an auto repair shop. A garage is depicted to the southwest of the Site from at least 1968 through 1996. This property is currently occupied by a utility. Surrounding properties in all other directions have been developed mainly with commercial retail and dwellings since at least 1909. ATC concludes that the historical use of the Site for auto related operations and use of the eastern adjoining property as a gasoline station and the southwestern adjacent property as a garage represent a *recognized environmental condition* for the Site.

Copies of the fire insurance maps are provided in Appendix G.

5.3.3 Site Tax Files

ATC reviewed available tax information from the New York City Department of Finance website for ownership information on the Site. According to these records, the Site is currently owned by Garage

Estates Company. The review of tax files did not identify past uses indicating *recognized environmental conditions* at the Site.

5.3.4 Recorded Land Title Records

The acquisition of recorded land title records was not required by the scope of work for the Phase I ESA.

5.3.5 Historical USGS Topographic Quadrangles

Historical topographical maps were not reviewed for the Site and surrounding properties based on their limited usefulness in densely developed urban areas and given the adequate coverage by other historical resources (e.g., Sanborn fire insurance maps, city directories, etc.).

5.3.6 City Directories

Research regarding the availability of historical city directories was conducted by EDR for the Site. City directories were available from 1920 through 2000. According to this review, the Site was listed with numerous auto related commercial listings from 1920 through at least 1956. The Site was identified with an auto repair shop listing for 1956. Surrounding properties were generally listed with residential, commercial and retail listings from 1920 through 1958. ATC concludes that the historical use of the Site as auto related operations represents a *recognized environmental condition* for the Site. Documentation is included in Appendix G.

5.3.7 Building Department Records

ATC reviewed available building department information provided by the NYCDOB via the on-line Building Information System website (<http://a810-bisweb.nyc.gov/bisweb/bsqpm01.jsp>). The Site is designated as Block 2069, Lot 21. One (1) open Department of Building (DOB) and one (1) open Environmental Control Board (ECB) violations were identified at the Site. The open violations are associated with construction related issues and do not appear to relate to environmental issues. Based on the nature of these violations, ATC concludes that they do not represent an environmental concern for the Site.

5.3.8 Zoning/Land Use Records

ATC reviewed the NYCDCP Zoning Map from the NYCDCP website, which indicated that the Site is located in an area that is currently zoned as C8-3 – “Commercial”. The Site was not identified as having a City Environmental Quality Review (CEQR) Declaration (also known as a Little “E” designation). A Little “E” designation is assigned to certain blocks or lots by a New York City agency (i.e., New York City Department of Environmental Protection, New York City Department of City Planning) as a result of an environmental assessment performed in conjunction with a zoning map amendment.

5.3.9 Prior Reports

ATC was not provided with any prior environmental reports.

5.3.10 Other Historical Sources

No other historical sources were reviewed.

6.0 SITE RECONNAISSANCE

The following is a summary of visual and/or physical observations of the Site on the day of the Site visit. Photographs can be found in Appendix C.

6.1 Methodology and Limiting Conditions

The Site visit and area reconnaissance were conducted by Ms. Bedia Saray, ATC Project Manager, on November 13, 2007. The Site reconnaissance consisted of visual and/or physical observations of: the property and improvements; adjoining properties as viewed from the Site; and, the surrounding area based on visual observations made during the trip to and from the Site. Unimproved portions of the Site were observed along the perimeter and in a general grid pattern in safely accessible areas. Building exteriors were observed along the perimeter from the ground, unless described otherwise. Building interiors were observed as they were made safely accessible, unless described otherwise.

6.2 Hazardous Substance Use, Storage, and Disposal

ATC did not observe the use, storage or disposal of hazardous substances, including hazardous wastes, on the Site.

ATC observed suspect petroleum staining on the floor (approximately 12'x18') in the east-northeastern portion of the cellar along the eastern wall by the door. ATC reviewed a drawing of proposed modification of the building prepared by the U.S. Post Office Department dated June 25, 1969. This drawing indicated the presence of two (2) 275-gallon lube oil tank location in the east-northeastern portion of the cellar, where suspect petroleum staining was observed. Based on the observed conditions, ATC concludes that this condition represents an environmental concern for the Site.

6.3 Underground Storage Tanks (USTs)

ATC did not observe evidence of USTs on the Site. However, the historical Sanborn maps revealed the presence of four (4) 550-gallon gasoline USTs at the Site from at least 1939 through 1996. The Site was not identified as a LTANKS facility, New York PBS tank facility, or New York Spill site. Based on the potential presence of these USTs at the Site and the lack of current information regarding these USTs, ATC concludes that they represent a *recognized environmental condition*.

The U. S. Post Office Department drawing dated June 25, 1969 indicated the presence a fill port in the vicinity of the ramp in the cellar that might be associated with potential USTs.

6.4 Aboveground Storage Tanks (ASTs)

At the time of the Site reconnaissance, ATC observed the presence of an out-of service approximately 550-gallon AST located underneath the second floor ramp on the eastern side of the first floor. ATC observed an inactive fuel oil fill port on the second floor right above the tank and an inactive vent pipe associated with this tank. ATC also observed the presence of an inactive small AST located underneath the staircase in the south-southwestern portion of the cellar. No evidence of spills or leaks was observed in the vicinity of the ASTs at the time of the Site reconnaissance. The Site was not identified as a LTANKS facility, New York PBS tank facility, or New York Spill site.

The U. S. Post Office Department drawing indicated the presence of a waste oil tank location and an associated fill port in the vicinity of the ramp on the first floor. The drawing also indicated the presence

of two (2) 275-gallon lube oil tank location in the east-northeastern portion of the cellar, where suspect petroleum staining on the floor (approximately 12'x18') was observed by ATC during the Site reconnaissance.

6.5 Other Petroleum Products

ATC did not observe the use, storage or disposal of other petroleum products on the Site.

6.6 Polychlorinated Biphenyls (PCBs)

Polychlorinated Biphenyls (PCBs) are a toxic chemical component of dielectric fluids, coolants or lubricating oils used in many electrical transformers, light ballasts, capacitors or other similar equipment manufactured prior to 1979.

Fluorescent lighting was observed throughout the Site building. The scope of work for this assessment did not include a survey of light ballasts. Fluorescent light ballasts at the Site may contain PCBs since the site building was constructed prior to 1979; however, no evidence of leakage associated with observed light ballasts was apparent as viewed from ground level. Units labeled as PCB-containing (or unlabeled units) should be handled and/or discarded in accordance with applicable federal and local regulations.

No other suspect PCB-containing equipment (i.e., hydraulic lifts, hydraulic elevators, hydraulic compactors, and hydraulic bailers) was observed during the Site reconnaissance.

6.7 Unidentified Substance Containers

ATC did not observe the presence of unidentified substance containers on the Site.

6.8 Non-hazardous Solid Waste

Non-hazardous solid waste is collected on a routine basis by the City of New York Department of Sanitation. No indicators of waste mismanagement or disposal of hazardous materials was observed in the vicinity of the trash disposal areas.

6.9 Wastewater

ATC did not observe indicators of wastewater generated, treated or discharged (including sanitary sewage and storm water) at the Site or to adjoining properties.

6.10 Waste Pits, Ponds and Lagoons

ATC did not observe indicators of waste pits, ponds or lagoons at the Site.

6.11 Sumps

ATC did not observe sumps at the Site.

6.12 Septic Systems

ATC did not observe indicators of a septic system on the Site.

6.13 Stormwater Management System

Stormwater runoff at the Site drains to catch basins located along West 155th Street that discharge to the municipal combined sanitary and stormwater sewer system.

6.14 Wells

ATC did not observe indicators of wells on the Site.

7.0 INTERVIEWS

The following persons were interviewed to obtain information regarding *recognized environmental conditions* in connection with the Site:

INTERVIEW SUMMARY				
Role	Name	Title/Company	Years Assoc. With Property	Interview Type
Site Contact	Ms. Mary Ann Villari	Broadway Housing Communities	Unknown	In person
George Polo	Manager at the Site	Manager at the Site	15 years	In person
Local Govt. Official	Representative	New York City Fire Department	N/A	FOI letter
Local Govt. Official	Representative	New York City Department of Environmental Protection	N/A	FOI letter
Local Govt. Official	Ms. Rena Bryant	New York City Department of Health and Mental Hygiene	N/A	FOI letter
State Gov't Official	Representative	New York State Department of Environmental Conservation	N/A	FOI letter

Pertinent information from the interviews is discussed in applicable sections of this report with details (including failed attempts to interview) documented on Record of Communication forms in Appendix J.

8.0 OTHER ENVIRONMENTAL CONDITIONS

8.1 Asbestos-Containing Material (ACM)

ATC conducted a limited visual assessment within the accessible areas of the Site building for suspect asbestos containing materials (ACM). The use of asbestos in many building products was banned by the U.S. Environmental Protection Agency (USEPA) by the late 1970s. In 1989, the USEPA issued a ruling prohibiting the manufacturing, importation, processing, and distribution of most asbestos containing products. This rule, known as the Ban and Phase-Out Rule, would have effectively banned the use of nearly 95% of all asbestos products used in the United States. However, the U.S. 5th Circuit Court of Appeals vacated and remanded most of the Ban and Phase-Out Rule in October 1991. Due to this court decision, many asbestos containing product categories not previously banned (prior to 1989) may still be in use today. Among these common material types found in buildings are floor tiles and roofing materials.

Based on the construction date (1929), it is likely that asbestos is present within the Site building materials. ATC observed suspect ACM, including floor tiles and mastic (in the northeast portion of second floor), plaster walls and roofing materials within the accessible areas of the Site building. These materials were generally observed in good condition with the exception of some damaged floor tiles in the northeastern portion of the second floor of the Site building. In the event that the suspect ACM is to be disturbed by future renovation or demolition work, a thorough inspection and proper asbestos abatement procedures should be implemented prior to the commencement of such work. ACM is outside of the Scope of ASTM Practice E 1527-05 and, therefore, the potential presence of ACM is not considered a *recognized environmental condition*.

8.2 Radon

Radon is a naturally occurring colorless, odorless gas that is a by-product of the decay of radioactive materials potentially present in bedrock and soil. The EPA guidance action level for annual residential exposure to radon is 4.0 picoCuries per liter of air (pCi/L). The guidance action level is not a regulatory requirement for private owners of commercial real estate, but is commonly used for comparison purposes to suggest whether further action at a building may be prudent.

ATC reviewed the New York State Department of Health (NYSDOH) Radon Program results dated August 2007, which provides information pertaining to screening tests performed in homes throughout New York State. The Radon Program screening results for New York County indicates that the Site is located in an area of low propensity with regard to the potential for elevated levels of radon gas. The results indicate that the average radon level was 2.15 pCi/l, which is below the USEPA recommended action level of 4.0 pCi/l. Based on this information, ATC concludes that radon is not a concern for the Site. Radon is outside of the Scope of ASTM Practice E 1527-05 and, therefore, radon is not considered a *recognized environmental condition*.

8.3 Lead in Drinking Water

Within the City of New York, potable water is supplied to Manhattan primarily from upstate New York reservoirs. ATC reviewed New York City's most recent Drinking Water Supply and Quality Report made available through the NYCDEP website (<http://www.ci.nyc.ny.us/html/dep/home.html>) for the year 2006. Review of the analytical data provided in the report confirmed that the municipally supplied water meets all drinking water standards established by the United States Environmental Protection Agency

Safe Water Drinking Act, including those for lead. No drinking water supply wells exist at the Site.

8.4 Lead-Based Paint (LBP)

Based on the construction date (1929), LBP is presumed to be present at the Site. During the course of ATC's inspection, painted surfaces within accessible areas were generally observed in fair condition with the exception of peeling paint observed in the bathroom on the first floor. LBP is outside of the Scope of ASTM Practice E 1527-05 and, therefore, the potential presence of LBP is not considered a *recognized environmental condition*.

8.5 Mold Screening Survey

ATC conducted a visual screening survey for mold conditions at the Site. The screening consisted of brief interviews and physical observations. Based on the results of the interview and physical observation, ATC found no evidence of potential mold growth at the Site within areas observed at the time of the Site reconnaissance. Mold conditions are outside the scope of ASTM Practice E 1527-05 and, therefore, the presence of mold or conditions favorable for mold growth are not *recognized environmental conditions*.

8.6 Additional User Requested Conditions

No additional User Requested Conditions were evaluated for this Phase I ESA.

9.0 REFERENCES

ASTM International. *Standard Practice for Environmental Site Assessments: Phase I Environmental Site Assessment Process*, ASTM Designation E 1527-05. November 2005.

ASTM International. *Standard Guide for Readily Observable Mold and Conditions Conducive to Mold in Commercial Buildings: Baseline Survey Process*, ASTM Designation E 2418-06. March 2006.

ASTM International. *Standard Guide for Limited Asbestos Screens of Buildings*, ASTM Designation E 2308-05. August 2005.

Environmental Data Resources, Inc. (EDR) *EDR Radius Map with Geocode*, Report Inquiry Number 2077001.2s, dated November 13, 2007.

Environmental Data Resources, Inc. (EDR) *EDR City Directory Abstract* Inquiry Number 2077001.4, dated November 13, 2007.

Environmental Data Resources, Inc. (EDR) *EDR Sanborn Map Report* Inquiry Number 2077001.3s, dated November 14, 2007.

New York Department of Environmental Conservation (NYDEC) Environmental Navigator website, <http://www.dec.state.ny.us/website/imsmaps/navigator/>

New York City Department of Building Website <http://a810-bisweb.nyc.gov/bisweb/>

New York City Department of Finance Website (<http://www.nyc.gov/html/dof/html/home/home.shtml>)

New York City Department of Environmental Protection (NYCDEP) website, <http://www.nyc.gov/html/dep/home.html>

United States Environmental Protection Agency (USEPA) website, <http://www.epa.gov/>


New York State Department of Health website, <http://www.nyhealth.gov/>

Propertyshark website www.propertyshark.com


10.0 APPENDICES

- Appendix A - Site Vicinity Map**
- Appendix B - Site Plan**
- Appendix C - Site Photographs**
- Appendix D - User Provided Documentation**
- Appendix E - Regulatory Database Report**
- Appendix F - Aerial Photographs (Not Used)**
- Appendix G - Historical Research Documentation**
- Appendix H - Prior Reports (None Provided)**
- Appendix I - Resumes**
- Appendix J - Records of Communication**
- Appendix K - Laboratory Reports (Not Used)**
- Appendix L - Other Supporting Documentation**
- Appendix M - Terminology**

APPENDIX A
SITE VICINITY MAP

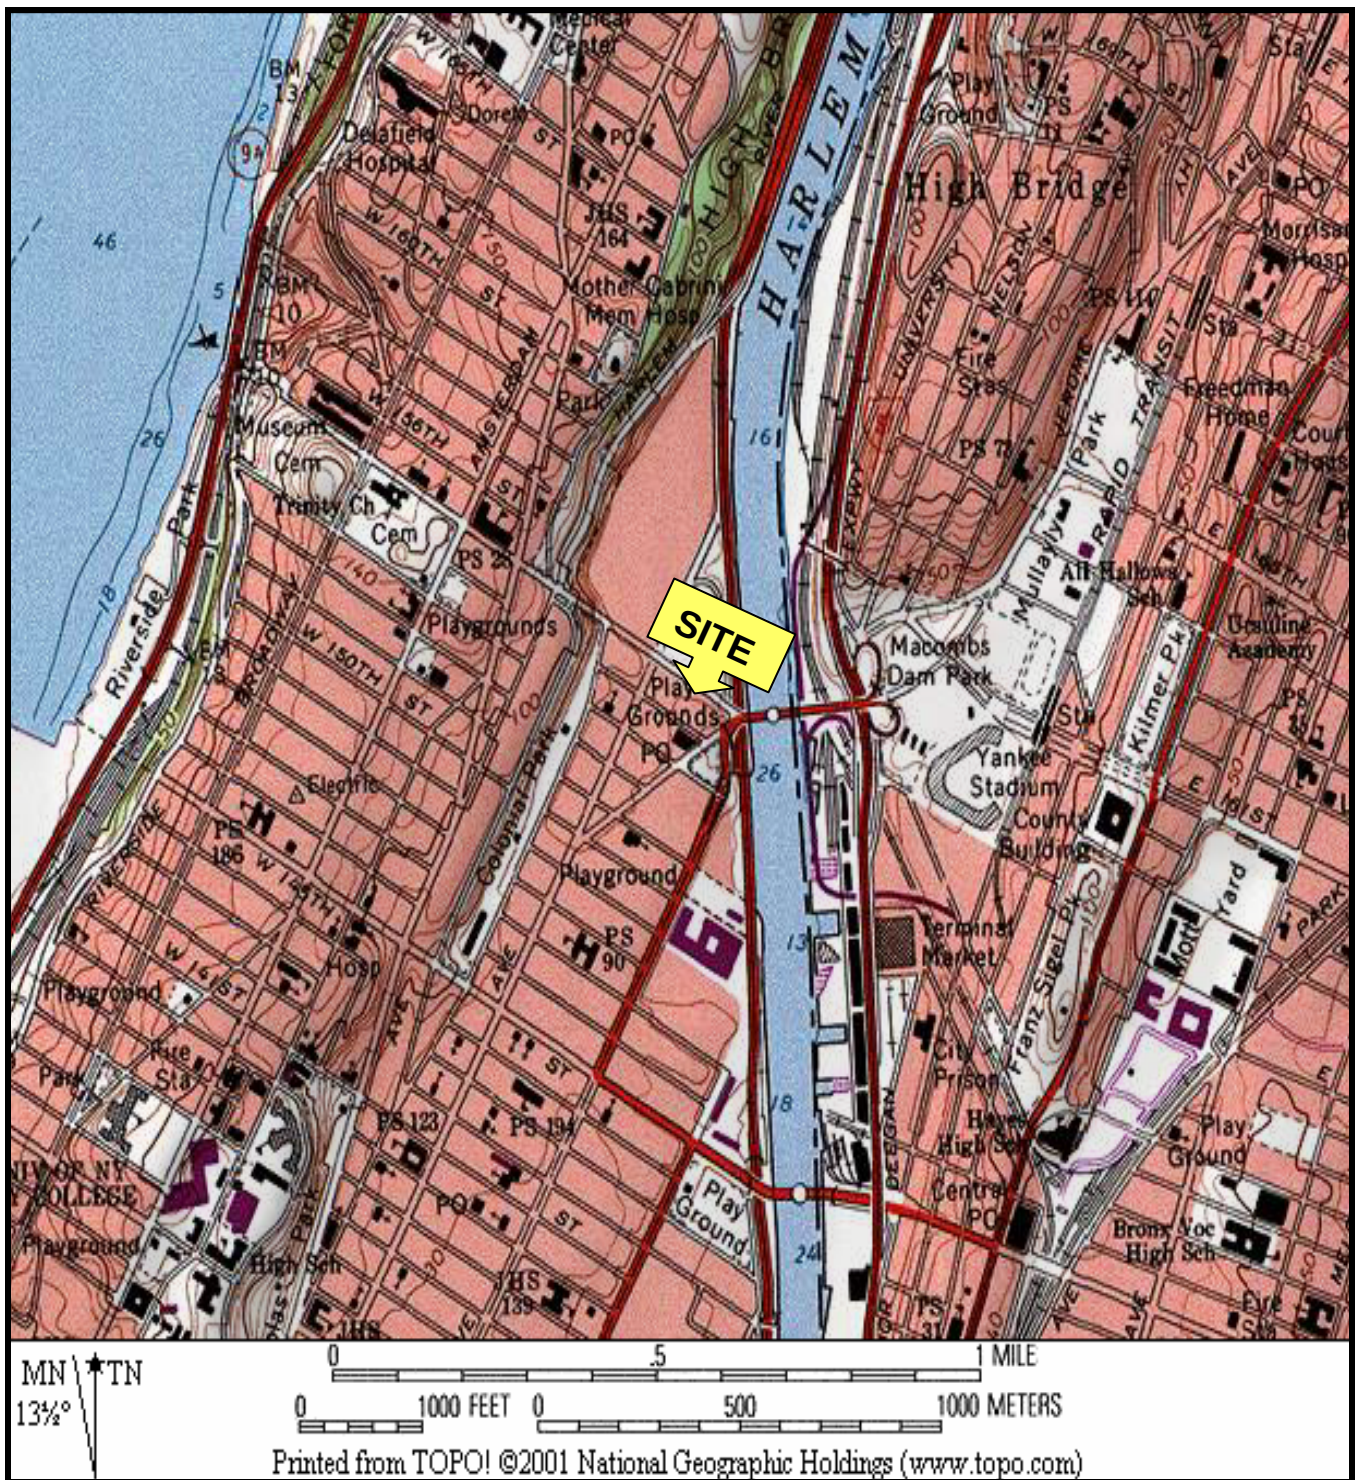

104 East 25th Street, 8th Floor
New York, NY 10010-2917
Phone (212) 353-8280 * Fax (212) 979-8447

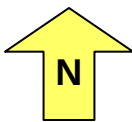

USGS 7.5 Quad Index
2440074-G8 Central Park, NY/ NJ

APPENDIX A - SITE LOCATION MAP

Client: Broadway Housing Communities
Site Address: 414 West 155th Street
New York, NY 10032
ATC Project No. 015.26789.0002
Scale: See Figure

APPENDIX B

SITE PLAN




104 East 25th Street, 10th Floor
New York, NY 10010-2917
(212) 353-8280 Fax (212) 979-8447

APPENDIX B - SITE PLAN

SITE: 414 West 155th Street
New York, NY
CLIENT: Broadway Housing Communities
ATC PROJECT #: 015.26789.0002
SCALE: Not to scale

LEGEND:

Site Boundary ---

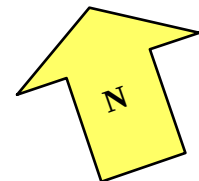

APPENDIX C
SITE PHOTOGRAPHS

PHASE I ENVIRONMENTAL SITE ASSESSMENT
414 WEST 155TH STREET
NEW YORK, NY



Photo 1: View of Site along St Nicholas Place.



Photo 2: View of gasoline station adjacent to south-southwest of the Site.



Photo 3: View of typical ceiling.



Photo 4: View of staining.

PHASE I ENVIRONMENTAL SITE ASSESSMENT
414 WEST 155TH STREET
NEW YORK, NY



Photo 5: View of the manager office on the first floor.



Photo 6: View of roof.



Photo 7: View of oil fill port located on the second floor associated with 550-gallon AST on the first floor.



Photo 8: View of 550-gallon AST on the first floor on the east side of the building.



Photo 9: View of small AST located in the basement underneath the staircase in the south-southwestern portion of the building.



Photo 10: View of excessive peeling paint in the bathroom next to the office on the first floor.

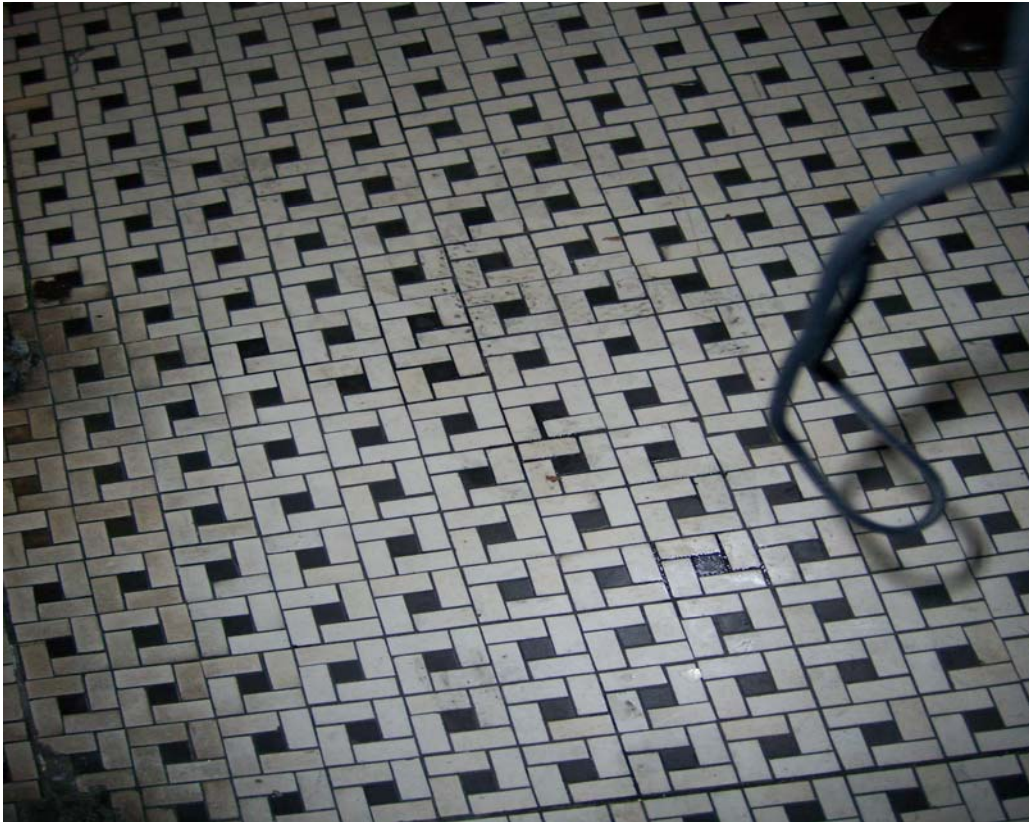


Photo 11: View of bathroom floor on the first floor.



Photo 12: View of garbage container next to main entrance on the first floor.

PHASE I ENVIRONMENTAL SITE ASSESSMENT
414 WEST 155TH STREET
NEW YORK, NY



Photo 13: View to the northwest across West 155th Street and St Nicholas Avenue.



Photo 14: View to the east St Nicholas Place.

PHASE I ENVIRONMENTAL SITE ASSESSMENT
414 WEST 155TH STREET
NEW YORK, NY



Photo 15: View to the northeast across West 155th Street and Harlem River Driveway.



Photo 16: View to the north across West 15th Street.

PHASE I ENVIRONMENTAL SITE ASSESSMENT
414 WEST 155TH STREET
NEW YORK, NY



Photo 17: View to the north-northwest across West 15th Street.



Photo 18: View to the west.

APPENDIX D
USER PROVIDED DOCUMENTATION



ATTACHMENT D CLIENT QUESTIONNAIRE

Per ASTM Standard Practice E 1527-05, Section 6, User Responsibilities, the User of an ESA has specific obligations for performing tasks during the ESA that will help identify the possibility of *recognized environmental conditions* in connection with the Site. Failure by the User to fully comply with the requirements may result in a *data gap* being identified in the report and may impact their ability to use the report to help qualify for *Landowner Liability Protections* (LLPs) under Comprehensive Environmental Response, Compensation, and Liability Act (CERCLA). If this questionnaire is not returned to ATC prior to issuance of the draft report, then ATC assumes that the User does not have any information or actual knowledge pursuant to ASTM Standard Practice E 1527-05, Section 6, User Responsibilities. ATC makes no representations or warranties regarding a User's qualification for protection under any federal, state or local laws, rules or regulations.

Please complete the following and return immediately via email or fax to the attention of:

Matthew Mankovich at matt.mankovich@atcassociates.com or (212) 979-8447 (fax#)

If other parties are intending to be the Users of the ESA report, then please forward a copy of this questionnaire for them to complete and return to ATC.

Site Name: Broadway Housing Communities Phase I ESA

Site Address: 414 West 155th Street, New York, NY 10032

ATC Project Number: _____

Please provide the following information (if available) per the requirements of ASTM E 1527-05.

1. Environmental cleanup liens that are filed or recorded against the Site (40 CFR 312.25)

Are you aware of any environmental cleanup liens against the Site that are filed or recorded under federal, tribal, state or local law? Yes ☐ or No ☐

If yes, please provide a description of the lien(s).

2. Activity and land use limitations (AULs) that are in place on the Site or that have been filed or recorded in a registry (40 CFR 312.26)

Are you aware of any AULs, such as engineering controls, land use restrictions or institutional controls that are in place at the Site and/or have been filed or recorded in a registry under federal, tribal, state or local law? Yes ☐ or No ☐ If yes, please provide.

3. Specialized knowledge or experience of the person seeking to qualify for the Landowner Liability Protections (40 CFR 312.28)

As the user of this ESA do you have any specialized knowledge or experience related to the Site or nearby properties? For example, are you involved in the same line of business as the current or former occupants of the Site or an adjoining property so that you would have specialized knowledge of the chemicals and processes used by this type of business?

Yes ☐ or No ☐ If yes, please explain.

4. Relationship of the purchase price to the fair market value of the Site if it were not contaminated (40 CFR 312.29)

a. Does the purchase price being paid for this Site reasonably reflect the fair market value of the Site? Yes ☐ or No ☐

b. If you conclude that there is a difference, have you considered whether the lower purchase price is because contamination is known or believed to be present at the Site?
Yes ☐ or No ☐ If yes, please explain.

5. Commonly known or reasonably ascertainable information about the Site (40 CFR 312.30)

Are you aware of commonly known or reasonably ascertainable information about the Site that would help the environmental professional to identify conditions indicative of releases or threatened releases? For example, as user,

a. Do you know the past uses of the site? Yes ☐ or No ☐ If yes, please state.

- b. Do you know of specific chemicals that are present or once were present at the Site?
Yes ☐ or No ☐ If yes, please state.

- c. Do you know of spills or other chemical releases that have taken place at the Site?
Yes ☐ or No ☐ If yes, please state.

6. Do you know of any environmental cleanups that have taken place at the Site?
Yes ☐ or No ☐ If yes, please state.

7. The degree of obviousness of the presence or likely presence of contamination at the Site, and the ability to detect the contamination by appropriate investigation (40 CFR 312.31)

As the user of this ESA, based on your knowledge and experience related to the Site are there any obvious indicators that point to the presence or likely presence of contamination at the Site?

Yes ☐ or No ☐ If yes, please explain.

This questionnaire was completed by:

Name

Title

Signature

Company of User

Address of User

Date

APPENDIX E
REGULATORY DATABASE REPORT



The EDR Radius Map with GeoCheck®

**414 West 155th Street
414 West 155th Street
New York, NY 10032**

Inquiry Number: 2077001.2s

November 13, 2007

The Standard in Environmental Risk Information

**440 Wheelers Farms Road
Milford, Connecticut 06461**

Nationwide Customer Service

**Telephone: 1-800-352-0050
Fax: 1-800-231-6802
Internet: www.edrnet.com**

TABLE OF CONTENTS

<u>SECTION</u>	<u>PAGE</u>
Executive Summary	ES1
Overview Map	2
Detail Map	3
Map Findings Summary	4
Map Findings	6
Orphan Summary	721
Government Records Searched/Data Currency Tracking	GR-1
 <u>GEOCHECK ADDENDUM</u>	
Physical Setting Source Addendum	A-1
Physical Setting Source Summary	A-2
Physical Setting Source Map	A-7
Physical Setting Source Map Findings	A-8
Physical Setting Source Records Searched	A-13

Thank you for your business.
Please contact EDR at 1-800-352-0050
with any questions or comments.

Disclaimer - Copyright and Trademark Notice

This Report contains certain information obtained from a variety of public and other sources reasonably available to Environmental Data Resources, Inc. It cannot be concluded from this Report that coverage information for the target and surrounding properties does not exist from other sources. **NO WARRANTY EXPRESSED OR IMPLIED, IS MADE WHATSOEVER IN CONNECTION WITH THIS REPORT. ENVIRONMENTAL DATA RESOURCES, INC. SPECIFICALLY DISCLAIMS THE MAKING OF ANY SUCH WARRANTIES, INCLUDING WITHOUT LIMITATION, MERCHANTABILITY OR FITNESS FOR A PARTICULAR USE OR PURPOSE. ALL RISK IS ASSUMED BY THE USER. IN NO EVENT SHALL ENVIRONMENTAL DATA RESOURCES, INC. BE LIABLE TO ANYONE, WHETHER ARISING OUT OF ERRORS OR OMISSIONS, NEGLIGENCE, ACCIDENT OR ANY OTHER CAUSE, FOR ANY LOSS OF DAMAGE, INCLUDING, WITHOUT LIMITATION, SPECIAL, INCIDENTAL, CONSEQUENTIAL, OR EXEMPLARY DAMAGES. ANY LIABILITY ON THE PART OF ENVIRONMENTAL DATA RESOURCES, INC. IS STRICTLY LIMITED TO A REFUND OF THE AMOUNT PAID FOR THIS REPORT.** Purchaser accepts this Report "AS IS". Any analyses, estimates, ratings, environmental risk levels or risk codes provided in this Report are provided for illustrative purposes only, and are not intended to provide, nor should they be interpreted as providing any facts regarding, or prediction or forecast of, any environmental risk for any property. Only a Phase I Environmental Site Assessment performed by an environmental professional can provide information regarding the environmental risk for any property. Additionally, the information provided in this Report is not to be construed as legal advice.

Copyright 2007 by Environmental Data Resources, Inc. All rights reserved. Reproduction in any media or format, in whole or in part, of any report or map of Environmental Data Resources, Inc., or its affiliates, is prohibited without prior written permission.

EDR and its logos (including Sanborn and Sanborn Map) are trademarks of Environmental Data Resources, Inc. or its affiliates. All other trademarks used herein are the property of their respective owners.

EXECUTIVE SUMMARY

A search of available environmental records was conducted by Environmental Data Resources, Inc (EDR). The report was designed to assist parties seeking to meet the search requirements of EPA's Standards and Practices for All Appropriate Inquiries (40 CFR Part 312), the ASTM Standard Practice for Environmental Site Assessments (E 1527-05) or custom requirements developed for the evaluation of environmental risk associated with a parcel of real estate.

TARGET PROPERTY INFORMATION

ADDRESS

414 WEST 155TH STREET
NEW YORK, NY 10032

COORDINATES

Latitude (North):	40.830640 - 40° 49' 50.3"
Longitude (West):	73.940810 - 73° 56' 26.9"
Universal Transverse Mercator:	Zone 18
UTM X (Meters):	589310.2
UTM Y (Meters):	4520285.0
Elevation:	111 ft. above sea level

USGS TOPOGRAPHIC MAP ASSOCIATED WITH TARGET PROPERTY

Target Property Map:	40073-G8 CENTRAL PARK, NY
Most Recent Revision:	1995

TARGET PROPERTY SEARCH RESULTS

The target property was not listed in any of the databases searched by EDR.

DATABASES WITH NO MAPPED SITES

No mapped sites were found in EDR's search of available ("reasonably ascertainable ") government records either on the target property or within the search radius around the target property for the following databases:

FEDERAL RECORDS

NPL.....	National Priority List
Proposed NPL.....	Proposed National Priority List Sites
Delisted NPL.....	National Priority List Deletions
NPL LIENS.....	Federal Superfund Liens
CERCLIS.....	Comprehensive Environmental Response, Compensation, and Liability Information System
CERC-NFRAP.....	CERCLIS No Further Remedial Action Planned
CORRACTS.....	Corrective Action Report
RCRA-TSDF.....	Resource Conservation and Recovery Act Information
RCRA-LQG.....	Resource Conservation and Recovery Act Information
ERNS.....	Emergency Response Notification System

EXECUTIVE SUMMARY

HMIRS	Hazardous Materials Information Reporting System
US ENG CONTROLS	Engineering Controls Sites List
US INST CONTROL	Sites with Institutional Controls
DOD	Department of Defense Sites
FUDS	Formerly Used Defense Sites
US BROWNFIELDS	A Listing of Brownfields Sites
CONSENT	Superfund (CERCLA) Consent Decrees
ROD	Records Of Decision
UMTRA	Uranium Mill Tailings Sites
ODI	Open Dump Inventory
TRIS	Toxic Chemical Release Inventory System
TSCA	Toxic Substances Control Act
FTTS	FIFRA/ TSCA Tracking System - FIFRA (Federal Insecticide, Fungicide, & Rodenticide Act)/TSCA (Toxic Substances Control Act)
SSTS	Section 7 Tracking Systems
LIENS 2	CERCLA Lien Information
RADINFO	Radiation Information Database
US CDL	Clandestine Drug Labs
HIST FTTS	FIFRA/TSCA Tracking System Administrative Case Listing
DEBRIS REGION 9	Torres Martinez Reservation Illegal Dump Site Locations
ICIS	Integrated Compliance Information System
LUCIS	Land Use Control Information System
DOT OPS	Incident and Accident Data
PADS	PCB Activity Database System
MLTS	Material Licensing Tracking System
MINES	Mines Master Index File
FINDS	Facility Index System/Facility Registry System
RAATS	RCRA Administrative Action Tracking System

STATE AND LOCAL RECORDS

HSWDS	Hazardous Substance Waste Disposal Site Inventory
DEL SHWS	Delisted Registry Sites
SWF/IF	Facility Register
SWRCY	Registered Recycling Facility List
SWTIRE	Registered Waste Tire Storage & Facility List
CBS UST	Chemical Bulk Storage Database
MOSF UST	Major Oil Storage Facilities Database
CBS AST	Chemical Bulk Storage Database
HIST AST	Historical Petroleum Bulk Storage Database
MOSF AST	Major Oil Storage Facilities Database
ENG CONTROLS	Registry of Engineering Controls
INST CONTROL	Registry of Institutional Controls
VCP	Voluntary Cleanup Agreements
BROWNFIELDS	Brownfields Site List
SPDES	State Pollutant Discharge Elimination System
AIRS	Air Emissions Data
CBS	Chemical Bulk Storage Site Listing
E DESIGNATION	E DESIGNATION SITE LISTING
RES DECL	Restrictive Declarations Listing
MOSF	Major Oil Storage Facility Site Listing

TRIBAL RECORDS

INDIAN RESERV	Indian Reservations

EXECUTIVE SUMMARY

INDIAN LUST..... Leaking Underground Storage Tanks on Indian Land
INDIAN UST..... Underground Storage Tanks on Indian Land

EDR PROPRIETARY RECORDS

Manufactured Gas Plants... EDR Proprietary Manufactured Gas Plants
EDR Historical Auto StationsEDR Proprietary Historic Gas Stations
EDR Historical Cleaners..... EDR Proprietary Historic Dry Cleaners

SURROUNDING SITES: SEARCH RESULTS

Surrounding sites were identified in the following databases.

Elevations have been determined from the USGS Digital Elevation Model and should be evaluated on a relative (not an absolute) basis. Relative elevation information between sites of close proximity should be field verified. Sites with an elevation equal to or higher than the target property have been differentiated below from sites with an elevation lower than the target property. Page numbers and map identification numbers refer to the EDR Radius Map report where detailed data on individual sites can be reviewed.

Sites listed in ***bold italics*** are in multiple databases.

Unmappable (orphan) sites are not considered in the foregoing analysis.

FEDERAL RECORDS

RCRAInfo: RCRAInfo is EPA's comprehensive information system, providing access to data supporting the Resource Conservation and Recovery Act (RCRA) of 1976 and the Hazardous and Solid Waste Amendments (HSWA) of 1984. RCRAInfo replaces the data recording and reporting abilities of the Resource Conservation and Recovery Information System(RCRIS). The database includes selective information on sites which generate, transport, store, treat and/or dispose of hazardous waste as defined by the Resource Conservation and Recovery Act (RCRA). Conditionally exempt small quantity generators (CESQGs) generate less than 100 kg of hazardous waste, or less than 1 kg of acutely hazardous waste per month. Small quantity generators (SQGs) generate between 100 kg and 1,000 kg of hazardous waste per month Large quantity generators generate over 1,000 kilograms (kg) of hazardous waste, or over 1 kg of acutely hazardous waste per month. Transporters are individuals or entities that move hazardous waste from the generator offsite to a facility that can recycle, treat, store, or dispose of the waste. TSDFs treat, store, or dispose of the waste.

A review of the RCRA-SQG list, as provided by EDR, and dated 06/13/2006 has revealed that there are 10 RCRA-SQG sites within approximately 0.25 miles of the target property.

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Dist / Dir</u>	<u>Map ID</u>	<u>Page</u>
<i>NYC BD OF ED - PUBLIC SCHOOL 2</i>	<i>475 W 155TH ST</i>	<i>0 - 1/8 WNW H23</i>		<i>82</i>
<i>ABAX INC</i>	<i>444 W 153RD ST APT 51</i>	<i>0 - 1/8 WSW 43</i>		<i>131</i>
<i>NYCHA - AUDUBON HOUSES</i>	<i>1909 AMSTERDAM AVE</i>	<i>1/8 - 1/4 WNW M52</i>		<i>147</i>
<i>K&B CLEANERS</i>	<i>1946 AMSTERDAM AVE</i>	<i>1/8 - 1/4 NNW P65</i>		<i>197</i>
<i>A & R CLEANERS</i>	<i>1988 AMSTERDAM AVE</i>	<i>1/8 - 1/4 N AF145</i>		<i>398</i>
<i>FOUR SEASONS CLEANERS</i>	<i>1838 AMSTERDAM AVE</i>	<i>1/8 - 1/4 WSW AO172</i>		<i>471</i>
<i>PINE TREE FRENCH CLEANERS</i>	<i>1838 AMSTERDAM AVE</i>	<i>1/8 - 1/4 WSW AO174</i>		<i>490</i>
<u>Lower Elevation</u>	<u>Address</u>	<u>Dist / Dir</u>	<u>Map ID</u>	<u>Page</u>
<i>GETTY PETROLEUM CORP</i>	<i>89-91 ST NICHOLAS PL</i>	<i>0 - 1/8 ESE B15</i>		<i>61</i>
<i>NYCTA - 155TH ST SUBSTATION</i>	<i>155TH ST & BRADHURST AV</i>	<i>1/8 - 1/4 ESE 51</i>		<i>147</i>
<i>BLOCKERS CLEANERS</i>	<i>840 ST NICHOLAS AVE</i>	<i>1/8 - 1/4 SSW K61</i>		<i>170</i>

EXECUTIVE SUMMARY

STATE AND LOCAL RECORDS

SHWS: The State Hazardous Waste Sites records are the states' equivalent to CERCLIS. These sites may or may not already be listed on the federal CERCLIS list. Priority sites planned for cleanup using state funds (state equivalent of Superfund) are identified along with sites where cleanup will be paid for by potentially responsible parties. The data come from the Department of Environmental Conservation's Inactive Hazardous waste Disposal Sites in New York State.

A review of the SHWS list, as provided by EDR, and dated 08/15/2007 has revealed that there is 1 SHWS site within approximately 1 mile of the target property.

<u>Lower Elevation</u>	<u>Address</u>	<u>Dist / Dir</u>	<u>Map ID</u>	<u>Page</u>
2350 FIFTH AVENUE CORP	2350 5TH AVE	1/2 - 1 SSE	241	697
Class Code: Significant threat to the public health or environment - action required.				

LTANKS: Leaking Storage Tank Incident Reports. These records contain an inventory of reported leaking storage tank incidents reported from 4/1/86 through the most recent update. They can be either leaking underground storage tanks or leaking aboveground storage tanks. The causes of the incidents are tank test failures, tank failures or tank overfills

A review of the LTANKS list, as provided by EDR, and dated 07/11/2007 has revealed that there are 72 LTANKS sites within approximately 0.5 miles of the target property.

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Dist / Dir</u>	<u>Map ID</u>	<u>Page</u>
PRINCE HALL MASONIC TEMPL Date Closed: 10/07/04	454 WEST 155TH STREET	0 - 1/8 WNW	A6	17
NORTH MANHATTAN SHOP Date Closed: 04/20/01	886 SOUTH ST. NICHOLAS	0 - 1/8 WSW	C8	21
886 ST. NICHOLAS AVENUE Date Closed: / /	886 ST NICHOLAS AVENUE	0 - 1/8 WSW	C9	27
RESIDENCE Date Closed: 10/09/98	943 ST NICHOLAS AVE	1/8 - 1/4N	J47	138
AUDUBON HOUSES Date Closed: 01/07/93 Date Closed: 05/01/95	1909 AMSTERDAM AVENUE	1/8 - 1/4WNW	M53	148
BETHUNE HOUSES Date Closed: 09/09/94	1945 AMSTERDAM AVENUE	1/8 - 1/4NNW	P69	223
514-516 W 156TH ST Date Closed: 11/18/94	514-516 W 156TH ST	1/8 - 1/4NW	P84	255
ST CATHERINE OF GENOA Date Closed: 01/19/06	506 WEST 153 RD ST	1/8 - 1/4W	S94	278
Not reported Date Closed: 12/04/01	513-515 157TH ST	1/8 - 1/4NNW	AB104	298
30TH PRECINCT NYPD Date Closed: 09/26/06	451 W 151ST ST	1/8 - 1/4SW	AG127	361
APARTMENT BUILDING Date Closed: 03/03/06	523 WEST 157TH ST	1/8 - 1/4NNW	AJ142	395
556 WEST 156TH ST-APT A Date Closed: 02/24/03	556 WEST 156TH ST-APT A	1/8 - 1/4NW	AM160	445
555 EDGECOMBE AVE Date Closed: 05/29/92	555 EDGECOMBE AVE	1/8 - 1/4NNE	AN162	450

EXECUTIVE SUMMARY

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Dist / Dir</u>	<u>Map ID</u>	<u>Page</u>
498 W 159TH ST Date Closed: 03/10/03	498 W 159TH ST	1/8 - 1/4N	AP175	491
518 WEST 151ST STREET Date Closed: 10/29/92	518 WEST 151ST STREET	1/4 - 1/2WSW 192		536
APT BLDG Date Closed: 06/13/05	425 W 160TH ST	1/4 - 1/2NNE 193		540
RESIDENCE Date Closed: 02/05/04	555 WEST 152ND ST	1/4 - 1/2W 195		548
Not reported Date Closed: 07/29/04	1003 SAINT NICHOLAS AVE	1/4 - 1/2N 196		550
501 W 150 ST. Date Closed: 03/29/92	501 W 150 ST.	1/4 - 1/2WSW 198		564
MOBIL S/S Date Closed: 09/21/94	3740 BROADWAY	1/4 - 1/2WNW AT203		599
MOBIL S/S Date Closed: / /	3740 BROADWAY	1/4 - 1/2WNW AT204		601
MOBIL S/S Date Closed: 09/21/94	3740 BROADWAY	1/4 - 1/2WNW AT205		607
CHURCH Date Closed: 11/14/05	444 EAST 149TH STREET	1/4 - 1/2SW AU206		609
Not reported Date Closed: 02/06/02	435 CONVENT AVE	1/4 - 1/2SW AU207		610
MULTI DWELLING Date Closed: 12/28/05	542 WEST 150TH ST	1/4 - 1/2WSW 208		613
575 W 159TH ST Date Closed: / /	575 W 159TH ST	1/4 - 1/2NNW 209		616
APARTMENT BLDG AT Date Closed: 11/30/98	428 CONVENT AVE	1/4 - 1/2SW 210		617
APRT BUILDING Date Closed: 07/12/06	555 W. 160TH ST	1/4 - 1/2NNW 213		625
APT COMPLEX Date Closed: 08/07/03	610 WEST 152ND ST	1/4 - 1/2W 214		627
APARTMENT Date Closed: 10/08/04	596 EDGECOMBE AVE	1/4 - 1/2NNE AW215		629
596 EDGECOMBE AVE Date Closed: 10/18/04	596 EDGECOMBE AVE	1/4 - 1/2NNE AW216		631
APARMENT COMPLEX Date Closed: 06/07/06	505 W 148TH ST	1/4 - 1/2SW 217		633
Not reported Date Closed: 09/11/98	580 WEST 161ST ST	1/4 - 1/2NNW AX220		639
580 WEST 161 ST/MANH Date Closed: 07/28/95	580 WEST 161ST STREET	1/4 - 1/2NNW AX221		642
580 161ST ST/MANH Date Closed: 11/26/90	580 161ST STREET	1/4 - 1/2NNW AX222		644
540 WEST 148TH ST Date Closed: 01/26/96	540 WEST 148TH S	1/4 - 1/2WSW 223		647

EXECUTIVE SUMMARY

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Dist / Dir</u>	<u>Map ID</u>	<u>Page</u>
Not reported Date Closed: 02/10/04	601 W 149TH ST	1/4 - 1/2WSW	AY226	653
DRY CLEANERS BUSINESS Date Closed: 12/24/03	601 W 149TH ST	1/4 - 1/2WSW	AY227	658
APARTMENT BUIDLING Date Closed: 05/05/06	2090-92 AMSTERDAMN AVE	1/4 - 1/2NNE	228	661
APARTMENT Date Closed: / /	3609 BROADWAY	1/4 - 1/2WSW	229	662
COLUMBIA PRESBYTERIAN HOSPITAL Date Closed: / /	630 W 160TH ST	1/4 - 1/2NNW	233	672
1070 ST. NICHOLAS AVENUE Date Closed: / /	1070 ST. NICOLAS AVE	1/4 - 1/2N	AZ235	682
1071 ST NICHOLAS AVE Date Closed: / /	1071 ST NICHOLAS AVE	1/4 - 1/2N	AZ236	683
<u>Lower Elevation</u>	<u>Address</u>	<u>Dist / Dir</u>	<u>Map ID</u>	<u>Page</u>
GETTY GAS STA Date Closed: 07/16/92	89 ST NICHOLAS PL	0 - 1/8 S	E17	66
87 ST NICHOLAS Date Closed: / /	87 ST NICHOLAS	0 - 1/8 S	E18	69
APARTMENT Date Closed: / /	401-405 EDGEcombe AVE	0 - 1/8 SE	33	105
49 SAINT NICHOLAS PLACE Date Closed: 11/01/95	49 SAINT NICHOLAS PLACE	1/8 - 1/4SSW	N57	162
364 EAST 155TH STREET/ BR Date Closed: 10/07/92	364 EAST 155TH STREET	1/8 - 1/4ESE	78	243
18-20 ST NICHOLAS PL. Date Closed: 02/02/94	18-20 ST NICHOLAS PL	1/8 - 1/4SSW	Z110	310
RANGEL Date Closed: 07/23/97	159-38 HARLEM RIVER DR	1/8 - 1/4NE	150	423
307 W. 153RD ST Date Closed: 11/25/94	301 153RD ST	1/8 - 1/4SE	168	463
AMOCO GASOLINE #60030 Date Closed: 03/03/03	800 ST. NICHOLAS AVE	1/8 - 1/4SSW	AR187	525
EDGEComb BUILDINGS Date Closed: 02/09/99	345 EDGEComb AVE	1/4 - 1/2S	194	542
HARLEM RIVER II HOUSES (HARLEM Date Closed: 04/26/95 Date Closed: 10/24/05	2850 8TH AVENUE	1/4 - 1/2SSE	197	553
POLO GROUNDS Date Closed: 12/21/05	2994 8TH AVENUE	1/4 - 1/2ENE	AS199	566
APT HOUSE Date Closed: / /	2999 8TH AVE	1/4 - 1/2ENE	AS200	569
POLO GROUNDS HOUSING Date Closed: / /	2999 8TH AVENUE	1/4 - 1/2ENE	AS201	571
POLO GROUNDS (POLO GROUNDS TOW Date Closed: 02/05/90 Date Closed: 04/26/95	2999 EIGHTH AVENUE	1/4 - 1/2ENE	AS202	574

EXECUTIVE SUMMARY

<u>Lower Elevation</u>	<u>Address</u>	<u>Dist / Dir</u>	<u>Map ID</u>	<u>Page</u>
99 MACOMBS PL/MANH/USPS Date Closed: 10/07/92	99 MACOMBS PLACE	1/4 - 1/2 SE	AV211	620
99 MACCOMBS PL/MANH/USPS Date Closed: 10/07/92	99 MACCOMBS PLACE	1/4 - 1/2 SE	AV212	622
625 W 152ND STREET Date Closed: 07/21/94	625 W. 152ND STREET	1/4 - 1/2 W	218	635
PRIVATE RESIDENCE Date Closed: 07/22/05	428 W 147TH ST	1/4 - 1/2 SSW	219	638
SANDERS HOME Date Closed: 02/28/07	406 WEST 147TH STREET	1/4 - 1/2 SSW	224	649
POLICE SERVICE AREA #6 Date Closed: 06/14/07	2786 8TH AVE	1/4 - 1/2 S	225	651
225 EAST 149TH ST/BX Date Closed: 05/25/95	225 EAST 149TH STREET	1/4 - 1/2 SSE	230	665
JACKIE ROBINSON POOL Date Closed: / /	88 BRADHURST AV	1/4 - 1/2 S	231	667
838 RIVERSIDE DR Date Closed: 03/06/92	838 RIVERSIDE DR	1/4 - 1/2 NW	232	670
APARTMENTS Date Closed: 11/26/04	779 RIVERSIDE DR	1/4 - 1/2 NW	234	679
950 UNIVERSITY AVE Date Closed: 04/02/98	950 UNIVERSITY AVE	1/4 - 1/2 E	237	686
APARTMENT BLDG. Date Closed: 06/02/04	853 RIVERSIDE DR	1/4 - 1/2 NW	238	693
RESIDENTS Date Closed: 01/23/03	416 W.145TH ST	1/4 - 1/2 SSW	BA239	694
Not reported Date Closed: 01/23/03	416 W 145TH ST	1/4 - 1/2 SSW	BA240	695

HIST LTANKS: A listing of leaking underground and aboveground storage tanks. The causes of the incidents are tank test failures, tank failures or tank overfills. In 2002, the Department of Environmental Conservation stopped providing updates to its original Spills Information Database. This database includes fields that are no longer available from the NYDEC as of January 1, 2002. Current information may be found in the NY LTANKS database.

A review of the HIST LTANKS list, as provided by EDR, and dated 01/01/2002 has revealed that there are 53 HIST LTANKS sites within approximately 0.5 miles of the target property.

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Dist / Dir</u>	<u>Map ID</u>	<u>Page</u>
NORTH MANHATTAN SHOP	886 SOUTH ST. NICHOLAS	0 - 1/8 WSW	C8	21
886 ST. NICHOLAS AVENUE	886 ST NICHOLAS AVENUE	0 - 1/8 WSW	C9	27
RESIDENCE	943 ST NICHOLAS AVE	1/8 - 1/4 N	J47	138
AUDUBON HOUSES	1909 AMSTERDAM AVENUE	1/8 - 1/4 WNW	M53	148
BETHUNE HOUSES	1945 AMSTERDAM AVENUE	1/8 - 1/4 NNW	P69	223
514-516 W 156TH ST	514-516 W 156TH ST	1/8 - 1/4 NW	P84	255
ST CATHERINE OF GENOA	506 WEST 153 RD ST	1/8 - 1/4 W	S94	278
Not reported	513-515 157TH ST	1/8 - 1/4 NNW	AB104	298
30TH PRECINCT NYPD	451 W 151ST ST	1/8 - 1/4 SW	AG127	361

EXECUTIVE SUMMARY

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Dist / Dir</u>	<u>Map ID</u>	<u>Page</u>
556 WEST 156TH ST-APT A	556 WEST 156TH ST-APT A	1/8 - 1/4NW	AM160	445
555 EDGEcombe AVE	555 EDGEcombe AVE	1/8 - 1/4NNE	AN162	450
498 W 159TH ST	498 W 159TH ST	1/8 - 1/4N	AP175	491
518 WEST 151ST STREET	518 WEST 151ST STREET	1/4 - 1/2WSW	192	536
APT BLDG	425 W 160TH ST	1/4 - 1/2NNE	193	540
RESIDENCE	555 WEST 152ND ST	1/4 - 1/2W	195	548
501 W 150 ST.	501 W 150 ST.	1/4 - 1/2WSW	198	564
MOBIL S/S	3740 BROADWAY	1/4 - 1/2WNW	AT203	599
MOBIL S/S	3740 BROADWAY	1/4 - 1/2WNW	AT204	601
Not reported	435 CONVENT AVE	1/4 - 1/2SW	AU207	610
APARTMENT BLDG AT	428 CONVENT AVE	1/4 - 1/2SW	210	617
APT COMPLEX	610 WEST 152ND ST	1/4 - 1/2W	214	627
APARMENT COMPLEX	505 W 148TH ST	1/4 - 1/2SW	217	633
Not reported	580 WEST 161ST ST	1/4 - 1/2NNW	AX220	639
580 WEST 161 ST/MANH	580 WEST 161ST STREET	1/4 - 1/2NNW	AX221	642
580 161ST ST/MANH	580 161ST STREET	1/4 - 1/2NNW	AX222	644
540 WEST 148TH ST	540 WEST 148TH S	1/4 - 1/2WSW	223	647
Not reported	601 W 149TH ST	1/4 - 1/2WSW	AY226	653
DRY CLEANERS BUSINESS	601 W 149TH ST	1/4 - 1/2WSW	AY227	658
COLUMBIA PRESBYTERIAN HOSPITAL	630 W 160TH ST	1/4 - 1/2NNW	233	672
1071 ST NICHOLAS AVE	1071 ST NICHOLAS AVE	1/4 - 1/2N	AZ236	683
<u>Lower Elevation</u>	<u>Address</u>	<u>Dist / Dir</u>	<u>Map ID</u>	<u>Page</u>
GETTY GAS STA	89 ST NICHOLAS PL	0 - 1/8 S	E17	66
87 ST NICHOLAS	87 ST NICHOLAS	0 - 1/8 S	E18	69
49 SAINT NICHOLAS PLACE	49 SAINT NICHOLAS PLACE	1/8 - 1/4SSW	N57	162
364 EAST 155TH STREET/ BR	364 EAST 155TH STREET	1/8 - 1/4ESE	78	243
18-20 ST NICHOLAS PL.	18-20 ST NICHOLAS PL	1/8 - 1/4SSW	Z110	310
RANGEL	159-38 HARLEM RIVER DR	1/8 - 1/4NE	150	423
307 W. 153RD ST	301 153RD ST	1/8 - 1/4SE	168	463
AMOCO GASOLINE #60030	800 ST. NICHOLAS AVE	1/8 - 1/4SSW	AR187	525
EDGEcomb BUILDINGS	345 EDGEcomb AVE	1/4 - 1/2S	194	542
HARLEM RIVER II HOUSES (HARLEM	2850 8TH AVENUE	1/4 - 1/2SSE	197	553
POLO GROUNDS	2994 8TH AVENUE	1/4 - 1/2ENE	AS199	566
APT HOUSE	2999 8TH AVE	1/4 - 1/2ENE	AS200	569
POLO GROUNDS HOUSING	2999 8TH AVENUE	1/4 - 1/2ENE	AS201	571
POLO GROUNDS (POLO GROUNDS TOW	2999 EIGHTH AVENUE	1/4 - 1/2ENE	AS202	574
99 MACOMBS PL/MANH/USPS	99 MACOMBS PLACE	1/4 - 1/2SE	AV211	620
99 MACCOMBS PL/MANH/USPS	99 MACCOMBS PLACE	1/4 - 1/2SE	AV212	622
625 W 152ND STREET	625 W. 152ND STREET	1/4 - 1/2W	218	635
POLICE SERVICE AREA #6	2786 8TH AVE	1/4 - 1/2S	225	651
225 EAST 149TH ST/BX	225 EAST 149TH STREET	1/4 - 1/2SSE	230	665
JACKIE ROBINSON POOL	88 BRADHURST AV	1/4 - 1/2S	231	667
838 RIVERSIDE DR	838 RIVERSIDE DR	1/4 - 1/2NW	232	670
APARTMENTS	779 RIVERSIDE DR	1/4 - 1/2NW	234	679
950 UNIVERSITY AVE	950 UNIVERSITY AVE	1/4 - 1/2E	237	686

EXECUTIVE SUMMARY

UST: The Underground Storage Tank database contains registered USTs. USTs are regulated under Subtitle I of the Resource Conservation and Recovery Act (RCRA). The data come from the Department of Environmental Conservation's Petroleum Bulk Storage (PBS) Database

A review of the UST list, as provided by EDR, and dated 07/11/2007 has revealed that there are 22 UST sites within approximately 0.25 miles of the target property.

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Dist / Dir</u>	<u>Map ID</u>	<u>Page</u>
MOST WORSHIPFUL PRINCE HALL GR	454 W. 155TH STREET	0 - 1/8 WNW A5		15
NORTH MANHATTAN SHOP	886 SOUTH ST. NICHOLAS	0 - 1/8 WSW C8		21
940 ST. NICHOLAS, LLC	940 ST. NICHOLAS AVENUE	0 - 1/8 N J41		127
1920 AMSTERDAM AVE.	1920 AMSTERDAM AVENUE	1/8 - 1/4WNW L49		143
AUDUBON HOUSES	1909 AMSTERDAM AVENUE	1/8 - 1/4WNW M53		148
501 W 156TH ST HOUSING DEV	501 W 156TH ST	1/8 - 1/4NW P59		167
BETHUNE (AUDUBON HOUSES)	1945 AMSTERDAM AVENUE	1/8 - 1/4NNW P68		219
1885 AMSTERDAM AVE	1885 AMSTERDAM AVE	1/8 - 1/4W S76		237
ST.CATHERINE OF GENOA CHURCH	506 WEST 153RD STREET	1/8 - 1/4W S92		272
P. S. 93M	501-503 WEST 152ND ST.	1/8 - 1/4WSW AE112		317
507 W 158 ST	507 WEST 158TH STREET	1/8 - 1/4NNW AF124		347
30TH POLICE PRECINCT	451 WEST 151ST STREET	1/8 - 1/4SW AG126		351
528 WEST 152ND STREET	528 WEST 152ND STREET	1/8 - 1/4W AK165		458
<u>Lower Elevation</u>	<u>Address</u>	<u>Dist / Dir</u>	<u>Map ID</u>	<u>Page</u>
GETTY #340	89 SAINT NICHOLAS PLACE	0 - 1/8 SSE D10		30
849 ST NICHOLAS AVENUE	849 ST. NICHOLAS AVENUE	1/8 - 1/4SSW K50		144
EDGEcombe ASSOC	48 SAINT NICHOLAS PL	1/8 - 1/4SSW N54		157
JGS PARKING GARAGE, INC.	250 BRADHURST AVENUE	1/8 - 1/4SE Q63		192
824 ST NICHOLAS AVE	824 SAINT NICHOLAS AVEN	1/8 - 1/4SSW AA102		293
CONVENT GARDEN FOR WOMEN	821 ST. NICHOLAS AVE	1/8 - 1/4SSW AA113		318
303 WEST 154TH ST	303 W 154TH ST	1/8 - 1/4SE AH135		380
GLASGALL ROOFING SHEET METAL	415 WEST 150TH ST	1/8 - 1/4SSW AR181		505
ST. NICHOLAS AMANA, INC.	800 ST NICHOLAS AVE	1/8 - 1/4SSW AR186		513

HIST UST: The Underground Storage Tank database contains registered USTs. USTs are regulated under Subtitle I of the Resource Conservation and Recovery Act (RCRA). The data come from the Department of Environmental Conservation's Petroleum Bulk Storage (PBS) Database

A review of the HIST UST list, as provided by EDR, and dated 01/01/2002 has revealed that there are 20 HIST UST sites within approximately 0.25 miles of the target property.

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Dist / Dir</u>	<u>Map ID</u>	<u>Page</u>
NORTH MANHATTAN SHOP	886 SOUTH ST. NICHOLAS	0 - 1/8 WSW C8		21
940 ST. NICHOLAS, LLC	940 ST. NICHOLAS AVENUE	0 - 1/8 N J41		127
AUDUBON HOUSES	1909 AMSTERDAM AVENUE	1/8 - 1/4WNW M53		148
501 W 156TH ST HOUSING DEV	501 W 156TH ST	1/8 - 1/4NW P59		167
BETHUNE (AUDUBON HOUSES)	1945 AMSTERDAM AVENUE	1/8 - 1/4NNW P68		219
1885 AMSTERDAM AVE	1885 AMSTERDAM AVE	1/8 - 1/4W S76		237
ST.CATHERINE OF GENOA CHURCH	506 WEST 153RD STREET	1/8 - 1/4W S93		274
513 WEST 157 STREET	513 WEST 157TH STREET	1/8 - 1/4NNW AB106		302
507 W 158 ST	507 WEST 158TH STREET	1/8 - 1/4NNW AF124		347
30TH POLICE PRECINCT	451 WEST 151ST STREET	1/8 - 1/4SW AG126		351
555 EDGELANDS AVE	555 EDGEcombe AVE	1/8 - 1/4NNE AN161		447
528 WEST 152ND STREET	528 WEST 152ND STREET	1/8 - 1/4W AK166		459
<u>Lower Elevation</u>	<u>Address</u>	<u>Dist / Dir</u>	<u>Map ID</u>	<u>Page</u>
GETTY #340	89 SAINT NICHOLAS PLACE	0 - 1/8 SSE D11		42

EXECUTIVE SUMMARY

Lower Elevation	Address	Dist / Dir	Map ID	Page
849 ST NICHOLAS AVENUE	849 ST. NICHOLAS AVENUE	1/8 - 1/4SSW	K50	144
EDGEcombe ASSOC	48 SAINT NICHOLAS PL	1/8 - 1/4SSW	N54	157
824 ST NICHOLAS AVE	824 SAINT NICHOLAS AVEN	1/8 - 1/4SSW	AA102	293
CONVENT GARDEN FOR WOMEN	821 ST. NICHOLAS AVE	1/8 - 1/4SSW	AA113	318
303 WEST 154TH ST	303 W 154TH ST	1/8 - 1/4SE	AH136	381
GLASGALL ROOFING SHEET METAL	415 WEST 150TH ST	1/8 - 1/4SSW	AR182	507
ST. NICHOLAS AMANA, INC.	800 ST NICHOLAS AVE	1/8 - 1/4SSW	AR186	513

AST: The Aboveground Storage Tank database contains registered ASTs. The data come from the Department of Environmental Conservation's Petroleum Bulk Storage (PBS) Database.

A review of the AST list, as provided by EDR, and dated 07/11/2007 has revealed that there are 115 AST sites within approximately 0.25 miles of the target property.

Equal/Higher Elevation	Address	Dist / Dir	Map ID	Page
880 ST NICHOLAS AVE ASSOC	880 ST NICHOLAS AVE	0 - 1/8 SW	C13	57
429 HOLDING CORP	429 WEST 154TH ST	0 - 1/8 WSW	F20	76
P.S. 28	475 WEST 155TH STREET	0 - 1/8 WNW	H26	89
873 ST NICHOLAS AVE	873 SAINT NICHOLAS AVEN	0 - 1/8 SW	I29	97
870 ST. NICHOLAS AVENUE CORPOR	870 ST. NICHOLAS AVENUE	0 - 1/8 SW	I31	101
402 W. 153 STREET COOP CORP	402 W. 153 ST.	0 - 1/8 SW	I32	104
153 STREET APTS.LLCC	445 W 153 ST	0 - 1/8 SW	I36	112
935 NICK C/O BEACH LANE MANAGE	935 SAINT NICHOLAS AVEN	0 - 1/8 N	J37	113
449 WEST 153RD ST	449 WEST 153RD ST	0 - 1/8 SW	39	122
938 ST. NICHOLAS AVE.	938 ST. NICHOLAS AVENUE	0 - 1/8 N	J42	130
465 WEST 157 STREET	465 WEST 157TH STREET	0 - 1/8 N	J45	134
853 ST. NICHOLAS REALTY CORP.	853 ST. NICHOLAS AVE	0 - 1/8 SSW	K46	136
PRANA NINE PROPERTIES	945 ST. NICHOLAS AVENUE	1/8 - 1/4N	55	159
515 EDGEcombe AVENUE	515 EDGEcombe AVENUE	1/8 - 1/4NNE	62	189
1946 AMSTERDAM AVE.	1946 AMSTERDAM AVENUE	1/8 - 1/4NNW	P64	195
509-517 WEST 155TH STREET	509-517 WEST 155TH STRE	1/8 - 1/4WNW	L67	217
450-454 WEST 152ND STREET HDFC	450 WEST 152ND STREET	1/8 - 1/4SW	R71	226
453 W 152ND ST. LLC	453 WEST 152ND STREET	1/8 - 1/4SW	R72	228
464 WEST 152ND ST	464 W 152ND ST	1/8 - 1/4SW	T77	240
SMH REALTY CORP.	512 WEST 156TH STREET	1/8 - 1/4NW	P79	245
465 W 152ND ST.	465 WEST 152ND STREET	1/8 - 1/4SW	T80	248
DANCE THEATRE OF HARLEM	466 WEST 152ND ST	1/8 - 1/4SW	T81	249
J & TE REALTH CORP	515-519 WEST 156 ST	1/8 - 1/4NW	P85	257
ROGER MORRIS APT. CORP.	474-8 WEST 158TH STREET	1/8 - 1/4N	W86	260
473 WEST 158TH ST	473 W 158TH ST	1/8 - 1/4N	W87	262
PRANA NINE PROPERTIES, LLC	516 WEST 156TH STREET	1/8 - 1/4NW	X88	265
961 ST. NICHOLAS AVENUE	961 SAINT NICHOLAS AVE	1/8 - 1/4N	W89	266
NORTH PRESBYTERIAN CHURCH	525 WEST 155TH STREET	1/8 - 1/4WNW	Y90	268
ST.CATHERINE OF GENOA CHURCH	506 WEST 153RD STREET	1/8 - 1/4W	S93	274
523 WEST 156TH STREET	523 WEST 156 STREET	1/8 - 1/4NW	X95	281
484 CONVENT AVENUE	484 CONVENT AVENUE	1/8 - 1/4SW	R96	282
525 WEST 156TH STREET	525 W 156TH ST	1/8 - 1/4NW	X97	284
535 WEST 155TH STREET	535 WEST 155TH STREET	1/8 - 1/4WNW	Y100	290
531 WEST 156 STREET	531 WEST 156TH STREET	1/8 - 1/4NW	X101	292
513-515 WEST 157 ST	513-515 WEST 157TH STRE	1/8 - 1/4NNW	AB105	301
539 WEST 155TH STREET	539 W 155TH ST	1/8 - 1/4WNW	Y108	305
535 WEST 156TH STREET	535 WEST 156TH STREET	1/8 - 1/4NW	AD109	308
515 WEST 157TH STREET	515 WEST 157TH STREET	1/8 - 1/4NNW	AB111	316
417 E 151 ST	417 EAST 151ST STREET	1/8 - 1/4SSW	116	336

EXECUTIVE SUMMARY

Equal/Higher Elevation	Address	Dist / Dir	Map ID	Page
502 WEST 152 LLC	502 WEST 152ND STREET	1/8 - 1/4WSW	AE117	337
539156 LLC	539-541 WEST 156TH STRE	1/8 - 1/4NW	AD118	339
AP AMSTERDAM - 1973 AMSTERDAM	498 W. 158TH STREET	1/8 - 1/4NNW	AF119	340
SALVATION ARMY CITADEL CORPS	425 EAST 159TH STREET	1/8 - 1/4NNE	121	343
519 WEST 157 STREET	519 WEST 157TH STREET	1/8 - 1/4NNW	AB123	346
544 WEST 156TH H.D.F.C.	544 WEST 156TH STREET	1/8 - 1/4NW	AD128	364
WEST BRIDGE ASSOCIATES LP	510 WEST 152ND STREET	1/8 - 1/4WSW	AE129	366
546 WEST 156TH STREET HDFC	546 WEST 156TH STREET	1/8 - 1/4NW	AD132	372
WBD REALTY. LLC	463 WEST 159TH ST	1/8 - 1/4N	AI134	377
BUILDING 512 W 158 ST	512 W 158 ST	1/8 - 1/4NNW	AF137	383
537 REALTY ASSOCIATES, LLC	470 WEST 159TH STREET	1/8 - 1/4N	AI139	388
WBD REALTY, LLC	465 WEST 159TH ST	1/8 - 1/4N	AI140	389
WED REALTY, LLC	467 WEST 159TH ST	1/8 - 1/4N	AI141	392
469-71 WEST 159TH STREET	469-71 WEST 159TH STREE	1/8 - 1/4N	AI143	396
518-20 WEST 152ND STREET	518 WEST 152ND STREET	1/8 - 1/4WSW	AK146	417
WEST BRIDGE ASSOCIATES, L.P.	519 WEST 152ND STREET	1/8 - 1/4WSW	AK147	418
520 WEST 158 STREET HDFC	520 WEST 158 STREET	1/8 - 1/4NNW	AL148	420
470 CONVENT AVENUE	470 CONVENT AVENUE	1/8 - 1/4SW	149	421
527 REALTY NY LLC	527 WEST 157TH STREET	1/8 - 1/4NW	AJ152	428
522 WEST 158 STREET	522 WEST 158TH STREET	1/8 - 1/4NNW	AL153	430
555 W 156 ST	555 W 156 ST	1/8 - 1/4NW	AM154	431
524 W. 152 ST. HDFC	524 WEST 152ND STREET	1/8 - 1/4WSW	AK155	434
CITY OF NY DEPARTMENT OF H.P.D	522 W 152 ST	1/8 - 1/4WSW	AK156	435
523-525 WEST 152ND STREET H.D.	523-525 WEST 152ND STRE	1/8 - 1/4WSW	AK157	438
525 WEST 158TH REALTY LLC	525 WEST 158TH STREET	1/8 - 1/4NNW	AL158	440
556 W 156 ST	556 W 156 ST	1/8 - 1/4NW	AM159	442
555 EDGELANDS AVE	555 EDGEcombe AVE	1/8 - 1/4NNE	AN161	447
530 WEST 157TH STREET	530 WEST 157TH STREET	1/8 - 1/4NW	AJ163	452
529 WEST 152ND STREET HDFC (T.	529 WEST 152ND STREET	1/8 - 1/4W	AK164	455
559 WEST 156TH ST NEW YORK NY	559 WEST 156TH ST	1/8 - 1/4NW	AM167	460
529 WEST 158TH ST. INC.	529 WEST 158TH STREET	1/8 - 1/4NNW	AL169	466
550 WEST 153RD STREET	550 WEST 153RD STREET	1/8 - 1/4W	170	467
532 WEST 152 ST	532 WEST 152ND STREET	1/8 - 1/4W	AK171	470
MARIPOSA PROPERTIES	498 WEST 159TH STREET	1/8 - 1/4N	AP176	493
534-536 WEST 152ND STREET	534-536 WEST 152ND STRE	1/8 - 1/4W	177	496
537 WEST 158TH ST.	537 WEST 158TH ST.	1/8 - 1/4NNW	AQ179	501
507 W 159TH ST	507 W 159TH ST	1/8 - 1/4N	AP180	503
WEST BRIDGE ASSOCIATES, L.P.	508 WEST 151ST STREET	1/8 - 1/4WSW	AO183	508
509 WEST 159TH ST.	509 W 159 ST	1/8 - 1/4N	AP184	509
504-517 WEST 159TH ST	504 W 159TH ST	1/8 - 1/4N	AP185	511
CITY OF NY DEPARTMENT OF H.P.D	510 W 151 ST	1/8 - 1/4WSW	AO188	528
512 WEST 151ST STREET	512 WEST 151ST STREET	1/8 - 1/4WSW	AO190	532
W-158 ST HARLEM HOLDING CORP	540 W 158 ST	1/8 - 1/4NNW	AQ191	533
Lower Elevation	Address	Dist / Dir	Map ID	Page
GETTY #340	89 SAINT NICHOLAS PLACE	0 - 1/8 SSE	D11	42
409 EDGEcombe AVENUE, HDFC	409 EDGEcombe AVENUE	0 - 1/8 SE	G24	85
SIMMONS REALTY CORP	76 ST NICHOLAS PL	0 - 1/8 S	E27	92
75 EQUITY HOLDING, LLC	75 ST. NICHOLAS PLACE	0 - 1/8 S	E28	94
405 EDGEcombe AVE	405 EDGEcombe AVE	0 - 1/8 SE	G30	98
CHAMA HOLDING CORP	393 EDGEcombe AVE	0 - 1/8 SSE	44	132
ST. NICHOLAS PLACE LLC	52-54 ST. NICHOLAS PLAC	1/8 - 1/4S	N56	161
CHAMA HOLDING CORP	385 EDGEcombe AVE	1/8 - 1/4SSE	O58	165
242-246 BRADHURST HOLDING LLC	242-246 BRADHURST AVENU	1/8 - 1/4SE	Q66	216
MELROSE HOUSING ESTATES LP	408 EAST 152ND STREET	1/8 - 1/4SSW	70	225

EXECUTIVE SUMMARY

<u>Lower Elevation</u>	<u>Address</u>	<u>Dist / Dir</u>	<u>Map ID</u>	<u>Page</u>
CITY OF NY DEPARTMENT OF H.P.D	400 W 152 ST	1/8 - 1/4SSW	N73	229
401 WEST 152 ST HDFC	401 WEST 152 ST	1/8 - 1/4SSW	N74	232
CHAMA HOLDING CORP	379-81 EDGECOMBE AVE	1/8 - 1/4S	O75	235
234 BRADHURST AVENUE	234 BRADHURST AVENUE	1/8 - 1/4SE	U82	252
377 EDGECOMBE AVE	377 EDGECOMBE AVE	1/8 - 1/4S	V83	253
230 BRADHURST AVE.	230 BRADHURST AVE.	1/8 - 1/4SSE	U91	269
371 EDGECOMBE AVENUE, HDFC	371 EDGECOMBE AVENUE	1/8 - 1/4S	V98	286
40 ST. NICHOLAS LLC	40 ST. NICHOLAS PLACE	1/8 - 1/4SSW	Z99	289
N.K.P. REALTY CORP.	26 ST NICHOLAS PL	1/8 - 1/4SSW	Z103	296
367 EDGECOMBE AVE. CORP.	367 EDGECOMBE AVENUE	1/8 - 1/4S	AC107	304
18-20 ST NICHOLAS PL.	18-20 ST NICHOLAS PL	1/8 - 1/4SSW	Z110	310
400 WEST 151ST STREET	400 WEST 151ST STREET	1/8 - 1/4SSW	AA114	332
MELROSE HOUSING ESTATES LP	389 EAST 151ST STREET	1/8 - 1/4SSW	AA115	335
VARAE ROYAL REALTY	216 BRADHURST AVENUE	1/8 - 1/4SSE	120	341
363 EDGECOMBE AVE CORP.	363 EDGECOMBE AVENUE	1/8 - 1/4S	AC122	344
MANDE COMPLETE AUTO REPAIR	304 WEST 155TH STREET	1/8 - 1/4ESE	125	350
2918 8TH AVENUE ASSOCIATES	2918 8TH AVE	1/8 - 1/4SE	AH130	368
MADAM C J WALKER HOUSES	2919 8 AVE	1/8 - 1/4SE	AH131	370
2915 8TH AVE -OR-	2915 FREDERICK DOUGLASS	1/8 - 1/4SE	AH133	375
M-D	813 ST NICHOLAS AVE	1/8 - 1/4SSW	138	385
357 EDGECOMBE AVE	357 EDGECOMBE AVENUE	1/8 - 1/4S	151	426
192/196/200 BRADHURST AVE	196 BRADHURST AVE	1/8 - 1/4S	178	499
408 W 150 ST	408 WEST 150TH STREET	1/8 - 1/4SSW	AR189	531

MANIFEST: Manifest is a document that lists and tracks hazardous waste from the generator through transporters to a TSD facility.

A review of the NY MANIFEST list, as provided by EDR, and dated 08/27/2007 has revealed that there are 8 NY MANIFEST sites within approximately 0.25 miles of the target property.

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Dist / Dir</u>	<u>Map ID</u>	<u>Page</u>
CONSOLIDATED EDISON	460 W 155TH ST	0 - 1/8 WNW	A12	56
NYC BD OF ED - PUBLIC SCHOOL 2	475 W 155TH ST	0 - 1/8 WNW	H23	82
CONSOLIDATED EDISON	W 155TH ST / AMSTERDA	1/8 - 1/4WNW	L48	141
K&B CLEANERS	1946 AMSTERDAM AVE	1/8 - 1/4NNW	P65	197
A & R CLEANERS	1988 AMSTERDAM AVE	1/8 - 1/4N	AF145	398
FOUR SEASONS CLEANERS	1838 AMSTERDAM AVE	1/8 - 1/4WSW	AO172	471
<u>Lower Elevation</u>	<u>Address</u>	<u>Dist / Dir</u>	<u>Map ID</u>	<u>Page</u>
GETTY PETROLEUM CORP	89-91 ST NICHOLAS PL	0 - 1/8 ESE	B15	61
BLOCKERS CLEANERS	840 ST NICHOLAS AVE	1/8 - 1/4SSW	K61	170

SPILLS: Data collected on spills reported to NYSDEC. is required by one or more of the following: Article 12 of the Navigation Law, 6 NYCRR Section 613.8 (from PBS regs), or 6 NYCRR Section 595.2 (from CBS regs). It includes spills active as of April 1, 1986, as well as spills occurring since this date.

A review of the NY Spills list, as provided by EDR, and dated 07/11/2007 has revealed that there are 15 NY Spills sites within approximately 0.125 miles of the target property.

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Dist / Dir</u>	<u>Map ID</u>	<u>Page</u>
MAN HOLE #61738	W 155TH ST / ST.NICHO	0 - 1/8 WNW	A1	6
Date Closed: 02/06/04				

EXECUTIVE SUMMARY

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Dist / Dir</u>	<u>Map ID</u>	<u>Page</u>
Not reported Date Closed: 11/14/03	W 155TH ST/ST NICHOLAS	0 - 1/8 WNW A2		8
MANHOLE #61738 Date Closed: 05/11/04	155TH ST / ST.NICHOLA	0 - 1/8 WNW A3		11
MANHOLE 61738 Date Closed: 04/08/04	WEST 155TH ST/ST NICHOL	0 - 1/8 WNW A4		13
Not reported Date Closed: 07/09/02	403 WEST 154TH ST	0 - 1/8 SW C14		60
APARTMENT Date Closed: / /	935 ST NICHOLAS AVE	0 - 1/8 NNW 19		75
IFO Date Closed: 02/07/00	429 W 154TH ST	0 - 1/8 WSW F21		79
410 EAST 153RD ST/BX Date Closed: 05/25/95	410 EAST 153RD STREET	0 - 1/8 SW I34		107
445 WEST 153RD ST Date Closed: / /	445 WEST 153RD ST	0 - 1/8 SW I35		109
Not reported Date Closed: 08/28/01	938 ST NICHOLAS AV	0 - 1/8 N J40		125
<u>Lower Elevation</u>	<u>Address</u>	<u>Dist / Dir</u>	<u>Map ID</u>	<u>Page</u>
HARLEM RIVER DR & W 155TH Date Closed: 04/27/98	HARLEM RIVER DR / W 1	0 - 1/8 ESE B7		18
385 EDGEComb AVENUE Date Closed: 03/21/95	385 EDGEComb AVENUE	0 - 1/8 SE B16		64
WASTE DEBRIS Date Closed: 01/24/05	409 EDGEComb AVENUE	0 - 1/8 SE G22		81
Not reported Date Closed: 12/02/02	409 EDGEComb AV	0 - 1/8 SE G25		88
385 EDGEComb AVE Date Closed: 02/01/93 Date Closed: 06/13/94	385 EDGEComb AVE	0 - 1/8 S 38		116

HIST SPILLS: This database contains records of chemical and petroleum spill incidents. Under State law, petroleum and hazardous chemical spills that can impact the waters of the state must be reported by the spiller (and, in some cases, by anyone who has knowledge of the spills). In 2002, the Department of Environmental Conservation stopped providing updates to its original Spills Information Database. This database includes fields that are no longer available from the NYDEC as of January 1, 2002. Current information may be found in the NY SPILLS database.

A review of the NY Hist Spills list, as provided by EDR, and dated 01/01/2002 has revealed that there are 11 NY Hist Spills sites within approximately 0.125 miles of the target property.

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Dist / Dir</u>	<u>Map ID</u>	<u>Page</u>
MAN HOLE #61738	W 155TH ST / ST.NICHO	0 - 1/8 WNW A1		6
Not reported	W 155TH ST/ST NICHOLAS	0 - 1/8 WNW A2		8
MANHOLE #61738	155TH ST / ST.NICHOLA	0 - 1/8 WNW A3		11
MANHOLE 61738	WEST 155TH ST/ST NICHOL	0 - 1/8 WNW A4		13

EXECUTIVE SUMMARY

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Dist / Dir</u>	<u>Map ID</u>	<u>Page</u>
<i>IFO</i>	<i>429 W 154TH ST</i>	<i>0 - 1/8 WSW</i>	<i>F21</i>	<i>79</i>
<i>410 EAST 153RD ST/BX</i>	<i>410 EAST 153RD STREET</i>	<i>0 - 1/8 SW</i>	<i>I34</i>	<i>107</i>
<i>445 WEST 153RD ST</i>	<i>445 WEST 153RD ST</i>	<i>0 - 1/8 SW</i>	<i>I35</i>	<i>109</i>
<i>Not reported</i>	<i>938 ST NICHOLAS AV</i>	<i>0 - 1/8 N</i>	<i>J40</i>	<i>125</i>
<u>Lower Elevation</u>	<u>Address</u>	<u>Dist / Dir</u>	<u>Map ID</u>	<u>Page</u>
<i>HARLEM RIVER DR & W 155TH</i>	<i>HARLEM RIVER DR / W 1</i>	<i>0 - 1/8 ESE</i>	<i>B7</i>	<i>18</i>
<i>385 EDGEComb AVENUE</i>	<i>385 EDGEComb AVENUE</i>	<i>0 - 1/8 SE</i>	<i>B16</i>	<i>64</i>
<i>385 EDGEComb AVE</i>	<i>385 EDGEComb AVE</i>	<i>0 - 1/8 S</i>	<i>38</i>	<i>116</i>

DRYCLEANERS: A listing of all registered drycleaning facilities.

A review of the DRYCLEANERS list, as provided by EDR, and dated 06/15/2004 has revealed that there are 3 DRYCLEANERS sites within approximately 0.25 miles of the target property.

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Dist / Dir</u>	<u>Map ID</u>	<u>Page</u>
OTHA/K & B CLEANERS	1940 AMSTERDAM AVENUE	1/8 - 1/4NW	P60	170
ANDRES CLEANERS	1988 AMSTERDAM AVE.	1/8 - 1/4N	AF144	398
FOUR SEASONS/PINETREE FRNCH CL	1838 AMSTERDAM AVENUE	1/8 - 1/4WSW	AO173	490

EXECUTIVE SUMMARY

Due to poor or inadequate address information, the following sites were not mapped:


<u>Site Name</u>	<u>Database(s)</u>
CONSOLIDATED EDISON	NY MANIFEST
NEW YORK CITY DEPT OF TRANSPORTATI	FINDS, RCRA-LQG, NY MANIFEST
CONED	NY MANIFEST
CONSOLIDATED EDISON	NY MANIFEST
NYS DOT BRIDGE BIN 1077050	RCRA-LQG, NY MANIFEST
CONSOLIDATED EDISON	NY MANIFEST
V5274	RCRA-SQG, NY MANIFEST
V8233	RCRA-SQG, NY MANIFEST
TM2097	RCRA-SQG, NY MANIFEST
W 157TH STREET AND BROADWAY	RCRA-SQG, NY MANIFEST
564 WEST 160TH STREET	LTANKS
CITY COLLEGE OF NEW YORK	UST
GRACE INDUSTRIES INC	UST
1608-10 AMSTERDAM AVENUE H.D.F.C.	AST
HIGHBRIDGE PARK PARTNERS LLC	AST
CITY COLLEGE OF NEW YORK	AST
CITY COLLEGE OF NY	AST, HIST AST
NYCDEP - SHAFT 9B	RCRA-SQG, FINDS
133 STREET AT	NY Spills, NY Hist Spills
MANHOLE 58594	NY Spills
405 EDGECOMBE AVE	NY Spills
146TH STREET/ROCKAWAY BLV	NY Spills, NY Hist Spills
CITY COLLEGE OF NEW YORK - CUNY	HIST UST

-
- A horizontal number line is shown with tick marks at 0, 1/4, 1/2, and 1 Miles. The segment between 0 and 1/4 is highlighted in yellow.

SITE NAME: 414 West 155th Street
ADDRESS: 414 West 155th Street
New York NY 10032
LAT/LONG: 40.8306 / 73.9408

CLIENT: ATC Associates Inc.
CONTACT: Bedia Saray
INQUIRY #: 2077001.2s
DATE: November 13, 2007 7:31 pm

DETAIL MAP - 2077001.2s

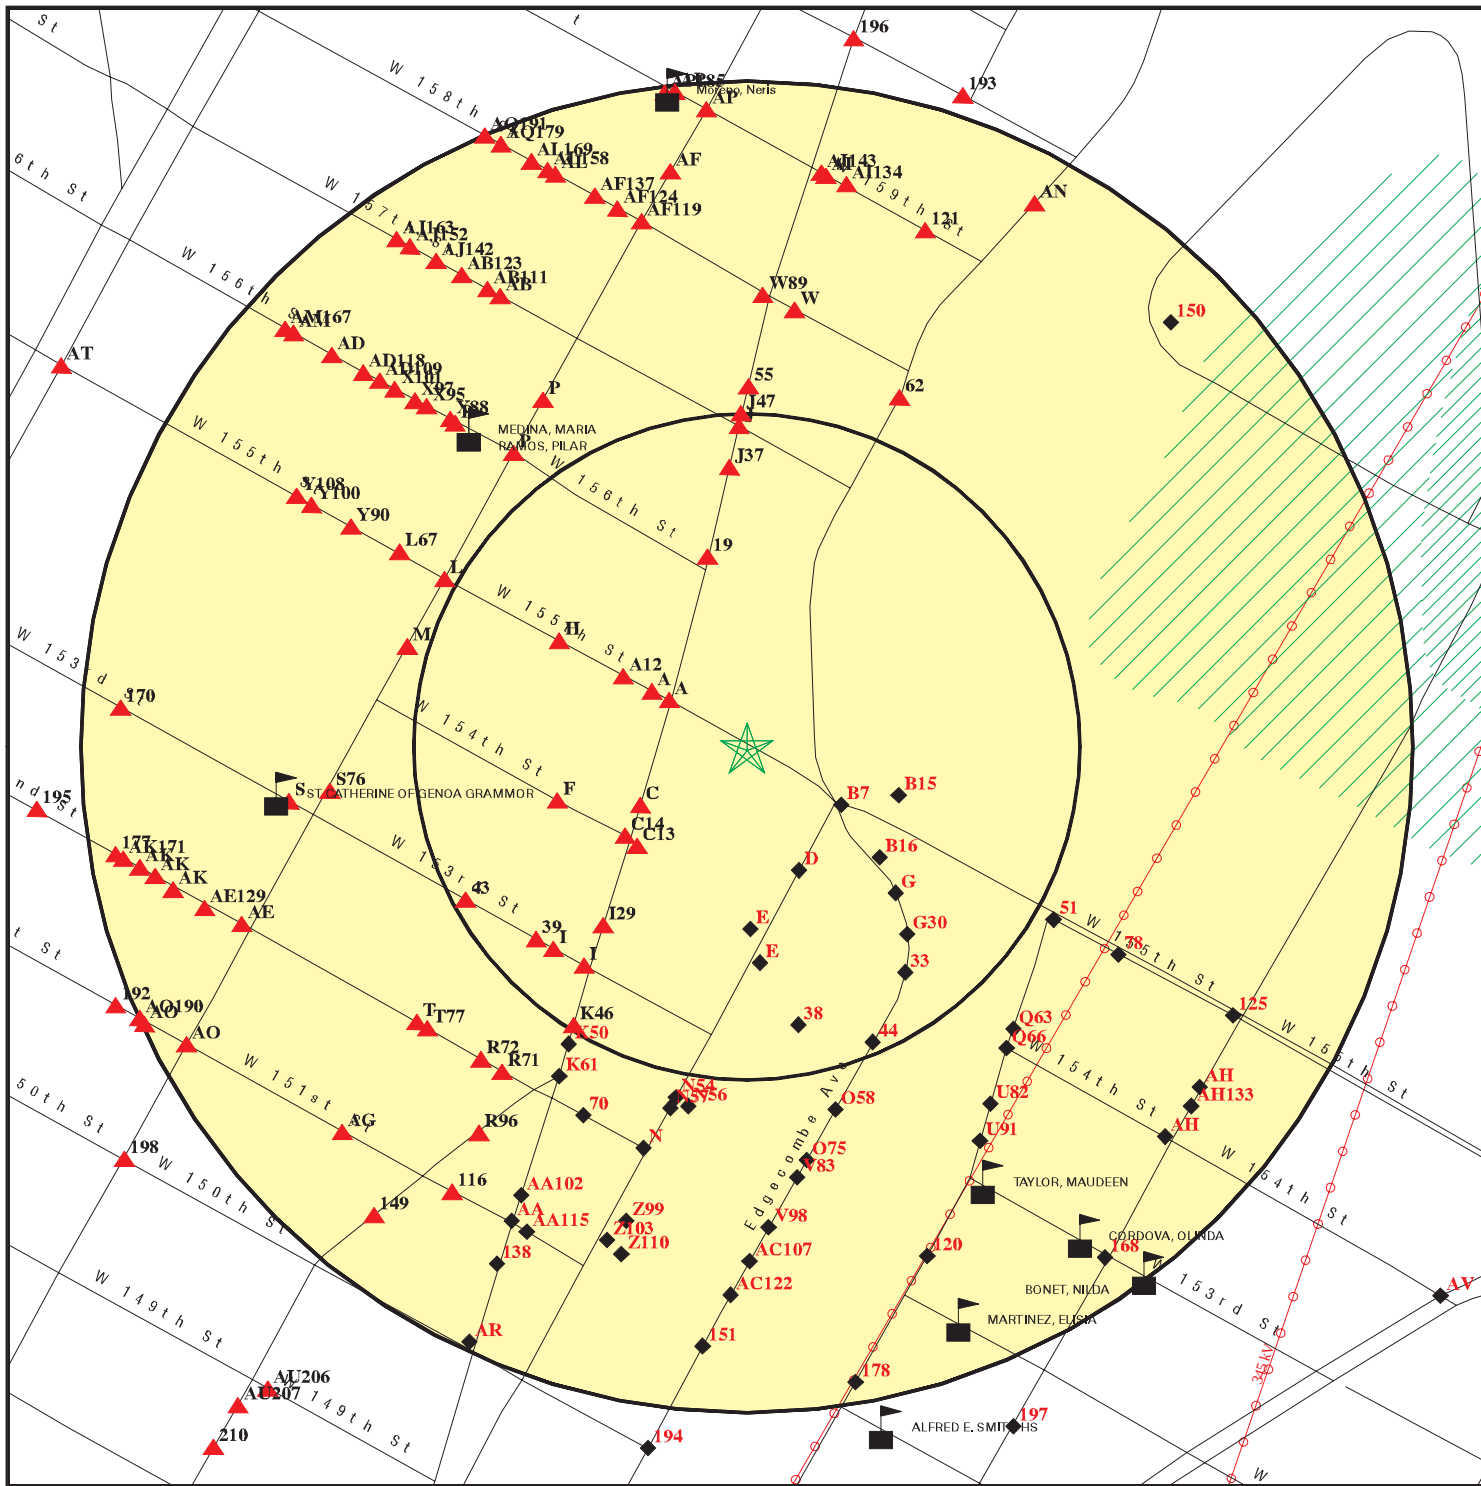

-  Target Property
 Sites at elevations higher than or equal to the target property
 Sites at elevations lower than the target property
 Manufactured Gas Plants
 Sensitive Receptors
 National Priority List Sites
 Dept. Defense Sites
 Indian Reservations BIA
 Power transmission lines
 Oil & Gas pipelines
 100-year flood zone
 500-year flood zone

This report includes Interactive Map Layers to display and/or hide map information. The legend includes only those icons for the default map view.

SITE NAME: 414 West 155th Street
ADDRESS: 414 West 155th Street
New York NY 10032
LAT/LONG: 40.8306 / 73.9408

CLIENT: ATC Associates Inc.
CONTACT: Bedia Saray
INQUIRY #: 2077001.2s
DATE: November 13, 2007 7:31 pm

MAP FINDINGS SUMMARY

Database	Target Property	Search Distance (Miles)	< 1/8	1/8 - 1/4	1/4 - 1/2	1/2 - 1	> 1	Total Plotted
<u>FEDERAL RECORDS</u>								
NPL		1.000	0	0	0	0	NR	0
Proposed NPL		1.000	0	0	0	0	NR	0
Delisted NPL		1.000	0	0	0	0	NR	0
NPL LIENS	TP		NR	NR	NR	NR	NR	0
CERCLIS		0.500	0	0	0	NR	NR	0
CERC-NFRAP		0.500	0	0	0	NR	NR	0
CORRACTS		1.000	0	0	0	0	NR	0
RCRA TSD		0.500	0	0	0	NR	NR	0
RCRA Lg. Quan. Gen.		0.250	0	0	NR	NR	NR	0
RCRA Sm. Quan. Gen.		0.250	3	7	NR	NR	NR	10
ERNS	TP		NR	NR	NR	NR	NR	0
HMIRS	TP		NR	NR	NR	NR	NR	0
US ENG CONTROLS		0.500	0	0	0	NR	NR	0
US INST CONTROL		0.500	0	0	0	NR	NR	0
DOD		1.000	0	0	0	0	NR	0
FUDS		1.000	0	0	0	0	NR	0
US BROWNFIELDS		0.500	0	0	0	NR	NR	0
CONSENT		1.000	0	0	0	0	NR	0
ROD		1.000	0	0	0	0	NR	0
UMTRA		0.500	0	0	0	NR	NR	0
ODI		0.500	0	0	0	NR	NR	0
TRIS	TP		NR	NR	NR	NR	NR	0
TSCA	TP		NR	NR	NR	NR	NR	0
FTTS	TP		NR	NR	NR	NR	NR	0
SSTS	TP		NR	NR	NR	NR	NR	0
LIENS 2	TP		NR	NR	NR	NR	NR	0
RADINFO	TP		NR	NR	NR	NR	NR	0
CDL	TP		NR	NR	NR	NR	NR	0
HIST FTTS	TP		NR	NR	NR	NR	NR	0
DEBRIS REGION 9		0.500	0	0	0	NR	NR	0
ICIS	TP		NR	NR	NR	NR	NR	0
LUCIS		0.500	0	0	0	NR	NR	0
DOT OPS	TP		NR	NR	NR	NR	NR	0
PADS	TP		NR	NR	NR	NR	NR	0
MLTS	TP		NR	NR	NR	NR	NR	0
MINES		0.250	0	0	NR	NR	NR	0
FINDS	TP		NR	NR	NR	NR	NR	0
RAATS	TP		NR	NR	NR	NR	NR	0
<u>STATE AND LOCAL RECORDS</u>								
HSWDS		0.500	0	0	0	NR	NR	0
State Haz. Waste		1.000	0	0	0	1	NR	1
DEL SHWS		1.000	0	0	0	0	NR	0
State Landfill		0.500	0	0	0	NR	NR	0
SWRCY		0.500	0	0	0	NR	NR	0
SWTIRE		0.500	0	0	0	NR	NR	0
LTANKS		0.500	6	17	49	NR	NR	72

MAP FINDINGS SUMMARY

Database	Target Property	Search Distance (Miles)	< 1/8	1/8 - 1/4	1/4 - 1/2	1/2 - 1	> 1	Total Plotted
HIST LTANKS		0.500	4	16	33	NR	NR	53
UST		0.250	4	18	NR	NR	NR	22
CBS UST		0.250	0	0	NR	NR	NR	0
MOSF UST		0.500	0	0	0	NR	NR	0
HIST UST		0.250	3	17	NR	NR	NR	20
AST		0.250	18	97	NR	NR	NR	115
CBS AST		0.250	0	0	NR	NR	NR	0
HIST AST		TP	NR	NR	NR	NR	NR	0
MOSF AST		0.500	0	0	0	NR	NR	0
MANIFEST		0.250	3	5	NR	NR	NR	8
NY Spills		0.125	15	NR	NR	NR	NR	15
NY Hist Spills		0.125	11	NR	NR	NR	NR	11
ENG CONTROLS		0.500	0	0	0	NR	NR	0
INST CONTROL		0.500	0	0	0	NR	NR	0
VCP		0.500	0	0	0	NR	NR	0
DRYCLEANERS		0.250	0	3	NR	NR	NR	3
BROWNFIELDS		0.500	0	0	0	NR	NR	0
SPDES		TP	NR	NR	NR	NR	NR	0
AIRS		TP	NR	NR	NR	NR	NR	0
CBS		0.250	0	0	NR	NR	NR	0
E DESIGNATION		TP	NR	NR	NR	NR	NR	0
RES DECL		0.180	0	0	NR	NR	NR	0
MOSF		0.500	0	0	0	NR	NR	0
<u>TRIBAL RECORDS</u>								
INDIAN RESERV		1.000	0	0	0	0	NR	0
INDIAN LUST		0.500	0	0	0	NR	NR	0
INDIAN UST		0.250	0	0	NR	NR	NR	0
<u>EDR PROPRIETARY RECORDS</u>								
Manufactured Gas Plants		1.000	0	0	0	0	NR	0
EDR Historical Auto Stations		0.250	0	0	NR	NR	NR	0
EDR Historical Cleaners		0.250	0	0	NR	NR	NR	0

NOTES:

TP = Target Property

NR = Not Requested at this Search Distance

Sites may be listed in more than one database

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

Site Database(s) EDR ID Number
EPA ID Number

A1
WNW
< 1/8
180 ft.

MAN HOLE #61738
W 155TH ST / ST.NICHOLAS
MANHATTEN, NY

NY Spills
NY Hist Spills

S104284143
N/A

Relative:
Higher

Site 1 of 7 in cluster A

Actual:
132 ft.

NY Spills:
Site ID: 168109
Facility Addr2: Not reported
Facility ID: 9910047
Spill Number: 9910047
Facility Type: ER
SWIS: 3101
Region of Spill: 2
Investigator: COMENALE
Referred To: Not reported
Spill Date: 11/18/99
Reported to Dept: 11/18/99
CID: 257
Spill Cause: Unknown
Water Affected: Not reported
Spill Source: Unknown
Spill Notifier: Affected Persons
Cleanup Ceased: / /
Cleanup Meets Std: False
Last Inspection: / /
Recommended Penalty: Penalty Not Recommended
UST Trust: False
Spill Class: Known release with minimal potential for fire or hazard. DEC Response.
Willing Responsible Party. Corrective action taken.
Spill Closed Dt: 02/06/04
Remediation Phase: 0
Date Entered In Computer: 11/18/99
Spill Record Last Update: 02/06/04
Spiller Name: Not reported
Spiller Company: UNKNOWN
Spiller Address: Not reported
Spiller City,St,Zip: NY
Spiller Company: 999
Spiller Phone: Not reported
Contact Name: RICHARD ROACH
Contact Phone: (212) 580-6763
DEC Region: 2
Program Number: 9910047
DER Facility ID: 141628
Site ID: 168109
Operable Unit ID: 1088742
Operable Unit: 01
Material ID: 299110
Material Code: 0066A
Material Name: UNKNOWN PETROLEUM
Case No.: Not reported
Material FA: Petroleum
Quantity: 7.00
Units: Gallons
Recovered: 0.00
Resource Affected: Soil
Oxygenate: False
DEC Memo: Not reported

MAP FINDINGS

EDR ID Number
EPA ID Number

S104284143

Remarks: Start CallerRemark - 9910047 on 3000 gals of water cleanup pending test results ref #129037 END CallerRemark - 9910047

Region of Spill:	2
Spill Number:	9910047
Investigator:	COMENALE
Caller Name:	Not reported
Caller Agency:	Not reported
Caller Phone:	Not reported
Notifier Name:	Not reported
Notifier Agency:	Not reported
Notifier Phone:	Not reported
Spill Date/Time:	11/18/1999 13:05
Reported to Dept Date/Time:	11/18/99 13:53
SWIS:	62
Spiller Name:	UNKNOWN
Spiller Contact:	Not reported
Spiller Phone:	() -
Spiller Contact:	RICHARD ROACH
Spiller Phone:	(212) 580-6763
Spiller Address:	Not reported
Spiller City,St,Zip:	Not reported
Spill Cause:	Unknown
Reported to Dept:	On Land
Water Affected:	Not reported
Spill Source:	12
Spill Notifier:	Affected Persons
PBS Number:	Not reported
Cleanup Ceased:	/ /
Cleanup Meets Std:	False
Last Inspection:	/ /
Recommended Penalty:	Penalty Not Recommended
Spiller Cleanup Dt:	/ /
Enforcement Date:	/ /
Invstgn Complete:	/ /
UST Involvement:	False
Spill Class:	Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken.

Spill Closed Dt:	/ /
Corrective Action Plan Submitted:	/ /
Date Region Sent Summary to Central Office:	/ /
Date Spill Entered In Computer Data File:	11/18/99
Date Spill Entered In Computer Data File:	Not reported
Update Date:	11/19/99
Is Updated:	False
PBS Number:	Not reported
Tank Number:	Not reported
Tank Size:	Not reported
Test Method:	Not reported
Leak Rate Failed Tank:	Not reported
Gross Leak Rate:	Not reported
Material Class Type:	Petroleum
Quantity Spilled:	7
Unkonwn Quantity Spilled:	False
Units:	Gallons
Quantity Recovered:	0

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

MAN HOLE #61738 (Continued)

EDR ID Number
EPA ID Number

Database(s)

S104284143

Unkonwn Quantity Recovered: False
Material: UNKNOWN PETROLEUM
Class Type: UNKNOWN PETROLEUM
Times Material Entry In File: 16414
CAS Number: Not reported
Last Date: 19940929
DEC Remarks: Not reported
Remark: on 3000 gals of water cleanup pending test results ref 129037

A2
WNW
< 1/8
180 ft.

W 155TH ST/ST NICHOLAS AV
MANHATTAN, NY

NY Spills
NY Hist Spills

S104648033
N/A

Site 2 of 7 in cluster A

Relative:
Higher

Actual:
132 ft.

NY Spills:
Site ID: 144225
Facility Addr2: Not reported
Facility ID: 9809008
Spill Number: 9809008
Facility Type: ER
SWIS: 3101
Region of Spill: 2
Investigator: CAENGELH
Referred To: Not reported
Spill Date: 10/19/98
Reported to Dept: 10/20/98
CID: 207
Spill Cause: Equipment Failure
Water Affected: Not reported
Spill Source: Commercial/Industrial
Spill Notifier: Responsible Party
Cleanup Ceased: / /
Cleanup Meets Std: False
Last Inspection: / /
Recommended Penalty: Penalty Not Recommended
UST Trust: False
Spill Class: Known release with minimal potential for fire or hazard. DEC Response.
Willing Responsible Party. Corrective action taken.
Spill Closed Dt: 11/14/03
Remediation Phase: 0
Date Entered In Computer: 10/20/98
Spill Record Last Update: 10/20/04
Spiller Name: RICHARD ROACH
Spiller Company: CON EDISON
Spiller Address: 4 IRVING PLACE
Spiller City,St,Zip: MANHATTAN, NY 10003
Spiller Company: 001
Spiller Phone: (212) 580-6764
Contact Name: RICHARD ROACH
Contact Phone: (212) 580-6764
DEC Region: 2
Program Number: 9809008
DER Facility ID: 122944
Site ID: 144225
Operable Unit ID: 1070195
Operable Unit: 01
Material ID: 316477

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

(Continued)

S104648033

Material Code: 0541A
Material Name: DIELECTRIC FLUID
Case No.: Not reported
Material FA: Petroleum
Quantity: 50.00
Units: Gallons
Recovered: 50.00
Resource Affected: Soil
Oxygenate: False
DEC Memo: Start DECRemark - 9809008 Prior to Sept, 2004 data translation this spill Lead DEC Field was "ENGELHARDT" 10/20/98, 10:43 hrs - Gerry Matterazzo, UT: manhole cleaned, drainage into drum - no clamp. Will break out manhole wall to make repairs. Pumped down and washed by Clean Harbors. Sampled 3 ppm PCB. (CAE) On location at 12:28 hrs. John Molahan, Trans Ops, on scene. Leak from feeder near wall of manhole. Feeder still under full pressure. Excavating outside manhole to break out wall. Notexposed yet. No visible contaminated soil - excavation is about 4 - 5 feet deep. Feeders look as if they are just below this level judging by their position in manhole. Clean Harbors removed 3000 gallons oil/water last night (4 - 5 inches of oil inmanhole). (CAE) E2MIS 120636 10/20/98 00:24 CARRILLO #03309 REPORTS: IN M-61738 W155 ST 120' W/O ST. NICHOLAS ST. FOUND APPROX. 50 GLS. OF DIELECTRIC FLUID ON APPROX. 1000 GLS OF WATER.. OIL WAS CONTAINED TO M/H. TOOK SAMPLE 3PPM PCB LAB SEQ. 98-11259 OIL & WATER HAVE BEEN REMOVED AND M/H CLEANED UP COMPLETE BY CLEAN HARBORS OIL NEVER ENTERED ANY WATERWAYS OR SEWER SYSTEMS. OIL WAS FROM 10" 345KV PIPE TYPE CABLE. NYSDEC #98-09008. This leak was originally enteredon 120616 as part of the leak search on Fdr M52 and was reported earlier. At the request of CIG this incident was entered to sepearate this incident from the one at 79th St and West End Ave. At 17:00 fluid was found in manhole 61738 by Con Ed crews looking for leak on M52. Samples were delivered to Chem Lab Clean Harbors was called and manhole was pumped out. At 19:55 manhole was pumped down and slight weep seen between reducer and wall @ E wall. Temp EPA ID # NYP004019683 for CTW removal from manhole. ATC notified at 21:35 for air monitoring at manhole. Chem Lab reports 98-11259 3ppm PCB's. Manhole cleaning was completed at approx 12 midnite. ATC on location for CTW removal. CTW removal completed between reducer and wall. Leak found inside manhole sleeve. Packing removed and fluid allowed to run into manhole into containment vessel. Manhole wall to be broken out for repairs. Excavation started on 10/20/98 at 08:00. Excavtion completed and temp clamp installed at 18:30 10/19/98. No fluid visible outside of manhole. Chem Lab reports 98-11260 70 ppb benzene. Clean Harbors removed 1 cubic yard of debris and 3000 gallons of oil/water from manhole. Permanent repairs started at 07:00 10/23/98. 48" long barrel through wall installed and tested. Repair completed 20:10 10/23/98. END DECRemark - 9809008
Remarks: Start CallerRemark - 9809008 spill cleaned up ref # 120636 END CallerRemark - 9809008

NY Hist Spills:

Region of Spill: 2
Spill Number: 9809008
Investigator: ENGELHARDT
Caller Name: Not reported
Caller Agency: Not reported
Caller Phone: Not reported
Notifier Name: Not reported
Notifier Agency: Not reported
Notifier Phone: Not reported
Spill Date/Time: 10/19/1998 18:00

MAP FINDINGS

EDR ID Number
EPA ID Number

S104648033

Reported to Dept Date/Time:	10/20/98 02:03
SWIS:	62
Spiller Name:	CON ED
Spiller Contact:	RICHARD ROACH
Spiller Phone:	(212) 580-6764
Spiller Contact:	RICHARD ROACH
Spiller Phone:	(212) 580-6764
Spiller Address:	4 IRVING PL
Spiller City,St,Zip:	NEW YORK, NY 10003-
Spill Cause:	Equipment Failure
Reported to Dept:	On Land
Water Affected:	Not reported
Spill Source:	01
Spill Notifier:	Responsible Party
PBS Number:	Not reported
Cleanup Ceased:	/ /
Cleanup Meets Std:	False
Last Inspection:	/ /
Recommended Penalty:	Penalty Not Recommended
Spiller Cleanup Dt:	/ /
Enforcement Date:	/ /
Invstgn Complete:	/ /
UST Involvement:	False
Spill Class:	Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken.
Spill Closed Dt:	/ /
Corrective Action Plan Submitted:	/ /
Date Region Sent Summary to Central Office:	/ /
Date Spill Entered In Computer Data File:	10/20/98
Date Spill Entered In Computer Data File:	Not reported
Update Date:	10/22/98
Is Updated:	False
PBS Number:	Not reported
Tank Number:	Not reported
Tank Size:	Not reported
Test Method:	Not reported
Leak Rate Failed Tank:	Not reported
Gross Leak Rate:	Not reported
Material Class Type:	Petroleum
Quantity Spilled:	50
Unkonwn Quantity Spilled:	False
Units:	Gallons
Quantity Recovered:	50
Unkonwn Quantity Recovered:	False
Material:	DIELECTRIC FLUID
Class Type:	DIELECTRIC FLUID
Times Material Entry In File:	41
CAS Number:	Not reported
Last Date:	Not reported
DEC Remarks:	Not reported
Remark:	spill cleaned up ref 120636

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

A3
WNW
< 1/8
180 ft.

MANHOLE #61738
155TH ST / ST.NICHOLAS AV
MANHATTAN, NY

NY Spills
NY Hist Spills

S104787656
N/A

Relative:
Higher

Site 3 of 7 in cluster A

Actual:
132 ft.

NY Spills:

Site ID: 170096
Facility Addr2: Not reported
Facility ID: 0004974
Spill Number: 0004974
Facility Type: ER
SWIS: 3101
Region of Spill: 2
Investigator: JHOCONNE
Referred To: Not reported
Spill Date: 07/26/00
Reported to Dept: 07/26/00
CID: 257
Spill Cause: Unknown
Water Affected: Not reported
Spill Source: Unknown
Spill Notifier: Affected Persons
Cleanup Ceased: / /
Cleanup Meets Std: False
Last Inspection: / /
Recommended Penalty: Penalty Not Recommended
UST Trust: False
Spill Class: Known release with minimal potential for fire or hazard. DEC Response.
Willing Responsible Party. Corrective action taken.
Spill Closed Dt: 05/11/04
Remediation Phase: 0
Date Entered In Computer: 07/26/00
Spill Record Last Update: 05/11/04
Spiller Name: Not reported
Spiller Company: UNKNOWN
Spiller Address: Not reported
Spiller City,St,Zip: ZZ -
Spiller Company: 001
Spiller Phone: Not reported
Contact Name: BRIAN JOYCE
Contact Phone: (212) 580-6763
DEC Region: 2
Program Number: 0004974
DER Facility ID: 143124
Site ID: 170096
Operable Unit ID: 827410
Operable Unit: 01
Material ID: 549710
Material Code: 0066A
Material Name: UNKNOWN PETROLEUM
Case No.: Not reported
Material FA: Petroleum
Quantity: 4.00
Units: Gallons
Recovered: 0.00
Resource Affected: Soil
Oxygenate: False
DEC Memo: Start DECRemark - 0004974 Prior to Sept, 2004 data translation this spill Lead

S104787656

DEC Field was "O'CONNELL" e2mis no. 132568: Transmission Operations reported approx. 4 gallons of unknown oil and 30 gallons of water in manhole 61738, feeder 51/52. Cleanup pending test results. LSN 00-07204 PCB <1 ppm LSN 00-07207 Benzene < 0.00020 ppm The manhole was cleaned out on 10/5/00. END
DECRemark - 0004974

Remarks: Start CallerRemark - 0004974 4 gals on 30 glas of water - cleanup pending test results ref#132568 END CallerRemark - 0004974

NY Hist Spills:

Region of Spill:	2
Spill Number:	0004974
Investigator:	O'CONNELL
Caller Name:	Not reported
Caller Agency:	Not reported
Caller Phone:	Not reported
Notifier Name:	Not reported
Notifier Agency:	Not reported
Notifier Phone:	Not reported
Spill Date/Time:	07/26/2000 10:30
Reported to Dept Date/Time:	07/26/00 11:12
SWIS:	62
Spiller Name:	UNKNOWN
Spiller Contact:	Not reported
Spiller Phone:	() -
Spiller Contact:	BRIAN JOYCE
Spiller Phone:	(212) 580-6763
Spiller Address:	Not reported
Spiller City,St,Zip:	-
Spill Cause:	Unknown
Reported to Dept:	On Land
Water Affected:	Not reported
Spill Source:	12
Spill Notifier:	Affected Persons
PBS Number:	Not reported
Cleanup Ceased:	/ /
Cleanup Meets Std:	False
Last Inspection:	/ /
Recommended Penalty:	Penalty Not Recommended
Spiller Cleanup Dt:	/ /
Enforcement Date:	/ /
Invstgn Complete:	/ /
UST Involvement:	False
Spill Class:	Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken.
Spill Closed Dt:	/ /
Corrective Action Plan Submitted:	/ /
Date Region Sent Summary to Central Office:	/ /
Date Spill Entered In Computer Data File:	07/26/00
Date Spill Entered In Computer Data File:	Not reported
Update Date:	07/28/00
Is Updated:	False
PBS Number:	Not reported
Tank Number:	Not reported
Tank Size:	Not reported
Test Method:	Not reported
Leak Rate Failed Tank:	Not reported
Gross Leak Rate:	Not reported

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

MANHOLE #61738 (Continued)

EDR ID Number
EPA ID Number

Database(s)

S104787656

Material Class Type: Petroleum
Quantity Spilled: 4
Unkonwn Quantity Spilled: False
Units: Gallons
Quantity Recovered: 0
Unkonwn Quantity Recovered: False
Material: UNKNOWN PETROLEUM
Class Type: UNKNOWN PETROLEUM
Times Material Entry In File: 16414
CAS Number: Not reported
Last Date: 19940929
DEC Remarks: Not reported
Remark: 4 gals on 30 glas of water - cleanup pending test results ref 132568

A4
WNW
< 1/8
180 ft.

MANHOLE 61738
WEST 155TH ST/ST NICHOLAS
MANHATTAN, NY

NY Spills
NY Hist Spills

S104654011
N/A

Site 4 of 7 in cluster A

Relative:
Higher

NY Spills:
Site ID: 302081
Facility Addr2: Not reported
Facility ID: 0003693
Spill Number: 0003693
Facility Type: ER
SWIS: 3101
Region of Spill: 2
Investigator: JHOCONNE
Referred To: Not reported
Spill Date: 06/26/00
Reported to Dept: 06/26/00
CID: 382
Spill Cause: Unknown
Water Affected: Not reported
Spill Source: Unknown
Spill Notifier: Other
Cleanup Ceased: / /
Cleanup Meets Std: False
Last Inspection: / /
Recommended Penalty: Penalty Not Recommended
UST Trust: False
Spill Class: Known release with minimal potential for fire or hazard. DEC Response.
Willing Responsible Party. Corrective action taken.
Spill Closed Dt: 04/08/04
Remediation Phase: 0
Date Entered In Computer: 06/26/00
Spill Record Last Update: 04/08/04
Spiller Name: Not reported
Spiller Company: UNKNOWN
Spiller Address: Not reported
Spiller City,St,Zip: ZZ -
Spiller Company: 001
Spiller Phone: Not reported
Contact Name: BILL MURPHY
Contact Phone: (212) 580-6763
DEC Region: 2
Program Number: 0003693

Actual:
132 ft.

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

MANHOLE 61738 (Continued)

EDR ID Number
EPA ID Number

Database(s)

S104654011

DER Facility ID: 244085
Site ID: 302081
Operable Unit ID: 825031
Operable Unit: 01
Material ID: 548446
Material Code: 0066A
Material Name: UNKNOWN PETROLEUM
Case No.: Not reported
Material FA: Petroleum
Quantity: 8.00
Units: Gallons
Recovered: 0.00
Resource Affected: Soil
Oxygenate: False
DEC Memo: Start DECRemark - 0003693 Prior to Sept, 2004 data translation this spill Lead
DEC Field was "O'CONNELL" e2mis no. 132022: 8 gallons of unknown oil on top
of 675 gallons water inside mh 61738. Chem lab reports 00-06178 <1.00ppm PCB.
On 6/29/00 Con Ed tanker pumped out manhole. The liquid is being returned to
Astoria oil/water separator. Cleanup complete. END DECRemark - 0003693
Remarks: Start CallerRemark - 0003693 OIL ON 675 GALS OF WATER CONRAINED IN MANHOLE.
CLEAN UP PENDING. CON ED 132-022 END CallerRemark - 0003693

NY Hist Spills:

Region of Spill: 2
Spill Number: 0003693
Investigator: O'CONNELL
Caller Name: Not reported
Caller Agency: Not reported
Caller Phone: Not reported
Notifier Name: Not reported
Notifier Agency: Not reported
Notifier Phone: Not reported
Spill Date/Time: 06/26/2000 11:55
Reported to Dept Date/Time: 06/26/00 12:45
SWIS: 62
Spiller Name: UNKNOWN
Spiller Contact: Not reported
Spiller Phone: () -
Spiller Contact: BILL MURPHY
Spiller Phone: (212) 580-6763
Spiller Address: Not reported
Spiller City,St,Zip: -
Spill Cause: Unknown
Reported to Dept: On Land
Water Affected: Not reported
Spill Source: 12
Spill Notifier: Other
PBS Number: Not reported
Cleanup Ceased: / /
Cleanup Meets Std: False
Last Inspection: / /
Recommended Penalty: Penalty Not Recommended
Spiller Cleanup Dt: / /
Enforcement Date: / /
Invstgn Complete: / /
UST Involvement: False
Spill Class: Known release with minimal potential for fire or hazard. DEC Response.

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s)
EDR ID Number
EPA ID Number

MANHOLE 61738 (Continued)

S104654011

Willing Responsible Party. Corrective action taken.

Spill Closed Dt: / /
Corrective Action Plan Submitted: / /
Date Region Sent Summary to Central Office: / /
Date Spill Entered In Computer Data File: 06/26/00
Date Spill Entered In Computer Data File: Not reported
Update Date: 06/26/00
Is Updated: False
PBS Number: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate Failed Tank: Not reported
Gross Leak Rate: Not reported
Material Class Type: Petroleum
Quantity Spilled: 8
Unkonwn Quantity Spilled: False
Units: Gallons
Quantity Recovered: 0
Unkonwn Quantity Recovered: False
Material: UNKNOWN PETROLEUM
Class Type: UNKNOWN PETROLEUM
Times Material Entry In File: 16414
CAS Number: Not reported
Last Date: 19940929
DEC Remarks: Not reported
Remark: OIL ON 675 GALS OF WATER CONRAINED IN MANHOLE. CLEAN UP PENDING. CON ED 132-022

A5 **MOST WORSHIPFUL PRINCE HALL GRAND LODGE**
WNW **454 W. 155TH STREET**
< 1/8 **NEW YORK, NY 10032**
218 ft.

UST **U004047646**
 N/A

Site 5 of 7 in cluster A

Relative:
Higher

UST:

Actual:
133 ft.

UST:

Facility Id: 2-609724
Expiration Date: 10/06/09
Renewal Date: / /
Total Capacity: 2000
Facility Type: Not reported
Mailing Company: MOST WORSHIPFUL PRINCE HALL GRAND LODGE
Mailing Title: TRUSTEE CHAIR MAN
Mailing Contact: ANDRE F. BAKER
Mailing Address: 454 W. 155TH STREET
Mailing Address 2: Not reported
Mailing City: NEW YORK
Mailing State: NY
Mailing Zip Code: 10032
Mailing Phone No: (212) 281-2211
Mailing Email: Not reported
Owner Title: TRUSTEE CHAIR MAN
Owner Name: ANDRE F. BAKER
Owner Address: 454 W. 155TH STREET
Owner Address 2: Not reported
Owner State: NY
Owner Zip Code: 10032

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s)
EDR ID Number
EPA ID Number

MOST WORSHIPFUL PRINCE HALL GRAND LODGE (Continued)

U004047646

Owner Phone: (212) 281-2211
Owner Company: MOST WORSHIPFUL PRINCE HALL GRAND LODGE
Emergency Contact: JULIUS MARSHALL
Emergency Phone: (212) 283-3175
Operator: ANDRE F. BAKER
Operator Phone: (212) 368-9050
Owner City: NEW YORK
Owner Sub Type: Corporate or Commercial
UTM X: 589241.81295
UTM Y: 4520526.93059
Site Type Name: Other
Site Type Status: Active
Comments: Not reported

Program Type: PBS

Tank Number: 001
Tank Location Name: Underground
Tank Status: In Service
Tank Model: Not reported
Pipe Model: Not reported
Active Status: Active
Install Date: / /
Capacity Gallons: 2000
Material Name: #2 Fuel Oil
Percentage: 100.00
Tank Type Name: Steel/Carbon Steel/Iron
Tank Internal Protection: Not reported
Tank Internal Protection 1: Not reported
Tank Internal Protection 2: Not reported
Pipe Location Name: Aboveground/Underground Combination
Pipe Type Name: Steel/Carbon Steel/Iron
Pipe External Protection 1: Not reported
Pipe External Protection 2: Not reported
Tank Secondary Containment 1: Not reported
Tank Secondary Containment 2: Not reported
Pipe Secondary Containment: Not reported
Tank Leak Detection 1: Not reported
Tank Leak Detection 2: Not reported
Pipe Leak Detection 1: Not reported
Pipe Leak Detection 2: Not reported
Type Of Overfill Prevention 1: Vent Whistle
Type Of Overfill Prevention 2: Not reported
Dispenser Method: Not reported
Spill Prevention: None
Tightness Test Method: Horner EYZ3/EYZ3 Locator Plus
Date Tested: 09/28/04
Next Test Date: 09/28/09
Date Tank Closed: / /

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

A6
WNW
< 1/8
218 ft.

PRINCE HALL MASONIC TEMPL
454 WEST 155TH STREET
NEW YORK, NY

LTANKS **S106702663**
N/A

Relative:
Higher

Site 6 of 7 in cluster A

Actual:
133 ft.

LTANKS:

Site ID: 246984
Spill Date: 08/31/04
Facility Addr2: Not reported
Facility ID: 0405972
Program Number: 0405972
SWIS: 3101
Region of Spill: 2
Investigator: CESAUYER
Referred To: Not reported
Reported to Dept: 08/31/04
CID: 15
Spill Cause: Tank Failure
Water Affected: Not reported
Spill Source: Unknown
Spill Notifier: Responsible Party
Cleanup Ceased: / /
Cleanup Meets Standard: False
Last Inspection: / /
Recommended Penalty: Penalty Not Recommended
UST Involvement: False
Spill Class: Known release with minimal potential for fire or hazard. DEC Response.
Willing Responsible Party. Corrective action taken.

Spill Closed Dt: 10/07/04
Remediation Phase: 0
Date Entered In Computer: 08/31/04
Spill Record Last Update: 10/07/04
Spille Namer: ANDRE BAKER
Spiller Company: CHURCH
Spiller Phone: (914) 525-3479
Spiller Extention: Not reported
Spiller Address: 454 WEST 155TH STREET
Spiller City,St,Zip: NEW YORK, NY
Spiller County: 001
Spiller Contact: ANDRE BAKER-CHAIR OF BRD
Spiller Phone: (914) 525-3479
Spiller Extention: Not reported
DEC Region: 2
Program Number: 0405972
DER Facility ID: 202789
Site ID: 246984
Operable Unit ID: 888661
Operable Unit: 01
Material ID: 486895
Material Code: 0001
Material Name: #2 Fuel Oil
Case No.: Not reported
Material FA: Petroleum
Quantity: 0.00
Units: Pounds
Recovered: 0.00
Resource Affected: Soil
Oxygenate: False

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

Database(s)
EDR ID Number
EPA ID Number

PRINCE HALL MASONIC TEMPL (Continued)

S106702663

Site ID: 246984
Operable Unit ID: 888661
Operable Unit: 01
Material ID: 486894
Material Code: 0001
Material Name: #2 Fuel Oil
Case No.: Not reported
Material FA: Petroleum
Quantity: 0.00
Units: Not reported
Recovered: 0.00
Resource Affected: Soil
Oxygenate: False
Site ID: Not reported
Spill Tank Test: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate: Not reported
Gross Fail: Not reported
Modified By: Not reported
Last Modified: Not reported
Test Method: Not reported
DEC Memo: Start DECRemark - 0405972 Prior to Sept, 2004 data translation this spill Lead DEC Field was "SAWYER" 8/31/2004 Sangesland spoke to Issac about this site. Eastmond was called to this property. Apparently the tank has been leaking for quite a while whenever it is more than half filled. 2000 gal tank wrapped in concrete. - No PBS registration Contacts for site: Andre Baker - Chairman of Board 914-525-3479 Richard - 718-469-5345 - home // 917-319-2519 - cell 9/1/2004 Sangesland spoke to Andre Baker about his tank. Discussed the various options (repair, reline, replace). Mr. Baker said they were getting bids on repairing the tank and said he would be working on this over the next couple of weeks. Mr. Baker was specifically told the tank MUST BE TAKEN OUT OF SERVICE TODAY and a temp tank installed. Sangesland told him that his oil company or any of the tank companies bidding on his repair job could probably set up a temp tank. Do Work letter was sent today. 10/07/04 - Sawyer - Received passed tank test for syatem at above address. Mr. Leon Gladman 718 590 0777 or 646 302 5940 the lodge treasurer was very positive that no spill had occurred there. No further action. Closed. ENDDECRemark - 0405972
Remarks: Start CallerRemark - 0405972 TANK RUPTURED ON CONCRETE. TANK NEEDS TO BE CLEANED. END CallerRemark - 0405972

B7
ESE
< 1/8
220 ft.

HARLEM RIVER DR & W 155TH
HARLEM RIVER DR / W 155TH
MANHATTAN, NY

NY Spills S103273331
NY Hist Spills N/A

Site 1 of 3 in cluster B

Relative:
Lower

NY Spills:
Site ID: 81519
Facility Addr2: Not reported
Facility ID: 9800207
Spill Number: 9800207
Facility Type: ER
SWIS: 3101
Region of Spill: 2
Investigator: O'DOWD

Actual:
103 ft.

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

HARLEM RIVER DR & W 155TH (Continued)

EDR ID Number
EPA ID Number

Database(s)

S103273331

Referred To: Not reported
Spill Date: 04/06/98
Reported to Dept: 04/06/98
CID: 266
Spill Cause: Traffic Accident
Water Affected: Not reported
Spill Source: Commercial Vehicle
Spill Notifier: Fire Department
Cleanup Ceased: / /
Cleanup Meets Std: False
Last Inspection: / /
Recommended Penalty: Penalty Not Recommended
UST Trust: False
Spill Class: Known release with minimal potential for fire or hazard. DEC Response.
Willing Responsible Party. Corrective action taken.
Spill Closed Dt: 04/27/98
Remediation Phase: 0
Date Entered In Computer: 04/06/98
Spill Record Last Update: 04/27/98
Spiller Name: Not reported
Spiller Company: PATCO TRANSPORTATION, INC
Spiller Address: Not reported
Spiller City,St,Zip: ZZ
Spiller Company: 001
Spiller Phone: (860) 677-2497
Contact Name: Not reported
Contact Phone: Not reported
DEC Region: 2
Program Number: 9800207
DER Facility ID: 75415
Site ID: 81519
Operable Unit ID: 1060712
Operable Unit: 01
Material ID: 325751
Material Code: 0008
Material Name: Diesel
Case No.: Not reported
Material FA: Petroleum
Quantity: 150.00
Units: Gallons
Recovered: 0.00
Resource Affected: Surface Water
Oxygenate: False
DEC Memo: Not reported
Remarks: Start CallerRemark - 9800207 DRIVER HAD A HEART ATTACK. HIT DIVIDER AND RUPTURER SADDLE TANKS. SOME ONTO ROADWAY AND UNKNOWN AMOUNT INTO STORM SEWER. REGISTRATION ON TRACTOR ZH7714 (ON). ABSORBANT APPLIED TO ROADWAY. ATTEMPTING TO RECOVER FROMSTORM DRAIN. END CallerRemark - 9800207

NY Hist Spills:

Region of Spill: 2
Spill Number: 9800207
Investigator: O'DOWD
Caller Name: Not reported
Caller Agency: Not reported
Caller Phone: Not reported
Notifier Name: Not reported

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s)
EDR ID Number
EPA ID Number

HARLEM RIVER DR & W 155TH (Continued)

S103273331

Notifier Agency: Not reported
Notifier Phone: Not reported
Spill Date/Time: 04/06/1998 11:19
Reported to Dept Date/Time: 04/06/98 12:10
SWIS: 62
Spiller Name: PATCO TRANSPORTATION, INC
Spiller Contact: Not reported
Spiller Phone: (860) 677-2497
Spiller Address: Not reported
Spiller City,St,Zip: Not reported
Spill Cause: Traffic Accident
Reported to Dept: Surface Water
Water Affected: Not reported
Spill Source: 07
Spill Notifier: Fire Department
PBS Number: Not reported
Cleanup Ceased: / /
Cleanup Meets Std: False
Last Inspection: / /
Recommended Penalty: Penalty Not Recommended
Spiller Cleanup Dt: / /
Enforcement Date: / /
Invstgn Complete: / /
UST Involvement: False
Spill Class: Known release with minimal potential for fire or hazard. DEC Response.
Willing Responsible Party. Corrective action taken.
Spill Closed Dt: 04/27/98
Corrective Action Plan Submitted: / /
Date Region Sent Summary to Central Office: / /
Date Spill Entered In Computer Data File: 04/06/98
Date Spill Entered In Computer Data File: Not reported
Update Date: 04/27/98
Is Updated: False
PBS Number: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate Failed Tank: Not reported
Gross Leak Rate: Not reported
Material Class Type: Petroleum
Quantity Spilled: 150
Unkonwn Quantity Spilled: False
Units: Gallons
Quantity Recovered: 0
Unkonwn Quantity Recovered: True
Material: DIESEL
Class Type: DIESEL
Times Material Entry In File: 10625
CAS Number: Not reported
Last Date: 19940728
DEC Remarks: FAX TO ECS.4/6/98 4:30 PM SPOKE TO RONALD/DEP. HE WAS AT THE SCENE. THEY SANDED THE AREA. SMALL AMOUNT OF OIL GOT INTO STORM DRAIN WHICH DRAINS TO THE LOWER LEVEL. HIGHWAY WAS TO SAND THAT AREA ALSO.) NOTHING GOT INTO WATER AS FAR AS HE KNEW.
Remark: DRIVER HAD A HEART ATTACK. HIT DIVIDER AND RUPTURER SADDLE TANKS. SOME ONTO ROADWAY AND UNKNOWN AMOUNT INTO STORM SEWER. REGISTRATION ON TRACTOR ZH7714 ON). ABSORBANT APPLIED TO ROADWAY. ATTEMPTING TO RECOVER FROM STORM DRAIN.

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

C8
WSW
< 1/8
240 ft.

NORTH MANHATTAN SHOP
886 SOUTH ST. NICHOLAS AVENUE
NEW YORK, NY 10032

UST
LTANKS
HIST UST
HIST LTANKS

U003153154
N/A

Relative:
Higher

Site 1 of 4 in cluster C

UST:

Actual:
131 ft.

UST:

Facility Id: 2-456357
Expiration Date: 12/06/98
Renewal Date: / /
Total Capacity: 0
Facility Type: Not reported
Mailing Company: DEPT OF GENERAL SERVICES
Mailing Title: Not reported
Mailing Contact: RICHARD ROBILOTTA
Mailing Address: ONE CENTER STREET
Mailing Address 2: Not reported
Mailing City: NEW YORK
Mailing State: NY
Mailing Zip Code: 10007
Mailing Phone No: (212) 669-4328
Mailing Email: Not reported
Owner Title: Not reported
Owner Name: Not reported
Owner Address: ONE CENTER STREET
Owner Address 2: Not reported
Owner State: NY
Owner Zip Code: 10007
Owner Phone: (212) 669-4328
Owner Company: DEPT OF GENERAL SERVICES
Emergency Contact: L. LARRAGIOTI
Emergency Phone: (212) 862-1366
Operator: L. LARRAGIOTI
Operator Phone: (212) 862-1366
Owner City: NEW YORK
Owner Sub Type: Local Government
UTM X: 589238.94891
UTM Y: 4520488.25923
Site Type Name: Other
Site Type Status: Unregulated
Comments: Not reported

Program Type: PBS

Tank Number: 001
Tank Location Name: Underground
Tank Status: Closed - Removed
Tank Model: Not reported
Pipe Model: Not reported
Active Status: Inactive
Install Date: 06/01/96
Capacity Gallons: 5000
Material Name: Gasoline
Percentage: 100.00
Tank Type Name: Steel/Carbon Steel/Iron
Tank Internal Protection: None
Tank Internal Protection 1: Original Sacrificial Anode
Tank Internal Protection 2: Not reported

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s)
EDR ID Number
EPA ID Number

NORTH MANHATTAN SHOP (Continued)

U003153154

Pipe Location Name: Underground/On-ground
Pipe Type Name: No Piping
Pipe External Protection 1: None
Pipe External Protection 2: Not reported
Tank Secondary Containment 1: None
Tank Secondary Containment 2: Not reported
Pipe Secondary Containment: Not reported
Tank Leak Detection 1: In-Tank System (ATG)
Tank Leak Detection 2: Not reported
Pipe Leak Detection 1: Not reported
Pipe Leak Detection 2: Not reported
Type Of Overfill Prevention 1: None
Type Of Overfill Prevention 2: Not reported
Dispenser Method: Suction
Spill Prevention: Not reported
Tightness Test Method: Testing Not Required
Date Tested: / /
Next Test Date: / /
Date Tank Closed: 06/01/96

Tank Number: 002
Tank Location Name: Underground
Tank Status: Closed - Removed
Tank Model: Not reported
Pipe Model: Not reported
Active Status: Inactive
Install Date: 06/01/96
Capacity Gallons: 5000
Material Name: #2 Fuel Oil
Percentage: 100.00
Tank Type Name: Steel/Carbon Steel/Iron
Tank Internal Protection: None
Tank Internal Protection 1: None
Tank Internal Protection 2: Not reported
Pipe Location Name: Underground/On-ground
Pipe Type Name: Steel/Carbon Steel/Iron
Pipe External Protection 1: None
Pipe External Protection 2: Not reported
Tank Secondary Containment 1: None
Tank Secondary Containment 2: Not reported
Pipe Secondary Containment: Not reported
Tank Leak Detection 1: None
Tank Leak Detection 2: Not reported
Pipe Leak Detection 1: Not reported
Pipe Leak Detection 2: Not reported
Type Of Overfill Prevention 1: None
Type Of Overfill Prevention 2: Not reported
Dispenser Method: Not reported
Spill Prevention: Not reported
Tightness Test Method: Testing Not Required
Date Tested: / /
Next Test Date: / /
Date Tank Closed: 06/01/96

LTANKS:
Site ID: 143507

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s)
EDR ID Number
EPA ID Number

NORTH MANHATTAN SHOP (Continued)

U003153154

Spill Date: 12/23/97
Facility Addr2: Not reported
Facility ID: 9710796
Program Number: 9710796
SWIS: 3101
Region of Spill: 2
Investigator: JAKOLLEE
Referred To: Not reported
Reported to Dept: 12/23/97
CID: 15
Spill Cause: Tank Failure
Water Affected: Not reported
Spill Source: Commercial/Industrial
Spill Notifier: Other
Cleanup Ceased: / /
Cleanup Meets Standard: False
Last Inspection: / /
Recommended Penalty: Penalty Not Recommended
UST Involvement: True
Spill Class: Known release that creates potential for fire or hazard. DEC Response.
Willing Responsible Party. Corrective action taken.
Spill Closed Dt: 04/20/01
Remediation Phase: 0
Date Entered In Computer: 12/23/97
Spill Record Last Update: 04/19/01
Spille Namer: TONY MARINO
Spiller Company: NORTH MANHATTEN SHOP
Spiller Phone: (718) 391-1062
Spiller Extention: Not reported
Spiller Address: 886 SOUTH ST NICHOLAS AV
Spiller City,St,Zip: MANHATTEN, NY -
Spiller County: 001
Spiller Contact: TONY MARINO
Spiller Phone: (718) 391-1062
Spiller Extention: Not reported
DEC Region: 2
Program Number: 9710796
DER Facility ID: 122392
Site ID: 143507
Operable Unit ID: 1057171
Operable Unit: 01
Material ID: 329077
Material Code: 0008
Material Name: Diesel
Case No.: Not reported
Material FA: Petroleum
Quantity: 0.00
Units: Gallons
Recovered: 0.00
Resource Affected: Soil
Oxygenate: False
Site ID: Not reported
Spill Tank Test: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate: Not reported

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

NORTH MANHATTAN SHOP (Continued)

EDR ID Number
EPA ID Number

Database(s)

U003153154

Gross Fail: Not reported
Modified By: Not reported
Last Modified: Not reported
Test Method: Not reported
DEC Memo: Start DECRemark - 9710796 Prior to Sept, 2004 data translation this spill Lead
DEC Field was "KOLLEENY" TANK WAS ABANDONED IN PLACE, NOT REMOVED. CLOSURE
BORING SOIL SAMPLES SHOWED SEMI-VOCS. TCLP ANALYSIS OF SOIL SAMPLES TAKEN IN
ADDITIONAL INVESTIGATION INDICATED THAT RESIDUAL CONTAMINATION IS NOT LIKELY TO
IMPACT GROUNDWATER. SOIL CONTAMINATION IS IN AN ENCLOSED AREA, SURROUNDED ON 3
SIDES BY CONCRETE WALLS, UNDERLAIN BY CONCRETE OVER BEDROCK, AND COVERED BY
CONCRETE PATIO. SITE IS AT110 FEET ABOVE SEA LEVEL, SO LOCAL WATER TABLE IS
LIKELY TO BE WELL BELOW CONCRETE/BEDROCK INTERFACE. HOWEVER, SOIL DOES
CONTAIN LEVELS OF CARCINOGENIC SVOCs THAT COULD POSE A THREAT TO HUMAN HEALTH
IF INGESTED OR INHALED. IN EVENT OF ANY CONSTRUCTION OR DEMOLITION WORK THAT
WOULD INVOLVE CONTACT WITH THIS SOIL, APPROPRIATE PRECAUTIONS SHOULD BE TAKEN
TO PREVENT INGESTION/INHALATION OF SOIL PARTICLES BY WORKERS. END DECRemark -
9710796
Remarks: Start CallerRemark - 9710796 RESULTS FROM SOIL SAMPLES SHOW CONTAMINATION AT A
TANK REMOVAL SITE END CallerRemark - 9710796

HIST UST:

PBS Number: 2-456357
SPDES Number: Not reported
Emergency Contact: L. LARRAGIOTI
Emergency Telephone: (212) 862-1366
Operator: L. LARRAGIOTI
Operator Telephone: (212) 862-1366
Owner Name: DEPT OF GENERAL SERVICES
Owner Address: ONE CENTER STREET
Owner City,St,Zip: NEW YORK, NY 10007
Owner Telephone: (212) 669-4328
Owner Type: Local Government
Owner Subtype: The City of New York
Mailing Name: DEPT OF GENERAL SERVICES
Mailing Address: ONE CENTER STREET
Mailing Address 2: Not reported
Mailing City,St,Zip: NEW YORK, NY 10007
Mailing Contact: RICHARD ROBILOTTA
Mailing Telephone: (212) 669-4328
Owner Mark: First Owner
Facility Status: 2 - Unregulated by PBS (the total capacity is less than 1,101 gallons)
and Subpart 360-14.
Facility Addr2: Not reported
SWIS ID: 6201
Old PBS Number: Not reported
Facility Type: OTHER
Inspected Date: Not reported
Inspector: Not reported
Inspection Result: Not reported
Federal ID: Not reported
Certification Flag: False
Certification Date: 01/18/1995
Expiration Date: 12/06/1998
Renew Flag: False
Renewal Date: Not reported
Total Capacity: 0
FAMT: True

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

NORTH MANHATTAN SHOP (Continued)

EDR ID Number
EPA ID Number

Database(s)

U003153154

Facility Screen: No Missing Data
Owner Screen: Minor Data Missing
Tank Screen: 0
Dead Letter: False
CBS Number: Not reported
Town or City: NEW YORK CITY
County Code: 62
Town or City: 01
Region: 2

Tank Id: 001
Tank Location: UNDERGROUND
Tank Status: Closed-Removed
Install Date: 19960601
Capacity (gals): 5000
Product Stored: UNLEADED GASOLINE
Tank Type: Steel/carbon steel
Tank Internal: None
Tank External: Sacrificial Anode
Pipe Location: Underground
Pipe Type: NONE
Pipe Internal: None
Pipe External: None
Second Containment: None
Leak Detection: In-tank System
Overfill Prot: None
Dispenser: Suction
Date Tested: Not reported
Next Test Date: Not reported
Missing Data for Tank: No Missing Data
Date Closed: 06/01/1996
Test Method: Not reported
Deleted: False
Updated: True
Lat/long: Not reported

Tank Id: 002
Tank Location: UNDERGROUND
Tank Status: Closed-Removed
Install Date: 19960601
Capacity (gals): 5000
Product Stored: NOS 1,2, OR 4 FUEL OIL
Tank Type: Steel/carbon steel
Tank Internal: None
Tank External: None
Pipe Location: Underground
Pipe Type: STEEL/IRON
Pipe Internal: None
Pipe External: None
Second Containment: None
Leak Detection: None
Overfill Prot: None
Dispenser: 0
Date Tested: Not reported
Next Test Date: Not reported
Missing Data for Tank: No Missing Data

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s)
EDR ID Number
EPA ID Number

NORTH MANHATTAN SHOP (Continued)

U003153154

Date Closed: 06/01/1996
Test Method: Not reported
Deleted: False
Updated: True
Lat/long: Not reported

HIST LTANKS:

Region of Spill: 2
Spill Number: 9710796
Investigator: KOLLEENY
Caller Name: Not reported
Caller Agency: Not reported
Caller Phone: Not reported
Caller Extension: Not reported
Notifier Name: Not reported
Notifier Agency: Not reported
Notifier Phone: Not reported
Notifier Extension: Not reported
Spill Date: 12/23/1997
Spill Time: 08:00
Reported to Department Date: 12/23/97
Reported to Department Time: 08:44
SWIS: 62
Spiller Contact: TONY MARINO
Spiller Phone: (718) 391-1062
Spiller Extension: Not reported
Spiller Name: NORTH MANHATTEN SHOP
Spiller Address: 886 SOUTH ST NICHOLAS AV
Spiller City,St,Zip: MANHATTEN, NY -
Facility Contact: TONY MARINO
Facility Phone: (718) 391-1062
Facility Extension: Not reported
Spill Cause: Tank Failure
Resource Affectd: On Land
Water Affected: Not reported
Spill Source: Other Commercial/Industrial
Spill Notifier: Other
PBS Number: Not reported
Cleanup Ceased: / /
Cleanup Meets Standard: False
Last Inspection: / /
Recommended Penalty: Penalty Not Recommended
Spiller Cleanup Date: / /
Enforcement Date: / /
Investigation Complete: / /
UST Involvement: True
Spill Class: Known release that creates potential for fire or hazard. DEC Response.
Willing Responsible Party. Corrective action taken.
Spill Closed Dt: 04/20/01
Date Region Sent Summary to Central Office: / /
Corrective Action Plan Submitted: / /
Date Spill Entered In Computer Data File: 12/23/97
Time Spill Entered In Computer Data File: Not reported
Spill Record Last Update: 04/19/01
Is Updated: False
PBS Number: Not reported
Tank Number: Not reported

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

NORTH MANHATTAN SHOP (Continued)

EDR ID Number
EPA ID Number

Database(s)

U003153154

Tank Size: Not reported
Test Method: Not reported
Leak Rate Failed Tank: Not reported
Gross Leak Rate: Not reported
Material Class Type: Petroleum
Quantity Spilled: 0
Unkonwn Quantity Spilled: True
Units: Gallons
Quantity Recovered: 0
Unkonwn Quantity Recovered: False
Material: DIESEL
Class Type: DIESEL
Times Material Entry In File: 10625
CAS Number: Not reported
Last Date: 19940728
DEC Remarks: TANK WAS ABANDONED IN PLACE, NOT REMOVED. CLOSURE BORING SOIL SAMPLES SHOWED SEMI-VOCS. TCLP ANALYSIS OF SOIL SAMPLES TAKEN IN ADDITIONAL INVESTIGATION INDICATED THAT RESIDUAL CONTAMINATION IS NOT LIKELY TO IMPACT GROUNDWATER. SOIL CONTAMINATION IS IN AN ENCLOSED AREA, SURROUNDED ON 3 SIDES BY CONCRETE WALLS, UNDERLAIN BY CONCRETE OVER BEDROCK, AND COVERED BY CONCRETE PATIO. SITE IS AT 110 FEET ABOVE SEA LEVEL, SO LOCAL WATER TABLE IS LIKELY TO BE WELL BELOW CONCRETE/BEDROCK INTERFACE. HOWEVER, SOIL DOES CONTAIN LEVELS OF CARCINOGENIC SVOCS THAT COULD POSE A THREAT TO HUMAN HEALTH IF INGESTED OR INHALED. IN EVENT OF ANY CONSTRUCTION OR DEMOLITION WORK THAT WOULD INVOLVE CONTACT WITH THIS SOIL, APPROPRIATE PRECAUTIONS SHOULD BE TAKEN TO PREVENT INGESTION/INHALATION OF SOIL PARTICLES BY WORKERS.
Spill Cause: RESULTS FROM SOIL SAMPLES SHOW CONTAMINATION AT A TANK REMOVAL SITE

C9
WSW
< 1/8
240 ft.

886 ST. NICHOLAS AVENUE
886 ST NICHOLAS AVENUE
MANHATTAN, NY

LTANKS
HIST LTANKS

S102660667
N/A

Relative:
Higher

Site 2 of 4 in cluster C

Actual:
131 ft.

LTANKS:
Site ID: 72419
Spill Date: 07/14/95
Facility Addr2: Not reported
Facility ID: 9504500
Program Number: 9504500
SWIS: 3101
Region of Spill: 2
Investigator: SXLASDIN
Referred To: Not reported
Reported to Dept: 07/14/95
CID: 15
Spill Cause: Tank Failure
Water Affected: Not reported
Spill Source: Unknown
Spill Notifier: Affected Persons
Cleanup Ceased: / /
Cleanup Meets Standard: False
Last Inspection: / /
Recommended Penalty: Penalty Not Recommended
UST Involvement: False
Spill Class: Known release with minimal potential for fire or hazard. DEC Response.
Willing Responsible Party. Corrective action taken.
Spill Closed Dt: / /

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

886 ST. NICHOLAS AVENUE (Continued)

EDR ID Number
EPA ID Number

Database(s)

S102660667

Remediation Phase: 1
Date Entered In Computer: 08/07/95
Spill Record Last Update: 06/22/07
Spille Namer: Not reported
Spiller Company: NYC HAZMAT UNIT
Spiller Phone: (212) 442-4782
Spiller Extention: Not reported
Spiller Address: 280 BROADWAY - ROOM 403
Spiller City,St,Zip: NEW YORK, NY
Spiller County: 001
Spiller Contact: Not reported
Spiller Phone: Not reported
Spiller Extention: Not reported
DEC Region: 2
Program Number: 9504500
DER Facility ID: 68362
Site ID: 72419
Operable Unit ID: 1019251
Operable Unit: 01
Material ID: 567003
Material Code: 0001
Material Name: #2 Fuel Oil
Case No.: Not reported
Material FA: Petroleum
Quantity: -1.00
Units: Gallons
Recovered: 0.00
Resource Affected: Soil
Oxygenate: False
Site ID: Not reported
Spill Tank Test: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate: Not reported
Gross Fail: Not reported
Modified By: Not reported
Last Modified: Not reported
Test Method: Not reported
DEC Memo: Start DECRemark - 9504500 6/7/07-Matthew Klaas (Albany DER) -Attempted to speak with Alexander Kostic of Hill International at 212-292-3562, this number is no longer in service, and has no message on how to reach Hill International. -Attempted to contact NYC Hazmat Unit (Potential Spiller) at 212-422-4782 this number is incorrect for the Hazmat Unit and there was no way to obtain a current listing for the unit. -I was able to locate a current telephone number for Hill International, 212-244-3700, where I was put in contact with Sylvie Chan. After speaking with her at length on the telephone, she requested I forward her some basic information about the file so she would be able to check anything on file concerning this and get back tome. She told me she would find what she could and then return any findings. 6/11/07-Matthew Klaas (Albany DER) -Drafted a letter to Hill International requesting additional information regarding this spill form. END DECRemark - 9504500
Remarks: Start CallerRemark - 9504500 CALLER FOUND TANK ON ABANDONED LOT - ALEXANDER KOSTIC TANK COVERED W/SOIL - OWNER THINKS THEIR TANK IS THERE. PLAN TO EXCAVATE IN A FEW MONTHS - WILL CALL BACK PRIOR TO REMOVAL & TO REGISTER TANK. END CallerRemark - 9504500

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s)
EDR ID Number
EPA ID Number

886 ST. NICHOLAS AVENUE (Continued)

S102660667

HIST LTANKS:

Region of Spill: 2
Spill Number: 9504500
Investigator: SIGONA
Caller Name: Not reported
Caller Agency: Not reported
Caller Phone: Not reported
Caller Extension: Not reported
Notifier Name: Not reported
Notifier Agency: Not reported
Notifier Phone: Not reported
Notifier Extension: Not reported
Spill Date: 07/14/1995
Spill Time: 14:00
Reported to Department Date: 07/14/95
Reported to Department Time: 14:17
SWIS: 62
Spiller Contact: Not reported
Spiller Phone: Not reported
Spiller Extention: Not reported
Spiller Name: NYC HAZMAT UNIT
Spiller Address: 280 BROADWAY - ROOM 403
Spiller City,St,Zip: NEW YORK, NEW YORK
Facility Contact: Not reported
Facility Phone: (212) 442-4782
Facility Extention: Not reported
Spill Cause: Tank Failure
Resource Affectd: On Land
Water Affected: Not reported
Spill Source: Unknown
Spill Notifier: Affected Persons
PBS Number: Not reported
Cleanup Ceased: / /
Cleanup Meets Standard: False
Last Inspection: / /
Recommended Penalty: Penalty Not Recommended
Spiller Cleanup Date: / /
Enforcement Date: / /
Investigation Complete: / /
UST Involvement: False
Spill Class: Known release with minimal potential for fire or hazard. DEC Response.
Willing Responsible Party. Corrective action taken.
Spill Closed Dt: / /
Date Region Sent Summary to Central Office: / /
Corrective Action Plan Submitted: / /
Date Spill Entered In Computer Data File: 08/07/95
Time Spill Entered In Computer Data File: Not reported
Spill Record Last Update: / /
Is Updated: False
PBS Number: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate Failed Tank: Not reported
Gross Leak Rate: Not reported
Material Class Type: Petroleum
Quantity Spilled: -1

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

886 ST. NICHOLAS AVENUE (Continued)

EDR ID Number
EPA ID Number

Database(s)

S102660667

Unkonwn Quantity Spilled: False
Units: Gallons
Quantity Recovered: 0
Unkonwn Quantity Recovered: False
Material: #2 FUEL OIL
Class Type: #2 FUEL OIL
Times Material Entry In File: 24464
CAS Number: Not reported
Last Date: 19941207
DEC Remarks: Not reported
Spill Cause: CALLER FOUND TANK ON ABANDONED LOT - ALEXANDER KOSTIC TANK COVERED W/SOIL - OWNER THINKS THEIR TANK IS THERE. PLAN TO EXCAVATE IN A FEW MONTHS - WILL CALL BACK PRIOR TO REMOVAL TO REGISTER TANK.

D10 GETTY #340
SSE 89 SAINT NICHOLAS PLACE
< 1/8 NEW YORK, NY 10032
266 ft.

UST U004062863
N/A

Site 1 of 2 in cluster D

Relative:
Lower

UST:

Actual:
106 ft.

UST:

Facility Id: 2-291935
Expiration Date: 05/24/09
Renewal Date: / /
Total Capacity: 16760
Facility Type: Not reported
Mailing Company: GETTY PETROLEUM MAKETING INC.
Mailing Title: ENV. COMP. MGR
Mailing Contact: SCOTT J. HANLEY
Mailing Address: 1500 HEMPSTEAD TURNPIKE
Mailing Address 2: Not reported
Mailing City: EAST MEADOW
Mailing State: NY
Mailing Zip Code: 11554
Mailing Phone No: (516) 542-4900
Mailing Email: Not reported
Owner Title: Not reported
Owner Name: Not reported
Owner Address: 1500 HEMPSTEAD TURNPIKE
Owner Address 2: Not reported
Owner State: NY
Owner Zip Code: 11554
Owner Phone: (516) 542-4900
Owner Company: GETTY PETROLEUM MAKETING INC.
Emergency Contact: SCOTT HANLEY
Emergency Phone: (718) 324-5110
Operator: 89-91 ST NICHLAS S/S INC.
Operator Phone: (212) 694-0240
Owner City: EAST MEADOW
Owner Sub Type: Corporate or Commercial
UTM X: 589376.39399
UTM Y: 4520445.33776
Site Type Name: Retail Gasoline Sales
Site Type Status: Active
Comments: Not reported

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s)
EDR ID Number
EPA ID Number

GETTY #340 (Continued)

U004062863

Program Type: PBS

Tank Number: 001
Tank Location Name: Underground
Tank Status: Closed - Removed
Tank Model: Not reported
Pipe Model: Not reported
Active Status: Inactive
Install Date: 08/01/72
Capacity Gallons: 4000
Material Name: Gasoline
Percentage: 100.00
Tank Type Name: Steel/Carbon Steel/Iron
Tank Internal Protection: None
Tank Internal Protection 1: None
Tank Internal Protection 2: Not reported
Pipe Location Name: No Piping
Pipe Type Name: Galvanized Steel
Pipe External Protection 1: None
Pipe External Protection 2: Not reported
Tank Secondary Containment 1: Vault (w/o access)
Tank Secondary Containment 2: Not reported
Pipe Secondary Containment: Not reported
Tank Leak Detection 1: None
Tank Leak Detection 2: Not reported
Pipe Leak Detection 1: Not reported
Pipe Leak Detection 2: Not reported
Type Of Overfill Prevention 1: None
Type Of Overfill Prevention 2: Not reported
Dispenser Method: Suction
Spill Prevention: Not reported
Tightness Test Method: VacuTest
Date Tested: 11/01/94
Next Test Date: / /
Date Tank Closed: 05/01/95

Tank Number: 002
Tank Location Name: Underground
Tank Status: Closed - Removed
Tank Model: Not reported
Pipe Model: Not reported
Active Status: Inactive
Install Date: 06/01/60
Capacity Gallons: 550
Material Name: Gasoline
Percentage: 100.00
Tank Type Name: Steel/Carbon Steel/Iron
Tank Internal Protection: None
Tank Internal Protection 1: None
Tank Internal Protection 2: Not reported
Pipe Location Name: No Piping
Pipe Type Name: Galvanized Steel
Pipe External Protection 1: None
Pipe External Protection 2: Not reported
Tank Secondary Containment 1: Vault (w/o access)
Tank Secondary Containment 2: Not reported

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s) EDR ID Number
EPA ID Number

GETTY #340 (Continued)

U004062863

Pipe Secondary Containment: Not reported
Tank Leak Detection 1: None
Tank Leak Detection 2: Not reported
Pipe Leak Detection 1: Not reported
Pipe Leak Detection 2: Not reported
Type Of Overfill Prevention 1: None
Type Of Overfill Prevention 2: Not reported
Dispenser Method: Suction
Spill Prevention: Not reported
Tightness Test Method: VacuTest
Date Tested: 11/01/94
Next Test Date: / /
Date Tank Closed: 05/01/95

Tank Number: 003
Tank Location Name: Underground
Tank Status: Closed - Removed
Tank Model: Not reported
Pipe Model: Not reported
Active Status: Inactive
Install Date: 06/01/60
Capacity Gallons: 550
Material Name: Gasoline
Percentage: 100.00
Tank Type Name: Steel/Carbon Steel/Iron
Tank Internal Protection: None
Tank Internal Protection 1: None
Tank Internal Protection 2: Not reported
Pipe Location Name: No Piping
Pipe Type Name: Galvanized Steel
Pipe External Protection 1: None
Pipe External Protection 2: Not reported
Tank Secondary Containment 1: Vault (w/o access)
Tank Secondary Containment 2: Not reported
Pipe Secondary Containment: Not reported
Tank Leak Detection 1: None
Tank Leak Detection 2: Not reported
Pipe Leak Detection 1: Not reported
Pipe Leak Detection 2: Not reported
Type Of Overfill Prevention 1: None
Type Of Overfill Prevention 2: Not reported
Dispenser Method: Suction
Spill Prevention: Not reported
Tightness Test Method: VacuTest
Date Tested: 11/01/94
Next Test Date: / /
Date Tank Closed: 05/01/95

Tank Number: 004
Tank Location Name: Underground
Tank Status: Closed - Removed
Tank Model: Not reported
Pipe Model: Not reported
Active Status: Inactive
Install Date: 06/01/60

Map ID
 Direction
 Distance
 Distance (ft.)
 Elevation Site

MAP FINDINGS

Database(s) EDR ID Number
 EPA ID Number

GETTY #340 (Continued)

U004062863

Capacity Gallons: 550
 Material Name: Gasoline
 Percentage: 100.00
 Tank Type Name: Steel/Carbon Steel/Iron
 Tank Internal Protection: None
 Tank Internal Protection 1: None
 Tank Internal Protection 2: Not reported
 Pipe Location Name: No Piping
 Pipe Type Name: Galvanized Steel
 Pipe External Protection 1: None
 Pipe External Protection 2: Not reported
 Tank Secondary Containment 1: Vault (w/o access)
 Tank Secondary Containment 2: Not reported
 Pipe Secondary Containment: Not reported
 Tank Leak Detection 1: None
 Tank Leak Detection 2: Not reported
 Pipe Leak Detection 1: Not reported
 Pipe Leak Detection 2: Not reported
 Type Of Overfill Prevention 1: None
 Type Of Overfill Prevention 2: Not reported
 Dispenser Method: Suction
 Spill Prevention: Not reported
 Tightness Test Method: VacuTest
 Date Tested: 11/01/94
 Next Test Date: / /
 Date Tank Closed: 05/01/95

Tank Number: 005
 Tank Location Name: Underground
 Tank Status: Closed - Removed
 Tank Model: Not reported
 Pipe Model: Not reported
 Active Status: Inactive
 Install Date: 06/01/60
 Capacity Gallons: 550
 Material Name: Gasoline
 Percentage: 100.00
 Tank Type Name: Steel/Carbon Steel/Iron
 Tank Internal Protection: None
 Tank Internal Protection 1: None
 Tank Internal Protection 2: Not reported
 Pipe Location Name: No Piping
 Pipe Type Name: Galvanized Steel
 Pipe External Protection 1: None
 Pipe External Protection 2: Not reported
 Tank Secondary Containment 1: Vault (w/o access)
 Tank Secondary Containment 2: Not reported
 Pipe Secondary Containment: Not reported
 Tank Leak Detection 1: None
 Tank Leak Detection 2: Not reported
 Pipe Leak Detection 1: Not reported
 Pipe Leak Detection 2: Not reported
 Type Of Overfill Prevention 1: None
 Type Of Overfill Prevention 2: Not reported
 Dispenser Method: Suction
 Spill Prevention: Not reported

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s)
EDR ID Number
EPA ID Number

GETTY #340 (Continued)

U004062863

Tightness Test Method: VacuTest
Date Tested: 11/01/94
Next Test Date: / /
Date Tank Closed: 05/01/95

Tank Number: 006
Tank Location Name: Underground
Tank Status: Closed - Removed
Tank Model: Not reported
Pipe Model: Not reported
Active Status: Inactive
Install Date: 06/01/60
Capacity Gallons: 550
Material Name: Gasoline
Percentage: 100.00
Tank Type Name: Steel/Carbon Steel/Iron
Tank Internal Protection: None
Tank Internal Protection 1: None
Tank Internal Protection 2: Not reported
Pipe Location Name: No Piping
Pipe Type Name: Galvanized Steel
Pipe External Protection 1: None
Pipe External Protection 2: Not reported
Tank Secondary Containment 1: Vault (w/o access)
Tank Secondary Containment 2: Not reported
Pipe Secondary Containment: Not reported
Tank Leak Detection 1: None
Tank Leak Detection 2: Not reported
Pipe Leak Detection 1: Not reported
Pipe Leak Detection 2: Not reported
Type Of Overfill Prevention 1: None
Type Of Overfill Prevention 2: Not reported
Dispenser Method: Suction
Spill Prevention: Not reported
Tightness Test Method: VacuTest
Date Tested: 11/01/94
Next Test Date: / /
Date Tank Closed: 05/01/95

Tank Number: 007
Tank Location Name: Underground
Tank Status: Closed - Removed
Tank Model: Not reported
Pipe Model: Not reported
Active Status: Inactive
Install Date: 06/01/60
Capacity Gallons: 550
Material Name: Gasoline
Percentage: 100.00
Tank Type Name: Steel/Carbon Steel/Iron
Tank Internal Protection: None
Tank Internal Protection 1: None
Tank Internal Protection 2: Not reported
Pipe Location Name: No Piping
Pipe Type Name: Galvanized Steel

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s)
EDR ID Number
EPA ID Number

GETTY #340 (Continued)

U004062863

Pipe External Protection 1: None
Pipe External Protection 2: Not reported
Tank Secondary Containment 1: Vault (w/o access)
Tank Secondary Containment 2: Not reported
Pipe Secondary Containment: Not reported
Tank Leak Detection 1: None
Tank Leak Detection 2: Not reported
Pipe Leak Detection 1: Not reported
Pipe Leak Detection 2: Not reported
Type Of Overfill Prevention 1: None
Type Of Overfill Prevention 2: Not reported
Dispenser Method: Suction
Spill Prevention: Not reported
Tightness Test Method: VacuTest
Date Tested: 11/01/94
Next Test Date: / /
Date Tank Closed: 05/01/95

Tank Number: 008
Tank Location Name: Underground
Tank Status: Closed - Removed
Tank Model: Not reported
Pipe Model: Not reported
Active Status: Inactive
Install Date: 06/01/60
Capacity Gallons: 550
Material Name: Gasoline
Percentage: 100.00
Tank Type Name: Steel/Carbon Steel/Iron
Tank Internal Protection: None
Tank Internal Protection 1: None
Tank Internal Protection 2: Not reported
Pipe Location Name: No Piping
Pipe Type Name: Galvanized Steel
Pipe External Protection 1: None
Pipe External Protection 2: Not reported
Tank Secondary Containment 1: Vault (w/o access)
Tank Secondary Containment 2: Not reported
Pipe Secondary Containment: Not reported
Tank Leak Detection 1: None
Tank Leak Detection 2: Not reported
Pipe Leak Detection 1: Not reported
Pipe Leak Detection 2: Not reported
Type Of Overfill Prevention 1: None
Type Of Overfill Prevention 2: Not reported
Dispenser Method: Suction
Spill Prevention: Not reported
Tightness Test Method: VacuTest
Date Tested: 11/01/94
Next Test Date: / /
Date Tank Closed: 05/01/95

Tank Number: 009
Tank Location Name: Underground
Tank Status: Closed - Removed

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s)
EDR ID Number
EPA ID Number

GETTY #340 (Continued)

U004062863

Tank Model: Not reported
Pipe Model: Not reported
Active Status: Inactive
Install Date: 06/01/60
Capacity Gallons: 550
Material Name: Gasoline
Percentage: 100.00
Tank Type Name: Steel/Carbon Steel/Iron
Tank Internal Protection: None
Tank Internal Protection 1: None
Tank Internal Protection 2: Not reported
Pipe Location Name: No Piping
Pipe Type Name: Galvanized Steel
Pipe External Protection 1: None
Pipe External Protection 2: Not reported
Tank Secondary Containment 1: Vault (w/o access)
Tank Secondary Containment 2: Not reported
Pipe Secondary Containment: Not reported
Tank Leak Detection 1: None
Tank Leak Detection 2: Not reported
Pipe Leak Detection 1: Not reported
Pipe Leak Detection 2: Not reported
Type Of Overfill Prevention 1: None
Type Of Overfill Prevention 2: Not reported
Dispenser Method: Suction
Spill Prevention: Not reported
Tightness Test Method: VacuTest
Date Tested: 11/01/94
Next Test Date: / /
Date Tank Closed: 05/01/95

Tank Number: 010
Tank Location Name: Underground
Tank Status: Closed - Removed
Tank Model: Not reported
Pipe Model: Not reported
Active Status: Inactive
Install Date: 06/01/60
Capacity Gallons: 550
Material Name: Gasoline
Percentage: 100.00
Tank Type Name: Steel/Carbon Steel/Iron
Tank Internal Protection: None
Tank Internal Protection 1: None
Tank Internal Protection 2: Not reported
Pipe Location Name: No Piping
Pipe Type Name: Galvanized Steel
Pipe External Protection 1: None
Pipe External Protection 2: Not reported
Tank Secondary Containment 1: Vault (w/o access)
Tank Secondary Containment 2: Not reported
Pipe Secondary Containment: Not reported
Tank Leak Detection 1: None
Tank Leak Detection 2: Not reported
Pipe Leak Detection 1: Not reported
Pipe Leak Detection 2: Not reported

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s) EDR ID Number
EPA ID Number

GETTY #340 (Continued)

U004062863

Type Of Overfill Prevention 1: None
Type Of Overfill Prevention 2: Not reported
Dispenser Method: Suction
Spill Prevention: Not reported
Tightness Test Method: VacuTest
Date Tested: 11/01/94
Next Test Date: / /
Date Tank Closed: 05/01/95

Tank Number: 011
Tank Location Name: Underground
Tank Status: Closed - Removed
Tank Model: Not reported
Pipe Model: Not reported
Active Status: Inactive
Install Date: 06/01/60
Capacity Gallons: 550
Material Name: Gasoline
Percentage: 100.00
Tank Type Name: Steel/Carbon Steel/Iron
Tank Internal Protection: None
Tank Internal Protection 1: None
Tank Internal Protection 2: Not reported
Pipe Location Name: No Piping
Pipe Type Name: Galvanized Steel
Pipe External Protection 1: None
Pipe External Protection 2: Not reported
Tank Secondary Containment 1: Vault (w/o access)
Tank Secondary Containment 2: Not reported
Pipe Secondary Containment: Not reported
Tank Leak Detection 1: None
Tank Leak Detection 2: Not reported
Pipe Leak Detection 1: Not reported
Pipe Leak Detection 2: Not reported
Type Of Overfill Prevention 1: None
Type Of Overfill Prevention 2: Not reported
Dispenser Method: Suction
Spill Prevention: Not reported
Tightness Test Method: VacuTest
Date Tested: 11/01/94
Next Test Date: / /
Date Tank Closed: 05/01/95

Tank Number: 012
Tank Location Name: Underground
Tank Status: Closed - Removed
Tank Model: Not reported
Pipe Model: Not reported
Active Status: Inactive
Install Date: 06/01/60
Capacity Gallons: 550
Material Name: Gasoline
Percentage: 100.00
Tank Type Name: Steel/Carbon Steel/Iron
Tank Internal Protection: None

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s)
EDR ID Number
EPA ID Number

GETTY #340 (Continued)

U004062863

Tank Internal Protection 1:	None
Tank Internal Protection 2:	Not reported
Pipe Location Name:	No Piping
Pipe Type Name:	Galvanized Steel
Pipe External Protection 1:	None
Pipe External Protection 2:	Not reported
Tank Secondary Containment 1:	Vault (w/o access)
Tank Secondary Containment 2:	Not reported
Pipe Secondary Containment:	Not reported
Tank Leak Detection 1:	None
Tank Leak Detection 2:	Not reported
Pipe Leak Detection 1:	Not reported
Pipe Leak Detection 2:	Not reported
Type Of Overfill Prevention 1:	None
Type Of Overfill Prevention 2:	Not reported
Dispenser Method:	Suction
Spill Prevention:	Not reported
Tightness Test Method:	VacuTest
Date Tested:	11/01/94
Next Test Date:	/ /
Date Tank Closed:	05/01/95
Tank Number:	013
Tank Location Name:	Underground
Tank Status:	Closed - Removed
Tank Model:	Not reported
Pipe Model:	Not reported
Active Status:	Inactive
Install Date:	06/01/60
Capacity Gallons:	550
Material Name:	Gasoline
Percentage:	100.00
Tank Type Name:	Steel/Carbon Steel/Iron
Tank Internal Protection:	None
Tank Internal Protection 1:	None
Tank Internal Protection 2:	Not reported
Pipe Location Name:	No Piping
Pipe Type Name:	Galvanized Steel
Pipe External Protection 1:	None
Pipe External Protection 2:	Not reported
Tank Secondary Containment 1:	Vault (w/o access)
Tank Secondary Containment 2:	Not reported
Pipe Secondary Containment:	Not reported
Tank Leak Detection 1:	None
Tank Leak Detection 2:	Not reported
Pipe Leak Detection 1:	Not reported
Pipe Leak Detection 2:	Not reported
Type Of Overfill Prevention 1:	None
Type Of Overfill Prevention 2:	Not reported
Dispenser Method:	Suction
Spill Prevention:	Not reported
Tightness Test Method:	VacuTest
Date Tested:	11/01/94
Next Test Date:	/ /
Date Tank Closed:	05/01/95

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s)
EDR ID Number
EPA ID Number

GETTY #340 (Continued)

U004062863

Tank Number: 020
Tank Location Name: Underground
Tank Status: In Service
Tank Model: Not reported
Pipe Model: Not reported
Active Status: Active
Install Date: 10/01/95
Capacity Gallons: 4000
Material Name: Gasoline
Percentage: 100.00
Tank Type Name: Fiberglass Reinforced Plastic (FRP)
Tank Internal Protection: None
Tank Internal Protection 1: Fiberglass
Tank Internal Protection 2: Not reported
Pipe Location Name: Underground/On-ground
Pipe Type Name: Fiberglass Reinforced Plastic (FRP)
Pipe External Protection 1: Fiberglass
Pipe External Protection 2: Not reported
Tank Secondary Containment 1: Double-Walled (Underground)
Tank Secondary Containment 2: Not reported
Pipe Secondary Containment: Double-Walled (Underground)
Tank Leak Detection 1: Interstitial - Electronic Monitoring
Tank Leak Detection 2: Other
Pipe Leak Detection 1: Pressurized Piping Leak Detector
Pipe Leak Detection 2: Tank Top Sump
Type Of Overfill Prevention 1: Float Vent Valve
Type Of Overfill Prevention 2: High Level Alarm
Dispenser Method: Submersible
Spill Prevention: Catch Basin
Tightness Test Method: Horner EYZ3/EYZ3 Locator Plus
Date Tested: 11/03/04
Next Test Date: / /
Date Tank Closed: / /

Tank Number: 021
Tank Location Name: Underground
Tank Status: In Service
Tank Model: Not reported
Pipe Model: Not reported
Active Status: Active
Install Date: 10/01/95
Capacity Gallons: 4000
Material Name: Gasoline
Percentage: 100.00
Tank Type Name: Fiberglass Reinforced Plastic (FRP)
Tank Internal Protection: None
Tank Internal Protection 1: Fiberglass
Tank Internal Protection 2: Not reported
Pipe Location Name: Underground/On-ground
Pipe Type Name: Fiberglass Reinforced Plastic (FRP)
Pipe External Protection 1: Fiberglass
Pipe External Protection 2: Not reported
Tank Secondary Containment 1: Double-Walled (Underground)
Tank Secondary Containment 2: Not reported
Pipe Secondary Containment: Double-Walled (Underground)
Tank Leak Detection 1: Interstitial - Electronic Monitoring

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s)
EDR ID Number
EPA ID Number

GETTY #340 (Continued)

U004062863

Tank Leak Detection 2: Other
Pipe Leak Detection 1: Pressurized Piping Leak Detector
Pipe Leak Detection 2: Tank Top Sump
Type Of Overfill Prevention 1: Float Vent Valve
Type Of Overfill Prevention 2: High Level Alarm
Dispenser Method: Submersible
Spill Prevention: Catch Basin
Tightness Test Method: Horner EYZ3/EYZ3 Locator Plus
Date Tested: 11/03/04
Next Test Date: / /
Date Tank Closed: / /

Tank Number: 022
Tank Location Name: Underground
Tank Status: In Service
Tank Model: Not reported
Pipe Model: Not reported
Active Status: Active
Install Date: 10/01/95
Capacity Gallons: 4000
Material Name: Gasoline
Percentage: 100.00
Tank Type Name: Fiberglass Reinforced Plastic (FRP)
Tank Internal Protection: None
Tank Internal Protection 1: Fiberglass
Tank Internal Protection 2: Not reported
Pipe Location Name: Underground/On-ground
Pipe Type Name: Fiberglass Reinforced Plastic (FRP)
Pipe External Protection 1: Fiberglass
Pipe External Protection 2: Not reported
Tank Secondary Containment 1: Double-Walled (Underground)
Tank Secondary Containment 2: Not reported
Pipe Secondary Containment: Double-Walled (Underground)
Tank Leak Detection 1: Interstitial - Electronic Monitoring
Tank Leak Detection 2: Other
Pipe Leak Detection 1: Pressurized Piping Leak Detector
Pipe Leak Detection 2: Tank Top Sump
Type Of Overfill Prevention 1: Float Vent Valve
Type Of Overfill Prevention 2: High Level Alarm
Dispenser Method: Submersible
Spill Prevention: Catch Basin
Tightness Test Method: Horner EYZ3/EYZ3 Locator Plus
Date Tested: 11/03/04
Next Test Date: / /
Date Tank Closed: / /

Tank Number: 025
Tank Location Name: Underground
Tank Status: In Service
Tank Model: Not reported
Pipe Model: Not reported
Active Status: Active
Install Date: 10/01/95
Capacity Gallons: 4000
Material Name: Gasoline

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s)
EDR ID Number
EPA ID Number

GETTY #340 (Continued)

U004062863

Percentage: 100.00
Tank Type Name: Fiberglass Reinforced Plastic (FRP)
Tank Internal Protection: None
Tank Internal Protection 1: Fiberglass
Tank Internal Protection 2: Not reported
Pipe Location Name: Underground/On-ground
Pipe Type Name: Fiberglass Reinforced Plastic (FRP)
Pipe External Protection 1: Fiberglass
Pipe External Protection 2: Not reported
Tank Secondary Containment 1: Double-Walled (Underground)
Tank Secondary Containment 2: Not reported
Pipe Secondary Containment: Double-Walled (Underground)
Tank Leak Detection 1: Interstitial - Electronic Monitoring
Tank Leak Detection 2: Other
Pipe Leak Detection 1: Pressurized Piping Leak Detector
Pipe Leak Detection 2: Tank Top Sump
Type Of Overfill Prevention 1: Float Vent Valve
Type Of Overfill Prevention 2: High Level Alarm
Dispenser Method: Submersible
Spill Prevention: Catch Basin
Tightness Test Method: Horner EZY3/EZY3 Locator Plus
Date Tested: 11/03/04
Next Test Date: / /
Date Tank Closed: / /

Tank Number: 026
Tank Location Name: Underground, vaulted, with access
Tank Status: Closed - In Place
Tank Model: Not reported
Pipe Model: Not reported
Active Status: Inactive
Install Date: / /
Capacity Gallons: 550
Material Name: Empty
Percentage: 100.00
Tank Type Name: Steel/Carbon Steel/Iron
Tank Internal Protection: None
Tank Internal Protection 1: None
Tank Internal Protection 2: Not reported
Pipe Location Name: Underground/On-ground
Pipe Type Name: Steel/Carbon Steel/Iron
Pipe External Protection 1: None
Pipe External Protection 2: Not reported
Tank Secondary Containment 1: None
Tank Secondary Containment 2: Not reported
Pipe Secondary Containment: Not reported
Tank Leak Detection 1: None
Tank Leak Detection 2: Not reported
Pipe Leak Detection 1: Not reported
Pipe Leak Detection 2: Not reported
Type Of Overfill Prevention 1: None
Type Of Overfill Prevention 2: Not reported
Dispenser Method: Not reported
Spill Prevention: Not reported
Tightness Test Method: Testing Not Required
Date Tested: / /

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

GETTY #340 (Continued)

EDR ID Number
EPA ID Number

Database(s)

U004062863

Next Test Date: / /
Date Tank Closed: 11/01/01

Tank Number: 028
Tank Location Name: Underground
Tank Status: Closed - Removed
Tank Model: Not reported
Pipe Model: Not reported
Active Status: Inactive
Install Date: 10/01/96
Capacity Gallons: 550
Material Name: Waste Oil/Used Oil
Percentage: 100.00
Tank Type Name: Steel/Carbon Steel/Iron
Tank Internal Protection: None
Tank Internal Protection 1: Painted/Asphalt Coating
Tank Internal Protection 2: Not reported
Pipe Location Name: No Piping
Pipe Type Name: No Piping
Pipe External Protection 1: None
Pipe External Protection 2: Not reported
Tank Secondary Containment 1: Vault (w/o access)
Tank Secondary Containment 2: Not reported
Pipe Secondary Containment: Not reported
Tank Leak Detection 1: Other
Tank Leak Detection 2: Not reported
Pipe Leak Detection 1: Not reported
Pipe Leak Detection 2: Not reported
Type Of Overfill Prevention 1: Product Level Gauge (A/G)
Type Of Overfill Prevention 2: Not reported
Dispenser Method: None
Spill Prevention: None
Tightness Test Method: Testing Not Required
Date Tested: / /
Next Test Date: / /
Date Tank Closed: 04/01/04

D11
SSE
< 1/8
266 ft.

GETTY #340
89 SAINT NICHOLAS PLACE
NEW YORK, NY 10032

AST U003074487
HIST UST N/A

Site 2 of 2 in cluster D

Relative:
Lower

AST:

Actual:
106 ft.

AST:

Region: STATE
Facility Id: 2-291935
UTM X: 589376.39399
UTM Y: 4520445.33776
Expiration Date: 05/24/09
Renewal Date: / /
Total Capacity: 16760
Facility Type: Not reported
Site Type Name: Retail Gasoline Sales
Site Type Status: Active
Mailing Company: GETTY PETROLEUM MAKETING INC.

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s)
EDR ID Number
EPA ID Number

GETTY #340 (Continued)

U003074487

Mailing Title: ENV. COMP. MGR
Mailing Contact: SCOTT J. HANLEY
Mailing Address: 1500 HEMPSTEAD TURNPIKE
Mailing Address 2: Not reported
Mailing City: EAST MEADOW
Mailing State: NY
Mailing Zip Code: 11554
Mailing Phone No: (516) 542-4900
Mailing Email: Not reported
Owner Title: Not reported
Owner Name: Not reported
Owner Address: 1500 HEMPSTEAD TURNPIKE
Owner Address 2: Not reported
Owner State: NY
Owner Zip Code: 11554
Owner Phone: (516) 542-4900
Owner Company: GETTY PETROLEUM MAKETING INC.
Emergency Contact: SCOTT HANLEY
Emergency Phone: (718) 324-5110
Operator: 89-91 ST NICHLAS S/S INC.
Operator Phone: (212) 694-0240
Owner City: EAST MEADOW
Owner Sub Type: Corporate or Commercial
Program Type: PBS

Tank Number: 023
Tank Location Name: Aboveground on crib, rack, or cradle
Tank Status: Closed - Removed
Tank Model: Not reported
Pipe Model: Not reported
Active Status: Inactive
Install Date: 06/01/96
Capacity Gallons: 240
Material Name: #2 Fuel Oil
Percentage: 100.00
Tank Type Name: Steel/Carbon Steel/Iron
Tank Internal Protection: None
Tank Internal Protection 1: Painted/Asphalt Coating
Tank Internal Protection 2: Jacketed
Pipe Location Name: Aboveground
Pipe Type Name: Copper
Pipe External Protection 1: None
Pipe External Protection 2: Not reported
Tank Secondary Containment 1: Double-Walled (Underground)
Tank Secondary Containment 2: Not reported
Pipe Secondary Containment: Not reported
Tank Leak Detection 1: In-Tank System (ATG)
Tank Leak Detection 2: Not reported
Pipe Leak Detection 1: Not reported
Pipe Leak Detection 2: Not reported
Type Of Overfill Prevention 1: Float Vent Valve
Type Of Overfill Prevention 2: Not reported
Dispenser Method: Suction
Spill Prevention: Catch Basin
Tightness Test Method: Testing Not Required
Date Tested: / /
Next Test Date: / /

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s)
EDR ID Number
EPA ID Number

GETTY #340 (Continued)

U003074487

Date Tank Closed: 06/01/96

Tank Number: 024
Tank Location Name: Aboveground on crib, rack, or cradle
Tank Status: Closed - Removed
Tank Model: Not reported
Pipe Model: Not reported
Active Status: Inactive
Install Date: 05/01/95
Capacity Gallons: 180
Material Name: #2 Fuel Oil
Percentage: 100.00
Tank Type Name: Steel/Carbon Steel/Iron
Tank Internal Protection: None
Tank Internal Protection 1: Painted/Asphalt Coating
Tank Internal Protection 2: Not reported
Pipe Location Name: Aboveground
Pipe Type Name: Copper
Pipe External Protection 1: None
Pipe External Protection 2: Not reported
Tank Secondary Containment 1: Vault (w/o access)
Tank Secondary Containment 2: Not reported
Pipe Secondary Containment: Not reported
Tank Leak Detection 1: Interstitial - Electronic Monitoring
Tank Leak Detection 2: Other
Pipe Leak Detection 1: Exempt Suction Piping
Pipe Leak Detection 2: Not reported
Type Of Overfill Prevention 1: Product Level Gauge (A/G)
Type Of Overfill Prevention 2: Vent Whistle
Dispenser Method: Suction
Spill Prevention: Not reported
Tightness Test Method: Testing Not Required
Date Tested: / /
Next Test Date: / /
Date Tank Closed: 04/01/04

Tank Number: 024-A
Tank Location Name: Aboveground on crib, rack, or cradle
Tank Status: Closed - Removed
Tank Model: Not reported
Pipe Model: Not reported
Active Status: Inactive
Install Date: 06/01/96
Capacity Gallons: 180
Material Name: Waste Oil/Used Oil
Percentage: 100.00
Tank Type Name: Steel/Carbon Steel/Iron
Tank Internal Protection: None
Tank Internal Protection 1: Painted/Asphalt Coating
Tank Internal Protection 2: Jacketed
Pipe Location Name: No Piping
Pipe Type Name: No Piping
Pipe External Protection 1: None
Pipe External Protection 2: Not reported
Tank Secondary Containment 1: Double-Walled (Underground)

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s)
EDR ID Number
EPA ID Number

GETTY #340 (Continued)

U003074487

Tank Secondary Containment 2: Not reported
Pipe Secondary Containment: Not reported
Tank Leak Detection 1: In-Tank System (ATG)
Tank Leak Detection 2: Not reported
Pipe Leak Detection 1: Not reported
Pipe Leak Detection 2: Not reported
Type Of Overfill Prevention 1: Float Vent Valve
Type Of Overfill Prevention 2: Not reported
Dispenser Method: Gravity
Spill Prevention: Catch Basin
Tightness Test Method: Testing Not Required
Date Tested: / /
Next Test Date: / /
Date Tank Closed: 06/01/96

Tank Number: 027
Tank Location Name: Aboveground - in contact with impervious barrier
Tank Status: In Service
Tank Model: Not reported
Pipe Model: Not reported
Active Status: Active
Install Date: 10/01/95
Capacity Gallons: 280
Material Name: Lube Oil
Percentage: 100.00
Tank Type Name: Steel/Carbon Steel/Iron
Tank Internal Protection: None
Tank Internal Protection 1: Painted/Asphalt Coating
Tank Internal Protection 2: Not reported
Pipe Location Name: No Piping
Pipe Type Name: No Piping
Pipe External Protection 1: None
Pipe External Protection 2: Not reported
Tank Secondary Containment 1: Modified Double-Walled (Aboveground)
Tank Secondary Containment 2: Not reported
Pipe Secondary Containment: None
Tank Leak Detection 1: Interstitial - Manual Monitoring
Tank Leak Detection 2: Not reported
Pipe Leak Detection 1: None
Pipe Leak Detection 2: Not reported
Type Of Overfill Prevention 1: Product Level Gauge (A/G)
Type Of Overfill Prevention 2: Not reported
Dispenser Method: None
Spill Prevention: Catch Basin
Tightness Test Method: Testing Not Required
Date Tested: / /
Next Test Date: / /
Date Tank Closed: / /

Tank Number: 029
Tank Location Name: Aboveground - in contact with impervious barrier
Tank Status: In Service
Tank Model: Not reported
Pipe Model: Not reported
Active Status: Active

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s)
EDR ID Number
EPA ID Number

GETTY #340 (Continued)

U003074487

Install Date:	04/01/04
Capacity Gallons:	240
Material Name:	#2 Fuel Oil
Percentage:	100.00
Tank Type Name:	Steel/Carbon Steel/Iron
Tank Internal Protection:	None
Tank Internal Protection 1:	Painted/Asphalt Coating
Tank Internal Protection 2:	Not reported
Pipe Location Name:	Aboveground
Pipe Type Name:	Copper
Pipe External Protection 1:	None
Pipe External Protection 2:	Not reported
Tank Secondary Containment 1:	Modified Double-Walled (Aboveground)
Tank Secondary Containment 2:	Not reported
Pipe Secondary Containment:	None
Tank Leak Detection 1:	Interstitial - Manual Monitoring
Tank Leak Detection 2:	Not reported
Pipe Leak Detection 1:	None
Pipe Leak Detection 2:	Not reported
Type Of Overfill Prevention 1:	Product Level Gauge (A/G)
Type Of Overfill Prevention 2:	Not reported
Dispenser Method:	Suction
Spill Prevention:	Catch Basin
Tightness Test Method:	Testing Not Required
Date Tested:	/ /
Next Test Date:	/ /
Date Tank Closed:	/ /
Tank Number:	030
Tank Location Name:	Aboveground - in contact with impervious barrier
Tank Status:	In Service
Tank Model:	Not reported
Pipe Model:	Not reported
Active Status:	Active
Install Date:	04/01/04
Capacity Gallons:	240
Material Name:	Waste Oil/Used Oil
Percentage:	100.00
Tank Type Name:	Steel/Carbon Steel/Iron
Tank Internal Protection:	None
Tank Internal Protection 1:	Painted/Asphalt Coating
Tank Internal Protection 2:	Not reported
Pipe Location Name:	No Piping
Pipe Type Name:	No Piping
Pipe External Protection 1:	None
Pipe External Protection 2:	Not reported
Tank Secondary Containment 1:	Impervious Underlayment
Tank Secondary Containment 2:	Not reported
Pipe Secondary Containment:	None
Tank Leak Detection 1:	Impervious Barrier/Concrete Pad (A/G)
Tank Leak Detection 2:	Not reported
Pipe Leak Detection 1:	None
Pipe Leak Detection 2:	Not reported
Type Of Overfill Prevention 1:	Product Level Gauge (A/G)
Type Of Overfill Prevention 2:	Not reported
Dispenser Method:	None

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s)
EDR ID Number
EPA ID Number

GETTY #340 (Continued)

U003074487

Spill Prevention: Catch Basin
Tightness Test Method: Testing Not Required
Date Tested: / /
Next Test Date: / /
Date Tank Closed: / /

HIST UST:

PBS Number: 2-291935
SPDES Number: Not reported
Emergency Contact: SCOTT HANLEY
Emergency Telephone: (718) 324-5110
Operator: MIGUEL ROSA
Operator Telephone: (212) 694-0240
Owner Name: GETTY PETROLEUM MARKETING, INC.
Owner Address: 125 JERICHO TURNPIKE
Owner City,St,Zip: JERICHO, NY 11753
Owner Telephone: (516) 338-1276
Owner Type: Corporate/Commercial
Owner Subtype: Not reported
Mailing Name: DELTA ENVIRONMENTAL CONSULTANTS
Mailing Address: % GETTY PROPERTIES CORP.
Mailing Address 2: 125 JERICHO TURNPIKE, STE 202
Mailing City,St,Zip: JERICHO, NY 11753
Mailing Contact: RICHARD SWEDBORG
Mailing Telephone: (516) 478-5436
Owner Mark: Second Owner
Facility Status: 1 - Active PBS facility, i.e. total capacity of the PBS tanks is
 greater than 1,100 gallons, regardless if Subpart 360-14 tanks exist
 or not at the facility.

Facility Addr2: Not reported
SWIS ID: 6201
Old PBS Number: Not reported
Facility Type: RETAIL GASOLINE SALES
Inspected Date: Not reported
Inspector: Not reported
Inspection Result: Not reported
Federal ID: Not reported
Certification Flag: False
Certification Date: 11/24/2000
Expiration Date: 03/23/2004
Renew Flag: False
Renewal Date: Not reported
Total Capacity: 16000
FAMT: True
Facility Screen: No Missing Data
Owner Screen: No Missing Data
Tank Screen: No Missing Data
Dead Letter: False
CBS Number: Not reported
Town or City: NEW YORK CITY
County Code: 62
Town or City: 01
Region: 2

Tank Id: 001
Tank Location: UNDERGROUND
Tank Status: Closed-Removed

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

GETTY #340 (Continued)

EDR ID Number
EPA ID Number

Database(s)

U003074487

Install Date: 19720801
Capacity (gals): 4000
Product Stored: UNLEADED GASOLINE
Tank Type: Steel/carbon steel
Tank Internal: None
Tank External: None
Pipe Location: None
Pipe Type: GALVANIZED STEEL
Pipe Internal: None
Pipe External: None
Second Containment: Diking
Leak Detection: None
Overfill Prot: None
Dispenser: Suction
Date Tested: 11/01/1994
Next Test Date: Not reported
Missing Data for Tank: No Missing Data
Date Closed: 05/01/1995
Test Method: Tankology [Vacutect]
Deleted: False
Updated: True
Lat/long: Not reported

Tank Id: 002
Tank Location: UNDERGROUND
Tank Status: Closed-Removed
Install Date: 19600601
Capacity (gals): 550
Product Stored: UNLEADED GASOLINE
Tank Type: Steel/carbon steel
Tank Internal: None
Tank External: None
Pipe Location: None
Pipe Type: GALVANIZED STEEL
Pipe Internal: None
Pipe External: None
Second Containment: Diking
Leak Detection: None
Overfill Prot: None
Dispenser: Suction
Date Tested: 11/01/1994
Next Test Date: Not reported
Missing Data for Tank: No Missing Data
Date Closed: 05/01/1995
Test Method: Tankology [Vacutect]
Deleted: False
Updated: True
Lat/long: Not reported

Tank Id: 003
Tank Location: UNDERGROUND
Tank Status: Closed-Removed
Install Date: 19600601
Capacity (gals): 550
Product Stored: UNLEADED GASOLINE

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

GETTY #340 (Continued)

EDR ID Number
EPA ID Number

Database(s)

U003074487

Tank Type: Steel/carbon steel
Tank Internal: None
Tank External: None
Pipe Location: None
Pipe Type: GALVANIZED STEEL
Pipe Internal: None
Pipe External: None
Second Containment: Diking
Leak Detection: None
Overfill Prot: None
Dispenser: Suction
Date Tested: 11/01/1994
Next Test Date: Not reported
Missing Data for Tank: No Missing Data
Date Closed: 05/01/1995
Test Method: Tankology [Vacutect]
Deleted: False
Updated: True
Lat/long: Not reported

Tank Id: 004
Tank Location: UNDERGROUND
Tank Status: Closed-Removed
Install Date: 19600601
Capacity (gals): 550
Product Stored: UNLEADED GASOLINE
Tank Type: Steel/carbon steel
Tank Internal: None
Tank External: None
Pipe Location: None
Pipe Type: GALVANIZED STEEL
Pipe Internal: None
Pipe External: None
Second Containment: Diking
Leak Detection: None
Overfill Prot: None
Dispenser: Suction
Date Tested: 11/01/1994
Next Test Date: Not reported
Missing Data for Tank: No Missing Data
Date Closed: 05/01/1995
Test Method: Tankology [Vacutect]
Deleted: False
Updated: True
Lat/long: Not reported

Tank Id: 005
Tank Location: UNDERGROUND
Tank Status: Closed-Removed
Install Date: 19600601
Capacity (gals): 550
Product Stored: UNLEADED GASOLINE
Tank Type: Steel/carbon steel
Tank Internal: None
Tank External: None

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s)
EDR ID Number
EPA ID Number

GETTY #340 (Continued)

U003074487

Pipe Location: None
Pipe Type: GALVANIZED STEEL
Pipe Internal: None
Pipe External: None
Second Containment: Diking
Leak Detection: None
Overfill Prot: None
Dispenser: Suction
Date Tested: 11/01/1994
Next Test Date: Not reported
Missing Data for Tank: No Missing Data
Date Closed: 05/01/1995
Test Method: Tankology [Vacutect]
Deleted: False
Updated: True
Lat/long: Not reported

Tank Id: 006
Tank Location: UNDERGROUND
Tank Status: Closed-Removed
Install Date: 19600601
Capacity (gals): 550
Product Stored: UNLEADED GASOLINE
Tank Type: Steel/carbon steel
Tank Internal: None
Tank External: None
Pipe Location: None
Pipe Type: GALVANIZED STEEL
Pipe Internal: None
Pipe External: None
Second Containment: Diking
Leak Detection: None
Overfill Prot: None
Dispenser: Suction
Date Tested: 11/01/1994
Next Test Date: Not reported
Missing Data for Tank: No Missing Data
Date Closed: 05/01/1995
Test Method: Tankology [Vacutect]
Deleted: False
Updated: True
Lat/long: Not reported

Tank Id: 007
Tank Location: UNDERGROUND
Tank Status: Closed-Removed
Install Date: 19600601
Capacity (gals): 550
Product Stored: UNLEADED GASOLINE
Tank Type: Steel/carbon steel
Tank Internal: None
Tank External: None
Pipe Location: None
Pipe Type: GALVANIZED STEEL
Pipe Internal: None

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

GETTY #340 (Continued)

EDR ID Number
EPA ID Number

Database(s)

U003074487

Pipe External: None
Second Containment: Diking
Leak Detection: None
Overfill Prot: None
Dispenser: Suction
Date Tested: 11/01/1994
Next Test Date: Not reported
Missing Data for Tank: No Missing Data
Date Closed: 05/01/1995
Test Method: Tankology [Vacutect]
Deleted: False
Updated: True
Lat/long: Not reported

Tank Id: 008
Tank Location: UNDERGROUND
Tank Status: Closed-Removed
Install Date: 19600601
Capacity (gals): 550
Product Stored: UNLEADED GASOLINE
Tank Type: Steel/carbon steel
Tank Internal: None
Tank External: None
Pipe Location: None
Pipe Type: GALVANIZED STEEL
Pipe Internal: None
Pipe External: None
Second Containment: Diking
Leak Detection: None
Overfill Prot: None
Dispenser: Suction
Date Tested: 11/01/1994
Next Test Date: Not reported
Missing Data for Tank: No Missing Data
Date Closed: 05/01/1995
Test Method: Tankology [Vacutect]
Deleted: False
Updated: True
Lat/long: Not reported

Tank Id: 009
Tank Location: UNDERGROUND
Tank Status: Closed-Removed
Install Date: 19600601
Capacity (gals): 550
Product Stored: UNLEADED GASOLINE
Tank Type: Steel/carbon steel
Tank Internal: None
Tank External: None
Pipe Location: None
Pipe Type: GALVANIZED STEEL
Pipe Internal: None
Pipe External: None
Second Containment: Diking
Leak Detection: None

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

GETTY #340 (Continued)

EDR ID Number
EPA ID Number

Database(s)

U003074487

Overfill Prot: None
Dispenser: Suction
Date Tested: 11/01/1994
Next Test Date: Not reported
Missing Data for Tank: No Missing Data
Date Closed: 05/01/1995
Test Method: Tankology [Vacutect]
Deleted: False
Updated: True
Lat/long: Not reported

Tank Id: 010
Tank Location: UNDERGROUND
Tank Status: Closed-Removed
Install Date: 19600601
Capacity (gals): 550
Product Stored: UNLEADED GASOLINE
Tank Type: Steel/carbon steel
Tank Internal: None
Tank External: None
Pipe Location: None
Pipe Type: GALVANIZED STEEL
Pipe Internal: None
Pipe External: None
Second Containment: Diking
Leak Detection: None
Overfill Prot: None
Dispenser: Suction
Date Tested: 11/01/1994
Next Test Date: Not reported
Missing Data for Tank: No Missing Data
Date Closed: 05/01/1995
Test Method: Tankology [Vacutect]
Deleted: False
Updated: True
Lat/long: Not reported

Tank Id: 011
Tank Location: UNDERGROUND
Tank Status: Closed-Removed
Install Date: 19600601
Capacity (gals): 550
Product Stored: UNLEADED GASOLINE
Tank Type: Steel/carbon steel
Tank Internal: None
Tank External: None
Pipe Location: None
Pipe Type: GALVANIZED STEEL
Pipe Internal: None
Pipe External: None
Second Containment: Diking
Leak Detection: None
Overfill Prot: None
Dispenser: Suction
Date Tested: 11/01/1994

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

GETTY #340 (Continued)

EDR ID Number
EPA ID Number

Database(s)

U003074487

Next Test Date: Not reported
Missing Data for Tank: No Missing Data
Date Closed: 05/01/1995
Test Method: Tankology [Vacutect]
Deleted: False
Updated: True
Lat/long: Not reported

Tank Id: 012
Tank Location: UNDERGROUND
Tank Status: Closed-Removed
Install Date: 19600601
Capacity (gals): 550
Product Stored: UNLEADED GASOLINE
Tank Type: Steel/carbon steel
Tank Internal: None
Tank External: None
Pipe Location: None
Pipe Type: GALVANIZED STEEL
Pipe Internal: None
Pipe External: None
Second Containment: Diking
Leak Detection: None
Overfill Prot: None
Dispenser: Suction
Date Tested: 11/01/1994
Next Test Date: Not reported
Missing Data for Tank: No Missing Data
Date Closed: 05/01/1995
Test Method: Tankology [Vacutect]
Deleted: False
Updated: True
Lat/long: Not reported

Tank Id: 013
Tank Location: UNDERGROUND
Tank Status: Closed-Removed
Install Date: 19600601
Capacity (gals): 550
Product Stored: UNLEADED GASOLINE
Tank Type: Steel/carbon steel
Tank Internal: None
Tank External: None
Pipe Location: None
Pipe Type: GALVANIZED STEEL
Pipe Internal: None
Pipe External: None
Second Containment: Diking
Leak Detection: None
Overfill Prot: None
Dispenser: Suction
Date Tested: 11/01/1994
Next Test Date: Not reported
Missing Data for Tank: No Missing Data
Date Closed: 05/01/1995

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

GETTY #340 (Continued)

EDR ID Number
EPA ID Number

Database(s)

U003074487

Test Method: Tankology [Vacutect]
Deleted: False
Updated: True
Lat/long: Not reported

Tank Id: 020
Tank Location: UNDERGROUND
Tank Status: In Service
Install Date: 19960601
Capacity (gals): 4000
Product Stored: UNLEADED GASOLINE
Tank Type: Fiberglass reinforced plastic [FRP]
Tank Internal: Fiberglass Liner (FRP)
Tank External: 45
Pipe Location: Underground
Pipe Type: STAINLESS STEEL ALLOY
Pipe Internal: Fiberglass Liner (FRP)
Pipe External: 45
Second Containment: Vault (w/access)
Leak Detection: 14
Overfill Prot: High Level Alarm, Catch Basin
Dispenser: Submersible
Date Tested: Not reported
Next Test Date: Not reported
Missing Data for Tank: No Missing Data
Date Closed: Not reported
Test Method: Not reported
Deleted: False
Updated: True
Lat/long: Not reported

Tank Id: 021
Tank Location: UNDERGROUND
Tank Status: In Service
Install Date: 19960601
Capacity (gals): 4000
Product Stored: UNLEADED GASOLINE
Tank Type: Fiberglass reinforced plastic [FRP]
Tank Internal: Fiberglass Liner (FRP)
Tank External: 45
Pipe Location: Underground
Pipe Type: STAINLESS STEEL ALLOY
Pipe Internal: Fiberglass Liner (FRP)
Pipe External: 45
Second Containment: Vault (w/access)
Leak Detection: 14
Overfill Prot: High Level Alarm, Catch Basin
Dispenser: Submersible
Date Tested: Not reported
Next Test Date: Not reported
Missing Data for Tank: No Missing Data
Date Closed: Not reported
Test Method: Not reported
Deleted: False
Updated: True

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

GETTY #340 (Continued)

EDR ID Number
EPA ID Number

Database(s)

U003074487

Lat/long: Not reported

Tank Id: 022
Tank Location: UNDERGROUND
Tank Status: In Service
Install Date: 19960601
Capacity (gals): 4000
Product Stored: UNLEADED GASOLINE
Tank Type: Fiberglass reinforced plastic [FRP]
Tank Internal: Fiberglass Liner (FRP)
Tank External: 45
Pipe Location: Underground
Pipe Type: STAINLESS STEEL ALLOY
Pipe Internal: Fiberglass Liner (FRP)
Pipe External: 45
Second Containment: Vault (w/access)
Leak Detection: 14
Overfill Prot: High Level Alarm, Catch Basin
Dispenser: Submersible
Date Tested: Not reported
Next Test Date: Not reported
Missing Data for Tank: No Missing Data
Date Closed: Not reported
Test Method: Not reported
Deleted: False
Updated: True
Lat/long: Not reported

Tank Id: 025
Tank Location: UNDERGROUND
Tank Status: In Service
Install Date: 19960601
Capacity (gals): 4000
Product Stored: UNLEADED GASOLINE
Tank Type: Fiberglass reinforced plastic [FRP]
Tank Internal: Fiberglass Liner (FRP)
Tank External: 45
Pipe Location: Underground
Pipe Type: STAINLESS STEEL ALLOY
Pipe Internal: Fiberglass Liner (FRP)
Pipe External: 45
Second Containment: Vault (w/access)
Leak Detection: 14
Overfill Prot: High Level Alarm, Catch Basin
Dispenser: Submersible
Date Tested: Not reported
Next Test Date: Not reported
Missing Data for Tank: No Missing Data
Date Closed: Not reported
Test Method: Not reported
Deleted: False
Updated: True
Lat/long: Not reported

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

GETTY #340 (Continued)

EDR ID Number
EPA ID Number

U003074487

Tank Id: 026
Tank Location: UNDERGROUND, VAULTED, WITH ACCESS
Tank Status: Closed-In Place
Install Date: Not reported
Capacity (gals): 550
Product Stored: EMPTY
Tank Type: Steel/carbon steel
Tank Internal: None
Tank External: None
Pipe Location: Underground
Pipe Type: STEEL/IRON
Pipe Internal: None
Pipe External: None
Second Containment: None
Leak Detection: None
Overfill Prot: None
Dispenser: 0
Date Tested: Not reported
Next Test Date: Not reported
Missing Data for Tank: No Missing Data
Date Closed: 11/01/2001
Test Method: Not reported
Deleted: False
Updated: True
Lat/long: Not reported

A12
WNW
< 1/8
282 ft.

CONSOLIDATED EDISON
460 W 155TH ST
MANHATTAN, NY

NY MANIFEST 1009244081
N/A

Site 7 of 7 in cluster A

Relative:
Higher

NY MANIFEST:
Document ID: NYE1606383
Manifest Status: Not reported
Trans1 State ID: NYD006982359
Trans2 State ID: Not reported
Generator Ship Date: 11/29/2005
Trans1 Recv Date: 11/29/2005
Trans2 Recv Date: Not reported
TSD Site Recv Date: 12/01/2005
Part A Recv Date: Not reported
Part B Recv Date: Not reported
Generator EPA ID: NYP004138087
Trans1 EPA ID: 12446JT
Trans2 EPA ID: Not reported
TSDF ID: NYD077444263
Waste Code: B007 - OTHER MISCELLANEOUS PCB WASTES
Quantity: 00066
Units: K - Kilograms (2.2 pounds)
Number of Containers: 001
Container Type: DM - Metal drums, barrels
Handling Method: L Landfill.
Specific Gravity: 01.00
Year: Not reported
Manifest Tracking Num: Not reported
Import Ind: Not reported
Export Ind: Not reported

Actual:
136 ft.

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

CONSOLIDATED EDISON (Continued)

EDR ID Number
EPA ID Number

Database(s)

1009244081

Discr Quantity Ind: Not reported
Discr Type Ind: Not reported
Discr Residue Ind: Not reported
Discr Partial Reject Ind: Not reported
Discr Full Reject Ind: Not reported
Manifest Ref Num: Not reported
Alt Fac RCRA Id: Not reported
Alt Fac Sign Date: Not reported
Mgmt Method Type Code: Not reported
EPA ID: NYP004138087
Facility Name: CONSOLIDATED EDISON
Facility Address: 460 W 155TH ST
Facility City: MANHATTAN
Facility Address 2: Not reported
Country: USA
County: NE
Mailing Name: CONSOLIDATED EDISON
Mailing Contact: FRANKLYN MURRAY
Mailing Address: 4 IRVING PL RM 828
Mailing Address 2: Not reported
Mailing City: NEW YORK
Mailing State: NY
Mailing Zip: Not reported
Mailing Zip4: Not reported
Mailing Country: USA
Mailing Phone: 212-460-2808

C13 880 ST NICHOLAS AVE ASSOC
SW 880 ST NICHOLAS AVE
< 1/8 NY, NY 10032
293 ft.

AST U003391131
HIST AST N/A

Site 3 of 4 in cluster C

Relative:
Higher

AST:

Actual:
130 ft.

AST:

Region: STATE
Facility Id: 2-334081
UTM X: 589276.55025
UTM Y: 4520458.67441
Expiration Date: 12/15/08
Renewal Date: 06/04/02
Total Capacity: 5000
Facility Type: Not reported
Site Type Name: Apartment Building/Office Building
Site Type Status: Active
Mailing Company: MAGAW MANAGEMENT LLC
Mailing Title: Not reported
Mailing Contact: ONIX A. SOSA
Mailing Address: PO BOX 187
Mailing Address 2: Not reported
Mailing City: BOGOTA
Mailing State: NJ
Mailing Zip Code: 07603-0187
Mailing Phone No: (347) 983-5000
Mailing Email: MAGAWMGT.COM
Owner Title: GENERAL MANAGER
Owner Name: ONIX A. SOSA

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s)
EDR ID Number
EPA ID Number

880 ST NICHOLAS AVE ASSOC (Continued)

U003391131

Owner Address: PO BOX 187
Owner Address 2: Not reported
Owner State: NJ
Owner Zip Code: 07603-0187
Owner Phone: (347) 983-5000
Owner Company: NORTHWST FRONTIERS PROPERTY LLC
Emergency Contact: ONIX A. SOSA
Emergency Phone: (718) 360-5382
Operator: DIEGO SANTANA
Operator Phone: (646) 667-3151
Owner City: BOGOTA
Owner Sub Type: Corporate or Commercial
Program Type: PBS

Tank Number: 001
Tank Location Name: Aboveground on crib, rack, or cradle
Tank Status: In Service
Tank Model: Not reported
Pipe Model: Not reported
Active Status: Active
Install Date: 01/01/20
Capacity Gallons: 5000
Material Name: #2 Fuel Oil
Percentage: 100.00
Tank Type Name: Steel/Carbon Steel/Iron
Tank Internal Protection: None
Tank Internal Protection 1: None
Tank Internal Protection 2: Not reported
Pipe Location Name: Aboveground
Pipe Type Name: Steel/Carbon Steel/Iron
Pipe External Protection 1: None
Pipe External Protection 2: Not reported
Tank Secondary Containment 1: Vault (w/o access)
Tank Secondary Containment 2: Not reported
Pipe Secondary Containment: Not reported
Tank Leak Detection 1: None
Tank Leak Detection 2: Not reported
Pipe Leak Detection 1: Exempt Suction Piping
Pipe Leak Detection 2: Not reported
Type Of Overfill Prevention 1: Product Level Gauge (A/G)
Type Of Overfill Prevention 2: Not reported
Dispenser Method: Suction
Spill Prevention: Not reported
Tightness Test Method: Testing Not Required
Date Tested: / /
Next Test Date: / /
Date Tank Closed: / /

HIST AST:

PBS Number: 2-334081
SWIS Code: 6201
Operator: DOMINGO TORRES
Facility Phone: (212) 283-7914
Facility Addr2: 880 ST NICHOLAS AVE
Facility Type: APARTMENT BUILDING
Emergency: MILTON MANNING
Emergency Tel: (212) 283-7913

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s)

EDR ID Number
EPA ID Number

880 ST NICHOLAS AVE ASSOC (Continued)

U003391131

Old PBSNO: Not reported
Date Inspected: Not reported
Inspector: Not reported
Result of Inspection: Not reported
Owner Name: 880 ST NICHOLAS CORPORATION
Owner Address: 880 ST NICHOLAS AVENUE SUITE 21
Owner City,St,Zip: NY, NY 10012
Federal ID: Not reported
Owner Tel: (212) 283-7914
Owner Type: Corporate/Commercial
Owner Subtype: Not reported
Mailing Contact: MILTON MANNINA
Mailing Name: 880 ST NICHOLAS CORPORATION
Mailing Address: 880 ST NICHOLAS AVENUE SUITE 21
Mailing Address 2: Not reported
Mailing City,St,Zip: NY, NY 10032
Mailing Telephone: (212) 283-7914
Owner Mark: First Owner
Facility Status: 1 - Active PBS facility, i.e. total capacity of the PBS tanks is greater than 1,100 gallons, regardless if Subpart 360-14 tanks exist or not at the facility.

Certification Flag: False
Certification Date: 01/16/1998
Expiration: 10/02/2002
Renew Flag: False
Renew Date: Not reported
Total Capacity: 5000
FAMT: True
Facility Screen: No Missing Data
Owner Screen: No Missing Data
Tank Screen: Minor Data Missing
Dead Letter: False
CBS Number: Not reported
Town or City: NEW YORK CITY
County Code: 62
Town or City Code: 01
Region: 2

Tank ID: 001
Tank Location: ABOVEGROUND ON SADDLES LEGS, STILTS, RACK, OR CRADLE
Tank Status: In Service
Install Date: Not reported
Capacity (Gal): 5000
Product Stored: NOS 1,2, OR 4 FUEL OIL
Tank Type: Steel/carbon steel
Tank Internal: Not reported
Tank External: Not reported
Pipe Location: Aboveground
Pipe Type: STEEL/IRON
Pipe Internal: Not reported
Pipe External: Not reported
Tank Containment: Diking
Leak Detection: 0
Overfill Protection: 4
Dispenser Method: Suction
Date Tested: Not reported
Next Test Date: Not reported

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

880 ST NICHOLAS AVE ASSOC (Continued)

EDR ID Number
EPA ID Number

Database(s)

U003391131

Missing Data for Tank: Minor Data Missing
Date Closed: Not reported
Test Method: Not reported
Deleted: False
Updated: True
SPDES Number: Not reported
Lat/Long: Not reported

C14
SW
< 1/8
298 ft.

403 WEST 154TH ST
MANHATTAN, NY

NY Spills S106005426
N/A

Site 4 of 4 in cluster C

Relative:
Higher

NY Spills:

Actual:
131 ft.

Site ID: 262130
Facility Addr2: Not reported
Facility ID: 0203720
Spill Number: 0203720
Facility Type: ER
SWIS: 3101
Region of Spill: 2
Investigator: JBVOUGHT
Referred To: Not reported
Spill Date: 07/09/02
Reported to Dept: 07/09/02
CID: 15
Spill Cause: Equipment Failure
Water Affected: Not reported
Spill Source: Private Dwelling
Spill Notifier: Affected Persons
Cleanup Ceased: / /
Cleanup Meets Std: False
Last Inspection: / /
Recommended Penalty: Penalty Not Recommended
UST Trust: False
Spill Class: Known release with minimal potential for fire or hazard. DEC Response.
Willing Responsible Party. Corrective action taken.
Spill Closed Dt: 07/09/02
Remediation Phase: 0
Date Entered In Computer: 07/09/02
Spill Record Last Update: 12/26/02
Spiller Name: SAME
Spiller Company: CRYSTAL TRANSPORTATION
Spiller Address: 2010 WHITE PLAINS ROAD
Spiller City,St,Zip: BRONX, NY 10462-
Spiller Company: 001
Spiller Phone: Not reported
Contact Name: CALLER
Contact Phone: Not reported
DEC Region: 2
Program Number: 0203720
DER Facility ID: 214068
Site ID: 262130
Operable Unit ID: 854730
Operable Unit: 01
Material ID: 563020
Material Code: 0001

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

(Continued)

S106005426

Material Name: #2 Fuel Oil
Case No.: Not reported
Material FA: Petroleum
Quantity: 3.00
Units: Gallons
Recovered: 3.00
Resource Affected: Soil
Oxygenate: False
DEC Memo: Start DECRemark - 0203720 Prior to Sept, 2004 data translation this spill Lead
DEC Field was "VOUGHT" 7/9/2002-VOUGHT-Spoke with Joe Mansueto who stated that
broken fill box was stripped threads which caused hose to disconnect spilling
oil onto sidewalk. Spill cleaned using Speedy Dry. No sewers or drains
affected. Castle Oil company 718-579-3414 will have owner repair fill port.
Spill closed by Vought. END DECRemark - 0203720
Remarks: Start CallerRemark - 0203720 broken fill line to building. all cleaned up END
CallerRemark - 0203720

B15
ESE
< 1/8
316 ft.

GETTY PETROLEUM CORP
89-91 ST NICHOLAS PL
NEW YORK, NY 10032

RCRA-SQG
FINDS
NY MANIFEST

1001028932
NYR000011643

Site 2 of 3 in cluster B

Relative:
Lower

RCRAInfo:
Owner: GETTY PETROLEUM CORP
(516) 286-2600
EPA ID: NYR000011643
Contact: Not reported
Classification: Small Quantity Generator
TSDF Activities: Not reported
Violation Status: No violations found

Actual:
84 ft.

FINDS:

Other Pertinent Environmental Activity Identified at Site

RCRAInfo is a national information system that supports the Resource Conservation and Recovery Act (RCRA) program through the tracking of events and activities related to facilities that generate, transport, and treat, store, or dispose of hazardous waste. RCRAInfo allows RCRA program staff to track the notification, permit, compliance, and corrective action activities required under RCRA.

NY MANIFEST:

Document ID: MAG2629280
Manifest Status: Completed after the designated time period for a TSDF to get a copy to the DEC
Trans1 State ID: 2142ACT
Trans2 State ID: ME654380
Generator Ship Date: 950818
Trans1 Recv Date: 950818
Trans2 Recv Date: 950821
TSD Site Recv Date: 950822
Part A Recv Date: 950913
Part B Recv Date: 950914
Generator EPA ID: NYR000011643

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s)
EDR ID Number
EPA ID Number

GETTY PETROLEUM CORP (Continued)

1001028932

Trans1 EPA ID: MAD039322250
Trans2 EPA ID: MAD039322250
TSDF ID: MAD053452637
Waste Code: D001 - NON-LISTED IGNITABLE WASTES
Quantity: 00165
Units: G - Gallons (liquids only)* (8.3 pounds)
Number of Containers: 003
Container Type: DM - Metal drums, barrels
Handling Method: B Incineration, heat recovery, burning.
Specific Gravity: 100
Year: 95
Manifest Tracking Num: Not reported
Import Ind: Not reported
Export Ind: Not reported
Discr Quantity Ind: Not reported
Discr Type Ind: Not reported
Discr Residue Ind: Not reported
Discr Partial Reject Ind: Not reported
Discr Full Reject Ind: Not reported
Manifest Ref Num: Not reported
Alt Fac RCRA Id: Not reported
Alt Fac Sign Date: Not reported
Mgmt Method Type Code: Not reported
EPA ID: NYR000011643
Facility Name: GETTY PETROLEUM CORP
Facility Address: 89-91 ST NICHOLAS PL
Facility City: NEW YORK
Facility Address 2: Not reported
Country: USA
County: NE
Mailing Name: GETTY PETROLEUM CORP
Mailing Contact: STEVE GORDON
Mailing Address: 89-91 ST NICHOLAS PL
Mailing Address 2: Not reported
Mailing City: NEW YORK
Mailing State: NY
Mailing Zip: Not reported
Mailing Zip4: 8004
Mailing Country: USA
Mailing Phone: 800-645-8265

Document ID: NYG3195549
Manifest Status: Not reported
Trans1 State ID: NYD077444263
Trans2 State ID: Not reported
Generator Ship Date: 12/28/2001
Trans1 Recv Date: 12/28/2001
Trans2 Recv Date: Not reported
TSD Site Recv Date: 01/02/2002
Part A Recv Date: Not reported
Part B Recv Date: Not reported
Generator EPA ID: NYR000011643
Trans1 EPA ID: NYD077444263
Trans2 EPA ID: Not reported
TSDF ID: Not reported
Waste Code: D001 - NON-LISTED IGNITABLE WASTES
Quantity: 00090

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s)
EDR ID Number
EPA ID Number

GETTY PETROLEUM CORP (Continued)

1001028932

Units: G - Gallons (liquids only)* (8.3 pounds)
Number of Containers: 002
Container Type: DM - Metal drums, barrels
Handling Method: B Incineration, heat recovery, burning.
Specific Gravity: 01.00
Year: 01
Manifest Tracking Num: Not reported
Import Ind: Not reported
Export Ind: Not reported
Discr Quantity Ind: Not reported
Discr Type Ind: Not reported
Discr Residue Ind: Not reported
Discr Partial Reject Ind: Not reported
Discr Full Reject Ind: Not reported
Manifest Ref Num: Not reported
Alt Fac RCRA Id: Not reported
Alt Fac Sign Date: Not reported
Mgmt Method Type Code: Not reported
EPA ID: NYR000011643
Facility Name: GETTY PETROLEUM CORP
Facility Address: 89-91 ST NICHOLAS PL
Facility City: NEW YORK
Facility Address 2: Not reported
Country: USA
County: NE
Mailing Name: GETTY PETROLEUM CORP
Mailing Contact: STEVE GORDON
Mailing Address: 89-91 ST NICHOLAS PL
Mailing Address 2: Not reported
Mailing City: NEW YORK
Mailing State: NY
Mailing Zip: Not reported
Mailing Zip4: 8004
Mailing Country: USA
Mailing Phone: 800-645-8265

Document ID: 06
Manifest Status: 000078423JJK
Trans1 State ID: NYR000011643
Trans2 State ID: Not reported
Generator Ship Date: CDX480000000
Trans1 Recv Date: Not reported
Trans2 Recv Date: NYD049178296
TSD Site Recv Date: Not reported
Part A Recv Date: Not reported
Part B Recv Date: Not reported
Generator EPA ID: N
Trans1 EPA ID: N
Trans2 EPA ID: N
TSD ID: N
Waste Code: N
Quantity: Not reported
Units: 4
Number of Containers: DF
Container Type: 1200
Handling Method: P
Specific Gravity: 1

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

GETTY PETROLEUM CORP (Continued)

EDR ID Number
EPA ID Number

Database(s)

1001028932

Waste Code: B
Quantity: Not reported
Units: Not reported
Number of Containers: Not reported
Container Type: Not reported
Handling Method: Not reported
Specific Gravity: Not reported
Year: Not reported
Manifest Tracking Num: Not reported
Import Ind: Not reported
Export Ind: Not reported
Discr Quantity Ind: Not reported
Discr Type Ind: Not reported
Discr Residue Ind: Not reported
Discr Partial Reject Ind: Not reported
Discr Full Reject Ind: Not reported
Manifest Ref Num: Not reported
Alt Fac RCRA Id: Not reported
Alt Fac Sign Date: Not reported
Mgmt Method Type Code: Not reported
EPA ID: NYR000011643
Facility Name: GETTY PETROLEUM CORP
Facility Address: 89-91 ST NICHOLAS PL
Facility City: NEW YORK
Facility Address 2: Not reported
Country: USA
County: NE
Mailing Name: GETTY PETROLEUM CORP
Mailing Contact: STEVE GORDON
Mailing Address: 89-91 ST NICHOLAS PL
Mailing Address 2: Not reported
Mailing City: NEW YORK
Mailing State: NY
Mailing Zip: Not reported
Mailing Zip4: 8004
Mailing Country: USA
Mailing Phone: 800-645-8265

B16
SE
< 1/8
342 ft.

385 EDGEComb AVENUE
385 EDGEComb AVENUE
MANHATTAN, NY

NY Spills
NY Hist Spills

S104495992
N/A

Relative:
Lower

Site 3 of 3 in cluster B

Actual:
101 ft.

NY Spills:
Site ID: 108390
Facility Addr2: Not reported
Facility ID: 9416465
Spill Number: 9416465
Facility Type: ER
SWIS: 3101
Region of Spill: 2
Investigator: SMMARTIN
Referred To: Not reported
Spill Date: 03/21/95
Reported to Dept: 03/21/95
CID: 15
Spill Cause: Equipment Failure

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

385 EDGECOMB AVENUE (Continued)

EDR ID Number
EPA ID Number

Database(s)

S104495992

Water Affected: Not reported
Spill Source: Private Dwelling
Spill Notifier: Responsible Party
Cleanup Ceased: 03/21/95
Cleanup Meets Std: True
Last Inspection: / /
Recommended Penalty: Penalty Not Recommended
UST Trust: False
Spill Class: Known release with minimal potential for fire or hazard. DEC Response.
Willing Responsible Party. Corrective action taken.
Spill Closed Dt: 03/21/95
Remediation Phase: 0
Date Entered In Computer: 04/25/95
Spill Record Last Update: 09/30/04
Spiller Name: Not reported
Spiller Company: UNKNOWN
Spiller Address: Not reported
Spiller City,St,Zip: NY
Spiller Company: 999
Spiller Phone: Not reported
Contact Name: Not reported
Contact Phone: Not reported
DEC Region: 2
Program Number: 9416465
DER Facility ID: 95260
Site ID: 108390
Operable Unit ID: 1010202
Operable Unit: 01
Material ID: 371620
Material Code: 0002
Material Name: #4 Fuel Oil
Case No.: Not reported
Material FA: Petroleum
Quantity: 15.00
Units: Gallons
Recovered: 0.00
Resource Affected: Soil
Oxygenate: False
DEC Memo: Start DECRemark - 9416465 Prior to Sept, 2004 data translation this spill Lead
DEC Field was "MARTINKAT" END DECRemark - 9416465
Remarks: Start CallerRemark - 9416465 DEFECTIVE GAUGE END CallerRemark - 9416465

NY Hist Spills:
Region of Spill: 2
Spill Number: 9416465
Investigator: MARTINKAT
Caller Name: Not reported
Caller Agency: Not reported
Caller Phone: Not reported
Notifier Name: Not reported
Notifier Agency: Not reported
Notifier Phone: Not reported
Spill Date/Time: 03/21/1995 09:39
Reported to Dept Date/Time: 03/21/95 09:47
SWIS: 62
Spiller Name: UNKNOWN
Spiller Contact: Not reported

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

385 EDGECOMB AVENUE (Continued)

EDR ID Number
EPA ID Number

Database(s)

S104495992

Spiller Phone: Not reported
Spiller Address: Not reported
Spiller City,St,Zip: Not reported
Spill Cause: Equipment Failure
Reported to Dept: On Land
Water Affected: Not reported
Spill Source: 09
Spill Notifier: Responsible Party
PBS Number: Not reported
Cleanup Ceased: 03/21/95
Cleanup Meets Std: True
Last Inspection: / /
Recommended Penalty: Penalty Not Recommended
Spiller Cleanup Dt: / /
Enforcement Date: / /
Invstgn Complete: / /
UST Involvement: False
Spill Class: Known release with minimal potential for fire or hazard. DEC Response.
Willing Responsible Party. Corrective action taken.
Spill Closed Dt: 03/21/95
Corrective Action Plan Submitted: / /
Date Region Sent Summary to Central Office: / /
Date Spill Entered In Computer Data File: 04/25/95
Date Spill Entered In Computer Data File: Not reported
Update Date: / /
Is Updated: False
PBS Number: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate Failed Tank: Not reported
Gross Leak Rate: Not reported
Material Class Type: Petroleum
Quantity Spilled: 15
Unkonwn Quantity Spilled: False
Units: Gallons
Quantity Recovered: 0
Unkonwn Quantity Recovered: False
Material: #4 FUEL OIL
Class Type: #4 FUEL OIL
Times Material Entry In File: 1751
CAS Number: Not reported
Last Date: 19941205
DEC Remarks: Not reported
Remark: DEFECTIVE GAUGE

E17
South
< 1/8
361 ft.

GETTY GAS STA
89 ST NICHOLAS PL
NYC, NY

LTANKS
HIST LTANKS
S100964971
N/A

Site 1 of 4 in cluster E

Relative:
Lower

LTANKS:
Site ID: 136562
Spill Date: 09/08/88
Facility Addr2: Not reported
Facility ID: 8805013
Program Number: 8805013

Actual:
107 ft.

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

GETTY GAS STA (Continued)

EDR ID Number
EPA ID Number

Database(s)

S100964971

SWIS: 3101
Region of Spill: 2
Investigator: SULLIVAN
Referred To: Not reported
Reported to Dept: 09/09/88
CID: 15
Spill Cause: Tank Test Failure
Water Affected: Not reported
Spill Source: Gasoline Station
Spill Notifier: Tank Tester
Cleanup Ceased: 07/16/92
Cleanup Meets Standard: True
Last Inspection: / /
Recommended Penalty: Penalty Not Recommended
UST Involvement: True
Spill Class: Known release that creates potential for fire or hazard. DEC Response.
Willing Responsible Party. Corrective action taken.
Spill Closed Dt: 07/16/92
Remediation Phase: 0
Date Entered In Computer: 09/20/88
Spill Record Last Update: 04/30/04
Spille Namer: Not reported
Spiller Company: GETTY-LEEMILTS PETRO, INC
Spiller Phone: (516) 576-9500
Spiller Extention: Not reported
Spiller Address: 175 SUNNYSIDE BLVD
Spiller City,St,Zip: PLAINVIEW, NY 11803
Spiller County: 001
Spiller Contact: Not reported
Spiller Phone: Not reported
Spiller Extention: Not reported
DEC Region: 2
Program Number: 8805013
DER Facility ID: 116854
Site ID: 136562
Operable Unit ID: 922174
Operable Unit: 01
Material ID: 456933
Material Code: 0009
Material Name: Gasoline
Case No.: Not reported
Material FA: Petroleum
Quantity: -1.00
Units: Gallons
Recovered: 0.00
Resource Affected: Groundwater
Oxygenate: False
Site ID: 136562
Spill Tank Test: 1534586
Tank Number: Not reported
Tank Size: 0
Test Method: 00
Leak Rate: 0.00
Gross Fail: Not reported
Modified By: Spills
Last Modified: 10/01/04
Test Method: Unknown

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s) EDR ID Number
EPA ID Number

GETTY GAS STA (Continued)

S100964971

DEC Memo: Not reported
Remarks: Start CallerRemark - 8805013 4K TK FAILED PETRO-TITE @ UNREADABLE RATE. END
CallerRemark - 8805013

HIST LTANKS:

Region of Spill: 2
Spill Number: 8805013
Investigator: SULLIVAN
Caller Name: Not reported
Caller Agency: Not reported
Caller Phone: Not reported
Caller Extension: Not reported
Notifier Name: Not reported
Notifier Agency: Not reported
Notifier Phone: Not reported
Notifier Extension: Not reported
Spill Date: 09/08/1988
Spill Time: 16:00
Reported to Department Date: 09/09/88
Reported to Department Time: 13:51
SWIS: 62
Spiller Contact: Not reported
Spiller Phone: Not reported
Spiller Extension: Not reported
Spiller Name: GETTY-LEEMILTS PETRO, INC
Spiller Address: 175 SUNNYSIDE BLVD
Spiller City,St,Zip: PLAINVIEW, 11803
Facility Contact: Not reported
Facility Phone: (516) 576-9500
Facility Extension: Not reported
Spill Cause: Tank Test Failure
Resource Affectd: Groundwater
Water Affected: Not reported
Spill Source: Gas Station
Spill Notifier: Tank Tester
PBS Number: 2-291935
Cleanup Ceased: 07/16/92
Cleanup Meets Standard: True
Last Inspection: / /
Recommended Penalty: Penalty Not Recommended
Spiller Cleanup Date: / /
Enforcement Date: / /
Investigation Complete: / /
UST Involvement: True
Spill Class: Known release that creates potential for fire or hazard. DEC Response.
Willing Responsible Party. Corrective action taken.
Spill Closed Dt: 07/16/92
Date Region Sent Summary to Central Office: / /
Corrective Action Plan Submitted: / /
Date Spill Entered In Computer Data File: 09/20/88
Time Spill Entered In Computer Data File: Not reported
Spill Record Last Update: 07/28/92
Is Updated: False
PBS Number: Not reported
Tank Number: Not reported
Tank Size: 0
Test Method: Not reported

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

GETTY GAS STA (Continued)

EDR ID Number
EPA ID Number

Database(s)

S100964971

Leak Rate Failed Tank: 0.00
Gross Leak Rate: Not reported
Material Class Type: Petroleum
Quantity Spilled: -1
Unkonwn Quantity Spilled: False
Units: Gallons
Quantity Recovered: 0
Unkonwn Quantity Recovered: False
Material: GASOLINE
Class Type: GASOLINE
Times Material Entry In File: 21329
CAS Number: Not reported
Last Date: 19940929
DEC Remarks: Not reported
Spill Cause: 4K TK FAILED PETRO-TITE @ UNREADABLE RATE.

E18
South
< 1/8
361 ft.

87 ST NICHOLAS
87 ST NICHOLAS
MANHATTAN, NY

LTANKS
HIST LTANKS

S101658370
N/A

Site 2 of 4 in cluster E

Relative:
Lower

Actual:
107 ft.

LTANKS:
Site ID: 83151
Spill Date: 06/22/95
Facility Addr2: Not reported
Facility ID: 9503535
Program Number: 9503535
SWIS: 3101
Region of Spill: 2
Investigator: rjfeng
Referred To: DPES STARTUP 4/1/2007
Reported to Dept: 06/22/95
CID: 15
Spill Cause: Tank Failure
Water Affected: Not reported
Spill Source: Gasoline Station
Spill Notifier: Responsible Party
Cleanup Ceased: 06/02/04
Cleanup Meets Standard: False
Last Inspection: / /
Recommended Penalty: Penalty Not Recommended
UST Involvement: True
Spill Class: Known release with minimal potential for fire or hazard. DEC Response.
Willing Responsible Party. Corrective action taken.
Spill Closed Dt: / /
Remediation Phase: 3
Date Entered In Computer: 07/18/95
Spill Record Last Update: 06/27/07
Spille Namer: Not reported
Spiller Company: GETTY
Spiller Phone: Not reported
Spiller Extention: Not reported
Spiller Address: Not reported
Spiller City,St,Zip: NY
Spiller County: 001
Spiller Contact: Not reported
Spiller Phone: Not reported

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

87 ST NICHOLAS (Continued)

EDR ID Number
EPA ID Number

Database(s)

S101658370

Spiller Extention: Not reported
DEC Region: 2
Program Number: 9503535
DER Facility ID: 301696
Site ID: 83151
Operable Unit ID: 1018004
Operable Unit: 01
Material ID: 365036
Material Code: 0009
Material Name: Gasoline
Case No.: Not reported
Material FA: Petroleum
Quantity: -1.00
Units: Gallons
Recovered: 0.00
Resource Affected: Soil
Oxygenate: False
Site ID: Not reported
Spill Tank Test: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate: Not reported
Gross Fail: Not reported
Modified By: Not reported
Last Modified: Not reported
Test Method: Not reported
DEC Memo: Start DECRemark - 9503535 Prior to Sept, 2004 data translation this spill Lead DEC Field was "VOUGHT" 3/13/03 REASSIGNED FROM ROMMEL TO VOUGHT. 4/30/04-Vought-Changed spill address from 87 St. Nicholas to 89 St. Nicholas due to correct address and address on all Tyree correspondence. Site may also be known as 89-91 St. Nicholas Ave due to use previously on Tyree reports. Also changed name of spiller to Getty. File review by Vought: Closure Report (Tyree Org Dan Ruffini 631-249-3150)-January 1996. Tanks removed as part of station rebuild. Removal of twelve (550-gallon) gasoline USTs and one (4000-gallon) tank. Tanks removed in June 1995. Tank upgrade included the installation of four (4000-gallon) gasoline USTs. New tanks placed in existing tank excavation. Visual evidence and petroleum odors detected during excavation. Depth of excavation was ten feet and 1040 tons of soil removed. Soil analyticals show 1460ppb benzene (North), 12000ppb toluene(North), 6720ppb toluene(South), 3240ppb xylene(South), 5230ppb toluene(West), 3040ppb xylene(west), 4010ppb toluene(west), 3330ppb xylene(west), 11500ppb toluene(bottom), and 2560ppb xylene(bottom). Subsurface Investigation Report (Tyree Org Paul Hatcher)-Dec 2000. Investigation result of DEC requirements. Five Geoprobe borings performed resulting in collection of six soil samples and two groundwater samples. Groundwater at depth of 26-27'. Soil analyticals show up to 104000ppb 1,2,4-trimethylbenzene(SB310-15'), 18500ppb xylene(SB3 10-15'), 13200ppb naphthalene(SB3 10-15'), 819ppb benzene(SB4 10-15'), 5260ppb toluene(SB4 10-15'), 10900ppb 1,2,4-trimethylbenzene(SB4 10-15'), 323ppb benzene(SB4 20-25'), 1960ppb toluene(SB4 10-15'). Groundwater analyticals show up to 184ppb benzene(SB4), 4470ppb MTBE(SB-4), 5ppb benzene(SB5) and 33ppb MTBE(SB5). Tank Removal Report (Tyree Org Phillip De Blasi)-December 2001. Reason for tank removal was tanks were identified while attempting to install monitoring wells in March 2001. Apartment building to the south, commercial buildings to the east and a garage to the west. Tanks removed were two (550-gallon) gasoline tanks. "External corrosion and small hole in tank #2". Five endpoint soil samples taken show no TAGM 4046 Required Soil Cleanup

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

EDR ID Number
EPA ID Number
Database(s)

87 ST NICHOLAS (Continued)

S101658370

Objective exceedences. Quarterly Monitoring Reports (Tyree Org) August 2002 thru March 2003. Three monitoring wells onsite. Quarterly sampling and gauging. Free product in well W1 (.08'). Groundwater flow to the east at a depth of 14-16'. Soil analyticals show up to 9700ppb benzene(W1 10-15'), 122000ppb toluene(W1 10-15'), 41100ppb naphthalene(W1 10-15') and 291pp benzene(W3 15-20'). Groundwater analyticals show up to 7490ppb benzene(W1), 3680ppb toluene(W1), 590ppb naphthalene(W1), 92100ppb MTBE(W1), 200ppb benzene(W2), 318ppb MTBE(W2), 875ppb benzene(W3), 124ppb naphthalene(W3) and 867ppb MTBE(W3). Letter from DEC(Vought)-4/29/03. Letter requesting expediting of sidewalk wells for wells in side walk on St. Nicholas Avenue. Well Proposal from Tyree-6/12/0. Letter proposing installation of two wells (in the northeast corner of the property and the other in the sidewalk along St. Nicholas Avenue). Letter from DEC(Vought)-6/25/03. Letter sent approving 6/12/03 proposal. Quarterly Monitoring Reports (Tyree Org) April 2003 thru Dec 2003. Three monitoring wells onsite. Quarterly sampling and weekly gauging. Free product in well W1 (.28'), W3 (.03'). Weekly bailing of wells recovering 1.25 gallons of free product. Groundwater flow to the east at a depth of 14-16'. Groundwater analyticals show up to 17400ppb benzene(W1), 14300ppb toluene(W1), 8580ppb MTBE(W1), 9ppb xylene(W2) and free product in W3. Subsurface Investigation Report (Tyree Org Gabriela Dory)-December 2003. Reason for investigation is DEC requirement. Two Geoprobe borings performed. Groundwater at 15'. Soil analyticals show 36700ppb benzene(TB-1 12-16'), 325000ppb toluene(TB1 12-16'), 66500ppb naphthalene(TB1 12-16'), 60ppb benzene(TB2 12-16'), and 1752ppb xylene(TB2 12-16'). Groundwater analyticals show 14500ppb benzene(TB1), 1340ppb naphthalene(TB1), 142ppb benzene(TB2), 1221ppb xylene(TB2) and 344ppb naphthalene(TB2). 5/4/04-Vought-After file review DEC requires STIPULATION AGREEMENT WITH: 1)delineation of soil and groundwater north of former tank pad, east of W1, east of W3 and at former boring location TB-2. Vought handed over Stipulation during 5/5/04 Getty meeting with DEC with a due date to DEC by 6/4/04. 6/2/04-Vought-Received signed Stipulation from Shea and submitted to DEC Kunkel for implementation. Stipulation implemented by DEC Kunkel on 6/2/04. 10/7/04-Vought-New file review by Vought: Email from Tyree (Lapeitra) to DEC Vought dated 6/23/04. "on June 24 and 25 four (4) monitoring wells will be installed as per the Stipulation Agreement". "A subsurface investigation will follow shortly afterward". Subsurface Investigation Report (Tyree) received on 7/20/04. Commercial properties to the east, south, and west, park to the north. Installation of two onsite wells and two offsite wells. Groundwater 14-22' below grade and flow to the north. Soil analyticals show 494ppb benzene(B6 15-17') and minor PAH exceedences(B4 10-12'). Groundwater analyticals show 1220ppb benzene(MW4), 1340ppb toluene(MW4), 1700ppb ethylbenzene(MW4), 4490ppb xylene(MW4), 11ppb MTBE(MW4), 1ppb benzene(MW5), 8ppb xylene(MW5), 14ppb benzene(MW6), 13ppb xylene(MW6) and 670ppb MTBE(MW6). Groundwater Monitoring Report (Tyree)- July thru Sept 2004. Seven monitoring wells onsite. Groundwater analyticals show 20600ppb benzene(W1), 42100ppb toluene(W1), 2820ppb ethylbenzene(W1), 15400ppb xylene(W1), 7190ppb MTBE(W1), 1ppb benzene(W2), 4720ppb benzene(W3), 41ppb toluene(W3), 429ppb ethylbenzene(W3), 403ppb xylene(W3), 5190ppb MTBE(W3), 633ppb benzene(W4), 16ppb toluene(W4), 4410ppb ethylbenzene(W4), 12700ppb xylene(W4), 982ppb benzene(W6), 21ppb toluene(W6), 78ppb ethylbenzene(W6), 84ppb xylene(W6) and 962ppb MTBE(W6). 10/7/04-Vought-Sent letter approving of Subsurface Investigation and requiring remedial Action Plan as per CAP. 5/12/05-Vought-New file review by Vought: Groundwater Monitoring Report (Tyree)-October 2004 thru March 2005. Seven monitoring wells onsite. Groundwater flow to the east and at depths of 13-24' below grade. Groundwater analyticals show 16700ppb benzene(W1), 13100ppb toluene(W1), 2710ppb ethylbenzene(W1), 14100ppb xylene(W1), 8070ppb MTBE(W1), 5ppb toluene(W2), 30ppb xylene(W2), 3450ppb benzene(W3), 22ppb toluene(W3), 128ppb

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s)
EDR ID Number
EPA ID Number

87 ST NICHOLAS (Continued)

S101658370

ethylbenzene(W3), 176ppb xylene(W3), 4330ppb MTBE(W3), 217ppb benzene(W4), 93ppb toluene(W4), 2320ppb ethylbenzene(W4), 6600ppb xylene(W4), 28ppb xylene(W5), 224ppb benzene(W6), 9ppb ethylbenzene(W6), 32ppb xylene(W6), 1290ppb MTBE(W6), 8ppb xylene(W7). Site Status and Proposed Remedial Action Plan(Tyree Brothers)-February 2005. "TBES is proposing the use of in-situ passive bailers to collect product from wells W-1 and W-3". Bailers will be utilized until "a permanent remedial alternative is in place". Proposal for a dual phase pilot extraction test. Extraction well will be located between wells with highest contamination(W1 and W3). Results of pilot test will be provided in a Pilot Test Report. Vought sent letter approving of Pilot Test. 08/31/2005 - Feng - Project transferred from Vought to Feng. 10/5/2005 - Feng - Quarterly Monitoring Report from Tyree (4/2005 - 6/2005). 7 monitoring wells onsite and offsite. NO LNAPL detected. Groundwater flow easterly (perched above bedrock) at a depth of 13.44' to 24.91' below grade. Analyticals for W-1: 46,280ppb BTEX, 6,130ppb MTBE. W-2: 3ppb BTEX, non-detected MTBE. W-3: 4,554ppb BTEX, 4,640ppb MTBE. W-4: 14,058ppb BTEX, non-detected MTBE. W-5: 11ppb BTEX, non-detected MTBE. W-6: 475ppb BTEX, 1,140ppb MTBE. W-7: non-detected for both BTEX and MTBE. Noted that the DPE Pilot Test will commence during the next quarter. 10/5/2005 - Feng - Subsurface Investigation Report, dated 6/27/2005. On 6/8/2005 to 6/10/2005, two (2) saturated zone piezometer wells (P1 and P2), three (3) vadose zone piezometer wells (A1, A2, A3), and one (1) extraction well were installed on the southeast side of the site. VOCs test shows that P1(9'-11') has 271ppb Acetone, P2 (7'-9') has 364ppb Acetone, EW1(11'-13') has 200ppb acetone. The other concentrations are below Guidance value. 10/7/2005 - Feng - Sent letter of approving Dual Phase Extraction system design, dated July 2005 (letter reviewed by Sun) to Getty, Tyree and Delta. In the system design, four (4) extraction wells onsite will be installed to cover the area of concern. Namely, there are four (4) extraction wells for vadose zone with Radius of Influence (ROI) of 28 feet. Among these four (4) wells, there is one (1) extraction well (EW-2) serves for both vadose and saturated zone purposes with ROI of 50 feet. DEC approved with some notes below: 1) Adjust the Location of Saturated Zone Extraction Well (EW-2) to cover the W-3 area and further W-4 area. 2) Revise the Proposed DPE System Flow Diagram. 3) Submit the System Design Specification. 4) tabulate and describe OMMP. 5) measurement and analysis of groundwater. 11/2/2005 - Feng - Quarterly Monitoring Report from Tyree (4/2005 - 6/2005). 7 monitoring wells onsite and offsite. NO LNAPL detected. Groundwater flow easterly (perched above bedrock) at a depth of 15.30' to 24.53' below grade. Analyticals for W-1: 41,690ppb BTEX, 6,300ppb MTBE. W-2: low, dry this quarter. W-3: 2,053ppb BTEX, 1,990ppb MTBE. W-4: 7,938ppb BTEX, non-detected MTBE. W-5: 48ppb BTEX, non-detected MTBE. W-6: 74ppb BTEX, 1,360ppb MTBE. W-7: 38 BTEX and 1 MTBE. 1/17/2006 - Feng - Quarterly Monitoring Report, 10/2005 - 12/2005. That is an active gasoline /service station. Groundwater flows to east (perched above bedrock) at depth of 13.47' to 25.03' bg. 7 monitoring wells on and off site. W-1, 48,010 ppb BTEX, 3,860 ppb MTBE. W-2, 4 ppb BTEX, MTBE MDL. W-3, 2,956 ppb BTEX, 2,480 ppb MTBE. W-4, 13,485 ppb BTEX, MTBE MDL. W-5, 1 ppb BTEX, MTBE MDL. W-6, 415 ppb BTEX, 909 ppb MTBE. W-7, 10 ppb BTEX, MTBE MDL. (RJF) 1/18/2006 - Feng - Emailed Nick Marrone inquired the status of DPES installation. (RJF) 1/19/2006 - Feng - Reply from Nick Marrone "Things were moving slowly in the beginning of the month because of the holidays, but we are scheduling field crew to start installing the system piping in the next few weeks. Our vendor who we purchase our systems from is reviewing our data and will be assembling it soon." 4/10/2006 - Feng - Emailed Nick Marrone and requesting the status of the system installation and asking for an approximate date of completing installation and start running the system. (RJF) 4/10/2006 - Feng - Reply from Paul Hatcher, "The system is being designed right now. There

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s)
EDR ID Number
EPA ID Number

87 ST NICHOLAS (Continued)

S101658370

are space considerations to be considered given the small site. Also, there was some problems connecting the wells (i.e. subsurface conditions) that delayed the trenching operations a bit, but that's all done now. We've started getting the electrician to make the connections"and "It's probably going to be a month or two until we get the system delivered and hooked up." (RJF) 5/3/2006 - Feng - Quarterly Monitoring Report, 1/2006 - 3/2006. Active gasoline/service station. Groundwater flows to east (perched above bedrock) at depth of 13.54' to 25.22' bg. There are 7 monitoring wells on and off site and 4 Dual Phase Extraction. Sampling as of 3/21/2006. W-1, decreased and 39,920 ppb BTEX (12,900 ppb Benzene, 10,900 ppb Toluene, 2,520 ppb Ethylbenzene, 13,600ppb Total Xylenes), 3,710 ppb MTBE. W-2, MDL. W-3, 3,044 ppb BTEX (2,300 ppb Benzene, 29 ppb Toluene, 222 ppb Ethylbenzene, 493 ppb Total Xylenes), 3,760 ppb MTBE. W-4, 11,441 ppb BTEX (224 ppb B, 87 ppb T, 2,680 ppb E, 8,450 ppb X), MTBE MDL. W-5, MDL. W-6, 281 ppb BTEX (225 ppb B), 1,120 ppb MTBE. W-7, MDL. Noted that 3 more dual phase extraction wells were installed during this last quarter. Also trenching and system piping were installed (map attached). The Dual Phase System is/will be assembled and sent this next quarter. Electrical service will be obtained shortly. (RJF) 11/9/2006 - Feng - Quarterly Monitoring Report, 7/2006 - 9/2006, 9/28/2006, by Tyree. The site is active gasoline/service station. Sampled and gauged on 9/28/2006. DTW 12.88 to 23.50' bg. Flows easterly (perched above bedrock). No LNAPL. BTEX range ND to 78,880 ppb. MTBE range ND to 2,430 ppb. Noted that the Dual Phase System was delivered in 9/2006. Electrical service will be obtained shortly. (RJF) 1/18/2007 - Feng - Getty Properties portfolio meeting with Tyree and Delta. Passive skimmer in W-1 and W-3. DPES installed onsite, all DPE wells trenched. System electric to be hooked up in 2/2007. DPES will start 4/1/2007. (RJF) 2/20/2007 - Feng - Quarterly Monitoring Report, 10/2006 - 12/2006, 1/8/2007, by Tyree. Active gasoline/service station. Groundwater sampled and gauged 12/27/2006. 7 monitoring and 4 Dual Phase Extraction wells. DTW 12.91' to 24.66' bg. Flows easterly (perched above bedrock). No LNAPL. W-1, 60,170 ppb BTEX, 2,080 ppb MTBE. W-2, NA. W-3, 2,272 ppb BTEX, 3,270 ppb MTBE. W-4, 69 ppb BTEX, MTBE MDL. W-5, MDL. W-5, 787 ppb BTEX, 720 ppb MTBE. W-7, MDL. (RJF) 3/30/2007 - Feng- Email updates from R.S. (Tyree). Con Ed is in the process of running the electric from the street to the sidewalk. (RJF) 6/27/2007 - Feng - Quarterly Monitoring Report, 1/2007 - 3/2007, 4/2007. Groundwater sampled 4/2/2007. 7 monitoring wells and 4 dual phase extraction wells. DTW 12.34' to 24.42' bg. No LNAPL. Flows to east. W-1, 60,260 ppb BTEX, 1,050 ppb MTBE. W-2, MDL. W-3, 274 ppb BTEX, 243 ppb MTBE. W-4, 148 ppb BTEX, MTBE MDL. W-5, MDL. W-6, 601 ppb BTEX, 786 ppb MTBE. W-7, MDL. Spoke to Rob S. (Tyree), the dual phase system has been delivered and all the piping are set last year. The problem now Tyree has is the electrical power supply from Con Edison. Rob will follow with Con Edison for the electrical power and may need DEC's assistance. (RJF) END DECRemark - 9503535 Start CallerRemark - 9503535 CONTAMINATED SOIL ORIGINAL SPILL ASSIGNED TO O'DOWD. END CallerRemark - 9503535

Remarks:

HIST LTANKS:

Region of Spill:	2
Spill Number:	9503535
Investigator:	ROMMEL
Caller Name:	Not reported
Caller Agency:	Not reported
Caller Phone:	Not reported
Caller Extension:	Not reported
Notifier Name:	Not reported
Notifier Agency:	Not reported
Notifier Phone:	Not reported

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

87 ST NICHOLAS (Continued)

EDR ID Number
EPA ID Number

Database(s)

S101658370

Notifier Extension: Not reported
Spill Date: 06/22/1995
Spill Time: 12:00
Reported to Department Date: 06/22/95
Reported to Department Time: 12:45
SWIS: 62
Spiller Contact: Not reported
Spiller Phone: Not reported
Spiller Extension: Not reported
Spiller Name: GETTY
Spiller Address: Not reported
Spiller City,St,Zip: Not reported
Facility Contact: Not reported
Facility Phone: Not reported
Facility Extension: Not reported
Spill Cause: Tank Failure
Resource Affectd: On Land
Water Affected: Not reported
Spill Source: Gas Station
Spill Notifier: Responsible Party
PBS Number: Not reported
Cleanup Ceased: / /
Cleanup Meets Standard: False
Last Inspection: / /
Recommended Penalty: Penalty Not Recommended
Spiller Cleanup Date: / /
Enforcement Date: / /
Investigation Complete: / /
UST Involvement: True
Spill Class: Known release with minimal potential for fire or hazard. DEC Response.
Willing Responsible Party. Corrective action taken.
Spill Closed Dt: / /
Date Region Sent Summary to Central Office: / /
Corrective Action Plan Submitted: / /
Date Spill Entered In Computer Data File: 07/18/95
Time Spill Entered In Computer Data File: Not reported
Spill Record Last Update: 01/03/00
Is Updated: False
PBS Number: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate Failed Tank: Not reported
Gross Leak Rate: Not reported
Material Class Type: Petroleum
Quantity Spilled: -1
Unkonwn Quantity Spilled: False
Units: Gallons
Quantity Recovered: 0
Unkonwn Quantity Recovered: False
Material: GASOLINE
Class Type: GASOLINE
Times Material Entry In File: 21329
CAS Number: Not reported
Last Date: 19940929
DEC Remarks: Not reported
Spill Cause: CONTAMINATED SOIL ORIGINAL SPILL ASSIGNED TO O DOWD.

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

19
NNW
< 1/8
386 ft.

APARTMENT
935 ST NICHOLAS AVE
NEW YORK, NY

Database(s) EDR ID Number
EPA ID Number

NY Spills S106469794
N/A

Relative:
Higher

Actual:
142 ft.

NY Spills:
Site ID: 202354
Facility Addr2: Not reported
Facility ID: 0402510
Spill Number: 0402510
Facility Type: ER
SWIS: 3101
Region of Spill: 2
Investigator: rmpiper
Referred To: Not reported
Spill Date: 06/08/04
Reported to Dept: 06/08/04
CID: 15
Spill Cause: Equipment Failure
Water Affected: Not reported
Spill Source: Private Dwelling
Spill Notifier: Other
Cleanup Ceased: / /
Cleanup Meets Std: False
Last Inspection: / /
Recommended Penalty: Penalty Not Recommended
UST Trust: False
Spill Class: Possible release with minimal potential for fire or hazard or Known release with no damage. DEC Response. Willing Responsible Party. Corrective action taken.

Spill Closed Dt: / /
Remediation Phase: 1
Date Entered In Computer: 06/08/04
Spill Record Last Update: 03/24/06
Spiller Name: MARK ROSEN
Spiller Company: APARTMENT
Spiller Address: 935 ST NICHOLAS AVE
Spiller City,St,Zip: NEW YORK, NY
Spiller Company: 001
Spiller Phone: (201) 446-0447
Contact Name: MARK ROSEN
Contact Phone: (201) 446-0447
DEC Region: 2
Program Number: 0402510
DER Facility ID: 168324
Site ID: 202354
Operable Unit ID: 886244
Operable Unit: 01
Material ID: 490126
Material Code: 0002
Material Name: #4 Fuel Oil
Case No.: Not reported
Material FA: Petroleum
Quantity: 20.00
Units: Gallons
Recovered: 0.00
Resource Affected: Soil
Oxygenate: False
DEC Memo: Start DECRemark - 0402510 Prior to Sept, 2004 data translation this spill Lead

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s)

EDR ID Number
EPA ID Number

APARTMENT (Continued)

S106469794

DEC Field was "TIPPLE" 6/8/04 Tipple responded////cleanup not completed, informed cleanup person of the deficiencies, he unloaded his cleaning supplies and continued with the cleanup. 6/8/2004 Sangesland visited the site later in the day. Spill had been adequately cleaned up. DEC tried to look at the tank in the building basemnt. There was no door to the tank room. It was clear where the tank was, but therewas no access. Sangesland spoke to the Super and the property manager and asked them to install a door so an inspection could be made. 6/22/2004 Sangesland followed up with a telephone call to the property manager to ask if the doorway was installed yet. Answer was NO, but they are working on it. Contact: Clara Mendoza 914-997-2435 x 117 8/2/2004 Sangesland left a message on Clara's voice mail asking if the door has been installed and if the tank is ready for an inspection.

*****HOLD THIS

SPILL OPEN UNTIL THE TANK CAN BE INSPECTED****

***** 8/3/2004

Sangesland called Clara again, after a pause the secretery said she couldn't make it to the phone right now. 1/13/06- DEC Piper left message w/ clara requesting call back. 3/13/06- DEC Piper left message w/ clara requesting call back. 3/24/06- DEC Piper tracked down ownership Beach Lane Management 280 No. Central Park Avenue, Suite 210 Hartsdale, NY 10530 NEED to set up inspection w/ PBS and DLE. Piper left message for Clara requesting call back to set up environmental compliance inspection of facility. END DECRemark - 0402510

Remarks: Start CallerRemark - 0402510 FAULTY GAUGE ON TANK, BEING CLEANED UP AT THIS TIME: ALLL ON CONCRETE END CallerRemark - 0402510

F20 429 HOLDING CORP
WSW 429 WEST 154TH ST
< 1/8 NEW YORK, NY 10032
390 ft.

AST U003386998
HIST AST N/A

Site 1 of 2 in cluster F

Relative:
Higher

AST:

Actual:
140 ft.

AST:

Region: STATE
Facility Id: 2-235431
UTM X: 589224.72431
UTM Y: 4520483.36152
Expiration Date: 07/07/97
Renewal Date: / /
Total Capacity: 2000
Facility Type: Not reported
Site Type Name: Apartment Building/Office Building
Site Type Status: Active
Mailing Company: 429 HOLDING CORP C/O L MORRISON
Mailing Title: Not reported
Mailing Contact: Not reported
Mailing Address: 1739 AMSTERDAM AVE
Mailing Address 2: Not reported
Mailing City: NEW YORK
Mailing State: NY
Mailing Zip Code: 10032
Mailing Phone No: (212) 368-0600
Mailing Email: Not reported
Owner Title: Not reported
Owner Name: Not reported
Owner Address: 1739 AMSTERDAM AVE

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s)
EDR ID Number
EPA ID Number

429 HOLDING CORP (Continued)

U003386998

Owner Address 2: Not reported
Owner State: NY
Owner Zip Code: 10032
Owner Phone: (212) 368-0600
Owner Company: 429 HOLDING CORP C/O L MORRISON
Emergency Contact: LEROY W MORRISON
Emergency Phone: (212) 368-0600
Operator: BYRON BROCKETT
Operator Phone: (212) 368-0600
Owner City: NEW YORK
Owner Sub Type: Corporate or Commercial
Program Type: PBS

Tank Number: 001
Tank Location Name: Aboveground - in contact with soil
Tank Status: In Service
Tank Model: Not reported
Pipe Model: Not reported
Active Status: Active
Install Date: / /
Capacity Gallons: 2000
Material Name: #2 Fuel Oil
Percentage: 100.00
Tank Type Name: Steel/Carbon Steel/Iron
Tank Internal Protection: None
Tank Internal Protection 1: None
Tank Internal Protection 2: Not reported
Pipe Location Name: No Piping
Pipe Type Name: Steel/Carbon Steel/Iron
Pipe External Protection 1: None
Pipe External Protection 2: Not reported
Tank Secondary Containment 1: None
Tank Secondary Containment 2: Not reported
Pipe Secondary Containment: Not reported
Tank Leak Detection 1: None
Tank Leak Detection 2: Not reported
Pipe Leak Detection 1: Not reported
Pipe Leak Detection 2: Not reported
Type Of Overfill Prevention 1: Product Level Gauge (A/G)
Type Of Overfill Prevention 2: Not reported
Dispenser Method: Not reported
Spill Prevention: Not reported
Tightness Test Method: Testing Not Required
Date Tested: / /
Next Test Date: / /
Date Tank Closed: / /

HIST AST:

PBS Number: 2-235431
SWIS Code: 6201
Operator: BYRON BROCKETT
Facility Phone: (212) 368-0600
Facility Addr2: 429 WEST 154TH ST
Facility Type: APARTMENT BUILDING
Emergency: LEROY W MORRISON
Emergency Tel: (212) 368-0600
Old PBSNO: Not reported

Map ID
 Direction
 Distance
 Distance (ft.)
 Elevation Site

MAP FINDINGS

Database(s)
 EDR ID Number
 EPA ID Number

429 HOLDING CORP (Continued)

U003386998

Date Inspected: Not reported
 Inspector: Not reported
 Result of Inspection: Not reported
 Owner Name: 429 HOLDING CORP C/O L MORRISON
 Owner Address: 1739 AMSTERDAM AVE
 Owner City,St,Zip: NEW YORK, NY 10032
 Federal ID: Not reported
 Owner Tel: (212) 368-0600
 Owner Type: Corporate/Commercial
 Owner Subtype: Not reported
 Mailing Contact: Not reported
 Mailing Name: 429 HOLDING CORP C/O L MORRISON
 Mailing Address: 1739 AMSTERDAM AVE
 Mailing Address 2: Not reported
 Mailing City,St,Zip: NEW YORK, NY 10032
 Mailing Telephone: (212) 368-0600
 Owner Mark: First Owner
 Facility Status: 1 - Active PBS facility, i.e. total capacity of the PBS tanks is greater than 1,100 gallons, regardless if Subpart 360-14 tanks exist or not at the facility.
 Certification Flag: False
 Certification Date: 05/29/1992
 Expiration: 07/07/1997
 Renew Flag: False
 Renew Date: Not reported
 Total Capacity: 2000
 FAMT: True
 Facility Screen: No Missing Data
 Owner Screen: Minor Data Missing
 Tank Screen: Minor Data Missing
 Dead Letter: False
 CBS Number: Not reported
 Town or City: NEW YORK CITY
 County Code: 62
 Town or City Code: 01
 Region: 2
 Tank ID: 001
 Tank Location: ABOVEGROUND
 Tank Status: In Service
 Install Date: Not reported
 Capacity (Gal): 2000
 Product Stored: NOS 1,2, OR 4 FUEL OIL
 Tank Type: Steel/carbon steel
 Tank Internal: Not reported
 Tank External: Not reported
 Pipe Location: Not reported
 Pipe Type: STEEL/IRON
 Pipe Internal: Not reported
 Pipe External: Not reported
 Tank Containment: None
 Leak Detection: 0
 Overfill Protection: 4
 Dispenser Method: Gravity
 Date Tested: Not reported
 Next Test Date: Not reported
 Missing Data for Tank: Minor Data Missing

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

429 HOLDING CORP (Continued)

EDR ID Number
EPA ID Number

U003386998

Date Closed: Not reported
Test Method: Not reported
Deleted: False
Updated: False
SPDES Number: Not reported
Lat/Long: Not reported

F21
WSW
< 1/8
390 ft.

IFO
429 W 154TH ST
NEW YORK, NY

NY Spills
NY Hist Spills

S104509153
N/A

Site 2 of 2 in cluster F

Relative:
Higher

NY Spills:

Actual:
140 ft.

Site ID: 209158
Facility Addr2: Not reported
Facility ID: 9911969
Spill Number: 9911969
Facility Type: ER
SWIS: 3101
Region of Spill: 2
Investigator: SACCACIO
Referred To: Not reported
Spill Date: 01/16/00
Reported to Dept: 01/16/00
CID: 15
Spill Cause: Equipment Failure
Water Affected: Not reported
Spill Source: Commercial Vehicle
Spill Notifier: Responsible Party
Cleanup Ceased: / /
Cleanup Meets Std: False
Last Inspection: / /
Recommended Penalty: Penalty Not Recommended
UST Trust: False
Spill Class: Known release with minimal potential for fire or hazard. DEC Response.
Willing Responsible Party. Corrective action taken.
Spill Closed Dt: 02/07/00
Remediation Phase: 0
Date Entered In Computer: 01/16/00
Spill Record Last Update: 02/07/00
Spiller Name: JOHN
Spiller Company: MYSTIC BULK CARRIERS
Spiller Address: 19-02 STEINWAY ST
Spiller City,St,Zip: ASTORIA, NY
Spiller Company: 001
Spiller Phone: (718) 932-9075
Contact Name: GEORGE SILVERIS
Contact Phone: (800) 635-3835
DEC Region: 2
Program Number: 9911969
DER Facility ID: 173491
Site ID: 209158
Operable Unit ID: 1086494
Operable Unit: 01
Material ID: 553010
Material Code: 0001
Material Name: #2 Fuel Oil

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

IFO (Continued)

EDR ID Number
EPA ID Number

Database(s)

S104509153

Case No.: Not reported
Material FA: Petroleum
Quantity: 5.00
Units: Gallons
Recovered: 5.00
Resource Affected: Soil
Oxygenate: False
DEC Memo: Not reported
Remarks: Start CallerRemark - 9911969 SPILL WAS LESS THAN 5 GALLONS AND HAS BEEN CLEANED
UP BY MYSTIC. END CallerRemark - 9911969

NY Hist Spills:

Region of Spill: 2
Spill Number: 9911969
Investigator: SACCACIO
Caller Name: Not reported
Caller Agency: Not reported
Caller Phone: Not reported
Notifier Name: Not reported
Notifier Agency: Not reported
Notifier Phone: Not reported
Spill Date/Time: 01/16/2000 15:00
Reported to Dept Date/Time: 01/16/00 15:37
SWIS: 62
Spiller Name: MYSTIC BULK CARRIERS
Spiller Contact: JOHN
Spiller Phone: (718) 932-9075
Spiller Contact: GEORGE SILVERIS
Spiller Phone: (800) 635-3835
Spiller Address: 19-02 STEINWAY ST
Spiller City,St,Zip: ASTORIA, NY
Spill Cause: Equipment Failure
Reported to Dept: On Land
Water Affected: Not reported
Spill Source: 07
Spill Notifier: Responsible Party
PBS Number: Not reported
Cleanup Ceased: / /
Cleanup Meets Std: False
Last Inspection: / /
Recommended Penalty: Penalty Not Recommended
Spiller Cleanup Dt: / /
Enforcement Date: / /
Invstgn Complete: / /
UST Involvement: False
Spill Class: Known release with minimal potential for fire or hazard. DEC Response.
Willing Responsible Party. Corrective action taken.
Spill Closed Dt: 02/07/00
Corrective Action Plan Submitted: / /
Date Region Sent Summary to Central Office: / /
Date Spill Entered In Computer Data File: 01/16/00
Date Spill Entered In Computer Data File: Not reported
Update Date: 02/07/00
Is Updated: False
PBS Number: Not reported
Tank Number: Not reported
Tank Size: Not reported

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

IFO (Continued)

EDR ID Number
EPA ID Number

S104509153

Test Method: Not reported
Leak Rate Failed Tank: Not reported
Gross Leak Rate: Not reported
Material Class Type: Petroleum
Quantity Spilled: 5
Unkonwn Quantity Spilled: False
Units: Gallons
Quantity Recovered: 5
Unkonwn Quantity Recovered: False
Material: #2 FUEL OIL
Class Type: #2 FUEL OIL
Times Material Entry In File: 24464
CAS Number: Not reported
Last Date: 19941207
DEC Remarks: 2/7/00 - Saccacio - Left a message on Sal s VM to submit an all cleaned up letter.
Remark: SPILL WAS LESS THAN 5 GALLONS AND HAS BEEN CLEANED UP BY MYSTIC.

G22
SE
< 1/8
413 ft.

WASTE DEBRIS
409 EDGECOMBE AVENUE
NEW YORK, NY

NY Spills S106009423
N/A

Site 1 of 4 in cluster G

Relative:
Lower

NY Spills:

Actual:
100 ft.

Site ID: 59348
Facility Addr2: Not reported
Facility ID: 0208638
Spill Number: 0208638
Facility Type: ER
SWIS: 3101
Region of Spill: 2
Investigator: CESAUYER
Referred To: Not reported
Spill Date: 11/20/02
Reported to Dept: 11/20/02
CID: 15
Spill Cause: Abandoned Drums
Water Affected: Not reported
Spill Source: Unknown
Spill Notifier: Local Agency
Cleanup Ceased: / /
Cleanup Meets Std: False
Last Inspection: / /
Recommended Penalty: Penalty Not Recommended
UST Trust: False
Spill Class: Known release that creates potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken.
Spill Closed Dt: 01/24/05
Remediation Phase: 0
Date Entered In Computer: 11/20/02
Spill Record Last Update: 01/24/05
Spiller Name: PAUL
Spiller Company: 401 EDGECOMB PARTNERS
Spiller Address: 21 WEST 86TH STREET
Spiller City,St,Zip: NEW YORK, NY 10024-
Spiller Company: 001
Spiller Phone: (212) 721-0424

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

WASTE DEBRIS (Continued)

EDR ID Number
EPA ID Number

Database(s)

S106009423

Contact Name: PAUL
Contact Phone: (212) 721-0424
DEC Region: 2
Program Number: 0208638
DER Facility ID: 58107
Site ID: 59348
Operable Unit ID: 861620
Operable Unit: 01
Material ID: 515635
Material Code: 0022
Material Name: Waste Oil/Used Oil
Case No.: Not reported
Material FA: Petroleum
Quantity: 0.00
Units: Gallons
Recovered: 0.00
Resource Affected: Soil
Oxygenate: False
DEC Memo: Start DECRemark - 0208638 Prior to Sept, 2004 data translation this spill Lead DEC Field was "SAWYER" 11/20/02 - R. Austin, subbing as DDO - Spill referred to Jeff Vought, for removal - DEP (Diaz) contacted for further info - w.c.b. to Duty Desk with info on whether or not drums are on private property, whether or not they have been "haz catted" as waste oil, and whether or not they are leaking. Reply will dictate course of action needed from DEC
11/21/2002: WASTE OIL. SOME ABSORBANT, TIVEX SUITS, BAGS OF GARBAGE ON THE DRUMS. SUPER OF 409 EDGEComb AVE COMPLAINED ABOUT 405 EDGEComb AVE. SUPER. 9 DRUMS ON THE SIDEWALK. DO NOT SEND A TANKER TRUCK TO THE SITE. DRUMS HAVE MINIMUM OIL. 11/21/2002: called roberto diaz. busy signal.
11/29/2002: DEC SIGONA CALLED RP 401 Edgecomb Partners, LLC on 11/29/02, 10:10 A.M. and spoke to Mr. Hector Alers. According to Hector the drums are scheduled to be removed on 12/2/02, The facility has been transferred from prior PBSowner HSG Realty and 401 Edgecomb was faxed an application and instructions to file transfer of ownership as required by Part 612. AJS.
1/23/2004-Vought-Spill transferred from Vought to Austin. 1/27/04 - Sawyer - Spill transferred from Austin to Sawyer. 1/18/05 - Sawyer - Spoke with Jerry Edleman of J&M Realty 917 952 5676 and he will try to find a manifest or trip ticket for the drums removed. 1/24/05 - Sawyer - Received documentation in the form of an invoice from Petroleum Tank Cleaners. The drums were removed on 12/3/2002 as listed on bill. This concludes course of action for this spill report. Closed. END DECRemark - 0208638
Remarks: Start CallerRemark - 0208638 9 abandoned 55 gal drums - none have spilled END CallerRemark - 0208638

H23
WNW
< 1/8
420 ft.

NYC BD OF ED - PUBLIC SCHOOL 28 MAN
475 W 155TH ST
NEW YORK, NY 10032

RCRA-SQG
FINDS
NY MANIFEST

1000912693
NY0000902437

Relative:
Higher

Site 1 of 2 in cluster H

Actual:
145 ft.

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

NYC BD OF ED - PUBLIC SCHOOL 28 MAN (Continued)

EDR ID Number
EPA ID Number

Database(s)

1000912693

RCRAInfo:

Owner: NYC BOARD OF EDUCATION
(718) 349-5600
EPA ID: NY0000902437
Contact: VICTOR DEL MASTRO
(718) 349-5590

Classification: Small Quantity Generator
TSDF Activities: Not reported

Violation Status: No violations found

FINDS:

Other Pertinent Environmental Activity Identified at Site

RCRAInfo is a national information system that supports the Resource Conservation and Recovery Act (RCRA) program through the tracking of events and activities related to facilities that generate, transport, and treat, store, or dispose of hazardous waste. RCRAInfo allows RCRA program staff to track the notification, permit, compliance, and corrective action activities required under RCRA.

NY MANIFEST:

Document ID: NYB6717618
Manifest Status: Not reported
Trans1 State ID: NY0000148163
Trans2 State ID: Not reported
Generator Ship Date: 08/28/1998
Trans1 Recv Date: 08/28/1998
Trans2 Recv Date: Not reported
TSD Site Recv Date: 12/10/1998
Part A Recv Date: Not reported
Part B Recv Date: Not reported
Generator EPA ID: NY0000902437
Trans1 EPA ID: NYD049178296
Trans2 EPA ID: Not reported
TSDF ID: NY1A371
Waste Code: D008 - LEAD 5.0 MG/L TCLP
Quantity: 00450
Units: P - Pounds
Number of Containers: 002
Container Type: DM - Metal drums, barrels
Handling Method: L Landfill.
Specific Gravity: 01.00
Year: 98
Manifest Tracking Num: Not reported
Import Ind: Not reported
Export Ind: Not reported
Discr Quantity Ind: Not reported
Discr Type Ind: Not reported
Discr Residue Ind: Not reported
Discr Partial Reject Ind: Not reported
Discr Full Reject Ind: Not reported
Manifest Ref Num: Not reported
Alt Fac RCRA Id: Not reported

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s) EDR ID Number
EPA ID Number

NYC BD OF ED - PUBLIC SCHOOL 28 MAN (Continued)

1000912693

Alt Fac Sign Date:	Not reported
Mgmt Method Type Code:	Not reported
EPA ID:	NY0000902437
Facility Name:	NYC BOARD OF EDUCATION
Facility Address:	PS-28
Facility City:	MANHATTAN
Facility Address 2:	Not reported
Country:	USA
County:	NE
Mailing Name:	NYC BOARD OF EDUCATION
Mailing Contact:	JACK BRUCCULERI
Mailing Address:	475-WEST 155TH ST
Mailing Address 2:	Not reported
Mailing City:	NEW YORK
Mailing State:	NY
Mailing Zip:	Not reported
Mailing Zip4:	Not reported
Mailing Country:	USA
Mailing Phone:	000-000-0000
Document ID:	NYB6891993
Manifest Status:	Completed after the designated time period for a TSDF to get a copy to the DEC
Trans1 State ID:	2A029
Trans2 State ID:	Not reported
Generator Ship Date:	950109
Trans1 Recv Date:	950109
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	950109
Part A Recv Date:	Not reported
Part B Recv Date:	950208
Generator EPA ID:	NY0000902437
Trans1 EPA ID:	NYD077444263
Trans2 EPA ID:	Not reported
TSDF ID:	NYD077444263
Waste Code:	D008 - LEAD 5.0 MG/L TCLP
Quantity:	00300
Units:	P - Pounds
Number of Containers:	001
Container Type:	DM - Metal drums, barrels
Handling Method:	L Landfill.
Specific Gravity:	100
Year:	95
Manifest Tracking Num:	Not reported
Import Ind:	Not reported
Export Ind:	Not reported
Discr Quantity Ind:	Not reported
Discr Type Ind:	Not reported
Discr Residue Ind:	Not reported
Discr Partial Reject Ind:	Not reported
Discr Full Reject Ind:	Not reported
Manifest Ref Num:	Not reported
Alt Fac RCRA Id:	Not reported
Alt Fac Sign Date:	Not reported
Mgmt Method Type Code:	Not reported
EPA ID:	NY0000902437
Facility Name:	NYC BOARD OF EDUCATION
Facility Address:	PS-28

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

NYC BD OF ED - PUBLIC SCHOOL 28 MAN (Continued)

EDR ID Number
EPA ID Number

Database(s)

1000912693

Facility City: MANHATTAN
Facility Address 2: Not reported
Country: USA
County: NE
Mailing Name: NYC BOARD OF EDUCATION
Mailing Contact: JACK BRUCCULERI
Mailing Address: 475-WEST 155TH ST
Mailing Address 2: Not reported
Mailing City: NEW YORK
Mailing State: NY
Mailing Zip: Not reported
Mailing Zip4: Not reported
Mailing Country: USA
Mailing Phone: 000-000-0000

G24 409 EDGEcombe AVENUE, HDFC
SE 409 EDGEcombe AVENUE
< 1/8 NEW YORK, NY 10030
422 ft.

AST U003394963
HIST AST N/A

Site 2 of 4 in cluster G

Relative:
Lower

AST:

Actual:
99 ft.

AST:

Region: STATE
Facility Id: 2-470171
UTM X: 589387.83110
UTM Y: 4520510.75790
Expiration Date: 03/28/09
Renewal Date: / /
Total Capacity: 7000
Facility Type: Not reported
Site Type Name: Apartment Building/Office Building
Site Type Status: Active
Mailing Company: WEBER-FARHAT REALTY
Mailing Title: Not reported
Mailing Contact: MOISES FARHAT
Mailing Address: 236 WEST 26TH ST
Mailing Address 2: SUITE 805
Mailing City: NEW YORK
Mailing State: NY
Mailing Zip Code: 10001
Mailing Phone No: (212) 727-0022
Mailing Email: Not reported
Owner Title: AGENT
Owner Name: MOISES FARHAT
Owner Address: 409 EDGEcombe AVENUE
Owner Address 2: Not reported
Owner State: NY
Owner Zip Code: 10032
Owner Phone: (212) 727-0022
Owner Company: 409 EDGEcombe AVENUE, HDFC
Emergency Contact: MOISES FARHAT
Emergency Phone: (212) 727-0022
Operator: ARNALDO LEWIS
Operator Phone: (212) 491-5920
Owner City: NEW YORK
Owner Sub Type: Corporate or Commercial

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s)
EDR ID Number
EPA ID Number

409 EDGECOMBE AVENUE, HDFC (Continued)

U003394963

Program Type: PBS

Tank Number: 001
Tank Location Name: Aboveground on crib, rack, or cradle
Tank Status: In Service
Tank Model: Not reported
Pipe Model: Not reported
Active Status: Active
Install Date: / /
Capacity Gallons: 7000
Material Name: #6 Fuel Oil
Percentage: 100.00
Tank Type Name: Steel/Carbon Steel/Iron
Tank Internal Protection: None
Tank Internal Protection 1: Painted/Asphalt Coating
Tank Internal Protection 2: Not reported
Pipe Location Name: Aboveground
Pipe Type Name: No Piping
Pipe External Protection 1: None
Pipe External Protection 2: Not reported
Tank Secondary Containment 1: Vault (w/o access)
Tank Secondary Containment 2: Not reported
Pipe Secondary Containment: Not reported
Tank Leak Detection 1: None
Tank Leak Detection 2: Not reported
Pipe Leak Detection 1: Exempt Suction Piping
Pipe Leak Detection 2: Not reported
Type Of Overfill Prevention 1: Product Level Gauge (A/G)
Type Of Overfill Prevention 2: Not reported
Dispenser Method: Suction
Spill Prevention: Not reported
Tightness Test Method: Testing Not Required
Date Tested: / /
Next Test Date: / /
Date Tank Closed: / /

HIST AST:

PBS Number: 2-470171
SWIS Code: 6201
Operator: ARNALDO LEWIS
Facility Phone: (212) 491-5920
Facility Addr2: 409 EDGECOMBE AVENUE
Facility Type: Not reported
Emergency: BRADFORD WINSTON
Emergency Tel: (212) 765-7900
Old PBSNO: Not reported
Date Inspected: Not reported
Inspector: Not reported
Result of Inspection: Not reported
Owner Name: 409 EDGECOMBE AVENUE, HDFC
Owner Address: 409 EDGECOMBE AVENUE
Owner City,St,Zip: NEW YORK, NY 10032
Federal ID: Not reported
Owner Tel: (212) 765-7900
Owner Type: Corporate/Commercial
Owner Subtype: Not reported
Mailing Contact: MR. BRADFORD WINSTON

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s)

EDR ID Number
EPA ID Number

409 EDGECOMBE AVENUE, HDFC (Continued)

U003394963

Mailing Name: T.U.C. MANAGEMENT COMPANY, INC.
Mailing Address: 119 WEST 57TH STREET, SUITE 1620
Mailing Address 2: Not reported
Mailing City,St,Zip: NEW YORK, NY 10019-2303
Mailing Telephone: (212) 765-7900
Owner Mark: First Owner
Facility Status: 1 - Active PBS facility, i.e. total capacity of the PBS tanks is greater than 1,100 gallons, regardless if Subpart 360-14 tanks exist or not at the facility.

Certification Flag: False
Certification Date: 03/01/1999
Expiration: 03/28/2004
Renew Flag: False
Renew Date: Not reported
Total Capacity: 7000
FAMT: True
Facility Screen: Minor Data Missing
Owner Screen: Minor Data Missing
Tank Screen: No Missing Data
Dead Letter: False
CBS Number: Not reported
Town or City: NEW YORK CITY
County Code: 62
Town or City Code: 01
Region: 2

Tank ID: 001
Tank Location: ABOVEGROUND ON SADDLES LEGS, STILTS, RACK, OR CRADLE
Tank Status: In Service
Install Date: Not reported
Capacity (Gal): 7000
Product Stored: NOS 5 OR 6 FUEL OIL
Tank Type: Steel/carbon steel
Tank Internal: 0
Tank External: 01
Pipe Location: Aboveground
Pipe Type: NONE
Pipe Internal: None
Pipe External: 00
Tank Containment: Diking
Leak Detection: 00
Overfill Protection: 4
Dispenser Method: Suction
Date Tested: Not reported
Next Test Date: Not reported
Missing Data for Tank: No Missing Data
Date Closed: Not reported
Test Method: Not reported
Deleted: False
Updated: True
SPDES Number: Not reported
Lat/Long: Not reported

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

G25
SE
< 1/8
422 ft.

409 EDGECOMBE AV
MANHATTAN, NY

Site 3 of 4 in cluster G

Relative:
Lower

Actual:
99 ft.

NY Spills:

Site ID: 241556
Facility Addr2: Not reported
Facility ID: 0208990
Spill Number: 0208990
Facility Type: ER
SWIS: 3101
Region of Spill: 2
Investigator: SMSANGES
Referred To: Not reported
Spill Date: 11/27/02
Reported to Dept: 12/02/02
CID: 15
Spill Cause: Unknown
Water Affected: Not reported
Spill Source: Unknown
Spill Notifier: Affected Persons
Cleanup Ceased: / /
Cleanup Meets Std: False
Last Inspection: / /
Recommended Penalty: Penalty Not Recommended
UST Trust: False
Spill Class: Possible release with minimal potential for fire or hazard or Known release with no damage. DEC Response. Willing Responsible Party. Corrective action taken.

Spill Closed Dt: 12/02/02
Remediation Phase: 0
Date Entered In Computer: 12/02/02
Spill Record Last Update: 02/06/03
Spiller Name: Not reported
Spiller Company: UNKNOWN
Spiller Address: Not reported
Spiller City,St,Zip: NY
Spiller Company: 999
Spiller Phone: Not reported
Contact Name: MITTIE WILLIAMS
Contact Phone: (212) 491-5920
DEC Region: 2
Program Number: 0208990
DER Facility ID: 198573
Site ID: 241556
Operable Unit ID: 862172
Operable Unit: 01
Material ID: 515979
Material Code: 0064A
Material Name: UNKNOWN MATERIAL
Case No.: Not reported
Material FA: Other
Quantity: 0.00
Units: Gallons
Recovered: 0.00
Resource Affected: Soil
Oxygenate: False

Database(s)

EDR ID Number
EPA ID Number

NY Spills

S106009705
N/A

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

(Continued)

EDR ID Number
EPA ID Number

S106009705

DEC Memo: Start DECRemark - 0208990 Prior to Sept, 2004 data translation this spill Lead
DEC Field was "SANGESLAND" 12/2/2002 - Sangesland spoke with Mittie Williams
concerning this site. She now has a boiler contractor on site who says the
problem is not related in any way to oil or a spill. The problem is rainwater
which is leaking through a crack in the wall and building up in a lowspot on
the basement floor. Spill Closed END DECRemark - 0208990
Remarks: Start CallerRemark - 0208990 caller contacted dep last wednesday and today they
told her to contact dec... material is comming up from the ground. nfd. END
CallerRemark - 0208990

H26
WNW
< 1/8
427 ft.

P.S. 28
475 WEST 155TH STREET
NEW YORK, NY 10032

AST
HIST AST
U003394198
N/A

Site 2 of 2 in cluster H

Relative:
Higher

AST:

Actual:
146 ft.

AST:

Region: STATE
Facility Id: 2-354058
UTM X: 589231.39478
UTM Y: 4520573.48202
Expiration Date: 06/28/08
Renewal Date: / /
Total Capacity: 10000
Facility Type: Not reported
Site Type Name: School
Site Type Status: Active
Mailing Company: NEW YORK CITY DEPARTMENT OF EDUCATION
Mailing Title: Not reported
Mailing Contact: JAMES A. MERLO
Mailing Address: FIELD OPERATIONS-FUEL DIVISION
Mailing Address 2: 44-36 VERNON BOULEVARD
Mailing City: LONG ISLAND CITY
Mailing State: NY
Mailing Zip Code: 11101
Mailing Phone No: (718) 349-5738
Mailing Email: Not reported
Owner Title: Not reported
Owner Name: Not reported
Owner Address: 44-36 VERNON BOULEVARD
Owner Address 2: Not reported
Owner State: NY
Owner Zip Code: 11101
Owner Phone: (718) 349-5738
Owner Company: NEW YORK CITY DEPARTMENT OF EDUCATION
Emergency Contact: SCHOOL SAFETY
Emergency Phone: (718) 935-3300
Operator: PLANT OPERATIONS
Operator Phone: (718) 349-5400
Owner City: LONG ISLAND CITY
Owner Sub Type: Local Government
Program Type: PBS

Tank Number: 001
Tank Location Name: Aboveground on crib, rack, or cradle
Tank Status: In Service

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

P.S. 28 (Continued)

EDR ID Number
EPA ID Number

Database(s)

U003394198

Tank Model: Not reported
Pipe Model: Not reported
Active Status: Active
Install Date: / /
Capacity Gallons: 10000
Material Name: #6 Fuel Oil
Percentage: 100.00
Tank Type Name: Steel/Carbon Steel/Iron
Tank Internal Protection: None
Tank Internal Protection 1: None
Tank Internal Protection 2: Not reported
Pipe Location Name: No Piping
Pipe Type Name: Steel/Carbon Steel/Iron
Pipe External Protection 1: None
Pipe External Protection 2: Not reported
Tank Secondary Containment 1: Vault (w/o access)
Tank Secondary Containment 2: Not reported
Pipe Secondary Containment: Not reported
Tank Leak Detection 1: None
Tank Leak Detection 2: Not reported
Pipe Leak Detection 1: Exempt Suction Piping
Pipe Leak Detection 2: Not reported
Type Of Overfill Prevention 1: Product Level Gauge (A/G)
Type Of Overfill Prevention 2: Not reported
Dispenser Method: Suction
Spill Prevention: Not reported
Tightness Test Method: Testing Not Required
Date Tested: / /
Next Test Date: / /
Date Tank Closed: / /

HIST AST:

PBS Number: 2-354058
SWIS Code: 6201
Operator: PLANT OPERATION
Facility Phone: (718) 391-6000
Facility Addr2: 475 WEST 155TH STREET
Facility Type: SCHOOL
Emergency: SCHOOL SAFETY
Emergency Tel: (212) 979-3300
Old PBSNO: Not reported
Date Inspected: Not reported
Inspector: Not reported
Result of Inspection: Not reported
Owner Name: CITY OF NEW YORK C/O BOARD OF EDUCATION
Owner Address: 28-11 QUEENS PLAZA NORTH
Owner City,St,Zip: LONG ISLAND CITY, NY 11101
Federal ID: Not reported
Owner Tel: (718) 391-6832
Owner Type: Local Government
Owner Subtype: Not reported
Mailing Contact: FRANK CARDELLO NTROL
Mailing Name: BOARD OF EDUCATION
Mailing Address: 28-11 QUEENS PLAZA NORTH
Mailing Address 2: 5 FLOOR
Mailing City,St,Zip: LONG ISLAND CITY, NY 11101
Mailing Telephone: (718) 391-6832

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

P.S. 28 (Continued)

EDR ID Number
EPA ID Number

Database(s)

U003394198

Owner Mark: First Owner
Facility Status: 1 - Active PBS facility, i.e. total capacity of the PBS tanks is greater than 1,100 gallons, regardless if Subpart 360-14 tanks exist or not at the facility.

Certification Flag: False
Certification Date: 08/26/1998
Expiration: 06/28/2003
Renew Flag: False
Renew Date: Not reported
Total Capacity: 10000
FAMT: True
Facility Screen: No Missing Data
Owner Screen: Minor Data Missing
Tank Screen: Minor Data Missing
Dead Letter: False
CBS Number: Not reported
Town or City: NEW YORK CITY
County Code: 62
Town or City Code: 01
Region: 2

Tank ID: 001
Tank Location: ABOVEGROUND ON SADDLES LEGS, STILTS, RACK, OR CRADLE
Tank Status: In Service
Install Date: Not reported
Capacity (Gal): 10000
Product Stored: NOS 5 OR 6 FUEL OIL
Tank Type: Steel/carbon steel
Tank Internal: Not reported
Tank External: Not reported
Pipe Location: Not reported
Pipe Type: STEEL/IRON
Pipe Internal: Not reported
Pipe External: Not reported
Tank Containment: Diking
Leak Detection: 0
Overfill Protection: 4
Dispenser Method: Suction
Date Tested: Not reported
Next Test Date: Not reported
Missing Data for Tank: Minor Data Missing
Date Closed: Not reported
Test Method: Not reported
Deleted: False
Updated: True
SPDES Number: Not reported
Lat/Long: Not reported

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

E27
South
< 1/8
428 ft.

SIMMONS REALTY CORP
76 ST NICHOLAS PL
NEW YORK, NY 10032

AST
HIST AST **U003389350**
N/A

Site 3 of 4 in cluster E

Relative:
Lower

AST:

Actual:
104 ft.

AST:

Region: STATE
Facility Id: 2-306428
UTM X: 589312.00000
UTM Y: 4520403.00000
Expiration Date: 10/18/10
Renewal Date: / /
Total Capacity: 5000
Facility Type: Not reported
Site Type Name: Apartment Building/Office Building
Site Type Status: Active
Mailing Company: PINNACLE HAMILTON LLC
Mailing Title: Not reported
Mailing Contact: MEIR BOUSKILA
Mailing Address: P.O. BOX 1919
Mailing Address 2: Not reported
Mailing City: NEW YORK
Mailing State: NY
Mailing Zip Code: 10119
Mailing Phone No: (212) 564-2111
Mailing Email: Not reported
Owner Title: Not reported
Owner Name: Not reported
Owner Address: P.O. BOX 1919
Owner Address 2: Not reported
Owner State: NY
Owner Zip Code: 10119
Owner Phone: (212) 564-2111
Owner Company: PINNACLE HAMILTON LLC
Emergency Contact: ABIDIN RADONCIC
Emergency Phone: (212) 222-7100
Operator: AMADO RODRIGUEZ
Operator Phone: (646) 529-4692
Owner City: NEW YORK
Owner Sub Type: Corporate or Commercial
Program Type: PBS

Tank Number: 001
Tank Location Name: Aboveground - in contact with soil
Tank Status: In Service
Tank Model: Not reported
Pipe Model: Not reported
Active Status: Active
Install Date: 03/14/16
Capacity Gallons: 5000
Material Name: #2 Fuel Oil
Percentage: 100.00
Tank Type Name: Steel/Carbon Steel/Iron
Tank Internal Protection: None
Tank Internal Protection 1: Painted/Asphalt Coating
Tank Internal Protection 2: Not reported
Pipe Location Name: Aboveground

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s)
EDR ID Number
EPA ID Number

SIMMONS REALTY CORP (Continued)

U003389350

Pipe Type Name: Steel/Carbon Steel/Iron
Pipe External Protection 1: Painted/Asphalt Coating
Pipe External Protection 2: Not reported
Tank Secondary Containment 1: None
Tank Secondary Containment 2: Not reported
Pipe Secondary Containment: None
Tank Leak Detection 1: None
Tank Leak Detection 2: Not reported
Pipe Leak Detection 1: Exempt Suction Piping
Pipe Leak Detection 2: Not reported
Type Of Overfill Prevention 1: Vent Whistle
Type Of Overfill Prevention 2: Not reported
Dispenser Method: Suction
Spill Prevention: None
Tightness Test Method: Testing Not Required
Date Tested: / /
Next Test Date: / /
Date Tank Closed: / /

HIST AST:

PBS Number: 2-306428
SWIS Code: 6201
Operator: JAMES SIMMONS
Facility Phone: (212) 926-8140
Facility Addr2: 76 ST NICHOLAS PL
Facility Type: Not reported
Emergency: JAMES SIMMONS
Emergency Tel: (914) 632-9392
Old PBSNO: Not reported
Date Inspected: Not reported
Inspector: Not reported
Result of Inspection: Not reported
Owner Name: JAMES SIMMONS
Owner Address: 175 OVERLOOK CIR
Owner City,St,Zip: NEW ROCHELLE, NY 10804
Federal ID: Not reported
Owner Tel: (914) 632-9392
Owner Type: Not reported
Owner Subtype: Not reported
Mailing Contact: Not reported
Mailing Name: JAMES SIMMONS
Mailing Address: 175 OVERLOOK CIR
Mailing Address 2: Not reported
Mailing City,St,Zip: NEW ROCHELLE, NY 10804
Mailing Telephone: (914) 632-9392
Owner Mark: First Owner
Facility Status: 1 - Active PBS facility, i.e. total capacity of the PBS tanks is greater than 1,100 gallons, regardless if Subpart 360-14 tanks exist or not at the facility.

Certification Flag: False
Certification Date: 07/14/1987
Expiration: 07/14/1992
Renew Flag: False
Renew Date: Not reported
Total Capacity: 4000
FAMT: True
Facility Screen: Minor Data Missing

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

SIMMONS REALTY CORP (Continued)

EDR ID Number
EPA ID Number

Database(s)

U003389350

Owner Screen: Minor Data Missing
Tank Screen: Minor Data Missing
Dead Letter: True
CBS Number: Not reported
Town or City: NEW YORK CITY
County Code: 62
Town or City Code: 01
Region: 2

Tank ID: 001
Tank Location: ABOVEGROUND
Tank Status: In Service
Install Date: Not reported
Capacity (Gal): 4000
Product Stored: NOS 1,2, OR 4 FUEL OIL
Tank Type: Steel/carbon steel
Tank Internal: Not reported
Tank External: Not reported
Pipe Location: Not reported
Pipe Type: STEEL/IRON
Pipe Internal: Not reported
Pipe External: Not reported
Tank Containment: None
Leak Detection: 0
Overfill Protection: 4
Dispenser Method: Suction
Date Tested: Not reported
Next Test Date: Not reported
Missing Data for Tank: Minor Data Missing
Date Closed: Not reported
Test Method: Not reported
Deleted: False
Updated: False
SPDES Number: Not reported
Lat/Long: Not reported

E28
South
< 1/8
438 ft.

75 EQUITY HOLDING, LLC
75 ST. NICHOLAS PLACE
NEW YORK, NY 10032

AST **U003397241**
HIST AST **N/A**

Relative:
Lower

Site 4 of 4 in cluster E

AST:

Actual:
104 ft.

AST:

Region: STATE
Facility Id: 2-603550
UTM X: 589346.59945
UTM Y: 4520391.57508
Expiration Date: 11/10/10
Renewal Date: / /
Total Capacity: 6000
Facility Type: Not reported
Site Type Name: Apartment Building/Office Building
Site Type Status: Active
Mailing Company: PINNACLE HAMILTON LLC
Mailing Title: Not reported
Mailing Contact: MEIR BOUSKILA

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

75 EQUITY HOLDING, LLC (Continued)

EDR ID Number
EPA ID Number

Database(s)

U003397241

Mailing Address: P.O. BOX 1920
Mailing Address 2: Not reported
Mailing City: NEW YORK
Mailing State: NY
Mailing Zip Code: 10116
Mailing Phone No: Not reported
Mailing Email: Not reported
Owner Title: Not reported
Owner Name: Not reported
Owner Address: P.O. BOX 1919
Owner Address 2: Not reported
Owner State: NY
Owner Zip Code: 10119
Owner Phone: (212) 564-2111
Owner Company: PINNACLE HAMILTON LLC
Emergency Contact: ABIDIN RADONCIC
Emergency Phone: (212) 222-7100
Operator: ANGEL
Operator Phone: (646) 529-6213
Owner City: NEW YORK
Owner Sub Type: Corporate or Commercial
Program Type: PBS

Tank Number: 100
Tank Location Name: Aboveground on crib, rack, or cradle
Tank Status: In Service
Tank Model: Not reported
Pipe Model: Not reported
Active Status: Active
Install Date: 01/01/26
Capacity Gallons: 6000
Material Name: #2 Fuel Oil
Percentage: 100.00
Tank Type Name: Steel/Carbon Steel/Iron
Tank Internal Protection: None
Tank Internal Protection 1: Painted/Asphalt Coating
Tank Internal Protection 2: Not reported
Pipe Location Name: Aboveground/Underground Combination
Pipe Type Name: Steel/Carbon Steel/Iron
Pipe External Protection 1: Painted/Asphalt Coating
Pipe External Protection 2: Not reported
Tank Secondary Containment 1: None
Tank Secondary Containment 2: Not reported
Pipe Secondary Containment: None
Tank Leak Detection 1: None
Tank Leak Detection 2: Not reported
Pipe Leak Detection 1: Exempt Suction Piping
Pipe Leak Detection 2: Not reported
Type Of Overfill Prevention 1: Vent Whistle
Type Of Overfill Prevention 2: Not reported
Dispenser Method: Suction
Spill Prevention: None
Tightness Test Method: Testing Not Required
Date Tested: / /
Next Test Date: / /
Date Tank Closed: / /

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

75 EQUITY HOLDING, LLC (Continued)

EDR ID Number
EPA ID Number

Database(s)

U003397241

HIST AST:

PBS Number: 2-603550
SWIS Code: 6201
Operator: LEE WEST
Facility Phone: (212) 254-4374
Facility Addr2: 75 ST. NICHOLAS PLACE
Facility Type: Not reported
Emergency: LEE WEST
Emergency Tel: (212) 254-4374
Old PBSNO: Not reported
Date Inspected: Not reported
Inspector: Not reported
Result of Inspection: Not reported
Owner Name: BARUCH SINGER
Owner Address: 95 DELANCEY STREET
Owner City,St,Zip: NEW YORK, NY 10002
Federal ID: Not reported
Owner Tel: (212) 254-4374
Owner Type: Corporate/Commercial
Owner Subtype: Not reported
Mailing Contact: Not reported
Mailing Name: BARUCH SINGER
Mailing Address: 95 DELANCEY STREET
Mailing Address 2: 95 DELANCEY STREET
Mailing City,St,Zip: NEW YORK, NY 10002
Mailing Telephone: (212) 254-4374
Owner Mark: First Owner
Facility Status: 1 - Active PBS facility, i.e. total capacity of the PBS tanks is greater than 1,100 gallons, regardless if Subpart 360-14 tanks exist or not at the facility.

Certification Flag: False
Certification Date: 02/19/1999
Expiration: 07/02/2003
Renew Flag: False
Renew Date: Not reported
Total Capacity: 6000
FAMT: True
Facility Screen: Minor Data Missing
Owner Screen: No Missing Data
Tank Screen: Minor Data Missing
Dead Letter: False
CBS Number: Not reported
Town or City: NEW YORK CITY
County Code: 62
Town or City Code: 01
Region: 2

Tank ID: 1
Tank Location: ABOVEGROUND
Tank Status: In Service
Install Date: Not reported
Capacity (Gal): 6000
Product Stored: EMPTY
Tank Type: Steel/carbon steel
Tank Internal: Not reported
Tank External: Not reported
Pipe Location: Not reported

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

75 EQUITY HOLDING, LLC (Continued)

EDR ID Number
EPA ID Number

Database(s)

U003397241

Pipe Type: Not reported
Pipe Internal: Not reported
Pipe External: Not reported
Tank Containment: Not reported
Leak Detection: Not reported
Overfill Protection: Not reported
Dispenser Method: Not reported
Date Tested: Not reported
Next Test Date: Not reported
Missing Data for Tank: Minor Data Missing
Date Closed: Not reported
Test Method: Not reported
Deleted: False
Updated: True
SPDES Number: Not reported
Lat/Long: Not reported

I29
SW
< 1/8
453 ft.

873 ST NICHOLAS AVE
873 SAINT NICHOLAS AVENUE
NEW YORK, NY 10032

AST A100183458
N/A

Site 1 of 6 in cluster I

Relative:
Higher

AST:

Actual:
122 ft.

AST:

Region: STATE
Facility Id: 2-606887
UTM X: 589220.28881
UTM Y: 4520402.87755
Expiration Date: 12/30/08
Renewal Date: / /
Total Capacity: 2000
Facility Type: Not reported
Site Type Name: Apartment Building/Office Building
Site Type Status: Active
Mailing Company: WEST NICHOLAS REALTY CORP.
Mailing Title: Not reported
Mailing Contact: CHRIS CALHOUN
Mailing Address: 611 WEST 148TH STREET
Mailing Address 2: Not reported
Mailing City: NEW YORK
Mailing State: NY
Mailing Zip Code: 10031
Mailing Phone No: Not reported
Mailing Email: Not reported
Owner Title: Not reported
Owner Name: Not reported
Owner Address: 611 W 148 ST
Owner Address 2: Not reported
Owner State: NY
Owner Zip Code: 10031
Owner Phone: Not reported
Owner Company: NEIGHBORHOOD PARTNERSHIP HDFO % W NICHOLAS REALTY
Emergency Contact: CHRIS CALHOUN
Emergency Phone: Not reported
Operator: WEST NICHOLAS REALTY CORP
Operator Phone: Not reported

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

873 ST NICHOLAS AVE (Continued)

EDR ID Number
EPA ID Number

Database(s)

A100183458

Owner City: NEW YORK
Owner Sub Type: Private Resident
Program Type: PBS

Tank Number: 01
Tank Location Name: Aboveground - in contact with soil
Tank Status: In Service
Tank Model: Not reported
Pipe Model: Not reported
Active Status: Active
Install Date: / /
Capacity Gallons: 2000
Material Name: #2 Fuel Oil
Percentage: 100.00
Tank Type Name: Steel/Carbon Steel/Iron
Tank Internal Protection: None
Tank Internal Protection 1: Painted/Asphalt Coating
Tank Internal Protection 2: Not reported
Pipe Location Name: Aboveground/Underground Combination
Pipe Type Name: Steel/Carbon Steel/Iron
Pipe External Protection 1: None
Pipe External Protection 2: Not reported
Tank Secondary Containment 1: None
Tank Secondary Containment 2: Not reported
Pipe Secondary Containment: Not reported
Tank Leak Detection 1: None
Tank Leak Detection 2: Not reported
Pipe Leak Detection 1: Exempt Suction Piping
Pipe Leak Detection 2: Not reported
Type Of Overfill Prevention 1: Vent Whistle
Type Of Overfill Prevention 2: Not reported
Dispenser Method: Suction
Spill Prevention: Not reported
Tightness Test Method: Testing Not Required
Date Tested: / /
Next Test Date: / /
Date Tank Closed: / /

G30 405 EDGECOMBE AVE
SE 405 EDGECOMBE AVE
< 1/8 NEW YORK, NY 10032
488 ft.

AST U003386928
HIST AST N/A

Site 4 of 4 in cluster G

Relative:
Lower

AST:

Actual:
99 ft.

AST:

Region: STATE
Facility Id: 2-195898
UTM X: 589388.22343
UTM Y: 4520506.21069
Expiration Date: 12/10/07
Renewal Date: 07/08/02
Total Capacity: 4000
Facility Type: Not reported
Site Type Name: Apartment Building/Office Building
Site Type Status: Active
Mailing Company: J&M REALTY CORP.

Map ID
 Direction
 Distance
 Distance (ft.)
 Elevation Site

MAP FINDINGS

Database(s)
 EDR ID Number
 EPA ID Number

405 EDGECOMBE AVE (Continued)

U003386928

Mailing Title: Not reported
 Mailing Contact: PAUL JACCOM
 Mailing Address: 21 WEST 86TH STREET
 Mailing Address 2: Not reported
 Mailing City: NEW YORK
 Mailing State: NY
 Mailing Zip Code: 10024
 Mailing Phone No: (212) 721-0424
 Mailing Email: Not reported
 Owner Title: Not reported
 Owner Name: Not reported
 Owner Address: 21 WEST 86 STREET
 Owner Address 2: Not reported
 Owner State: NY
 Owner Zip Code: 10024
 Owner Phone: (212) 721-0424
 Owner Company: 401 EDGECOMBE PARTNERS LLC
 Emergency Contact: PAUL JACCOM
 Emergency Phone: (212) 721-0424
 Operator: JULIO APONTE
 Operator Phone: (212) 721-0424
 Owner City: NEW YORK
 Owner Sub Type: Corporate or Commercial
 Program Type: PBS

Tank Number: 001
 Tank Location Name: Aboveground - in contact with soil
 Tank Status: In Service
 Tank Model: Not reported
 Pipe Model: Not reported
 Active Status: Active
 Install Date: / /
 Capacity Gallons: 4000
 Material Name: #6 Fuel Oil
 Percentage: 100.00
 Tank Type Name: Steel/Carbon Steel/Iron
 Tank Internal Protection: None
 Tank Internal Protection 1: None
 Tank Internal Protection 2: Not reported
 Pipe Location Name: Aboveground/Underground Combination
 Pipe Type Name: Steel/Carbon Steel/Iron
 Pipe External Protection 1: Painted/Asphalt Coating
 Pipe External Protection 2: Not reported
 Tank Secondary Containment 1: Other
 Tank Secondary Containment 2: Not reported
 Pipe Secondary Containment: Not reported
 Tank Leak Detection 1: Other
 Tank Leak Detection 2: Not reported
 Pipe Leak Detection 1: Exempt Suction Piping
 Pipe Leak Detection 2: Not reported
 Type Of Overfill Prevention 1: Product Level Gauge (A/G)
 Type Of Overfill Prevention 2: Not reported
 Dispenser Method: Suction
 Spill Prevention: Not reported
 Tightness Test Method: Testing Not Required
 Date Tested: / /
 Next Test Date: / /

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

405 EDGECOMBE AVE (Continued)

U003386928

Date Tank Closed: / /

HIST AST:

PBS Number: 2-195898
SWIS Code: 6201
Operator: STAHL ASSOCIATES,LTD
Facility Phone: (212) 568-6600
Facility Addr2: 405 EDGECOMBE AVE
Facility Type: APARTMENT BUILDING
Emergency: GROVER AUSTIN
Emergency Tel: (212) 690-3905
Old PBSNO: Not reported
Date Inspected: Not reported
Inspector: Not reported
Result of Inspection: Not reported
Owner Name: HSG REALTY CORP
Owner Address: 714 WEST 181 ST C/O STAHL ASSOCIATES,LTD
Owner City,St,Zip: NEW YORK, NY 10033
Federal ID: Not reported
Owner Tel: (212) 568-6600
Owner Type: Corporate/Commercial
Owner Subtype: Not reported
Mailing Contact: MICHAEL STAHL
Mailing Name: HSG REALTY CORP
Mailing Address: C/O STAHL ASSOCIATES,LTD
Mailing Address 2: 714 WEST 181ST STREET
Mailing City,St,Zip: NEW YORK, NY 10033
Mailing Telephone: (212) 568-6600
Owner Mark: First Owner
Facility Status: 1 - Active PBS facility, i.e. total capacity of the PBS tanks is greater than 1,100 gallons, regardless if Subpart 360-14 tanks exist or not at the facility.

Certification Flag: False
Certification Date: 09/25/1997
Expiration: 11/16/2002
Renew Flag: False
Renew Date: Not reported
Total Capacity: 4000
FAMT: True
Facility Screen: No Missing Data
Owner Screen: No Missing Data
Tank Screen: No Missing Data
Dead Letter: False
CBS Number: Not reported
Town or City: NEW YORK CITY
County Code: 62
Town or City Code: 01
Region: 2

Tank ID: 001
Tank Location: ABOVEGROUND
Tank Status: In Service
Install Date: Not reported
Capacity (Gal): 4000
Product Stored: NOS 5 OR 6 FUEL OIL
Tank Type: Steel/carbon steel
Tank Internal: 0

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

405 EDGEcombe AVE (Continued)

EDR ID Number
EPA ID Number

Database(s)

U003386928

Tank External: 0
Pipe Location: Aboveground/Underground Combination
Pipe Type: STEEL/IRON
Pipe Internal: None
Pipe External: 1
Tank Containment: Other
Leak Detection: 9
Overfill Protection: 4
Dispenser Method: Suction
Date Tested: Not reported
Next Test Date: Not reported
Missing Data for Tank: No Missing Data
Date Closed: Not reported
Test Method: Not reported
Deleted: False
Updated: True
SPDES Number: Not reported
Lat/Long: Not reported

I31
SW
< 1/8
538 ft.

870 ST. NICHOLAS AVENUE CORPORATION
870 ST. NICHOLAS AVENUE
NEW YORK, NY 10032

AST
HIST AST

U003397228
N/A

Site 2 of 6 in cluster I

Relative:
Higher

AST:

Actual:
115 ft.

AST:

Region: STATE
Facility Id: 2-603533
UTM X: 589264.40635
UTM Y: 4520409.78840
Expiration Date: 06/17/09
Renewal Date: / /
Total Capacity: 7500
Facility Type: Not reported
Site Type Name: Apartment Building/Office Building
Site Type Status: Active
Mailing Company: 870 ST. NICHOLAS AVENUE LLC.
Mailing Title: Not reported
Mailing Contact: ANNA RAPOPORT
Mailing Address: P.O. BOX 245240
Mailing Address 2: Not reported
Mailing City: BROOKLYN
Mailing State: NY
Mailing Zip Code: 11224
Mailing Phone No: (718) 266-2803
Mailing Email: Not reported
Owner Title: OWNER
Owner Name: ANNA RAPOPORT
Owner Address: P.O. BOX 245240
Owner Address 2: Not reported
Owner State: NY
Owner Zip Code: 11224
Owner Phone: (718) 266-2803
Owner Company: 870 ST. NICHOLAS AVE, LLC
Emergency Contact: ANNA RAPOPORT
Emergency Phone: (718) 266-2803

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s)
EDR ID Number
EPA ID Number

870 ST. NICHOLAS AVENUE CORPORATION (Continued)

U003397228

Operator: ARMANDO RODRIQUEZ
Operator Phone: (917) 365-3238
Owner City: BROOKLYN
Owner Sub Type: Corporate or Commercial
Program Type: PBS

Tank Number: 001
Tank Location Name: Aboveground on crib, rack, or cradle
Tank Status: In Service
Tank Model: Not reported
Pipe Model: Not reported
Active Status: Active
Install Date: / /
Capacity Gallons: 7500
Material Name: #4 Fuel Oil
Percentage: 100.00
Tank Type Name: Steel/Carbon Steel/Iron
Tank Internal Protection: None
Tank Internal Protection 1: Painted/Asphalt Coating
Tank Internal Protection 2: Not reported
Pipe Location Name: Aboveground
Pipe Type Name: Steel/Carbon Steel/Iron
Pipe External Protection 1: Painted/Asphalt Coating
Pipe External Protection 2: Not reported
Tank Secondary Containment 1: Vault (w/o access)
Tank Secondary Containment 2: Not reported
Pipe Secondary Containment: None
Tank Leak Detection 1: None
Tank Leak Detection 2: Not reported
Pipe Leak Detection 1: Exempt Suction Piping
Pipe Leak Detection 2: Not reported
Type Of Overfill Prevention 1: Product Level Gauge (A/G)
Type Of Overfill Prevention 2: Not reported
Dispenser Method: Suction
Spill Prevention: None
Tightness Test Method: Testing Not Required
Date Tested: / /
Next Test Date: / /
Date Tank Closed: / /

HIST AST:

PBS Number: 2-603533
SWIS Code: 6201
Operator: MEDANIO IRIZARRY
Facility Phone: (212) 690-9147
Facility Addr2: 870 ST. NICHOLAS AVENUE
Facility Type: Not reported
Emergency: ANNA RAPOPORT
Emergency Tel: (718) 714-6509
Old PBSNO: Not reported
Date Inspected: Not reported
Inspector: Not reported
Result of Inspection: Not reported
Owner Name: 870 ST. NICHOLAS AVENUE CORPORATION
Owner Address: P.O. BOX 245240
Owner City,St,Zip: BROOKLYN, NY 11224
Federal ID: Not reported

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

870 ST. NICHOLAS AVENUE CORPORATION (Continued)

EDR ID Number
EPA ID Number

Database(s)

U003397228

Owner Tel: (718) 714-6509
Owner Type: Corporate/Commercial
Owner Subtype: Not reported
Mailing Contact: ANNA RAPOPORT
Mailing Name: 870 ST. NICHOLAS AVENUE CORPORATION
Mailing Address: P.O. BOX 245240
Mailing Address 2: Not reported
Mailing City,St,Zip: BROOKLYN, NY 11224
Mailing Telephone: (718) 714-6509
Owner Mark: First Owner
Facility Status: 1 - Active PBS facility, i.e. total capacity of the PBS tanks is greater than 1,100 gallons, regardless if Subpart 360-14 tanks exist or not at the facility.

Certification Flag: False
Certification Date: 06/29/1998
Expiration: 06/24/2003
Renew Flag: False
Renew Date: Not reported
Total Capacity: 8000
FAMT: True
Facility Screen: Minor Data Missing
Owner Screen: No Missing Data
Tank Screen: No Missing Data
Dead Letter: False
CBS Number: Not reported
Town or City: NEW YORK CITY
County Code: 62
Town or City Code: 01
Region: 2

Tank ID: 001
Tank Location: ABOVEGROUND ON SADDLES LEGS, STILTS, RACK, OR CRADLE
Tank Status: In Service
Install Date: Not reported
Capacity (Gal): 8000
Product Stored: NOS 1,2, OR 4 FUEL OIL
Tank Type: Steel/carbon steel
Tank Internal: 0
Tank External: 00
Pipe Location: Aboveground
Pipe Type: STEEL/IRON
Pipe Internal: None
Pipe External: 00
Tank Containment: None
Leak Detection: 00
Overfill Protection: 6
Dispenser Method: Suction
Date Tested: Not reported
Next Test Date: Not reported
Missing Data for Tank: No Missing Data
Date Closed: Not reported
Test Method: Not reported
Deleted: False
Updated: True
SPDES Number: Not reported
Lat/Long: Not reported

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

I32
SW
< 1/8
540 ft.

402 W. 153 STREET COOP CORP
402 W. 153 ST.
NEW YORK, NY 10031

AST A100178270
N/A

Relative:
Higher

Site 3 of 6 in cluster I

AST:

Actual:
115 ft.

AST:

Region: STATE
Facility Id: 2-606044
UTM X: 589274.73064
UTM Y: 4520322.15372
Expiration Date: 06/21/06
Renewal Date: / /
Total Capacity: 3000
Facility Type: Not reported
Site Type Name: Apartment Building/Office Building
Site Type Status: Active
Mailing Company: 402 W. 153 ST COOP CORP
Mailing Title: Not reported
Mailing Contact: VIVIAN R. ALLEN
Mailing Address: 402 W. 153 STREET
Mailing Address 2: Not reported
Mailing City: NEW YORK
Mailing State: NY
Mailing Zip Code: 10031
Mailing Phone No: Not reported
Mailing Email: Not reported
Owner Title: Not reported
Owner Name: Not reported
Owner Address: 402 W. 153 ST.
Owner Address 2: Not reported
Owner State: NY
Owner Zip Code: 10031
Owner Phone: Not reported
Owner Company: 402 W. 153 ST. COOP CORP
Emergency Contact: VENICE LEWIS
Emergency Phone: Not reported
Operator: VIVIAN R. ALLEN
Operator Phone: Not reported
Owner City: NEW YORK
Owner Sub Type: Private Resident
Program Type: PBS

Tank Number: 001
Tank Location Name: Aboveground - in contact with soil
Tank Status: In Service
Tank Model: Not reported
Pipe Model: Not reported
Active Status: Active
Install Date: / /
Capacity Gallons: 3000
Material Name: #2 Fuel Oil
Percentage: 100.00
Tank Type Name: Concrete
Tank Internal Protection: None
Tank Internal Protection 1: None
Tank Internal Protection 2: Not reported
Pipe Location Name: No Piping

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

402 W. 153 STREET COOP CORP (Continued)

EDR ID Number
EPA ID Number

Database(s)

A100178270

Pipe Type Name: No Piping
Pipe External Protection 1: None
Pipe External Protection 2: Not reported
Tank Secondary Containment 1: None
Tank Secondary Containment 2: Not reported
Pipe Secondary Containment: Not reported
Tank Leak Detection 1: None
Tank Leak Detection 2: Not reported
Pipe Leak Detection 1: Not reported
Pipe Leak Detection 2: Not reported
Type Of Overfill Prevention 1: None
Type Of Overfill Prevention 2: Not reported
Dispenser Method: None
Spill Prevention: Not reported
Tightness Test Method: Testing Not Required
Date Tested: / /
Next Test Date: / /
Date Tank Closed: / /

33
SE
< 1/8
546 ft.

APARTMENT
401-405 EDGEcombe AVE
MANHATTAN, NY

LTANKS S106471583
N/A

Relative:
Lower

LTANKS:

Actual:
99 ft.

Site ID: 276097
Spill Date: 05/06/04
Facility Addr2: Not reported
Facility ID: 0401289
Program Number: 0401289
SWIS: 3101
Region of Spill: 2
Investigator: qxabidi
Referred To: Not reported
Reported to Dept: 05/06/04
CID: 15
Spill Cause: Tank Failure
Water Affected: Not reported
Spill Source: Institutional, Educational, Gov., Other
Spill Notifier: Other
Cleanup Ceased: / /
Cleanup Meets Standard: False
Last Inspection: / /
Recommended Penalty: Penalty Not Recommended
UST Involvement: False
Spill Class: Known release with minimal potential for fire or hazard. DEC Response.
Willing Responsible Party. Corrective action taken.
Spill Closed Dt: / /
Remediation Phase: 2
Date Entered In Computer: 05/06/04
Spill Record Last Update: 06/21/07
Spille Namer: VICTOR
Spiller Company: APARTMENT
Spiller Phone: (917) 731-0891
Spiller Extention: Not reported
Spiller Address: 401-405 EDGECOMB AVE
Spiller City,St,Zip: MANHATTAN, NY
Spiller County: 001

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

APARTMENT (Continued)

EDR ID Number
EPA ID Number

Database(s)

S106471583

Spiller Contact: VICTOR
Spiller Phone: (917) 731-0891
Spiller Extention: Not reported
DEC Region: 2
Program Number: 0401289
DER Facility ID: 224471
Site ID: 276097
Operable Unit ID: 885348
Operable Unit: 01
Material ID: 492502
Material Code: 0003
Material Name: #6 Fuel Oil
Case No.: Not reported
Material FA: Petroleum
Quantity: 0.00
Units: Pounds
Recovered: 0.00
Resource Affected: Soil
Oxygenate: False
Site ID: Not reported
Spill Tank Test: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate: Not reported
Gross Fail: Not reported
Modified By: Not reported
Last Modified: Not reported
Test Method: Not reported
DEC Memo: Start DECRemark - 0401289 Prior to Sept, 2004 data translation this spill Lead DEC Field was "KRIMGOLD" 5/6/2004 Sangesland spoke to Mark Salamack at PTC. He said there was a fuel delivery on 5/5 and today the super saw oil coming out onto the basement floor. The existing tank is wrapped in concrete and oil is coming out from under this wrap. PTC will set up temp tanks on 5/7. Then they will drain the existing tank, pull it out (along with all the lines) and reinstall a new tank/linessystem. During this process PTC will determine if any spill occured below the basement floor. If there is a contamination problem, they will clean it up and submit manifests and endpoint samples as required. 04/13/06- Case was transferred from Jake Krimgold to Koon Tang. 11/03/06: This spill is transferred from Mr. Koon Tang to Q.Abidi. Called Mr. Mark Salamack (PTC Company) at (718)624-4842 and talk to Ms. Dianna she said PTC Company only did Tank Cleaning for J & M Reality survices (212)721-0424. -QA 11/17/06: Called J & M Realty at (212)721-0424 and left message to call me back regarding information of the spill. -QA Called Mr. Mark Salamack (Petroleum Tank Cleaner) at (718)624-4842 and talked about the spill. He said that he did only Tank Test. He said tank test was failure. He will try to send me Tank Test failure report. Rest other work who did that PTC do not know. -QA 11/30/06: Called J & M Realty at (212)721-0424 and talked to Mr. Jerry he said. This spill is cleaned up. He is going to fax me closing confirmation letter to close the spill. -QA 12/13/06: Mr. Jerry Edelman, Agent (J & M Realty Services Corp.) sent a closing confirmation letter in which he has mentioned that cause of the spill isa small amount of oil was released in to the concrete alley when the driver of the truck flushed out the delivery line with air. According to Mr. Jerry spill was promptly cleaned up using and oil absorbing compound. According to Mr. Jerry spill is cleaned. -QA 01/02/07: Called Mr. Mark Salamack and talk about the spill. According to Mr. Mark Salamack (PTC), when he went to see the spill oil was out of the tank in

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

APARTMENT (Continued)

S106471583

Remarks: the basement. It could be the cause of overfilling, could be leaking of tank. Tank should be removed and soil should be checked soil underneath the tank. Called J & M Realty (212)721-0424 and talked to Mr. Jerry Edelman he said that he will send a letter mentioning the actual reason of the spill 02/05/07: Called Mr. Jerry Edelman at (212)721-0424 extension 13 and left message to call me back to discuss the spill. -QA 06/21/07: Called Mr. Jerry Edelman at (212)721-0424 extension 13 to discuss regarding spill. He was not there talked to Mr. Victor he said he will talk to Mr. Jerry about it. He will find out about the "Tank Test Report" (tank must be tested every five years). After getting that he will call me back. -QA END DECRemark - 0401289 Start CallerRemark - 0401289 tank is wrapped in concrete, doesn't know if it has holes in it, it is leaking out onto the ground END CallerRemark - 0401289

I34
SW
< 1/8
549 ft.

410 EAST 153RD ST/BX
410 EAST 153RD STREET
NEW YORK CITY, NY

NY Spills S104495273
NY Hist Spills N/A

Site 4 of 6 in cluster I

Relative:
Higher

Actual:
118 ft.

NY Spills:
Site ID: 216590
Facility Addr2: Not reported
Facility ID: 9011233
Spill Number: 9011233
Facility Type: ER
SWIS: 0301
Region of Spill: 2
Investigator: WILSON
Referred To: Not reported
Spill Date: 01/23/91
Reported to Dept: 01/23/91
CID: 15
Spill Cause: Equipment Failure
Water Affected: Not reported
Spill Source: Tank Truck
Spill Notifier: Responsible Party
Cleanup Ceased: 05/25/95
Cleanup Meets Std: True
Last Inspection: / /
Recommended Penalty: Penalty Not Recommended
UST Trust: False
Spill Class: Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken.
Spill Closed Dt: 05/25/95
Remediation Phase: 0
Date Entered In Computer: 02/01/91
Spill Record Last Update: 05/25/95
Spiller Name: Not reported
Spiller Company: CASTLE OIL
Spiller Address: 290 LOCUST AVENUE
Spiller City, St, Zip: NEW YORK, NY 10454
Spiller Company: 001
Spiller Phone: (212) 823-5800
Contact Name: Not reported
Contact Phone: Not reported
DEC Region: 2
Program Number: 9011233
DER Facility ID: 179327

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

410 EAST 153RD ST/BX (Continued)

S104495273

Site ID: 216590
Operable Unit ID: 948246
Operable Unit: 01
Material ID: 427784
Material Code: 0003
Material Name: #6 Fuel Oil
Case No.: Not reported
Material FA: Petroleum
Quantity: 20.00
Units: Gallons
Recovered: 0.00
Resource Affected: Soil
Oxygenate: False
DEC Memo: Not reported
Remarks: Start CallerRemark - 9011233 DELIVERY HOSE BURST DURING DELIVERY,SUSPECT FROZEN/PLUG FILL PIPE,OIL SPILLED TO SIDEWALK,STREET & ONTO CAR,SORB-ALL WAS APPLIED, WILL PICK UP & DISPOSE. END CallerRemark - 9011233

NY Hist Spills:

Region of Spill: 2
Spill Number: 9011233
Investigator: WILSON
Caller Name: Not reported
Caller Agency: Not reported
Caller Phone: Not reported
Notifier Name: Not reported
Notifier Agency: Not reported
Notifier Phone: Not reported
Spill Date/Time: 01/23/1991 11:40
Reported to Dept Date/Time: 01/23/91 12:07
SWIS: 60
Spiller Name: CASTLE OIL
Spiller Contact: Not reported
Spiller Phone: (212) 823-5800
Spiller Address: 290 LOCUST AVENUE
Spiller City,St,Zip: NEW YORK, N.Y. 10454
Spill Cause: Equipment Failure
Reported to Dept: On Land
Water Affected: Not reported
Spill Source: 08
Spill Notifier: Responsible Party
PBS Number: Not reported
Cleanup Ceased: 05/25/95
Cleanup Meets Std: True
Last Inspection: / /
Recommended Penalty: Penalty Not Recommended
Spiller Cleanup Dt: / /
Enforcement Date: / /
Invstgn Complete: / /
UST Involvement: False
Spill Class: Known release with minimal potential for fire or hazard. DEC Response.
Willing Responsible Party. Corrective action taken.
Spill Closed Dt: 05/25/95
Corrective Action Plan Submitted: / /
Date Region Sent Summary to Central Office: / /
Date Spill Entered In Computer Data File: 02/01/91
Date Spill Entered In Computer Data File: Not reported

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

410 EAST 153RD ST/BX (Continued)

EDR ID Number
EPA ID Number

Database(s)

S104495273

Update Date: 05/25/95
Is Updated: False
PBS Number: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate Failed Tank: Not reported
Gross Leak Rate: Not reported
Material Class Type: Petroleum
Quantity Spilled: 20
Unkonwn Quantity Spilled: False
Units: Gallons
Quantity Recovered: 0
Unkonwn Quantity Recovered: False
Material: #6 FUEL OIL
Class Type: #6 FUEL OIL
Times Material Entry In File: 2190
CAS Number: Not reported
Last Date: 19940728
DEC Remarks: Not reported
Remark: DELIVERY HOSE BURST DURING DELIVERY,SUSPECT FROZEN/PLUG FILL PIPE,OIL SPILLED TO SIDEWALK,STREET ONTO CAR,SORB-ALL WAS APPLIED, WILL PICK UP DISPOSE.

I35
SW
< 1/8
553 ft.

445 WEST 153RD ST
445 WEST 153RD ST
MANHATTEN, NY

NY Spills S104504193
NY Hist Spills N/A

Site 5 of 6 in cluster I

Relative:
Higher

Actual:
119 ft.

NY Spills:
Site ID: 275530
Facility Addr2: Not reported
Facility ID: 9712280
Spill Number: 9712280
Facility Type: ER
SWIS: 3101
Region of Spill: 2
Investigator: KSTANG
Referred To: Not reported
Spill Date: 02/03/98
Reported to Dept: 02/03/98
CID: 15
Spill Cause: Equipment Failure
Water Affected: Not reported
Spill Source: Commercial/Industrial
Spill Notifier: Responsible Party
Cleanup Ceased: / /
Cleanup Meets Std: False
Last Inspection: / /
Recommended Penalty: Penalty Not Recommended
UST Trust: False
Spill Class: Known release with minimal potential for fire or hazard. DEC Response.
Willing Responsible Party. Corrective action taken.
Spill Closed Dt: / /
Remediation Phase: 1
Date Entered In Computer: 02/03/98
Spill Record Last Update: 06/16/06
Spiller Name: Not reported

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

445 WEST 153RD ST (Continued)

EDR ID Number
EPA ID Number

Database(s)

S104504193

Spiller Company: LANGSAM PROPERTY SVCES
Spiller Address: Not reported
Spiller City,St,Zip: ZZ
Spiller Company: 001
Spiller Phone: Not reported
Contact Name: Not reported
Contact Phone: Not reported
DEC Region: 2
Program Number: 9712280
DER Facility ID: 224020
Site ID: 275530
Operable Unit ID: 1058657
Operable Unit: 01
Material ID: 326899
Material Code: 0001
Material Name: #2 Fuel Oil
Case No.: Not reported
Material FA: Petroleum
Quantity: 0.00
Units: Gallons
Recovered: 0.00
Resource Affected: Soil
Oxygenate: False
DEC Memo: Start DECRemark - 9712280 Prior to Sept, 2004 data translation this spill Lead
DEC Field was "MULQUEEN" WORKING ON GAS LINE TOOK SAMPLE WILL REMOVE SOIL.
1/29/99 - LANGSAM PROPERTY TRYING TO SELL AND CONTACTED DAWN JOHNSON AT HESS
REGARDING THESPILL REPORT. TOLD DAWN THAT THEY HAD ABANDONED FILL THAT NEEDED
INVESTIGATION. con ed e2mis notes 114551 Gas construction
crew excavating for a leaking gas service on the sidewalk found soil
contaminated with fuel oil. The oil is coming from an abandon fuel line on the
sidewalk. The gas crew is in the process of removing the soil and placing it
into 55 gallon drums. The soil will be removed to the district yard. The drums
will be labled and samples will be taken for oil finger print, pcb's and
tph. The fuel spill was not caued by Con Edison however we will have to clean
up the spill so we can continue our work. L.FARO 34079 update,78189,paul
lonseth, lab analysis indicates no pcb's present in sample. added resolved date
and stop date changed opn field. Logger Kenneth Heyman #96534 11/04/02
13:30 Update: This is a very old spill and it is difficult to get additional
information on this. Since this is a 3rd party spill and Paul Lonseth reported
that the lab results report non-hazardous I will CLODE this spill and remove
the resolve date. 06/16/06: This spill is transferred from Mike Mulqueen to
Mr. Koon Tang. END DECRemark - 9712280
Remarks: Start CallerRemark - 9712280 ABANDONED FUEL LINE UNDER SIDEWALK - CONTAMINATED
SOIL END CallerRemark - 9712280

NY Hist Spills:
Region of Spill: 2
Spill Number: 9712280
Investigator: MULQUEEN
Caller Name: Not reported
Caller Agency: Not reported
Caller Phone: Not reported
Notifier Name: Not reported
Notifier Agency: Not reported
Notifier Phone: Not reported
Spill Date/Time: 02/03/1998 12:15
Reported to Dept Date/Time: 02/03/98 14:03

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s)
EDR ID Number
EPA ID Number

445 WEST 153RD ST (Continued)

S104504193

SWIS: 62
Spiller Name: LANGSAM PROPERTY SVCES
Spiller Contact: Not reported
Spiller Phone: Not reported
Spiller Address: Not reported
Spiller City,St,Zip: Not reported
Spill Cause: Equipment Failure
Reported to Dept: On Land
Water Affected: Not reported
Spill Source: 01
Spill Notifier: Responsible Party
PBS Number: Not reported
Cleanup Ceased: / /
Cleanup Meets Std: False
Last Inspection: / /
Recommended Penalty: Penalty Not Recommended
Spiller Cleanup Dt: / /
Enforcement Date: / /
Invstgn Complete: / /
UST Involvement: False
Spill Class: Known release with minimal potential for fire or hazard. DEC Response.
Willing Responsible Party. Corrective action taken.
Spill Closed Dt: / /
Corrective Action Plan Submitted: / /
Date Region Sent Summary to Central Office: / /
Date Spill Entered In Computer Data File: 02/03/98
Date Spill Entered In Computer Data File: Not reported
Update Date: 01/29/99
Is Updated: False
PBS Number: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate Failed Tank: Not reported
Gross Leak Rate: Not reported
Material Class Type: Petroleum
Quantity Spilled: 0
Unkonwn Quantity Spilled: True
Units: Gallons
Quantity Recovered: 0
Unkonwn Quantity Recovered: False
Material: #2 FUEL OIL
Class Type: #2 FUEL OIL
Times Material Entry In File: 24464
CAS Number: Not reported
Last Date: 19941207
DEC Remarks: WORKING ON GAS LINE TOOK SAMPLE WILL REMOVE SOIL. 1/29/99 - LANGSAM PROPERTY TRYING TO SELL AND CONTACTED DAWN JOHNSON AT HESS REGARDING THE SPILL REPORT. TOLD DAWN THAT THEY HAD ABANDONED FILL THAT NEEDED INVESTIGATION.
Remark: ABANDONED FUEL LINE UNDER SIDEWALK - CONTAMINATED SOIL

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

EDR ID Number
EPA ID Number

I36
SW
< 1/8
553 ft.

153 STREET APTS.LLLC
445 W 153 ST
NY, NY 10031

AST **A100193956**
N/A

Relative:
Higher

Site 6 of 6 in cluster I

AST:

Actual:
119 ft.

AST:

Region: STATE
Facility Id: 2-328782
UTM X: 589212.36652
UTM Y: 4520396.28101
Expiration Date: 11/27/11
Renewal Date: / /
Total Capacity: 4000
Facility Type: Not reported
Site Type Name: Apartment Building/Office Building
Site Type Status: Active
Mailing Company: FRIEDMAN MANAGEMENT CORP.
Mailing Title: Not reported
Mailing Contact: ADAM STRYKER
Mailing Address: 225 WEST 34TH STREET
Mailing Address 2: SUITE 1305
Mailing City: NEW YORK
Mailing State: NY
Mailing Zip Code: 10122
Mailing Phone No: (212) 736-6888
Mailing Email: Not reported
Owner Title: MGR AGENT
Owner Name: ADAM STRYKER
Owner Address: C/O FRIEDMAN ,CORP. 225 WEST 34TH ST
Owner Address 2: Not reported
Owner State: NY
Owner Zip Code: 10122
Owner Phone: (212) 736-6888
Owner Company: FRIEDMAN MGMT.
Emergency Contact: ADAM STRYKER
Emergency Phone: (212) 736-6888
Operator: A. CASTRO
Operator Phone: (212) 368-2616
Owner City: NEW YORK]
Owner Sub Type: Corporate or Commercial
Program Type: PBS

Tank Number: 001
Tank Location Name: Aboveground - in contact with soil
Tank Status: In Service
Tank Model: Not reported
Pipe Model: Not reported
Active Status: Active
Install Date: / /
Capacity Gallons: 4000
Material Name: #2 Fuel Oil
Percentage: 100.00
Tank Type Name: Steel/Carbon Steel/Iron
Tank Internal Protection: None
Tank Internal Protection 1: None
Tank Internal Protection 2: Not reported
Pipe Location Name: No Piping

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

153 STREET APTS.LLLC (Continued)

EDR ID Number
EPA ID Number

Database(s)

A100193956

Pipe Type Name: Steel/Carbon Steel/Iron
Pipe External Protection 1: None
Pipe External Protection 2: Not reported
Tank Secondary Containment 1: None
Tank Secondary Containment 2: Not reported
Pipe Secondary Containment: Not reported
Tank Leak Detection 1: None
Tank Leak Detection 2: Not reported
Pipe Leak Detection 1: Exempt Suction Piping
Pipe Leak Detection 2: Not reported
Type Of Overfill Prevention 1: Product Level Gauge (A/G)
Type Of Overfill Prevention 2: Not reported
Dispenser Method: Suction
Spill Prevention: Not reported
Tightness Test Method: Testing Not Required
Date Tested: / /
Next Test Date: / /
Date Tank Closed: / /

J37
North
< 1/8
556 ft.

935 NICK C/O BEACH LANE MANAGEMENT, INC
935 SAINT NICHOLAS AVENUE
NEW YORK, NY 10032

AST U003383628
HIST AST N/A

Site 1 of 6 in cluster J

Relative:
Higher

AST:

Actual:
142 ft.

AST:

Region: STATE
Facility Id: 2-056537
UTM X: 589320.14307
UTM Y: 4520682.58043
Expiration Date: 02/18/12
Renewal Date: 10/30/01
Total Capacity: 5000
Facility Type: Not reported
Site Type Name: Apartment Building/Office Building
Site Type Status: Active
Mailing Company: 935 NICK
Mailing Title: Not reported
Mailing Contact: MARK SCHARFMAN
Mailing Address: C/O BEACH LANE MANAGEMENT, INC.
Mailing Address 2: 280 NO. CENTRAL PARK AVE., SUITE 210
Mailing City: HARTSDALE
Mailing State: NY
Mailing Zip Code: 10530
Mailing Phone No: (914) 997-2435
Mailing Email: Not reported
Owner Title: Not reported
Owner Name: Not reported
Owner Address: 280 NORTH CENTRAL PARK AVE., SUITE 210
Owner Address 2: Not reported
Owner State: NY
Owner Zip Code: 10530
Owner Phone: (914) 997-2435
Owner Company: 935 NICK C/O BEACH LANE MANAGEMENT, INC.
Emergency Contact: ROBERT BRYANT
Emergency Phone: (917) 237-8635

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s)
EDR ID Number
EPA ID Number

935 NICK C/O BEACH LANE MANAGEMENT, INC (Continued)

U003383628

Operator: HARVEY VINSON
Operator Phone: (212) 926-5327
Owner City: HARTSDALE
Owner Sub Type: Corporate or Commercial
Program Type: PBS

Tank Number: 001
Tank Location Name: Aboveground - in contact with soil
Tank Status: In Service
Tank Model: Not reported
Pipe Model: Not reported
Active Status: Active
Install Date: 04/08/16
Capacity Gallons: 5000
Material Name: #6 Fuel Oil
Percentage: 100.00
Tank Type Name: Steel/Carbon Steel/Iron
Tank Internal Protection: None
Tank Internal Protection 1: None
Tank Internal Protection 2: Not reported
Pipe Location Name: No Piping
Pipe Type Name: Galvanized Steel
Pipe External Protection 1: None
Pipe External Protection 2: Not reported
Tank Secondary Containment 1: None
Tank Secondary Containment 2: Not reported
Pipe Secondary Containment: Not reported
Tank Leak Detection 1: None
Tank Leak Detection 2: Not reported
Pipe Leak Detection 1: Exempt Suction Piping
Pipe Leak Detection 2: Not reported
Type Of Overfill Prevention 1: Product Level Gauge (A/G)
Type Of Overfill Prevention 2: Not reported
Dispenser Method: Suction
Spill Prevention: Not reported
Tightness Test Method: Testing Not Required
Date Tested: / /
Next Test Date: / /
Date Tank Closed: / /

HIST AST:

PBS Number: 2-056537
SWIS Code: 6201
Operator: HARVEY VINSON
Facility Phone: (212) 926-5327
Facility Addr2: 935 SAINT NICHOLAS AVENUE
Facility Type: APARTMENT BUILDING
Emergency: ROBERT BRYANT
Emergency Tel: (917) 237-8635
Old PBSNO: Not reported
Date Inspected: Not reported
Inspector: Not reported
Result of Inspection: Not reported
Owner Name: 935 NICK C/O BEACH LANE MANAGEMENT, INC.
Owner Address: 280 NORTH CENTRAL PARK AVE., SUITE 210
Owner City,St,Zip: HARTSDALE, NY 10530
Federal ID: Not reported

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

935 NICK C/O BEACH LANE MANAGEMENT, INC (Continued)

EDR ID Number
EPA ID Number

Database(s)

U003383628

Owner Tel:	(914) 997-2435
Owner Type:	Corporate/Commercial
Owner Subtype:	Not reported
Mailing Contact:	MARK SCHARFMAN
Mailing Name:	935 NICK
Mailing Address:	C/O BEACH LANE MANAGEMENT, INC.
Mailing Address 2:	280 NO. CENTRAL PARK AVE., SUITE 210
Mailing City,St,Zip:	HARTSDALE, NY 10530
Mailing Telephone:	(914) 997-2435
Owner Mark:	Second Owner
Facility Status:	1 - Active PBS facility, i.e. total capacity of the PBS tanks is greater than 1,100 gallons, regardless if Subpart 360-14 tanks exist or not at the facility.
Certification Flag:	False
Certification Date:	11/16/2001
Expiration:	02/18/2007
Renew Flag:	False
Renew Date:	20011030
Total Capacity:	5000
FAMT:	True
Facility Screen:	No Missing Data
Owner Screen:	No Missing Data
Tank Screen:	Minor Data Missing
Dead Letter:	False
CBS Number:	Not reported
Town or City:	NEW YORK CITY
County Code:	62
Town or City Code:	01
Region:	2
Tank ID:	001
Tank Location:	ABOVEGROUND
Tank Status:	In Service
Install Date:	Not reported
Capacity (Gal):	5000
Product Stored:	NOS 5 OR 6 FUEL OIL
Tank Type:	Steel/carbon steel
Tank Internal:	Not reported
Tank External:	Not reported
Pipe Location:	Not reported
Pipe Type:	GALVANIZED STEEL
Pipe Internal:	Not reported
Pipe External:	Not reported
Tank Containment:	Not reported
Leak Detection:	0
Overfill Protection:	4
Dispenser Method:	Suction
Date Tested:	Not reported
Next Test Date:	Not reported
Missing Data for Tank:	Minor Data Missing
Date Closed:	Not reported
Test Method:	Not reported
Deleted:	False
Updated:	False
SPDES Number:	Not reported
Lat/Long:	Not reported

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

38
South
< 1/8
560 ft.

385 EDGECOMB AVE
385 EDGECOMB AVE
MANHATTAN, NY

NY Spills
NY Hist Spills

EDR ID Number
EPA ID Number

S104495432
N/A

Relative:
Lower

Actual:
100 ft.

NY Spills:
Site ID: 269989
Facility Addr2: Not reported
Facility ID: 9403542
Spill Number: 9403542
Facility Type: ER
SWIS: 3101
Region of Spill: 2
Investigator: SMMARTIN
Referred To: Not reported
Spill Date: 06/13/94
Reported to Dept: 06/13/94
CID: 15
Spill Cause: Equipment Failure
Water Affected: Not reported
Spill Source: Institutional, Educational, Gov., Other
Spill Notifier: Other
Cleanup Ceased: 06/13/94
Cleanup Meets Std: True
Last Inspection: / /
Recommended Penalty: Penalty Not Recommended
UST Trust: False
Spill Class: Not reported
Spill Closed Dt: 06/13/94
Remediation Phase: 0
Date Entered In Computer: 07/25/94
Spill Record Last Update: 09/30/04
Spiller Name: Not reported
Spiller Company: UNKNOWN
Spiller Address: Not reported
Spiller City,St,Zip: NY
Spiller Company: 999
Spiller Phone: Not reported
Contact Name: Not reported
Contact Phone: Not reported
DEC Region: 2
Program Number: 9403542
DER Facility ID: 278617
Site ID: 269989
Operable Unit ID: 997290
Operable Unit: 01
Material ID: 383716
Material Code: 0002
Material Name: #4 Fuel Oil
Case No.: Not reported
Material FA: Petroleum
Quantity: 40.00
Units: Gallons
Recovered: 0.00
Resource Affected: Soil
Oxygenate: False
DEC Memo: Start DECRemark - 9403542 Prior to Sept, 2004 data translation this spill Lead
DEC Field was "MARTINKAT" END DECRemark - 9403542
Remarks: Start CallerRemark - 9403542 MALFUNCTIONS OF GAUGE- CLEANUP W/ABSORP.

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

385 EDGEComb AVE (Continued)

EDR ID Number
EPA ID Number

Database(s)

S104495432

6/13 3:35 CALLED ABC LEFT #.
ON SIDEWALK OVER FILLA AT VENT. END CallerRemark - 9403542

Site ID: 269990
Facility Addr2: Not reported
Facility ID: 9515044
Spill Number: 9515044
Facility Type: ER
SWIS: 3101
Region of Spill: 2
Investigator: SMMARTIN
Referred To: Not reported
Spill Date: 02/23/96
Reported to Dept: 02/23/96
CID: 15
Spill Cause: Equipment Failure
Water Affected: Not reported
Spill Source: Institutional, Educational, Gov., Other
Spill Notifier: Other
Cleanup Ceased: / /
Cleanup Meets Std: False
Last Inspection: / /
Recommended Penalty: Penalty Not Recommended
UST Trust: False
Spill Class: Known release with minimal potential for fire or hazard. DEC Response.
Willing Responsible Party. Corrective action taken.
Spill Closed Dt: 02/23/96
Remediation Phase: 0
Date Entered In Computer: 02/23/96
Spill Record Last Update: 03/14/96
Spiller Name: Not reported
Spiller Company: NO NAME
Spiller Address: 385 EDGEComb AVE
Spiller City,St,Zip: MANHATTEN, NY
Spiller Company: 001
Spiller Phone: Not reported
Contact Name: Not reported
Contact Phone: Not reported
DEC Region: 2
Program Number: 9515044
DER Facility ID: 219876
Site ID: 269990
Operable Unit ID: 1026149
Operable Unit: 01
Material ID: 355171
Material Code: 0002
Material Name: #4 Fuel Oil
Case No.: Not reported
Material FA: Petroleum
Quantity: 12.00
Units: Gallons
Recovered: 12.00
Resource Affected: Soil
Oxygenate: False
DEC Memo: Start DECRemark - 9515044 Prior to Sept, 2004 data translation this spill Lead
DEC Field was "MARTINKAT" 1) FROM PBS - OPERATOR, JOSE GARCIA (212) 368-5739 -
NO LONGER SUPER BUT WILL GO OUT AND CHECK IF SPILL HAS BEEN CLEANED - GAVE ME

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s)
EDR ID Number
EPA ID Number

385 EDGECOMB AVE (Continued)

S104495432

Remarks: #(212) 491-9113 SUPER - THEY SAID WRONG #. 2) CALLED JOE, AL EASTMOND DOING
CLEANUP. END DECRemark - 9515044
Start CallerRemark - 9515044 VENT ALARM FAILED - SPILL ON SIDE WALK BEING
CLEANED UP END CallerRemark - 9515044

[Click this hyperlink](#) while viewing on your computer to access
additional NY_SPILL: detail in the EDR Site Report.

NY Hist Spills:

Region of Spill: 2
Spill Number: 9403542
Investigator: MARTINKAT
Caller Name: Not reported
Caller Agency: Not reported
Caller Phone: Not reported
Notifier Name: Not reported
Notifier Agency: Not reported
Notifier Phone: Not reported
Spill Date/Time: 06/13/1994 15:26
Reported to Dept Date/Time: 06/13/94 15:26
SWIS: 62
Spiller Name: UNKNOWN
Spiller Contact: Not reported
Spiller Phone: Not reported
Spiller Address: Not reported
Spiller City,St,Zip: Not reported
Spill Cause: Equipment Failure
Reported to Dept: On Land
Water Affected: Not reported
Spill Source: 02
Spill Notifier: Other
PBS Number: Not reported
Cleanup Ceased: 06/13/94
Cleanup Meets Std: True
Last Inspection: / /
Recommended Penalty: Penalty Not Recommended
Spiller Cleanup Dt: / /
Enforcement Date: / /
Invstgn Complete: / /
UST Involvement: False
Spill Class: Not reported
Spill Closed Dt: 06/13/94
Corrective Action Plan Submitted: / /
Date Region Sent Summary to Central Office: / /
Date Spill Entered In Computer Data File: 07/25/94
Date Spill Entered In Computer Data File: Not reported
Update Date: / /
Is Updated: False
PBS Number: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate Failed Tank: Not reported
Gross Leak Rate: Not reported
Material Class Type: Petroleum
Quantity Spilled: 40
Unkonwn Quantity Spilled: False

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s)
EDR ID Number
EPA ID Number

385 EDGECOMB AVE (Continued)

S104495432

Units: Gallons
Quantity Recovered: 0
Unkonwn Quantity Recovered: False
Material: #4 FUEL OIL
Class Type: #4 FUEL OIL
Times Material Entry In File: 1751
CAS Number: Not reported
Last Date: 19941205
DEC Remarks: Not reported
Remark: MALFUNCTIONS OF GAUGE- CLEANUP W/ABSORP.
6/13 3:35 CALLED ABC LEFT . ON SIDEWALK OVER FILLA AT VENT.

Region of Spill: 2
Spill Number: 9515044
Investigator: MARTINKAT
Caller Name: Not reported
Caller Agency: Not reported
Caller Phone: Not reported
Notifier Name: Not reported
Notifier Agency: Not reported
Notifier Phone: Not reported
Spill Date/Time: 02/23/1996 09:50
Reported to Dept Date/Time: 02/23/96 10:05
SWIS: 62
Spiller Name: NO NAME
Spiller Contact: Not reported
Spiller Phone: Not reported
Spiller Address: 385 EDGECOMB AVE
Spiller City,St,Zip: MANHATTEN, NY
Spill Cause: Equipment Failure
Reported to Dept: On Land
Water Affected: Not reported
Spill Source: 02
Spill Notifier: Other
PBS Number: Not reported
Cleanup Ceased: / /
Cleanup Meets Std: False
Last Inspection: / /
Recommended Penalty: Penalty Not Recommended
Spiller Cleanup Dt: / /
Enforcement Date: / /
Invstgn Complete: / /
UST Involvement: False
Spill Class: Known release with minimal potential for fire or hazard. DEC Response.
Willing Responsible Party. Corrective action taken.
Spill Closed Dt: 02/23/96
Corrective Action Plan Submitted: / /
Date Region Sent Summary to Central Office: / /
Date Spill Entered In Computer Data File: 02/23/96
Date Spill Entered In Computer Data File: Not reported
Update Date: 03/14/96
Is Updated: False
PBS Number: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate Failed Tank: Not reported

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s)
EDR ID Number
EPA ID Number

385 EDGECOMB AVE (Continued)

S104495432

Gross Leak Rate: Not reported
Material Class Type: Petroleum
Quantity Spilled: 12
Unkonwn Quantity Spilled: False
Units: Gallons
Quantity Recovered: 12
Unkonwn Quantity Recovered: False
Material: #4 FUEL OIL
Class Type: #4 FUEL OIL
Times Material Entry In File: 1751
CAS Number: Not reported
Last Date: 19941205
DEC Remarks: 1) FROM PBS - OPERATOR, JOSE GARCIA 212) 368-5739 - NO LONGER SUPER BUT WILL
GO OUT AND CHECK IF SPILL HAS BEEN CLEANED - GAVE ME 212) 491-9113 SUPER -
THEY SAID WRONG . 2) CALLED JOE, AL EASTMOND DOING CLEANUP.
Remark: VENT ALARM FAILED - SPILL ON SIDE WALK BEING CLEANED UP

Region of Spill: 2
Spill Number: 9212757
Investigator: CAMMISA
Caller Name: Not reported
Caller Agency: Not reported
Caller Phone: Not reported
Notifier Name: Not reported
Notifier Agency: Not reported
Notifier Phone: Not reported
Spill Date/Time: 02/11/1993 12:30
Reported to Dept Date/Time: 02/11/93 13:38
SWIS: 62
Spiller Name: APT BLDG.
Spiller Contact: Not reported
Spiller Phone: (212) 283-3832
Spiller Address: 385 EDGECOMB AVE
Spiller City,St,Zip: Not reported
Spill Cause: Equipment Failure
Reported to Dept: On Land
Water Affected: Not reported
Spill Source: 01
Spill Notifier: Other
PBS Number: Not reported
Cleanup Ceased: 02/01/93
Cleanup Meets Std: True
Last Inspection: / /
Recommended Penalty: Penalty Not Recommended
Spiller Cleanup Dt: / /
Enforcement Date: / /
Invstgn Complete: / /
UST Involvement: False
Spill Class: Known release with minimal potential for fire or hazard. DEC Response.
Willing Responsible Party. Corrective action taken.
Spill Closed Dt: 02/01/93
Corrective Action Plan Submitted: / /
Date Region Sent Summary to Central Office: / /
Date Spill Entered In Computer Data File: 02/11/93
Date Spill Entered In Computer Data File: Not reported
Update Date: / /
Is Updated: False

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s)
EDR ID Number
EPA ID Number

385 EDGECOMB AVE (Continued)

S104495432

PBS Number: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate Failed Tank: Not reported
Gross Leak Rate: Not reported
Material Class Type: Petroleum
Quantity Spilled: 3
Unkonwn Quantity Spilled: False
Units: Gallons
Quantity Recovered: 0
Unkonwn Quantity Recovered: False
Material: #4 FUEL OIL
Class Type: #4 FUEL OIL
Times Material Entry In File: 1751
CAS Number: Not reported
Last Date: 19941205
DEC Remarks: Not reported
Remark: SUSPECT FAULTY PETROMETER-OIL CAME OUT VENT ONTO SIDEWALK-DRIVER CONTAINED W/
SPEEDI-DRI SPILL CLEANED-UP BY SPILL TEAM-AL EASTMOND TO DISPOSE WILL NOTIFY
NYCDEP

Region of Spill: 2
Spill Number: 9612833
Investigator: MARTINKAT
Caller Name: Not reported
Caller Agency: Not reported
Caller Phone: Not reported
Notifier Name: Not reported
Notifier Agency: Not reported
Notifier Phone: Not reported
Spill Date/Time: 01/29/1997 09:00
Reported to Dept Date/Time: 01/29/97 11:53
SWIS: 62
Spiller Name: T AND S TRUCKING
Spiller Contact: ROCKY VENUTO
Spiller Phone: (718) 499-2900
Spiller Address: 53 2ND AVE
Spiller City,St,Zip: BROOKLYN, NY 11215-
Spill Cause: Equipment Failure
Reported to Dept: On Land
Water Affected: Not reported
Spill Source: 01
Spill Notifier: Responsible Party
PBS Number: Not reported
Cleanup Ceased: / /
Cleanup Meets Std: False
Last Inspection: / /
Recommended Penalty: Penalty Not Recommended
Spiller Cleanup Dt: / /
Enforcement Date: / /
Invstgn Complete: / /
UST Involvement: False
Spill Class: Known release with minimal potential for fire or hazard. DEC Response.
Willing Responsible Party. Corrective action taken.
Spill Closed Dt: 01/29/97
Corrective Action Plan Submitted: / /

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s)
EDR ID Number
EPA ID Number

385 EDGECOMB AVE (Continued)

S104495432

Date Region Sent Summary to Central Office: / /
Date Spill Entered In Computer Data File: 01/29/97
Date Spill Entered In Computer Data File: Not reported
Update Date: 01/30/97
Is Updated: False
PBS Number: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate Failed Tank: Not reported
Gross Leak Rate: Not reported
Material Class Type: Petroleum
Quantity Spilled: 8
Unkonwn Quantity Spilled: False
Units: Gallons
Quantity Recovered: 8
Unkonwn Quantity Recovered: False
Material: #4 FUEL OIL
Class Type: #4 FUEL OIL
Times Material Entry In File: 1751
CAS Number: Not reported
Last Date: 19941205
DEC Remarks: Not reported
Remark: SPILL CAUSED BY FAULTY GAUGE. CLEANUP COMPLETE

[Click this hyperlink](#) while viewing on your computer to access additional NY_HIST_SPILL: detail in the EDR Site Report.

39
SW
< 1/8
564 ft.

449 WEST 153RD ST
449 WEST 153RD ST
NEW YORK, NY 10031

AST
HIST AST
U003390958
N/A

Relative:
Higher

AST:

AST:

Actual:
127 ft.

Region: STATE
Facility Id: 2-359556
UTM X: 589203.28108
UTM Y: 4520401.38938
Expiration Date: 08/28/12
Renewal Date: 04/05/02
Total Capacity: 2000
Facility Type: Not reported
Site Type Name: Apartment Building/Office Building
Site Type Status: Active
Mailing Company: LANGSAM PROPERTY SERVICES CORPORATION
Mailing Title: Not reported
Mailing Contact: MARIA MCCULLOUGH
Mailing Address: 1601 BRONXDALE AVENUE
Mailing Address 2: SUITE 201
Mailing City: BRONX
Mailing State: NY
Mailing Zip Code: 10462
Mailing Phone No: (718) 518-8000
Mailing Email: Not reported
Owner Title: ADM. ASST
Owner Name: MARIA MCCULLOUGH

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s)
EDR ID Number
EPA ID Number

449 WEST 153RD ST (Continued)

U003390958

Owner Address: 1601 BRONXDALE AV
Owner Address 2: Not reported
Owner State: NY
Owner Zip Code: 10022
Owner Phone: (718) 518-8000
Owner Company: 115 WEST 128TH STREET CORPORATION
Emergency Contact: CLIFF HILLE
Emergency Phone: (718) 518-8000
Operator: JUAM MADERA
Operator Phone: (347) 739-5345
Owner City: BRONX
Owner Sub Type: Corporate or Commercial
Program Type: PBS

Tank Number: 001
Tank Location Name: Aboveground - in contact with soil
Tank Status: In Service
Tank Model: Not reported
Pipe Model: Not reported
Active Status: Active
Install Date: 03/21/85
Capacity Gallons: 2000
Material Name: #2 Fuel Oil
Percentage: 100.00
Tank Type Name: Steel/Carbon Steel/Iron
Tank Internal Protection: None
Tank Internal Protection 1: None
Tank Internal Protection 2: Not reported
Pipe Location Name: No Piping
Pipe Type Name: Steel/Carbon Steel/Iron
Pipe External Protection 1: None
Pipe External Protection 2: Not reported
Tank Secondary Containment 1: None
Tank Secondary Containment 2: Not reported
Pipe Secondary Containment: Not reported
Tank Leak Detection 1: None
Tank Leak Detection 2: Not reported
Pipe Leak Detection 1: Exempt Suction Piping
Pipe Leak Detection 2: Not reported
Type Of Overfill Prevention 1: Product Level Gauge (A/G)
Type Of Overfill Prevention 2: Not reported
Dispenser Method: Suction
Spill Prevention: Not reported
Tightness Test Method: Testing Not Required
Date Tested: / /
Next Test Date: / /
Date Tank Closed: / /

HIST AST:

PBS Number: 2-359556
SWIS Code: 6201
Operator: EUGENE JOHNSON
Facility Phone: (212) 690-8520
Facility Addr2: 449 WEST 153RD ST
Facility Type: APARTMENT BUILDING
Emergency: JAMES LUCENTI
Emergency Tel: (718) 261-5346

Map ID
 Direction
 Distance
 Distance (ft.)
 Elevation Site

MAP FINDINGS

Database(s)
 EDR ID Number
 EPA ID Number

449 WEST 153RD ST (Continued)

U003390958

Old PBSNO: Not reported
 Date Inspected: Not reported
 Inspector: Not reported
 Result of Inspection: Not reported
 Owner Name: 115 WEST 128TH STREET CORPORATION
 Owner Address: 515 MADISON AVE , SUITE 905
 Owner City,St,Zip: NEW YORK, NY 10022
 Federal ID: Not reported
 Owner Tel: (212) 421-2173
 Owner Type: Corporate/Commercial
 Owner Subtype: Not reported
 Mailing Contact: Not reported
 Mailing Name: LANGSAM PROPERTY SERVICES CORPORATION
 Mailing Address: 1601 BRONXDALE AVENUE
 Mailing Address 2: Not reported
 Mailing City,St,Zip: BRONX, NY 10462
 Mailing Telephone: (718) 518-8000
 Owner Mark: First Owner
 Facility Status: 1 - Active PBS facility, i.e. total capacity of the PBS tanks is greater than 1,100 gallons, regardless if Subpart 360-14 tanks exist or not at the facility.

 Certification Flag: False
 Certification Date: 04/21/1998
 Expiration: 08/28/2002
 Renew Flag: False
 Renew Date: Not reported
 Total Capacity: 2000
 FAMT: True
 Facility Screen: No Missing Data
 Owner Screen: No Missing Data
 Tank Screen: Minor Data Missing
 Dead Letter: False
 CBS Number: Not reported
 Town or City: NEW YORK CITY
 County Code: 62
 Town or City Code: 01
 Region: 2

 Tank ID: 001
 Tank Location: ABOVEGROUND
 Tank Status: In Service
 Install Date: Not reported
 Capacity (Gal): 2000
 Product Stored: NOS 1,2, OR 4 FUEL OIL
 Tank Type: Steel/carbon steel
 Tank Internal: Not reported
 Tank External: Not reported
 Pipe Location: Not reported
 Pipe Type: STEEL/IRON
 Pipe Internal: Not reported
 Pipe External: Not reported
 Tank Containment: None
 Leak Detection: 0
 Overfill Protection: 4
 Dispenser Method: Suction
 Date Tested: Not reported
 Next Test Date: Not reported

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

449 WEST 153RD ST (Continued)

EDR ID Number
EPA ID Number

U003390958

Missing Data for Tank: Minor Data Missing
Date Closed: Not reported
Test Method: Not reported
Deleted: False
Updated: False
SPDES Number: Not reported
Lat/Long: Not reported

J40
North
< 1/8
634 ft.

938 ST NICHOLAS AV
MANHATTAN, NY

NY Spills
NY Hist Spills

S105140466
N/A

Site 2 of 6 in cluster J

Relative:
Higher

NY Spills:

Actual:
143 ft.

Site ID: 306446
Facility Addr2: Not reported
Facility ID: 0105627
Spill Number: 0105627
Facility Type: ER
SWIS: 3101
Region of Spill: 2
Investigator: JMROMMEL
Referred To: Not reported
Spill Date: 08/24/01
Reported to Dept: 08/24/01
CID: 15
Spill Cause: Human Error
Water Affected: Not reported
Spill Source: Private Dwelling
Spill Notifier: Other
Cleanup Ceased: / /
Cleanup Meets Std: False
Last Inspection: / /
Recommended Penalty: Penalty Not Recommended
UST Trust: False
Spill Class: Possible release with minimal potential for fire or hazard or Known release with no damage. DEC Response. Willing Responsible Party. Corrective action taken.
Spill Closed Dt: 08/28/01
Remediation Phase: 0
Date Entered In Computer: 08/24/01
Spill Record Last Update: 08/28/01
Spiller Name: FRANK AMATO
Spiller Company: Not reported
Spiller Address: 938 ST NICHOLAS AV
Spiller City,St,Zip: MANHATTAN, NY
Spiller Company: 001
Spiller Phone: (718) 222-8701
Contact Name: FRANK AMATO
Contact Phone: (718) 222-8701
DEC Region: 2
Program Number: 0105627
DER Facility ID: 247499
Site ID: 306446
Operable Unit ID: 843984
Operable Unit: 01
Material ID: 534083

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

(Continued)

S105140466

Material Code: 0002
Material Name: #4 Fuel Oil
Case No.: Not reported
Material FA: Petroleum
Quantity: 10.00
Units: Gallons
Recovered: 0.00
Resource Affected: Soil
Oxygenate: False
DEC Memo: Start DECRemark - 0105627 Prior to Sept, 2004 data translation this spill Lead
DEC Field was "ROMMEL" 08/24/01 Spoke to Tommy at BLT. Oil spilled out of
vent into a contained area - concrete floor and walls - no impact to soil or to
drains. Cleaned with speedy dri. Will return to celan with Orange
Biodegradable solvent. Closed. JMR END DECRemark - 0105627
Remarks: Start CallerRemark - 0105627 BROKEN GAUGE CAUSED TANK OVERFILL - CLEAN UP IN
PROGRESS END CallerRemark - 0105627

NY Hist Spills:

Region of Spill: 2
Spill Number: 0105627
Investigator: ROMMEL
Caller Name: Not reported
Caller Agency: Not reported
Caller Phone: Not reported
Notifier Name: Not reported
Notifier Agency: Not reported
Notifier Phone: Not reported
Spill Date/Time: 08/24/2001 14:30
Reported to Dept Date/Time: 08/24/01 14:34
SWIS: 62
Spiller Name: Not reported
Spiller Contact: FRANK AMATO
Spiller Phone: (718) 222-8701
Spiller Contact: FRANK AMATO
Spiller Phone: (718) 222-8701
Spiller Address: 938 ST NICHOLAS AV
Spiller City,St,Zip: MANHATTAN, NY
Spill Cause: Human Error
Reported to Dept: On Land
Water Affected: Not reported
Spill Source: 09
Spill Notifier: Other
PBS Number: Not reported
Cleanup Ceased: / /
Cleanup Meets Std: False
Last Inspection: / /
Recommended Penalty: Penalty Not Recommended
Spiller Cleanup Dt: / /
Enforcement Date: / /
Invstgn Complete: / /
UST Involvement: False
Spill Class: Possible release with minimal potential for fire or hazard or Known
release with no damage. DEC Response. Willing Responsible Party.
Corrective action taken.
Spill Closed Dt: 08/28/01
Corrective Action Plan Submitted: / /
Date Region Sent Summary to Central Office: / /

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

(Continued)

S105140466

Date Spill Entered In Computer Data File: 08/24/01
Date Spill Entered In Computer Data File: Not reported
Update Date: 08/28/01
Is Updated: False
PBS Number: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate Failed Tank: Not reported
Gross Leak Rate: Not reported
Material Class Type: Petroleum
Quantity Spilled: 10
Unkonwn Quantity Spilled: False
Units: Gallons
Quantity Recovered: 0
Unkonwn Quantity Recovered: True
Material: #4 FUEL OIL
Class Type: #4 FUEL OIL
Times Material Entry In File: 1751
CAS Number: Not reported
Last Date: 19941205
DEC Remarks: 08/24/01 Spoke to Tommy at BLT. Oil spilled out of vent into a contained area
- concrete floor and walls - no impact to soil or to drains. Cleaned with
speedy dri. Will return to celan with Orange Biodegradable solvent. Closed.
JMR
Remark: BROKEN GAUGE CAUSED TANK OVERFILL - CLEAN UP IN PROGRESS

J41
North
< 1/8
634 ft.

940 ST. NICHOLAS, LLC
940 ST. NICHOLAS AVENUE
NEW YORK, NY 10027

UST
HIST UST

U003178535
N/A

Site 3 of 6 in cluster J

Relative:
Higher

UST:

Actual:
143 ft.

UST:

Facility Id: 2-602910
Expiration Date: 12/15/09
Renewal Date: / /
Total Capacity: 6000
Facility Type: Not reported
Mailing Company: % J&M REALTY SERVICES CORP
Mailing Title: Not reported
Mailing Contact: 940 ST. NICHOLAS LLC
Mailing Address: 21 WEST 86TH STREET
Mailing Address 2: Not reported
Mailing City: NEW YORK
Mailing State: NY
Mailing Zip Code: 10024
Mailing Phone No: (212) 721-0424
Mailing Email: Not reported
Owner Title: AGENT FOR 940 ST. NICHOLAS, LLC
Owner Name: JERRY EDELMAN
Owner Address: C/O J&M REALTY SERVICES, 21 W. 86 STREET
Owner Address 2: Not reported
Owner State: NY
Owner Zip Code: 10024
Owner Phone: (212) 721-0424

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s) EDR ID Number
EPA ID Number

940 ST. NICHOLAS, LLC (Continued)

U003178535

Owner Company: 940 ST. NICHOLAS, LLC
Emergency Contact: J & M REALTY SERVICES
Emergency Phone: (212) 721-0424
Operator: J & M REALTY SERVICES
Operator Phone: (212) 721-0424
Owner City: NEW YORK
Owner Sub Type: Corporate or Commercial
UTM X: 589338.23871
UTM Y: 4520706.44727
Site Type Name: Apartment Building/Office Building
Site Type Status: Active
Comments: Not reported

Program Type: PBS

Tank Number: 001
Tank Location Name: Underground
Tank Status: In Service
Tank Model: Not reported
Pipe Model: Not reported
Active Status: Active
Install Date: / /
Capacity Gallons: 6000
Material Name: #4 Fuel Oil
Percentage: 100.00
Tank Type Name: Steel Tank Encased in Concrete
Tank Internal Protection: None
Tank Internal Protection 1: Jacketed
Tank Internal Protection 2: Not reported
Pipe Location Name: Aboveground
Pipe Type Name: Steel/Carbon Steel/Iron
Pipe External Protection 1: None
Pipe External Protection 2: Not reported
Tank Secondary Containment 1: Vault (w/o access)
Tank Secondary Containment 2: Not reported
Pipe Secondary Containment: None
Tank Leak Detection 1: None
Tank Leak Detection 2: Not reported
Pipe Leak Detection 1: None
Pipe Leak Detection 2: Not reported
Type Of Overfill Prevention 1: Vent Whistle
Type Of Overfill Prevention 2: Not reported
Dispenser Method: Suction
Spill Prevention: None
Tightness Test Method: Unknown
Date Tested: / /
Next Test Date: 12/27/87
Date Tank Closed: / /

HIST UST:

PBS Number: 2-602910
SPDES Number: Not reported
Emergency Contact: VITO SACCHETTI
Emergency Telephone: (718) 828-1111
Operator: VITO SACCHETTI
Operator Telephone: (718) 828-1111
Owner Name: MICHAEL SACCHETTI

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s) EDR ID Number
EPA ID Number

940 ST. NICHOLAS, LLC (Continued)

U003178535

Owner Address: 1466 ST. PETERS AVE.
Owner City,St,Zip: BRONX, NY 10461
Owner Telephone: (718) 828-1111
Owner Type: Corporate/Commercial
Owner Subtype: Not reported
Mailing Name: SACCHETTI & SON, INC.
Mailing Address: 1466 ST. PETERS AVENUE
Mailing Address 2: Not reported
Mailing City,St,Zip: BRONX, NY 10461
Mailing Contact: VITO SACCHETTI
Mailing Telephone: (718) 828-1111
Owner Mark: First Owner
Facility Status: 1 - Active PBS facility, i.e. total capacity of the PBS tanks is greater than 1,100 gallons, regardless if Subpart 360-14 tanks exist or not at the facility.

Facility Addr2: Not reported
SWIS ID: 6201
Old PBS Number: Not reported
Facility Type: APARTMENT BUILDING
Inspected Date: Not reported
Inspector: Not reported
Inspection Result: Not reported
Federal ID: Not reported
Certification Flag: False
Certification Date: 11/05/2001
Expiration Date: 01/17/2007
Renew Flag: False
Renewal Date: Not reported
Total Capacity: 5000
FAMT: True
Facility Screen: No Missing Data
Owner Screen: No Missing Data
Tank Screen: Minor Data Missing
Dead Letter: False
CBS Number: Not reported
Town or City: NEW YORK CITY
County Code: 62
Town or City: 01
Region: 2

Tank Id: 001
Tank Location: UNDERGROUND, VAULTED, WITH ACCESS
Tank Status: In Service
Install Date: Not reported
Capacity (gals): 5000
Product Stored: NOS 1,2, OR 4 FUEL OIL
Tank Type: Steel/carbon steel
Tank Internal: Not reported
Tank External: Not reported
Pipe Location: Not reported
Pipe Type: STEEL/IRON
Pipe Internal: Not reported
Pipe External: Not reported
Second Containment: Not reported
Leak Detection: Not reported
Overfill Prot: Product Level Gauge
Dispenser: Not reported

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

940 ST. NICHOLAS, LLC (Continued)

EDR ID Number
EPA ID Number

U003178535

Date Tested: Not reported
Next Test Date: Not reported
Missing Data for Tank: Minor Data Missing
Date Closed: Not reported
Test Method: Not reported
Deleted: False
Updated: True
Lat/long: Not reported

J42
North
< 1/8
634 ft.

938 ST. NICHOLAS AVE.
938 ST. NICHOLAS AVENUE
NEW YORK, NY 10032

AST A100178321
N/A

Site 4 of 6 in cluster J

Relative:
Higher

AST:

Actual:
143 ft.

AST:

Region: STATE
Facility Id: 2-606108
UTM X: 589304.72285
UTM Y: 4520680.46152
Expiration Date: 06/26/06
Renewal Date: / /
Total Capacity: 5000
Facility Type: Not reported
Site Type Name: Apartment Building/Office Building
Site Type Status: Active
Mailing Company: WAVECREST MANAGEMENT TEAM
Mailing Title: Not reported
Mailing Contact: NEIGHBORHOOD RESTORE HDFC
Mailing Address: 129-09 26TH AVENUE
Mailing Address 2: SUITE 301
Mailing City: FLUSHING
Mailing State: NY
Mailing Zip Code: 11354
Mailing Phone No: (718) 463-1200
Mailing Email: Not reported
Owner Title: Not reported
Owner Name: Not reported
Owner Address: 129-09 26TH AVENUE, SUITE 301
Owner Address 2: Not reported
Owner State: NY
Owner Zip Code: 11354
Owner Phone: (718) 463-1200
Owner Company: NEIGHBORHOOD RESTORE HDFC, % WAVECREST
Emergency Contact: PAUL MARTINEZ
Emergency Phone: (718) 463-1200
Operator: PAUL MARTINEZ
Operator Phone: (718) 463-1200
Owner City: FLUSHING
Owner Sub Type: Corporate or Commercial
Program Type: PBS

Tank Number: 01
Tank Location Name: Aboveground - in contact with soil
Tank Status: In Service
Tank Model: Not reported

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

938 ST. NICHOLAS AVE. (Continued)

EDR ID Number
EPA ID Number

Database(s)

A100178321

Pipe Model: Not reported
Active Status: Active
Install Date: / /
Capacity Gallons: 5000
Material Name: #2 Fuel Oil
Percentage: 100.00
Tank Type Name: Steel/Carbon Steel/Iron
Tank Internal Protection: None
Tank Internal Protection 1: None
Tank Internal Protection 2: Not reported
Pipe Location Name: Aboveground
Pipe Type Name: Steel/Carbon Steel/Iron
Pipe External Protection 1: None
Pipe External Protection 2: Not reported
Tank Secondary Containment 1: None
Tank Secondary Containment 2: Not reported
Pipe Secondary Containment: Not reported
Tank Leak Detection 1: None
Tank Leak Detection 2: Not reported
Pipe Leak Detection 1: Not reported
Pipe Leak Detection 2: Not reported
Type Of Overfill Prevention 1: Product Level Gauge (A/G)
Type Of Overfill Prevention 2: Vent Whistle
Dispenser Method: Not reported
Spill Prevention: Not reported
Tightness Test Method: Testing Not Required
Date Tested: / /
Next Test Date: / /
Date Tank Closed: / /

43
WSW
< 1/8
634 ft.

ABAX INC
444 W 153RD ST APT 51
NEW YORK, NY 10031

RCRA-SQG 1001961539
FINDS NYR000083261

Relative:
Higher

Actual:
141 ft.

RCRAInfo:
Owner: NYCHPD - HOUSING PRESERVATION & DEV
(212) 863-7764
EPA ID: NYR000083261
Contact: SWAVEK NASIADKA
(718) 784-2229
Classification: Small Quantity Generator
TSDF Activities: Not reported
Violation Status: No violations found

FINDS:
Other Pertinent Environmental Activity Identified at Site

RCRAInfo is a national information system that supports the Resource Conservation and Recovery Act (RCRA) program through the tracking of events and activities related to facilities that generate, transport, and treat, store, or dispose of hazardous waste. RCRAInfo allows RCRA program staff to track the notification, permit, compliance, and corrective action activities required under RCRA.

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

44
SSE
< 1/8
636 ft.

CHAMA HOLDING CORP
393 EDGEcombe AVE
MANHATTAN, NY 10031

AST
HIST AST

U003389072
N/A

Relative:
Lower

AST:

AST:

Actual:
89 ft.

Region: STATE
Facility Id: 2-285072
UTM X: 589396.96734
UTM Y: 4520473.56461
Expiration Date: 07/14/12
Renewal Date: 03/06/02
Total Capacity: 3000
Facility Type: Not reported
Site Type Name: Apartment Building/Office Building
Site Type Status: Active
Mailing Company: CHAMA HOLDING CORP
Mailing Title: Not reported
Mailing Contact: Not reported
Mailing Address: PO BOX 191024
Mailing Address 2: Not reported
Mailing City: BROOKLYN
Mailing State: NY
Mailing Zip Code: 11219
Mailing Phone No: (718) 972-5010
Mailing Email: Not reported
Owner Title: VP
Owner Name: SHIMON GREISMAN
Owner Address: PO BOX 191024
Owner Address 2: Not reported
Owner State: NY
Owner Zip Code: 11219
Owner Phone: (718) 972-5010
Owner Company: CHAMA HOLDING CORP
Emergency Contact: JOSE BENITEZ
Emergency Phone: (718) 972-5010
Operator: JOSE BENITEZ
Operator Phone: (718) 972-5010
Owner City: BROOKLYN
Owner Sub Type: Corporate or Commercial
Program Type: PBS

Tank Number: 001
Tank Location Name: Aboveground - in contact with soil
Tank Status: In Service
Tank Model: Not reported
Pipe Model: Not reported
Active Status: Active
Install Date: 01/01/45
Capacity Gallons: 3000
Material Name: #2 Fuel Oil
Percentage: 100.00
Tank Type Name: Steel/Carbon Steel/Iron
Tank Internal Protection: None
Tank Internal Protection 1: None
Tank Internal Protection 2: Not reported
Pipe Location Name: No Piping
Pipe Type Name: Steel/Carbon Steel/Iron

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s) EDR ID Number
EPA ID Number

CHAMA HOLDING CORP (Continued)

U003389072

Pipe External Protection 1: None
Pipe External Protection 2: Not reported
Tank Secondary Containment 1: Vault (w/o access)
Tank Secondary Containment 2: Not reported
Pipe Secondary Containment: Not reported
Tank Leak Detection 1: None
Tank Leak Detection 2: Not reported
Pipe Leak Detection 1: Exempt Suction Piping
Pipe Leak Detection 2: Not reported
Type Of Overfill Prevention 1: Product Level Gauge (A/G)
Type Of Overfill Prevention 2: Not reported
Dispenser Method: Suction
Spill Prevention: Not reported
Tightness Test Method: Testing Not Required
Date Tested: / /
Next Test Date: / /
Date Tank Closed: / /

HIST AST:

PBS Number: 2-285072
SWIS Code: 6201
Operator: VICTOR SERRANO
Facility Phone: (718) 972-5010
Facility Addr2: 393 EDGECOMBE AVE
Facility Type: APARTMENT BUILDING
Emergency: VICTOR SERRANO
Emergency Tel: (212) 491-2678
Old PBSNO: Not reported
Date Inspected: Not reported
Inspector: Not reported
Result of Inspection: Not reported
Owner Name: CHAMA HOLDING CORP
Owner Address: PO BOX 191024
Owner City,St,Zip: BROOKLYN, NY 11219
Federal ID: Not reported
Owner Tel: (718) 972-5010
Owner Type: Corporate/Commercial
Owner Subtype: Not reported
Mailing Contact: Not reported
Mailing Name: CHAMA HOLDING CORP
Mailing Address: PO BOX 191024
Mailing Address 2: Not reported
Mailing City,St,Zip: BROOKLYN, NY 11219
Mailing Telephone: (718) 972-5010
Owner Mark: First Owner
Facility Status: 1 - Active PBS facility, i.e. total capacity of the PBS tanks is greater than 1,100 gallons, regardless if Subpart 360-14 tanks exist or not at the facility.

Certification Flag: False
Certification Date: 07/07/1997
Expiration: 07/14/2002
Renew Flag: False
Renew Date: Not reported
Total Capacity: 3000
FAMT: True
Facility Screen: No Missing Data
Owner Screen: No Missing Data

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

CHAMA HOLDING CORP (Continued)

EDR ID Number
EPA ID Number

U003389072

Tank Screen: Minor Data Missing
Dead Letter: False
CBS Number: Not reported
Town or City: NEW YORK CITY
County Code: 62
Town or City Code: 01
Region: 2

Tank ID: 001
Tank Location: ABOVEGROUND
Tank Status: In Service
Install Date: Not reported
Capacity (Gal): 3000
Product Stored: NOS 1,2, OR 4 FUEL OIL
Tank Type: Steel/carbon steel
Tank Internal: Not reported
Tank External: Not reported
Pipe Location: Not reported
Pipe Type: STEEL/IRON
Pipe Internal: Not reported
Pipe External: Not reported
Tank Containment: Diking
Leak Detection: 0
Overfill Protection: 4
Dispenser Method: Suction
Date Tested: Not reported
Next Test Date: Not reported
Missing Data for Tank: Minor Data Missing
Date Closed: Not reported
Test Method: Not reported
Deleted: False
Updated: False
SPDES Number: Not reported
Lat/Long: Not reported

J45
North
< 1/8
637 ft.

465 WEST 157 STREET
465 WEST 157TH STREET
NEW YORK, NY 10032

AST A100183359
N/A

Relative:
Higher

Site 5 of 6 in cluster J

AST:

Actual:
144 ft.

AST:

Region: STATE
Facility Id: 2-606780
UTM X: 589295.98280
UTM Y: 4520698.89708
Expiration Date: 08/22/11
Renewal Date: / /
Total Capacity: 2500
Facility Type: Not reported
Site Type Name: Apartment Building/Office Building
Site Type Status: Active
Mailing Company: NYC/HPD/DAMP
Mailing Title: Not reported
Mailing Contact: ASST. COMMISSIONER/DAMP
Mailing Address: 100 GOLD STREET

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

465 WEST 157 STREET (Continued)

EDR ID Number
EPA ID Number

Database(s)

A100183359

Mailing Address 2: #7Z5
Mailing City: NEW YORK
Mailing State: NY
Mailing Zip Code: 10038
Mailing Phone No: (212) 863-7301
Mailing Email: Not reported
Owner Title: ASST COMMISSIONER DAMP
Owner Name: WILLA H. PADGETT
Owner Address: 100 GOLD ST., #7Z5
Owner Address 2: Not reported
Owner State: NY
Owner Zip Code: 10038
Owner Phone: (212) 863-7301
Owner Company: NYC/HPD/DAMP
Emergency Contact: 213/215 MOTT ST. H.D.F.C.
Emergency Phone: (646) 613-0908
Operator: ASST. COMM. DAMP
Operator Phone: (212) 863-7301
Owner City: NEW YORK
Owner Sub Type: Local Government
Program Type: PBS

Tank Number: 001
Tank Location Name: Aboveground - in contact with soil
Tank Status: In Service
Tank Model: Not reported
Pipe Model: Not reported
Active Status: Active
Install Date: / /
Capacity Gallons: 2500
Material Name: #2 Fuel Oil
Percentage: 100.00
Tank Type Name: Steel/Carbon Steel/Iron
Tank Internal Protection: None
Tank Internal Protection 1: Painted/Asphalt Coating
Tank Internal Protection 2: Not reported
Pipe Location Name: Aboveground/Underground Combination
Pipe Type Name: Steel/Carbon Steel/Iron
Pipe External Protection 1: None
Pipe External Protection 2: Not reported
Tank Secondary Containment 1: None
Tank Secondary Containment 2: Not reported
Pipe Secondary Containment: Not reported
Tank Leak Detection 1: None
Tank Leak Detection 2: Not reported
Pipe Leak Detection 1: Not reported
Pipe Leak Detection 2: Not reported
Type Of Overfill Prevention 1: Vent Whistle
Type Of Overfill Prevention 2: Not reported
Dispenser Method: Suction
Spill Prevention: Not reported
Tightness Test Method: Testing Not Required
Date Tested: / /
Next Test Date: / /
Date Tank Closed: / /

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

K46
SSW
< 1/8
648 ft.

853 ST. NICHOLAS REALTY CORP.
853 ST. NICHOLAS AVE
NEW YORK, NY 10031

AST
HIST AST **U003395557**
N/A

Site 1 of 3 in cluster K

Relative:
Equal

AST:

Actual:
111 ft.

AST:

Region: STATE
Facility Id: 2-600147
UTM X: 589229.07952
UTM Y: 4520325.20592
Expiration Date: 06/05/11
Renewal Date: 04/01/02
Total Capacity: 3500
Facility Type: Not reported
Site Type Name: Apartment Building/Office Building
Site Type Status: Active
Mailing Company: 853 ST. NICHOLAS REALTY CORP.
Mailing Title: Not reported
Mailing Contact: GARY B. RESNICK
Mailing Address: 998C OLD COUNTRY ROAD
Mailing Address 2: #303
Mailing City: PLAINVIEW
Mailing State: NY
Mailing Zip Code: 11803
Mailing Phone No: (631) 643-8707
Mailing Email: GRES@OPTONLINE.NET
Owner Title: AGENT
Owner Name: GARY B. RESNICK
Owner Address: 998C OLD COUNTRY ROAD, #303
Owner Address 2: Not reported
Owner State: NY
Owner Zip Code: 11803
Owner Phone: (631) 643-8707
Owner Company: 853 ST. NICHOLAS REALTY CORP
Emergency Contact: GARY B. RESNICK
Emergency Phone: (917) 560-3347
Operator: MARCELINO ABREU
Operator Phone: (917) 560-3346
Owner City: PLAINVIEW
Owner Sub Type: Corporate or Commercial
Program Type: PBS

Tank Number: 001
Tank Location Name: Aboveground on crib, rack, or cradle
Tank Status: In Service
Tank Model: Not reported
Pipe Model: Not reported
Active Status: Active
Install Date: / /
Capacity Gallons: 3500
Material Name: #2 Fuel Oil
Percentage: 100.00
Tank Type Name: Steel/Carbon Steel/Iron
Tank Internal Protection: Epoxy Liner
Tank Internal Protection 1: None
Tank Internal Protection 2: Not reported
Pipe Location Name: Aboveground

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s)
EDR ID Number
EPA ID Number

853 ST. NICHOLAS REALTY CORP. (Continued)

U003395557

Pipe Type Name: Steel/Carbon Steel/Iron
Pipe External Protection 1: None
Pipe External Protection 2: Not reported
Tank Secondary Containment 1: Vault (w/o access)
Tank Secondary Containment 2: Not reported
Pipe Secondary Containment: Not reported
Tank Leak Detection 1: None
Tank Leak Detection 2: Not reported
Pipe Leak Detection 1: Not reported
Pipe Leak Detection 2: Not reported
Type Of Overfill Prevention 1: Vent Whistle
Type Of Overfill Prevention 2: Not reported
Dispenser Method: Submersible
Spill Prevention: Not reported
Tightness Test Method: Testing Not Required
Date Tested: / /
Next Test Date: / /
Date Tank Closed: / /

HIST AST:

PBS Number: 2-600147
SWIS Code: 6201
Operator: JIMMY SIMMONS
Facility Phone: (212) 283-4305
Facility Addr2: 853 ST. NICHOLAS AVE
Facility Type: APARTMENT BUILDING
Emergency: GARY RESNICK
Emergency Tel: (212) 567-3399
Old PBSNO: Not reported
Date Inspected: Not reported
Inspector: Not reported
Result of Inspection: Not reported
Owner Name: 853 ST. NICHOLAS REALTY CORP
Owner Address: 232 SHERMAN AVENUE, #23
Owner City,St,Zip: NEW YORK, NY 10034
Federal ID: Not reported
Owner Tel: (212) 567-3399
Owner Type: Corporate/Commercial
Owner Subtype: Not reported
Mailing Contact: GARY RESNICK
Mailing Name: RESNICK & INTNER REALTY CO., LLC.
Mailing Address: 2 WEST 45TH STREET
Mailing Address 2: SUITE 900
Mailing City,St,Zip: NEW YORK, NY 10036
Mailing Telephone: (212) 567-3399
Owner Mark: First Owner
Facility Status: 1 - Active PBS facility, i.e. total capacity of the PBS tanks is greater than 1,100 gallons, regardless if Subpart 360-14 tanks exist or not at the facility.

Certification Flag: False
Certification Date: 06/20/1996
Expiration: 06/05/2001
Renew Flag: False
Renew Date: Not reported
Total Capacity: 3000
FAMT: True
Facility Screen: No Missing Data

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

853 ST. NICHOLAS REALTY CORP. (Continued)

EDR ID Number
EPA ID Number

Database(s)

U003395557

Owner Screen: No Missing Data
Tank Screen: No Missing Data
Dead Letter: False
CBS Number: Not reported
Town or City: NEW YORK CITY
County Code: 62
Town or City Code: 01
Region: 2

Tank ID: 001
Tank Location: ABOVEGROUND ON SADDLES LEGS, STILTS, RACK, OR CRADLE
Tank Status: In Service
Install Date: Not reported
Capacity (Gal): 3000
Product Stored: NOS 1,2, OR 4 FUEL OIL
Tank Type: Steel/carbon steel
Tank Internal: 1
Tank External: 1
Pipe Location: Underground
Pipe Type: STEEL/IRON
Pipe Internal: Epoxy Liner
Pipe External: 1
Tank Containment: Diking
Leak Detection: 0
Overfill Protection: 4
Dispenser Method: Suction
Date Tested: Not reported
Next Test Date: Not reported
Missing Data for Tank: No Missing Data
Date Closed: Not reported
Test Method: Not reported
Deleted: False
Updated: True
SPDES Number: Not reported
Lat/Long: Not reported

J47
North
1/8-1/4
662 ft.

RESIDENCE
943 ST NICHOLAS AVE
MANHATTAN, NY

LTANKS S104515028
HIST LTANKS N/A

Site 6 of 6 in cluster J

Relative:
Higher

LTANKS:

Actual:
146 ft.

Site ID: 114403
Spill Date: 10/09/98
Facility Addr2: Not reported
Facility ID: 9808544
Program Number: 9808544
SWIS: 3101
Region of Spill: 2
Investigator: WOOLSEY
Referred To: Not reported
Reported to Dept: 10/09/98
CID: 15
Spill Cause: Tank Overfill
Water Affected: Not reported
Spill Source: Private Dwelling
Spill Notifier: Responsible Party

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s)
EDR ID Number
EPA ID Number

RESIDENCE (Continued)

S104515028

Cleanup Ceased: / /
Cleanup Meets Standard: False
Last Inspection: / /
Recommended Penalty: Penalty Not Recommended
UST Involvement: False
Spill Class: Known release with minimal potential for fire or hazard. DEC Response.
Willing Responsible Party. Corrective action taken.
Spill Closed Dt: 10/09/98
Remediation Phase: 0
Date Entered In Computer: 10/09/98
Spill Record Last Update: 11/10/99
Spille Namer: JANET MATOS
Spiller Company: CASTLE OIL CO
Spiller Phone: (718) 579-3413
Spiller Extention: Not reported
Spiller Address: 290 LOCUST AVE
Spiller City,St,Zip: NEW YORK, NY
Spiller County: 001
Spiller Contact: KENNETH
Spiller Phone: (212) 491-9579
Spiller Extention: Not reported
DEC Region: 2
Program Number: 9808544
DER Facility ID: 99775
Site ID: 114403
Operable Unit ID: 1069731
Operable Unit: 01
Material ID: 316043
Material Code: 0001
Material Name: #2 Fuel Oil
Case No.: Not reported
Material FA: Petroleum
Quantity: 5.00
Units: Gallons
Recovered: 0.00
Resource Affected: Soil
Oxygenate: False
Site ID: Not reported
Spill Tank Test: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate: Not reported
Gross Fail: Not reported
Modified By: Not reported
Last Modified: Not reported
Test Method: Not reported
DEC Memo: Not reported
Remarks: Start CallerRemark - 9808544 SPILL HAS BEEN CONTAINED FOR CLEANUP. END
CallerRemark - 9808544

HIST LTANKS:
Region of Spill: 2
Spill Number: 9808544
Investigator: WOOLSEY
Caller Name: Not reported
Caller Agency: Not reported

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s)
EDR ID Number
EPA ID Number

RESIDENCE (Continued)

S104515028

Caller Phone: Not reported
Caller Extension: Not reported
Notifier Name: Not reported
Notifier Agency: Not reported
Notifier Phone: Not reported
Notifier Extension: Not reported
Spill Date: 10/09/1998
Spill Time: 12:52
Reported to Department Date: 10/09/98
Reported to Department Time: 12:55
SWIS: 62
Spiller Contact: KENNETH
Spiller Phone: (212) 491-9579
Spiller Extension: Not reported
Spiller Name: CASTLE OIL CO
Spiller Address: 290 LOCUST AVE
Spiller City,St,Zip: BRONX, NY
Facility Contact: JANET MATOS
Facility Phone: (718) 579-3413
Facility Extension: Not reported
Spill Cause: Tank Overfill
Resource Affectd: On Land
Water Affected: Not reported
Spill Source: Private Dwelling
Spill Notifier: Responsible Party
PBS Number: Not reported
Cleanup Ceased: / /
Cleanup Meets Standard: False
Last Inspection: / /
Recommended Penalty: Penalty Not Recommended
Spiller Cleanup Date: / /
Enforcement Date: / /
Investigation Complete: / /
UST Involvement: False
Spill Class: Known release with minimal potential for fire or hazard. DEC Response.
Willing Responsible Party. Corrective action taken.
Spill Closed Dt: 10/09/98
Date Region Sent Summary to Central Office: / /
Corrective Action Plan Submitted: / /
Date Spill Entered In Computer Data File: 10/09/98
Time Spill Entered In Computer Data File: Not reported
Spill Record Last Update: 11/10/99
Is Updated: False
PBS Number: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate Failed Tank: Not reported
Gross Leak Rate: Not reported
Material Class Type: Petroleum
Quantity Spilled: 5
Unkonwn Quantity Spilled: False
Units: Gallons
Quantity Recovered: 0
Unkonwn Quantity Recovered: True
Material: #2 FUEL OIL
Class Type: #2 FUEL OIL

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

RESIDENCE (Continued)

EDR ID Number
EPA ID Number

Database(s)

S104515028

Times Material Entry In File: 24464
CAS Number: Not reported
Last Date: 19941207
DEC Remarks: ONLY ABOUT 2 GALS. ON SIDEWALK. NO SEWERS AFFECTED, THEY WILL RECOVER ENTIRE AMOUNT.
Spill Cause: SPILL HAS BEEN CONTAINED FOR CLEANUP.

L48
WNW
1/8-1/4
685 ft.

CONSOLIDATED EDISON
W 155TH ST / AMSTERDAM AVE
NEW YORK, NY 10032

NY MANIFEST 1009239629
N/A

Site 1 of 3 in cluster L

Relative:
Higher

NY MANIFEST:

Actual:
147 ft.

Document ID: NYE0512514
Manifest Status: Not reported
Trans1 State ID: NYD006982359
Trans2 State ID: Not reported
Generator Ship Date: 10/02/2000
Trans1 Recv Date: 10/02/2000
Trans2 Recv Date: Not reported
TSD Site Recv Date: 10/03/2000
Part A Recv Date: Not reported
Part B Recv Date: Not reported
Generator EPA ID: NYP004063665
Trans1 EPA ID: NYD077444263
Trans2 EPA ID: Not reported
TSD ID: 20408AD
Waste Code: B007 - OTHER MISCELLANEOUS PCB WASTES
Quantity: 00204
Units: K - Kilograms (2.2 pounds)
Number of Containers: 003
Container Type: DM - Metal drums, barrels
Handling Method: L Landfill.
Specific Gravity: 01.00
Year: 00
Manifest Tracking Num: Not reported
Import Ind: Not reported
Export Ind: Not reported
Discr Quantity Ind: Not reported
Discr Type Ind: Not reported
Discr Residue Ind: Not reported
Discr Partial Reject Ind: Not reported
Discr Full Reject Ind: Not reported
Manifest Ref Num: Not reported
Alt Fac RCRA Id: Not reported
Alt Fac Sign Date: Not reported
Mgmt Method Type Code: Not reported
EPA ID: NYP004063665
Facility Name: CONSOLIDATED EDISON
Facility Address: W 155TH ST & AMSTERDAM AVE
Facility City: NEW YORK
Facility Address 2: Not reported
Country: USA
County: NE
Mailing Name: CONSOLIDATED EDISON
Mailing Contact: FRANKLIN MURRAY
Mailing Address: 4 IRVING PLACE RM 828

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s)
EDR ID Number
EPA ID Number

CONSOLIDATED EDISON (Continued)

1009239629

Mailing Address 2: Not reported
Mailing City: NEW YORK
Mailing State: NY
Mailing Zip: Not reported
Mailing Zip4: Not reported
Mailing Country: USA
Mailing Phone: 212-460-2808

Document ID: NYE0683163
Manifest Status: Not reported
Trans1 State ID: NYD006982359
Trans2 State ID: Not reported
Generator Ship Date: 09/29/2000
Trans1 Recv Date: 09/29/2000
Trans2 Recv Date: Not reported
TSD Site Recv Date: 10/02/2000
Part A Recv Date: Not reported
Part B Recv Date: Not reported
Generator EPA ID: NYP004063665
Trans1 EPA ID: NYD077444263
Trans2 EPA ID: Not reported
TSD ID: 20408AD
Waste Code: B007 - OTHER MISCELLANEOUS PCB WASTES
Quantity: 00218
Units: K - Kilograms (2.2 pounds)
Number of Containers: 003
Container Type: DM - Metal drums, barrels
Handling Method: L Landfill.
Specific Gravity: 01.00
Year: 00
Manifest Tracking Num: Not reported
Import Ind: Not reported
Export Ind: Not reported
Discr Quantity Ind: Not reported
Discr Type Ind: Not reported
Discr Residue Ind: Not reported
Discr Partial Reject Ind: Not reported
Discr Full Reject Ind: Not reported
Manifest Ref Num: Not reported
Alt Fac RCRA Id: Not reported
Alt Fac Sign Date: Not reported
Mgmt Method Type Code: Not reported
EPA ID: NYP004063665
Facility Name: CONSOLIDATED EDISON
Facility Address: W 155TH ST & AMSTERDAM AVE
Facility City: NEW YORK
Facility Address 2: Not reported
Country: USA
County: NE
Mailing Name: CONSOLIDATED EDISON
Mailing Contact: FRANKLIN MURRAY
Mailing Address: 4 IRVING PLACE RM 828
Mailing Address 2: Not reported
Mailing City: NEW YORK
Mailing State: NY
Mailing Zip: Not reported
Mailing Zip4: Not reported

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

CONSOLIDATED EDISON (Continued)

EDR ID Number
EPA ID Number

Database(s)

1009239629

Mailing Country: USA
Mailing Phone: 212-460-2808

L49
WNW
1/8-1/4
685 ft.

1920 AMSTERDAM AVE.
1920 AMSTERDAM AVENUE
NEW YORK, NY 10032

UST U004045138
N/A

Site 2 of 3 in cluster L

Relative:
Higher

UST:

Actual:
147 ft.

UST:

Facility Id: 2-608843
Expiration Date: 04/14/08
Renewal Date: / /
Total Capacity: 16000
Facility Type: Not reported
Mailing Company: EMPIRE STATE FUEL OIL
Mailing Title: Not reported
Mailing Contact: KENNETH REED
Mailing Address: 1640 MCDONALD AVENUE
Mailing Address 2: Not reported
Mailing City: BROOKLYN
Mailing State: NY
Mailing Zip Code: 11230
Mailing Phone No: (718) 627-5100
Mailing Email: Not reported
Owner Title: Not reported
Owner Name: Not reported
Owner Address: 107-109 EAST 126 ST.
Owner Address 2: Not reported
Owner State: NY
Owner Zip Code: 10035
Owner Phone: (212) 996-0200
Owner Company: MARION SCOTT REAL ESTATE A/A/F DUNWELL PLAZA
Emergency Contact: CARMEN ROLON
Emergency Phone: (212) 996-0200
Operator: FRED DELAHOSE
Operator Phone: (917) 788-6372
Owner City: NEW YORK
Owner Sub Type: Corporate or Commercial
UTM X: 589122.21172
UTM Y: 4520605.53599
Site Type Name: Apartment Building/Office Building
Site Type Status: Active
Comments: Not reported

Program Type: PBS

Tank Number: 001
Tank Location Name: Underground
Tank Status: In Service
Tank Model: Not reported
Pipe Model: Not reported
Active Status: Active
Install Date: / /
Capacity Gallons: 16000
Material Name: #2 Fuel Oil

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

1920 AMSTERDAM AVE. (Continued)

EDR ID Number
EPA ID Number

Database(s)

U004045138

Percentage: 100.00
Tank Type Name: Steel/Carbon Steel/Iron
Tank Internal Protection: None
Tank Internal Protection 1: None
Tank Internal Protection 2: Not reported
Pipe Location Name: Aboveground/Underground Combination
Pipe Type Name: Steel/Carbon Steel/Iron
Pipe External Protection 1: None
Pipe External Protection 2: Not reported
Tank Secondary Containment 1: None
Tank Secondary Containment 2: Not reported
Pipe Secondary Containment: Not reported
Tank Leak Detection 1: None
Tank Leak Detection 2: Not reported
Pipe Leak Detection 1: Exempt Suction Piping
Pipe Leak Detection 2: Not reported
Type Of Overfill Prevention 1: Product Level Gauge (A/G)
Type Of Overfill Prevention 2: Vent Whistle
Dispenser Method: Suction
Spill Prevention: Not reported
Tightness Test Method: Unknown
Date Tested: / /
Next Test Date: 12/27/87
Date Tank Closed: / /

K50 849 ST NICHOLAS AVENUE
SSW 849 ST. NICHOLAS AVENUE
1/8-1/4 NEW YORK, NY 10031
686 ft.

UST U003835976
HIST UST N/A

Site 2 of 3 in cluster K

Relative:
Lower

UST:

Actual:
110 ft.

UST:

Facility Id: 2-606764
Expiration Date: 08/21/06
Renewal Date: / /
Total Capacity: 3000
Facility Type: Not reported
Mailing Company: NYC/HPD/DAMP
Mailing Title: Not reported
Mailing Contact: ASST. COMMISSIONER/DAMP
Mailing Address: 100 GOLD STREET
Mailing Address 2: #7Z5
Mailing City: NEW YORK
Mailing State: NY
Mailing Zip Code: 10038
Mailing Phone No: (212) 863-7301
Mailing Email: Not reported
Owner Title: Not reported
Owner Name: Not reported
Owner Address: 100 GOLD ST., #7Z5
Owner Address 2: Not reported
Owner State: NY
Owner Zip Code: 10038
Owner Phone: (212) 863-7301
Owner Company: NYC/HPD/DAMP
Emergency Contact: 213/215 MOTT ST. H.D.F.C.

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s) EDR ID Number
EPA ID Number

849 ST NICHOLAS AVENUE (Continued)

U003835976

Emergency Phone: (646) 613-0908
Operator: ASST. COMMISSIONER/DAMP
Operator Phone: (212) 863-7301
Owner City: NEW YORK
Owner Sub Type: Local Government
UTM X: 589188.73750
UTM Y: 4520292.02657
Site Type Name: Apartment Building/Office Building
Site Type Status: Active
Comments: Not reported

Program Type: PBS

Tank Number: 001
Tank Location Name: Underground
Tank Status: In Service
Tank Model: Not reported
Pipe Model: Not reported
Active Status: Active
Install Date: / /
Capacity Gallons: 3000
Material Name: Gasoline
Percentage: 100.00
Tank Type Name: Steel/Carbon Steel/Iron
Tank Internal Protection: None
Tank Internal Protection 1: Painted/Asphalt Coating
Tank Internal Protection 2: Not reported
Pipe Location Name: Aboveground/Underground Combination
Pipe Type Name: Steel/Carbon Steel/Iron
Pipe External Protection 1: None
Pipe External Protection 2: Not reported
Tank Secondary Containment 1: None
Tank Secondary Containment 2: Not reported
Pipe Secondary Containment: Not reported
Tank Leak Detection 1: None
Tank Leak Detection 2: Not reported
Pipe Leak Detection 1: Not reported
Pipe Leak Detection 2: Not reported
Type Of Overfill Prevention 1: Vent Whistle
Type Of Overfill Prevention 2: Not reported
Dispenser Method: Suction
Spill Prevention: Not reported
Tightness Test Method: Unknown
Date Tested: / /
Next Test Date: 12/27/87
Date Tank Closed: / /

HIST UST:

PBS Number: 2-606764
SPDES Number: Not reported
Emergency Contact: ASST. COMMISSIONER/DAMP
Emergency Telephone: (212) 863-7301
Operator: ASST. COMMISSIONER/DAMP
Operator Telephone: (212) 863-7301
Owner Name: NYC/HPD/DAMP
Owner Address: 100 GOLD ST., #7Z5
Owner City,St,Zip: NEW YORK, NY 10038

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

849 ST NICHOLAS AVENUE (Continued)

EDR ID Number
EPA ID Number

Database(s)

U003835976

Owner Telephone: (212) 863-7301
Owner Type: Local Government
Owner Subtype: Not reported
Mailing Name: NYC/HPD/DAMP
Mailing Address: 100 GOLD STREET
Mailing Address 2: #7Z5
Mailing City,St,Zip: NEW YORK, NY 10038
Mailing Contact: ASST. COMMISSIONER/DAMP
Mailing Telephone: (212) 863-7301
Owner Mark: First Owner
Facility Status: 1 - Active PBS facility, i.e. total capacity of the PBS tanks is greater than 1,100 gallons, regardless if Subpart 360-14 tanks exist or not at the facility.

Facility Addr2: Not reported
SWIS ID: 6201
Old PBS Number: Not reported
Facility Type: APARTMENT BUILDING
Inspected Date: Not reported
Inspector: Not reported
Inspection Result: Not reported
Federal ID: Not reported
Certification Flag: False
Certification Date: 08/24/2001
Expiration Date: 08/21/2006
Renew Flag: False
Renewal Date: Not reported
Total Capacity: 3000
FAMT: True
Facility Screen: No Missing Data
Owner Screen: No Missing Data
Tank Screen: Minor Data Missing
Dead Letter: False
CBS Number: Not reported
Town or City: NEW YORK CITY
County Code: 62
Town or City: 01
Region: 2

Tank Id: 001
Tank Location: UNDERGROUND
Tank Status: In Service
Install Date: Not reported
Capacity (gals): 3000
Product Stored: UNLEADED GASOLINE
Tank Type: Steel/carbon steel
Tank Internal: None
Tank External: Painted/Asphalt Coating
Pipe Location: Aboveground/Underground Combination
Pipe Type: STEEL/IRON
Pipe Internal: None
Pipe External: None
Second Containment: Not reported
Leak Detection: None
Overfill Prot: Vent Whistle
Dispenser: Suction
Date Tested: Not reported
Next Test Date: 12/27/1987

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

849 ST NICHOLAS AVENUE (Continued)

EDR ID Number
EPA ID Number

Database(s)

U003835976

Missing Data for Tank: Minor Data Missing
Date Closed: Not reported
Test Method: Not reported
Deleted: False
Updated: True
Lat/long: Not reported

**51
ESE
1/8-1/4
698 ft.**

**NYCTA - 155TH ST SUBSTATION
155TH ST & BRADHURST AVE
NEW YORK, NY 10039**

**RCRA-SQG
FINDS**

**1000890214
NY0000277749**

**Relative:
Lower**

RCRAInfo:
Owner: NEW YORK CITY TRANSIT AUTHORITY
(718) 330-4581
EPA ID: NY0000277749
Contact: Not reported
Classification: Small Quantity Generator
TSDF Activities: Not reported
Violation Status: No violations found

**Actual:
19 ft.**

FINDS:

Other Pertinent Environmental Activity Identified at Site

RCRAInfo is a national information system that supports the Resource Conservation and Recovery Act (RCRA) program through the tracking of events and activities related to facilities that generate, transport, and treat, store, or dispose of hazardous waste. RCRAInfo allows RCRA program staff to track the notification, permit, compliance, and corrective action activities required under RCRA.

**M52
WNW
1/8-1/4
702 ft.**

**NYCHA - AUDUBON HOUSES
1909 AMSTERDAM AVE
NEW YORK, NY 10032**

**RCRA-SQG
FINDS**

**1004762900
NYR000101600**

Site 1 of 2 in cluster M

**Relative:
Higher**

RCRAInfo:
Owner: NYCHA
(718) 707-5731
EPA ID: NYR000101600
Contact: ANTHONY SOLOMITA
(718) 707-5731
Classification: Small Quantity Generator
TSDF Activities: Not reported

**Actual:
147 ft.**

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

NYCHA - AUDUBON HOUSES (Continued)

EDR ID Number
EPA ID Number

Database(s)

1004762900

Violation Status: No violations found

FINDS:

Other Pertinent Environmental Activity Identified at Site

FIS (New York - Facility Information System) is New York's Department of Environmental Conservation (DEC) information system for tracking environmental facility information found across the State.

RCRAInfo is a national information system that supports the Resource Conservation and Recovery Act (RCRA) program through the tracking of events and activities related to facilities that generate, transport, and treat, store, or dispose of hazardous waste. RCRAInfo allows RCRA program staff to track the notification, permit, compliance, and corrective action activities required under RCRA.

M53
WNW
1/8-1/4
702 ft.

AUDUBON HOUSES
1909 AMSTERDAM AVENUE
NEW YORK, NY 10032

UST
LTANKS
HIST UST
HIST LTANKS

U001840710
N/A

Site 2 of 2 in cluster M

Relative:
Higher

UST:

Actual:
147 ft.

UST:

Facility Id: 2-474819
Expiration Date: 03/28/09
Renewal Date: / /
Total Capacity: 12000
Facility Type: Not reported
Mailing Company: NEW YORK CITY HOUSING AUTHORITY
Mailing Title: Not reported
Mailing Contact: FUEL OIL REMEDIATION COORDINATOR
Mailing Address: 23-02 49TH AVENUE
Mailing Address 2: Not reported
Mailing City: LONG ISLAND CITY
Mailing State: NY
Mailing Zip Code: 11101
Mailing Phone No: (718) 707-5725
Mailing Email: Not reported
Owner Title: FUEL OIL REMEDIATION COORD.
Owner Name: FUEL OIL REMEDIATION COORD.
Owner Address: 23-02 49TH AVE
Owner Address 2: Not reported
Owner State: NY
Owner Zip Code: 11101
Owner Phone: (718) 707-5725
Owner Company: NYC HOUSING AUTHORITY
Emergency Contact: EMERGENCY SERVICE DEPT.
Emergency Phone: (718) 707-5725
Operator: FUEL OIL REM. COORD.
Operator Phone: (718) 707-5725
Owner City: LONG ISLAND CITY
Owner Sub Type: NYC Housing Authority (Local Government)
UTM X: 589143.09833
UTM Y: 4520566.53164
Site Type Name: Apartment Building/Office Building

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

AUDUBON HOUSES (Continued)

EDR ID Number
EPA ID Number

Database(s)

U001840710

Site Type Status: Active
Comments: Not reported

Program Type: PBS

Tank Number: 1
Tank Location Name: Underground
Tank Status: In Service
Tank Model: Not reported
Pipe Model: Not reported
Active Status: Active
Install Date: 01/01/94
Capacity Gallons: 12000
Material Name: #2 Fuel Oil
Percentage: 100.00
Tank Type Name: Fiberglass Coated Steel
Tank Internal Protection: None
Tank Internal Protection 1: Jacketed
Tank Internal Protection 2: Not reported
Pipe Location Name: Underground/On-ground
Pipe Type Name: Steel/Carbon Steel/Iron
Pipe External Protection 1: Original Sacrificial Anode
Pipe External Protection 2: Not reported
Tank Secondary Containment 1: Double-Walled (Underground)
Tank Secondary Containment 2: Not reported
Pipe Secondary Containment: Not reported
Tank Leak Detection 1: Interstitial - Electronic Monitoring
Tank Leak Detection 2: Not reported
Pipe Leak Detection 1: Exempt Suction Piping
Pipe Leak Detection 2: Not reported
Type Of Overfill Prevention 1: High Level Alarm
Type Of Overfill Prevention 2: Not reported
Dispenser Method: Suction
Spill Prevention: Not reported
Tightness Test Method: Testing Not Required
Date Tested: / /
Next Test Date: / /
Date Tank Closed: / /

Tank Number: OLD 1
Tank Location Name: Underground
Tank Status: Closed - Removed
Tank Model: Not reported
Pipe Model: Not reported
Active Status: Inactive
Install Date: 04/01/62
Capacity Gallons: 12000
Material Name: #2 Fuel Oil
Percentage: 100.00
Tank Type Name: Steel/Carbon Steel/Iron
Tank Internal Protection: None
Tank Internal Protection 1: None
Tank Internal Protection 2: Not reported
Pipe Location Name: No Piping
Pipe Type Name: Steel/Carbon Steel/Iron
Pipe External Protection 1: Wrapped

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s)
EDR ID Number
EPA ID Number

AUDUBON HOUSES (Continued)

U001840710

Pipe External Protection 2: Not reported
Tank Secondary Containment 1: None
Tank Secondary Containment 2: Not reported
Pipe Secondary Containment: Not reported
Tank Leak Detection 1: None
Tank Leak Detection 2: Not reported
Pipe Leak Detection 1: Not reported
Pipe Leak Detection 2: Not reported
Type Of Overfill Prevention 1: Product Level Gauge (A/G)
Type Of Overfill Prevention 2: Not reported
Dispenser Method: Suction
Spill Prevention: Not reported
Tightness Test Method: Testing Not Required
Date Tested: / /
Next Test Date: / /
Date Tank Closed: 04/01/94

LTANKS:

Site ID: 80798
Spill Date: 12/06/93
Facility Addr2: Not reported
Facility ID: 9310784
Program Number: 9310784
SWIS: 3101
Region of Spill: 2
Investigator: HEALY
Referred To: Not reported
Reported to Dept: 12/06/93
CID: 15
Spill Cause: Tank Failure
Water Affected: Not reported
Spill Source: Institutional, Educational, Gov., Other
Spill Notifier: Responsible Party
Cleanup Ceased: 05/01/95
Cleanup Meets Standard: True
Last Inspection: / /
Recommended Penalty: Penalty Not Recommended
UST Involvement: False
Spill Class: Known release with minimal potential for fire or hazard. DEC Response.
Willing Responsible Party. Corrective action taken.
Spill Closed Dt: 05/01/95
Remediation Phase: 0
Date Entered In Computer: 12/07/93
Spill Record Last Update: 05/01/95
Spiller Namer: Not reported
Spiller Company: NYCHA
Spiller Phone: (212) 306-3142
Spiller Extention: Not reported
Spiller Address: 250 BROADWAY
Spiller City,St,Zip: NEW YORK, NY
Spiller County: 001
Spiller Contact: Not reported
Spiller Phone: Not reported
Spiller Extention: Not reported
DEC Region: 2
Program Number: 9310784
DER Facility ID: 74832

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

AUDUBON HOUSES (Continued)

EDR ID Number
EPA ID Number

Database(s)

U001840710

Site ID: 80798
Operable Unit ID: 989529
Operable Unit: 01
Material ID: 389859
Material Code: 0003
Material Name: #6 Fuel Oil
Case No.: Not reported
Material FA: Petroleum
Quantity: -1.00
Units: Not reported
Recovered: 0.00
Resource Affected: Soil
Oxygenate: False
Site ID: 80798
Spill Tank Test: 1542263
Tank Number: 001
Tank Size: 0
Test Method: 00
Leak Rate: 0.00
Gross Fail: Not reported
Modified By: Spills
Last Modified: 10/01/04
Test Method: Unknown
DEC Memo: Not reported
Remarks: Start CallerRemark - 9310784 FOUND CONTAMINATED SOIL IN TANK PULL - SOIL IS STOCK PILED. END CallerRemark - 9310784

Site ID: 303173
Spill Date: 01/06/93
Facility Addr2: Not reported
Facility ID: 9211486
Program Number: 9211486
SWIS: 3101
Region of Spill: 2
Investigator: HEALY
Referred To: Not reported
Reported to Dept: 01/06/93
CID: 15
Spill Cause: Tank Overfill
Water Affected: Not reported
Spill Source: Unknown
Spill Notifier: Affected Persons
Cleanup Ceased: 01/07/93
Cleanup Meets Standard: True
Last Inspection: / /
Recommended Penalty: Penalty Not Recommended
UST Involvement: False
Spill Class: Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken.
Spill Closed Dt: 01/07/93
Remediation Phase: 0
Date Entered In Computer: 01/08/93
Spill Record Last Update: 05/14/98
Spille Namer: Not reported
Spiller Company: NYC HOUSING AUTHORITY
Spiller Phone: (212) 306-3129
Spiller Extention: Not reported

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

AUDUBON HOUSES (Continued)

EDR ID Number
EPA ID Number

Database(s)

U001840710

Spiller Address: 250 BROADWAY
Spiller City,St,Zip: NEW YORK, NY -
Spiller County: 001
Spiller Contact: Not reported
Spiller Phone: Not reported
Spiller Extention: Not reported
DEC Region: 2
Program Number: 9211486
DER Facility ID: 244956
Site ID: 303173
Operable Unit ID: 975775
Operable Unit: 01
Material ID: 404886
Material Code: 0002
Material Name: #4 Fuel Oil
Case No.: Not reported
Material FA: Petroleum
Quantity: 75.00
Units: Gallons
Recovered: 0.00
Resource Affected: Soil
Oxygenate: False
Site ID: 303173
Spill Tank Test: 1541032
Tank Number: Not reported
Tank Size: 0
Test Method: 00
Leak Rate: 0.00
Gross Fail: Not reported
Modified By: Spills
Last Modified: 10/01/04
Test Method: Unknown
DEC Memo: Not reported
Remarks: Start CallerRemark - 9211486 SPILL ON BOILER ROOM FLOOR AND MOST ON SOIL
OUTSIDE, NYCHA STAFF AND WINSTON CONTRACTING DOING CLEANUP END CallerRemark -
9211486

HIST UST:

PBS Number: 2-474819
SPDES Number: Not reported
Emergency Contact: EMERGENCY SERVICE SQUAD
Emergency Telephone: (212) 289-3940
Operator: RAFAEL VELEZ
Operator Telephone: (212) 306-3142
Owner Name: NYC HOUSING AUTHORITY
Owner Address: 250 BROADWAY
Owner City,St,Zip: NEW YORK, NY 10007
Owner Telephone: (212) 306-3142
Owner Type: Local Government
Owner Subtype: 51
Mailing Name: NYC HOUSING AUTHORITY
Mailing Address: 250 BROADWAY
Mailing Address 2: 16TH FLOOR
Mailing City,St,Zip: NEW YORK, NY 10007
Mailing Contact: FRANK OCELLO
Mailing Telephone: (212) 306-3142
Owner Mark: First Owner

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

AUDUBON HOUSES (Continued)

EDR ID Number
EPA ID Number

Database(s)

U001840710

Facility Status: 1 - Active PBS facility, i.e. total capacity of the PBS tanks is greater than 1,100 gallons, regardless if Subpart 360-14 tanks exist or not at the facility.

Facility Addr2: Not reported

SWIS ID: 6201

Old PBS Number: Not reported

Facility Type: APARTMENT BUILDING

Inspected Date: Not reported

Inspector: Not reported

Inspection Result: Not reported

Federal ID: Not reported

Certification Flag: False

Certification Date: 11/08/1999

Expiration Date: 03/28/2004

Renew Flag: False

Renewal Date: Not reported

Total Capacity: 12000

FAMT: True

Facility Screen: No Missing Data

Owner Screen: Minor Data Missing

Tank Screen: Minor Data Missing

Dead Letter: False

CBS Number: Not reported

Town or City: NEW YORK CITY

County Code: 62

Town or City: 01

Region: 2

Tank Id: 001

Tank Location: UNDERGROUND

Tank Status: Closed-Removed

Install Date: 19620401

Capacity (gals): 12000

Product Stored: NOS 1,2, OR 4 FUEL OIL

Tank Type: Steel/carbon steel

Tank Internal: Not reported

Tank External: Not reported

Pipe Location: Not reported

Pipe Type: STEEL/IRON

Pipe Internal: Not reported

Pipe External: Wrapped (Piping)

Second Containment: None

Leak Detection: None

Overfill Prot: Product Level Gauge

Dispenser: Suction

Date Tested: Not reported

Next Test Date: Not reported

Missing Data for Tank: Minor Data Missing

Date Closed: 11/01/1993

Test Method: Not reported

Deleted: False

Updated: True

Lat/long: Not reported

Tank Id: 01

Tank Location: UNDERGROUND

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

AUDUBON HOUSES (Continued)

EDR ID Number
EPA ID Number

Database(s)

U001840710

Tank Status: In Service
Install Date: 19940101
Capacity (gals): 12000
Product Stored: NOS 1,2, OR 4 FUEL OIL
Tank Type: Fiberglass coated steel
Tank Internal: Not reported
Tank External: Jacketed
Pipe Location: Underground
Pipe Type: STEEL/IRON
Pipe Internal: None
Pipe External: Sacrificial Anode
Second Containment: Vault (w/access)
Leak Detection: Electronic
Overfill Prot: High Level Alarm
Dispenser: Suction
Date Tested: Not reported
Next Test Date: Not reported
Missing Data for Tank: Minor Data Missing
Date Closed: Not reported
Test Method: Not reported
Deleted: False
Updated: True
Lat/long: Not reported

HIST LTANKS:

Region of Spill: 2
Spill Number: 9310784
Investigator: HEALY
Caller Name: Not reported
Caller Agency: Not reported
Caller Phone: Not reported
Caller Extension: Not reported
Notifier Name: Not reported
Notifier Agency: Not reported
Notifier Phone: Not reported
Notifier Extension: Not reported
Spill Date: 12/06/1993
Spill Time: 11:44
Reported to Department Date: 12/06/93
Reported to Department Time: 12:44
SWIS: 62
Spiller Contact: Not reported
Spiller Phone: Not reported
Spiller Extention: Not reported
Spiller Name: NYCHA
Spiller Address: 250 BROADWAY
Spiller City,St,Zip: NEW YORK CITY
Facility Contact: Not reported
Facility Phone: (212) 306-3142
Facility Extention: Not reported
Spill Cause: Tank Failure
Resource Affectd: On Land
Water Affected: Not reported
Spill Source: Other Non Commercial/Industrial
Spill Notifier: Responsible Party
PBS Number: 2-474819
Cleanup Ceased: 05/01/95

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s)
EDR ID Number
EPA ID Number

AUDUBON HOUSES (Continued)

U001840710

Cleanup Meets Standard: True
Last Inspection: / /
Recommended Penalty: Penalty Not Recommended
Spiller Cleanup Date: / /
Enforcement Date: / /
Investigation Complete: / /
UST Involvement: False
Spill Class: Known release with minimal potential for fire or hazard. DEC Response.
Willing Responsible Party. Corrective action taken.
Spill Closed Dt: 05/01/95
Date Region Sent Summary to Central Office: / /
Corrective Action Plan Submitted: / /
Date Spill Entered In Computer Data File: 12/07/93
Time Spill Entered In Computer Data File: Not reported
Spill Record Last Update: 05/01/95
Is Updated: False
PBS Number: Not reported
Tank Number: 001
Tank Size: 0
Test Method: Not reported
Leak Rate Failed Tank: 0.00
Gross Leak Rate: Not reported
Material Class Type: Petroleum
Quantity Spilled: -1
Unkonwn Quantity Spilled: False
Units: Not reported
Quantity Recovered: 0
Unkonwn Quantity Recovered: False
Material: #6 FUEL OIL
Class Type: #6 FUEL OIL
Times Material Entry In File: 2190
CAS Number: Not reported
Last Date: 19940728
DEC Remarks: Not reported
Spill Cause: FOUND CONTAMINATED SOIL IN TANK PULL - SOIL IS STOCK PILED.

Region of Spill: 2
Spill Number: 9211486
Investigator: HEALY
Caller Name: Not reported
Caller Agency: Not reported
Caller Phone: Not reported
Caller Extension: Not reported
Notifier Name: Not reported
Notifier Agency: Not reported
Notifier Phone: Not reported
Notifier Extension: Not reported
Spill Date: 01/06/1993
Spill Time: 13:30
Reported to Department Date: 01/06/93
Reported to Department Time: 15:35
SWIS: 62
Spiller Contact: Not reported
Spiller Phone: Not reported
Spiller Extention: Not reported
Spiller Name: NYC HOUSING AUTHORITY
Spiller Address: 250 BROADWAY

U001840710

Spiller City,St,Zip:	NEW YORK, NY	-
Facility Contact:	Not reported	
Facility Phone:	(212) 306-3129	
Facility Extention:	Not reported	
Spill Cause:	Tank Overfill	
Resource Affectd:	On Land	
Water Affected:	Not reported	
Spill Source:	Unknown	
Spill Notifier:	Affected Persons	
PBS Number:	2-474819	
Cleanup Ceased:	01/07/93	
Cleanup Meets Standard:	True	
Last Inspection:	/ /	
Recommended Penalty:	Penalty Not Recommended	
Spiller Cleanup Date:	/ /	
Enforcement Date:	/ /	
Investigation Complete:	/ /	
UST Involvement:	False	
Spill Class:	Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken.	
Spill Closed Dt:	01/07/93	
Date Region Sent Summary to Central Office:	/ /	
Corrective Action Plan Submitted:	/ /	
Date Spill Entered In Computer Data File:	01/08/93	
Time Spill Entered In Computer Data File:	Not reported	
Spill Record Last Update:	05/14/98	
Is Updated:	False	
PBS Number:	Not reported	
Tank Number:	Not reported	
Tank Size:	0	
Test Method:	Not reported	
Leak Rate Failed Tank:	0.00	
Gross Leak Rate:	Not reported	
Material Class Type:	Petroleum	
Quantity Spilled:	75	
Unkonwn Quantity Spilled:	False	
Units:	Gallons	
Quantity Recovered:	0	
Unkonwn Quantity Recovered:	False	
Material:	#4 FUEL OIL	
Class Type:	#4 FUEL OIL	
Times Material Entry In File:	1751	
CAS Number:	Not reported	
Last Date:	19941205	
DEC Remarks:	5/14/98 SSS CHANGED SPILL SITE FROM BUTHUNE TO AUDUBON HOUSES AFTER REVIEW OF THE FILES	
Spill Cause:	SPILL ON BOILER ROOM FLOOR AND MOST ON SOIL OUTSIDE, NYCHA STAFF AND WINSTON CONTRACTING DOING CLEANUP	

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

N54
SSW
1/8-1/4
708 ft.

EDGECOMBE ASSOC
48 SAINT NICHOLAS PL
NY, NY 10031

UST
HIST UST

U000417183
N/A

Relative:
Lower

Site 1 of 5 in cluster N

UST:

Actual:
103 ft.

UST:

Facility Id: 2-254177
Expiration Date: 07/14/92
Renewal Date: / /
Total Capacity: 0
Facility Type: Not reported
Mailing Company: EDGECOMBE ASSOC
Mailing Title: Not reported
Mailing Contact: Not reported
Mailing Address: 736 BROADWAY 4TH FL
Mailing Address 2: Not reported
Mailing City: NY
Mailing State: NY
Mailing Zip Code: 10003
Mailing Phone No: (212) 475-6001
Mailing Email: Not reported
Owner Title: Not reported
Owner Name: Not reported
Owner Address: 736 BROADWAY 4TH FL
Owner Address 2: Not reported
Owner State: NY
Owner Zip Code: 10003
Owner Phone: (212) 475-6001
Owner Company: EDGECOMBE ASSOC
Emergency Contact: JED MANAGEMENT
Emergency Phone: (212) 475-6001
Operator: JED MANAGEMENT
Operator Phone: (212) 475-6001
Owner City: NY
Owner Sub Type: Not reported
UTM X: 589292.08888
UTM Y: 4520268.45723
Site Type Name: Unknown
Site Type Status: Administratively Closed
Comments: 12/02/2003 - This site has been declared ADMINISTRATIVELY CLOSED. It has been removed from active status. (Please specify why below) Duplicate of 2-000442.
nl

Program Type: PBS

Tank Number: 001
Tank Location Name: Underground
Tank Status: Administratively Closed
Tank Model: Not reported
Pipe Model: Not reported
Active Status: Inactive
Install Date: / /
Capacity Gallons: 4000
Material Name: #2 Fuel Oil
Percentage: 100.00
Tank Type Name: Steel/Carbon Steel/Iron
Tank Internal Protection: None

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s)
EDR ID Number
EPA ID Number

EDGECOMBE ASSOC (Continued)

U000417183

Tank Internal Protection 1: None
Tank Internal Protection 2: Not reported
Pipe Location Name: No Piping
Pipe Type Name: Steel/Carbon Steel/Iron
Pipe External Protection 1: None
Pipe External Protection 2: Not reported
Tank Secondary Containment 1: Vault (w/o access)
Tank Secondary Containment 2: Not reported
Pipe Secondary Containment: Not reported
Tank Leak Detection 1: None
Tank Leak Detection 2: Not reported
Pipe Leak Detection 1: Not reported
Pipe Leak Detection 2: Not reported
Type Of Overfill Prevention 1: Product Level Gauge (A/G)
Type Of Overfill Prevention 2: Not reported
Dispenser Method: Suction
Spill Prevention: Not reported
Tightness Test Method: Testing Not Required
Date Tested: / /
Next Test Date: / /
Date Tank Closed: 12/02/03

HIST UST:

PBS Number: 2-254177
SPDES Number: Not reported
Emergency Contact: JED MANAGEMENT
Emergency Telephone: (212) 475-6001
Operator: JED MANAGEMENT
Operator Telephone: (212) 475-6001
Owner Name: EDGECOMBE ASSOC
Owner Address: 736 BROADWAY 4TH FL
Owner City,St,Zip: NY, NY 10003
Owner Telephone: (212) 475-6001
Owner Type: Not reported
Owner Subtype: Not reported
Mailing Name: EDGECOMBE ASSOC
Mailing Address: 736 BROADWAY 4TH FL
Mailing Address 2: Not reported
Mailing City,St,Zip: NY, NY 10003
Mailing Contact: Not reported
Mailing Telephone: (212) 475-6001
Owner Mark: First Owner
Facility Status: 1 - Active PBS facility, i.e. total capacity of the PBS tanks is greater than 1,100 gallons, regardless if Subpart 360-14 tanks exist or not at the facility.
Facility Addr2: 48 SAINT NICHOLAS PL
SWIS ID: 6201
Old PBS Number: Not reported
Facility Type: Not reported
Inspected Date: Not reported
Inspector: Not reported
Inspection Result: Not reported
Federal ID: Not reported
Certification Flag: False
Certification Date: 07/14/1987
Expiration Date: 07/14/1992
Renew Flag: False

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

EDGECOMBE ASSOC (Continued)

EDR ID Number
EPA ID Number

Database(s)

U000417183

Renewal Date: Not reported
Total Capacity: 4000
FAMT: True
Facility Screen: Minor Data Missing
Owner Screen: Minor Data Missing
Tank Screen: Minor Data Missing
Dead Letter: False
CBS Number: Not reported
Town or City: NEW YORK CITY
County Code: 62
Town or City: 01
Region: 2

Tank Id: 001
Tank Location: UNDERGROUND
Tank Status: In Service
Install Date: Not reported
Capacity (gals): 4000
Product Stored: NOS 1,2, OR 4 FUEL OIL
Tank Type: Steel/carbon steel
Tank Internal: Not reported
Tank External: Not reported
Pipe Location: Not reported
Pipe Type: STEEL/IRON
Pipe Internal: Not reported
Pipe External: Not reported
Second Containment: Diking
Leak Detection: None
Overfill Prot: Product Level Gauge
Dispenser: Suction
Date Tested: Not reported
Next Test Date: 12/27/1987
Missing Data for Tank: Minor Data Missing
Date Closed: Not reported
Test Method: Not reported
Deleted: False
Updated: False
Lat/long: Not reported

55
North
1/8-1/4
715 ft.

PRANA NINE PROPERTIES
945 ST. NICHOLAS AVENUE
NEW YORK, NY 10032

AST A100175741
N/A

Relative:
Higher

AST:
AST:

Actual:
150 ft.

Region: STATE
Facility Id: 2-605500
UTM X: 589330.51428
UTM Y: 4520724.56168
Expiration Date: 09/22/10
Renewal Date: / /
Total Capacity: 3000
Facility Type: MULTIPLE DWELLING
Site Type Name: Other
Site Type Status: Active
Mailing Company: PRANA NINE PROPERTIES

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s) EDR ID Number
EPA ID Number

PRANA NINE PROPERTIES (Continued)

A100175741

Mailing Title:	Not reported
Mailing Contact:	ROSARIO RVIZ
Mailing Address:	507 W. 186TH ST. #A4
Mailing Address 2:	Not reported
Mailing City:	NEW YORK
Mailing State:	NY
Mailing Zip Code:	10033
Mailing Phone No:	Not reported
Mailing Email:	Not reported
Owner Title:	PROPERTY MANAGER
Owner Name:	MAURICE MCKENZIE
Owner Address:	507 W. 186TH ST. #A4
Owner Address 2:	Not reported
Owner State:	NY
Owner Zip Code:	10033
Owner Phone:	Not reported
Owner Company:	PRANA NINE PROPERTIES
Emergency Contact:	MAURICE MCKENZIE
Emergency Phone:	Not reported
Operator:	BRION LOUISON
Operator Phone:	Not reported
Owner City:	NEW YORK
Owner Sub Type:	Private Resident
Program Type:	PBS
Tank Number:	001
Tank Location Name:	Aboveground - in contact with soil
Tank Status:	In Service
Tank Model:	Not reported
Pipe Model:	Not reported
Active Status:	Active
Install Date:	01/01/01
Capacity Gallons:	3000
Material Name:	#2 Fuel Oil
Percentage:	100.00
Tank Type Name:	Steel/Carbon Steel/Iron
Tank Internal Protection:	Epoxy Liner
Tank Internal Protection 1:	Painted/Asphalt Coating
Tank Internal Protection 2:	Not reported
Pipe Location Name:	Aboveground
Pipe Type Name:	Steel/Carbon Steel/Iron
Pipe External Protection 1:	Painted/Asphalt Coating
Pipe External Protection 2:	Not reported
Tank Secondary Containment 1:	Diking (Aboveground)
Tank Secondary Containment 2:	Not reported
Pipe Secondary Containment:	Diking (Aboveground)
Tank Leak Detection 1:	None
Tank Leak Detection 2:	Not reported
Pipe Leak Detection 1:	None
Pipe Leak Detection 2:	Not reported
Type Of Overfill Prevention 1:	Vent Whistle
Type Of Overfill Prevention 2:	Not reported
Dispenser Method:	None
Spill Prevention:	None
Tightness Test Method:	Testing Not Required
Date Tested:	/ /
Next Test Date:	/ /

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

PRANA NINE PROPERTIES (Continued)

EDR ID Number
EPA ID Number

Database(s)

Date Tank Closed: / /

A100175741

N56
South
1/8-1/4
721 ft.

ST. NICHOLAS PLACE LLC
52-54 ST. NICHOLAS PLACE
NEW YORK, NY 10031

AST A100194247
N/A

Site 2 of 5 in cluster N

Relative:
Lower

AST:

Actual:
103 ft.

AST:

Region: STATE
Facility Id: 2-607224
UTM X: 589268.89767
UTM Y: 4520274.45344
Expiration Date: 11/27/11
Renewal Date: / /
Total Capacity: 4000
Facility Type: Not reported
Site Type Name: Apartment Building/Office Building
Site Type Status: Active
Mailing Company: FRIEDMAN MANAGEMENT CORP.
Mailing Title: Not reported
Mailing Contact: ADAM STRYKER
Mailing Address: 225 WEST 34TH STREET
Mailing Address 2: SUITE 1305
Mailing City: NEW YORK
Mailing State: NY
Mailing Zip Code: 10122
Mailing Phone No: (212) 736-6888
Mailing Email: Not reported
Owner Title: MGR AGENT
Owner Name: ADAM STRYKER
Owner Address: 40 FRIEDMAN MGMT. CORP. 225 WEST 34TH ST
Owner Address 2: Not reported
Owner State: NY
Owner Zip Code: 10122
Owner Phone: (212) 736-6888
Owner Company: FRIEDMAN MANAGEMENT
Emergency Contact: ADAM STRYKER
Emergency Phone: (212) 736-6888
Operator: DANIEL MARTINEZ
Operator Phone: (212) 368-6757
Owner City: NEW YORK
Owner Sub Type: Corporate or Commercial
Program Type: PBS

Tank Number: 001
Tank Location Name: Aboveground - in contact with soil
Tank Status: In Service
Tank Model: Not reported
Pipe Model: Not reported
Active Status: Active
Install Date: / /
Capacity Gallons: 4000
Material Name: #2 Fuel Oil
Percentage: 100.00
Tank Type Name: Steel/Carbon Steel/Iron

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

ST. NICHOLAS PLACE LLC (Continued)

EDR ID Number
EPA ID Number

Database(s)

A100194247

Tank Internal Protection: None
Tank Internal Protection 1: None
Tank Internal Protection 2: Not reported
Pipe Location Name: No Piping
Pipe Type Name: No Piping
Pipe External Protection 1: None
Pipe External Protection 2: Not reported
Tank Secondary Containment 1: None
Tank Secondary Containment 2: Not reported
Pipe Secondary Containment: Not reported
Tank Leak Detection 1: None
Tank Leak Detection 2: Not reported
Pipe Leak Detection 1: Not reported
Pipe Leak Detection 2: Not reported
Type Of Overfill Prevention 1: None
Type Of Overfill Prevention 2: Not reported
Dispenser Method: None
Spill Prevention: Not reported
Tightness Test Method: Testing Not Required
Date Tested: / /
Next Test Date: / /
Date Tank Closed: / /

N57
SSW
1/8-1/4
731 ft.

49 SAINT NICHOLAS PLACE
49 SAINT NICHOLAS PLACE
NEW YORK, NY

LTANKS S102233221
HIST LTANKS N/A

Site 3 of 5 in cluster N

Relative:
Lower

LTANKS:

Actual:
103 ft.

Site ID: 214795
Spill Date: 11/01/95
Facility Addr2: Not reported
Facility ID: 9509504
Program Number: 9509504
SWIS: 3101
Region of Spill: 2
Investigator: LUCE
Referred To: Not reported
Reported to Dept: 11/01/95
CID: 15
Spill Cause: Tank Failure
Water Affected: Not reported
Spill Source: Private Dwelling
Spill Notifier: Other
Cleanup Ceased: / /
Cleanup Meets Standard: False
Last Inspection: / /
Recommended Penalty: Penalty Not Recommended
UST Involvement: False
Spill Class: Known release with minimal potential for fire or hazard. DEC Response.
Willing Responsible Party. Corrective action taken.
Spill Closed Dt: 11/01/95
Remediation Phase: 0
Date Entered In Computer: 11/01/95
Spill Record Last Update: 11/09/95
Spille Namer: IMANI BENNETT
Spiller Company: IMANI BENNETT

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

49 SAINT NICHOLAS PLACE (Continued)

EDR ID Number
EPA ID Number

Database(s)

S102233221

Spiller Phone: (212) 491-4772
Spiller Extention: Not reported
Spiller Address: 49 SAINT NICHOLAS PLACE
Spiller City,St,Zip: NEW YORK, NY 10031-
Spiller County: 001
Spiller Contact: IMANI BENNETT
Spiller Phone: (212) 491-4772
Spiller Extention: Not reported
DEC Region: 2
Program Number: 9509504
DER Facility ID: 177944
Site ID: 214795
Operable Unit ID: 1020054
Operable Unit: 01
Material ID: 360457
Material Code: 0001
Material Name: #2 Fuel Oil
Case No.: Not reported
Material FA: Petroleum
Quantity: 10.00
Units: Gallons
Recovered: 10.00
Resource Affected: Soil
Oxygenate: False
Site ID: Not reported
Spill Tank Test: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate: Not reported
Gross Fail: Not reported
Modified By: Not reported
Last Modified: Not reported
Test Method: Not reported
DEC Memo: Not reported
Remarks: Start CallerRemark - 9509504 LEAK FROM TANK ONTO CONCRETE BASEMENT FLOOR. TANK
PUMPED OUT AND BEING REPLACED. END CallerRemark - 9509504

HIST LTANKS:

Region of Spill: 2
Spill Number: 9509504
Investigator: LUCE
Caller Name: Not reported
Caller Agency: Not reported
Caller Phone: Not reported
Caller Extension: Not reported
Notifier Name: Not reported
Notifier Agency: Not reported
Notifier Phone: Not reported
Notifier Extension: Not reported
Spill Date: 11/01/1995
Spill Time: 01:45
Reported to Department Date: 11/01/95
Reported to Department Time: 11:41
SWIS: 62
Spiller Contact: IMANI BENNETT
Spiller Phone: (212) 491-4772

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s)
EDR ID Number
EPA ID Number

49 SAINT NICHOLAS PLACE (Continued)

S102233221

Spiller Extention: Not reported
Spiller Name: IMANI BENNETT
Spiller Address: 49 SAINT NICHOLAS PLACE
Spiller City,St,Zip: NEW YORK, NY 10031-
Facility Contact: IMANI BENNETT
Facility Phone: (212) 491-4772
Facility Extention: Not reported
Spill Cause: Tank Failure
Resource Affectd: On Land
Water Affected: Not reported
Spill Source: Private Dwelling
Spill Notifier: Other
PBS Number: Not reported
Cleanup Ceased: / /
Cleanup Meets Standard: False
Last Inspection: / /
Recommended Penalty: Penalty Not Recommended
Spiller Cleanup Date: / /
Enforcement Date: / /
Investigation Complete: / /
UST Involvement: False
Spill Class: Known release with minimal potential for fire or hazard. DEC Response.
Willing Responsible Party. Corrective action taken.
Spill Closed Dt: 11/01/95
Date Region Sent Summary to Central Office: / /
Corrective Action Plan Submitted: / /
Date Spill Entered In Computer Data File: 11/01/95
Time Spill Entered In Computer Data File: Not reported
Spill Record Last Update: 11/09/95
Is Updated: False
PBS Number: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate Failed Tank: Not reported
Gross Leak Rate: Not reported
Material Class Type: Petroleum
Quantity Spilled: 10
Unkonwn Quantity Spilled: False
Units: Gallons
Quantity Recovered: 10
Unkonwn Quantity Recovered: False
Material: #2 FUEL OIL
Class Type: #2 FUEL OIL
Times Material Entry In File: 24464
CAS Number: Not reported
Last Date: 19941207
DEC Remarks: Not reported
Spill Cause: LEAK FROM TANK ONTO CONCRETE BASEMENT FLOOR. TANK PUMPED OUT AND BEING REPLACED.

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

O58
SSE
1/8-1/4
739 ft.

CHAMA HOLDING CORP
385 EDGEcombe AVE
MANHATTAN, NY 10031

AST
HIST AST

U003388942
N/A

Relative:
Lower

Site 1 of 2 in cluster O

AST:

Actual:
86 ft.

AST:

Region: STATE
Facility Id: 2-283908
UTM X: 589417.78513
UTM Y: 4520446.72688
Expiration Date: 07/14/12
Renewal Date: 03/06/02
Total Capacity: 4000
Facility Type: Not reported
Site Type Name: Apartment Building/Office Building
Site Type Status: Active
Mailing Company: CHAMA HOLDING CORP
Mailing Title: Not reported
Mailing Contact: Not reported
Mailing Address: PO BOX 191024
Mailing Address 2: Not reported
Mailing City: BROOKLYN
Mailing State: NY
Mailing Zip Code: 11219
Mailing Phone No: (718) 972-5010
Mailing Email: Not reported
Owner Title: Not reported
Owner Name: Not reported
Owner Address: PO BOX 191024
Owner Address 2: Not reported
Owner State: NY
Owner Zip Code: 11219
Owner Phone: (718) 972-5010
Owner Company: CHAMA HOLDING CORP
Emergency Contact: EDUARDO MARTINEZ
Emergency Phone: (718) 972-5010
Operator: EDUARDO MARTINEZ
Operator Phone: (212) 491-1540
Owner City: BROOKLYN
Owner Sub Type: Corporate or Commercial
Program Type: PBS

Tank Number: 001
Tank Location Name: Aboveground - in contact with soil
Tank Status: In Service
Tank Model: Not reported
Pipe Model: Not reported
Active Status: Active
Install Date: 01/01/43
Capacity Gallons: 4000
Material Name: #2 Fuel Oil
Percentage: 100.00
Tank Type Name: Steel/Carbon Steel/Iron
Tank Internal Protection: None
Tank Internal Protection 1: None
Tank Internal Protection 2: Not reported
Pipe Location Name: No Piping

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s)
EDR ID Number
EPA ID Number

CHAMA HOLDING CORP (Continued)

U003388942

Pipe Type Name: Steel/Carbon Steel/Iron
Pipe External Protection 1: None
Pipe External Protection 2: Not reported
Tank Secondary Containment 1: Vault (w/o access)
Tank Secondary Containment 2: Not reported
Pipe Secondary Containment: Not reported
Tank Leak Detection 1: None
Tank Leak Detection 2: Not reported
Pipe Leak Detection 1: Exempt Suction Piping
Pipe Leak Detection 2: Not reported
Type Of Overfill Prevention 1: Product Level Gauge (A/G)
Type Of Overfill Prevention 2: Not reported
Dispenser Method: Suction
Spill Prevention: Not reported
Tightness Test Method: Testing Not Required
Date Tested: / /
Next Test Date: / /
Date Tank Closed: / /

HIST AST:

PBS Number: 2-283908
SWIS Code: 6201
Operator: VICTOR SERRANO
Facility Phone: (212) 491-2678
Facility Addr2: 385 EDGECOMBE AVE
Facility Type: APARTMENT BUILDING
Emergency: VICTOR SERRANO
Emergency Tel: (718) 972-5010
Old PBSNO: Not reported
Date Inspected: Not reported
Inspector: Not reported
Result of Inspection: Not reported
Owner Name: CHAMA HOLDING CORP
Owner Address: PO BOX 191024
Owner City,St,Zip: BROOKLYN, NY 11219
Federal ID: Not reported
Owner Tel: (718) 972-5010
Owner Type: Corporate/Commercial
Owner Subtype: Not reported
Mailing Contact: Not reported
Mailing Name: CHAMA HOLDING CORP
Mailing Address: PO BOX 191024
Mailing Address 2: Not reported
Mailing City,St,Zip: BROOKLYN, NY 11219
Mailing Telephone: (718) 972-5010
Owner Mark: First Owner
Facility Status: 1 - Active PBS facility, i.e. total capacity of the PBS tanks is greater than 1,100 gallons, regardless if Subpart 360-14 tanks exist or not at the facility.

Certification Flag: False
Certification Date: 08/01/1997
Expiration: 07/14/2002
Renew Flag: False
Renew Date: Not reported
Total Capacity: 4000
FAMT: True
Facility Screen: No Missing Data

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

CHAMA HOLDING CORP (Continued)

EDR ID Number
EPA ID Number

Database(s)

U003388942

Owner Screen: No Missing Data
Tank Screen: Minor Data Missing
Dead Letter: False
CBS Number: Not reported
Town or City: NEW YORK CITY
County Code: 62
Town or City Code: 01
Region: 2

Tank ID: 001
Tank Location: ABOVEGROUND
Tank Status: In Service
Install Date: Not reported
Capacity (Gal): 4000
Product Stored: NOS 1,2, OR 4 FUEL OIL
Tank Type: Steel/carbon steel
Tank Internal: Not reported
Tank External: Not reported
Pipe Location: Not reported
Pipe Type: STEEL/IRON
Pipe Internal: Not reported
Pipe External: Not reported
Tank Containment: Diking
Leak Detection: 0
Overfill Protection: 4
Dispenser Method: Suction
Date Tested: Not reported
Next Test Date: Not reported
Missing Data for Tank: Minor Data Missing
Date Closed: Not reported
Test Method: Not reported
Deleted: False
Updated: True
SPDES Number: Not reported
Lat/Long: Not reported

P59
NW
1/8-1/4
744 ft.

501 W 156TH ST HOUSING DEV
501 W 156TH ST
MANHATTAN, NY 10032

UST
HIST UST
U001836987
N/A

Site 1 of 9 in cluster P

Relative:
Higher

UST:

Actual:
147 ft.

UST:

Facility Id: 2-332062
Expiration Date: 08/23/03
Renewal Date: 09/29/93
Total Capacity: 5000
Facility Type: Not reported
Mailing Company: 501 W 156TH ST HOUSING DEV
Mailing Title: Not reported
Mailing Contact: Not reported
Mailing Address: 501 W 156TH ST
Mailing Address 2: Not reported
Mailing City: MANHATTAN
Mailing State: NY
Mailing Zip Code: 10032

Map ID
 Direction
 Distance
 Distance (ft.)
 Elevation Site

MAP FINDINGS

Database(s)
 EDR ID Number
 EPA ID Number

501 W 156TH ST HOUSING DEV (Continued)

U001836987

Mailing Phone No: (212) 926-5390
 Mailing Email: Not reported
 Owner Title: Not reported
 Owner Name: Not reported
 Owner Address: 501 W 156TH ST
 Owner Address 2: Not reported
 Owner State: NY
 Owner Zip Code: 10032
 Owner Phone: (212) 926-5390
 Owner Company: 501 W 156TH ST HOUSING DEV
 Emergency Contact: JANIFER P. WILSON
 Emergency Phone: (212) 926-5390
 Operator: CATHERINE MOZEE
 Operator Phone: (212) 926-5390
 Owner City: MANHATTAN
 Owner Sub Type: Corporate or Commercial
 UTM X: 589193.95243
 UTM Y: 4520692.15782
 Site Type Name: Apartment Building/Office Building
 Site Type Status: Active
 Comments: Not reported

 Program Type: PBS

 Tank Number: 038
 Tank Location Name: Underground
 Tank Status: In Service
 Tank Model: Not reported
 Pipe Model: Not reported
 Active Status: Active
 Install Date: 12/01/64
 Capacity Gallons: 5000
 Material Name: #2 Fuel Oil
 Percentage: 100.00
 Tank Type Name: Steel/Carbon Steel/Iron
 Tank Internal Protection: Epoxy Liner
 Tank Internal Protection 1: Painted/Asphalt Coating
 Tank Internal Protection 2: Not reported
 Pipe Location Name: Underground/On-ground
 Pipe Type Name: Steel/Carbon Steel/Iron
 Pipe External Protection 1: Jacketed
 Pipe External Protection 2: Not reported
 Tank Secondary Containment 1: None
 Tank Secondary Containment 2: Not reported
 Pipe Secondary Containment: Not reported
 Tank Leak Detection 1: Groundwater Well
 Tank Leak Detection 2: Not reported
 Pipe Leak Detection 1: Not reported
 Pipe Leak Detection 2: Not reported
 Type Of Overfill Prevention 1: Vent Whistle
 Type Of Overfill Prevention 2: Not reported
 Dispenser Method: Not reported
 Spill Prevention: Not reported
 Tightness Test Method: Unknown
 Date Tested: / /
 Next Test Date: 12/27/87
 Date Tank Closed: / /

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s)

EDR ID Number
EPA ID Number

501 W 156TH ST HOUSING DEV (Continued)

U001836987

HIST UST:

PBS Number: 2-332062
SPDES Number: Not reported
Emergency Contact: JANIFER P. WILSON
Emergency Telephone: (212) 926-5390
Operator: CATHERINE MOZEE
Operator Telephone: (212) 926-5390
Owner Name: 501 W 156TH ST HOUSING DEV
Owner Address: 501 W 156TH ST
Owner City,St,Zip: MANHATTAN, NY 10032
Owner Telephone: (212) 926-5390
Owner Type: Corporate/Commercial
Owner Subtype: Not reported
Mailing Name: 501 W 156TH ST HOUSING DEV
Mailing Address: 501 W 156TH ST
Mailing Address 2: Not reported
Mailing City,St,Zip: MANHATTAN, NY 10032
Mailing Contact: Not reported
Mailing Telephone: (212) 926-5390
Owner Mark: First Owner
Facility Status: 1 - Active PBS facility, i.e. total capacity of the PBS tanks is greater than 1,100 gallons, regardless if Subpart 360-14 tanks exist or not at the facility.

Facility Addr2: 501 W 156TH ST
SWIS ID: 6201
Old PBS Number: Not reported
Facility Type: APARTMENT BUILDING
Inspected Date: Not reported
Inspector: Not reported
Inspection Result: Not reported
Federal ID: Not reported
Certification Flag: False
Certification Date: 08/05/1998
Expiration Date: 08/23/2003
Renew Flag: True
Renewal Date: 19930929
Total Capacity: 5000
FAMT: True
Facility Screen: No Missing Data
Owner Screen: No Missing Data
Tank Screen: No Missing Data
Dead Letter: False
CBS Number: Not reported
Town or City: NEW YORK CITY
County Code: 62
Town or City: 01
Region: 2

Tank Id: 038
Tank Location: UNDERGROUND
Tank Status: In Service
Install Date: 19641201
Capacity (gals): 5000
Product Stored: NOS 1,2, OR 4 FUEL OIL
Tank Type: Steel/carbon steel
Tank Internal: Epoxy Liner
Tank External: Painted/Asphalt Coating

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

501 W 156TH ST HOUSING DEV (Continued)

EDR ID Number
EPA ID Number

Database(s)

U001836987

Pipe Location: Underground
Pipe Type: STEEL/IRON
Pipe Internal: Epoxy Liner
Pipe External: Jacketed
Second Containment: None
Leak Detection: Groundwater Well
Overfill Prot: Vent Whistle
Dispenser: Gravity
Date Tested: Not reported
Next Test Date: 12/27/1987
Missing Data for Tank: No Missing Data
Date Closed: Not reported
Test Method: Not reported
Deleted: False
Updated: True
Lat/long: Not reported

P60
NW
1/8-1/4
744 ft.

Relative:
Higher

Actual:
147 ft.

OTHA/K & B CLEANERS
1940 AMSTERDAM AVENUE
NEW YORK, NY 10032

DRYCLEANERS S106436126
N/A

Site 2 of 9 in cluster P

DRYCLEANERS:
Facility ID: 2-6201-00330
Region: NY

K61
SSW
1/8-1/4
751 ft.

BLOCKERS CLEANERS
840 ST NICHOLAS AVE
NEW YORK, NY 10031

RCRA-SQG 1004756540
FINDS NYD137908570
NY MANIFEST

Site 3 of 3 in cluster K

Relative:
Lower

Actual:
110 ft.

RCRAInfo:
Owner: ADOLPHUS BLOCKER
(212) 555-1212
EPA ID: NYD137908570
Contact: Not reported
Classification: Conditionally Exempt Small Quantity Generator
TSDF Activities: Not reported
Violation Status: No violations found

FINDS:

Other Pertinent Environmental Activity Identified at Site

NJ-NJEMS (New Jersey - New Jersey Environmental Management System).
The Department of Environmental Protection (NJDEP) manages large
databases of environmental information in this integrated system.

RCRAInfo is a national information system that supports the Resource
Conservation and Recovery Act (RCRA) program through the tracking of
events and activities related to facilities that generate, transport,
and treat, store, or dispose of hazardous waste. RCRAInfo allows RCRA
program staff to track the notification, permit, compliance, and

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s)
EDR ID Number
EPA ID Number

BLOCKERS CLEANERS (Continued)

1004756540

corrective action activities required under RCRA.

NY MANIFEST:

Document ID: NJA1421076
Manifest Status: Completed copy
Trans1 State ID: NJDEPS869
Trans2 State ID: Not reported
Generator Ship Date: 920602
Trans1 Recv Date: 920602
Trans2 Recv Date: Not reported
TSD Site Recv Date: 920602
Part A Recv Date: Not reported
Part B Recv Date: 920616
Generator EPA ID: NYD137908570
Trans1 EPA ID: ILD051060408
Trans2 EPA ID: Not reported
TSDF ID: NJD000768093
Waste Code: F002 - HALO SOLV + STILL BOTTOMS FM REC OF SOLV
Quantity: 00070
Units: P - Pounds
Number of Containers: 001
Container Type: DM - Metal drums, barrels
Handling Method: B Incineration, heat recovery, burning.
Specific Gravity: 100
Year: 92
Manifest Tracking Num: Not reported
Import Ind: Not reported
Export Ind: Not reported
Discr Quantity Ind: Not reported
Discr Type Ind: Not reported
Discr Residue Ind: Not reported
Discr Partial Reject Ind: Not reported
Discr Full Reject Ind: Not reported
Manifest Ref Num: Not reported
Alt Fac RCRA Id: Not reported
Alt Fac Sign Date: Not reported
Mgmt Method Type Code: Not reported
EPA ID: NYD137908570
Facility Name: BLOCKERS CLEANERS
Facility Address: 840 SAINT NICHOLAS AVENUE
Facility City: NEW YORK
Facility Address 2: Not reported
Country: USA
County: RI
Mailing Name: BLOCKERS CLEANERS
Mailing Contact: BLOCKERS CLEANERS
Mailing Address: 840 SAINT NICHOLAS AVENUE
Mailing Address 2: Not reported
Mailing City: NEW YORK
Mailing State: NY
Mailing Zip: Not reported
Mailing Zip4: Not reported
Mailing Country: USA
Mailing Phone: 212-368-9228

Document ID: NJA1416324

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s)
EDR ID Number
EPA ID Number

BLOCKERS CLEANERS (Continued)

1004756540

Manifest Status: Completed copy
Trans1 State ID: NJDEPS869
Trans2 State ID: Not reported
Generator Ship Date: 920403
Trans1 Recv Date: 920403
Trans2 Recv Date: Not reported
TSD Site Recv Date: 920403
Part A Recv Date: 920414
Part B Recv Date: 920416
Generator EPA ID: NYD137908570
Trans1 EPA ID: ILD051060408
Trans2 EPA ID: Not reported
TSD ID: NJD000768093
Waste Code: F002 - HALO SOLV + STILL BOTTOMS FM REC OF SOLV
Quantity: 00070
Units: P - Pounds
Number of Containers: 001
Container Type: DM - Metal drums, barrels
Handling Method: B Incineration, heat recovery, burning.
Specific Gravity: 100
Year: 92
Manifest Tracking Num: Not reported
Import Ind: Not reported
Export Ind: Not reported
Discr Quantity Ind: Not reported
Discr Type Ind: Not reported
Discr Residue Ind: Not reported
Discr Partial Reject Ind: Not reported
Discr Full Reject Ind: Not reported
Manifest Ref Num: Not reported
Alt Fac RCRA Id: Not reported
Alt Fac Sign Date: Not reported
Mgmt Method Type Code: Not reported
EPA ID: NYD137908570
Facility Name: BLOCKERS CLEANERS
Facility Address: 840 SAINT NICHOLAS AVENUE
Facility City: NEW YORK
Facility Address 2: Not reported
Country: USA
County: RI
Mailing Name: BLOCKERS CLEANERS
Mailing Contact: BLOCKERS CLEANERS
Mailing Address: 840 SAINT NICHOLAS AVENUE
Mailing Address 2: Not reported
Mailing City: NEW YORK
Mailing State: NY
Mailing Zip: Not reported
Mailing Zip4: Not reported
Mailing Country: USA
Mailing Phone: 212-368-9228

Document ID: NJA1463279
Manifest Status: Completed copy
Trans1 State ID: NJDEPS869
Trans2 State ID: Not reported
Generator Ship Date: 920630
Trans1 Recv Date: 920630

Map ID
 Direction
 Distance
 Distance (ft.)
 Elevation Site

MAP FINDINGS

Database(s)
 EDR ID Number
 EPA ID Number

BLOCKERS CLEANERS (Continued)

1004756540

Trans2 Recv Date: Not reported
 TSD Site Recv Date: 920630
 Part A Recv Date: 920715
 Part B Recv Date: 920710
 Generator EPA ID: NYD137908570
 Trans1 EPA ID: ILD051060408
 Trans2 EPA ID: Not reported
 TSD ID: NJD000768093
 Waste Code: F002 - HALO SOLV + STILL BOTTOMS FM REC OF SOLV
 Quantity: 00070
 Units: P - Pounds
 Number of Containers: 001
 Container Type: DM - Metal drums, barrels
 Handling Method: B Incineration, heat recovery, burning.
 Specific Gravity: 100
 Year: 92
 Manifest Tracking Num: Not reported
 Import Ind: Not reported
 Export Ind: Not reported
 Discr Quantity Ind: Not reported
 Discr Type Ind: Not reported
 Discr Residue Ind: Not reported
 Discr Partial Reject Ind: Not reported
 Discr Full Reject Ind: Not reported
 Manifest Ref Num: Not reported
 Alt Fac RCRA Id: Not reported
 Alt Fac Sign Date: Not reported
 Mgmt Method Type Code: Not reported
 EPA ID: NYD137908570
 Facility Name: BLOCKERS CLEANERS
 Facility Address: 840 SAINT NICHOLAS AVENUE
 Facility City: NEW YORK
 Facility Address 2: Not reported
 Country: USA
 County: RI
 Mailing Name: BLOCKERS CLEANERS
 Mailing Contact: BLOCKERS CLEANERS
 Mailing Address: 840 SAINT NICHOLAS AVENUE
 Mailing Address 2: Not reported
 Mailing City: NEW YORK
 Mailing State: NY
 Mailing Zip: Not reported
 Mailing Zip4: Not reported
 Mailing Country: USA
 Mailing Phone: 212-368-9228

 Document ID: NJA1343557
 Manifest Status: Completed copy
 Trans1 State ID: NJDEPS869
 Trans2 State ID: Not reported
 Generator Ship Date: 920311
 Trans1 Recv Date: 920311
 Trans2 Recv Date: Not reported
 TSD Site Recv Date: 920311
 Part A Recv Date: 920326
 Part B Recv Date: 920320
 Generator EPA ID: NYD137908570

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

BLOCKERS CLEANERS (Continued)

EDR ID Number
EPA ID Number

Database(s)

1004756540

Trans1 EPA ID: ILD051060408
Trans2 EPA ID: Not reported
TSDF ID: NJD000768093
Waste Code: F002 - HALO SOLV + STILL BOTTOMS FM REC OF SOLV
Quantity: 00070
Units: P - Pounds
Number of Containers: 001
Container Type: DM - Metal drums, barrels
Handling Method: B Incineration, heat recovery, burning.
Specific Gravity: 100
Year: 92
Manifest Tracking Num: Not reported
Import Ind: Not reported
Export Ind: Not reported
Discr Quantity Ind: Not reported
Discr Type Ind: Not reported
Discr Residue Ind: Not reported
Discr Partial Reject Ind: Not reported
Discr Full Reject Ind: Not reported
Manifest Ref Num: Not reported
Alt Fac RCRA Id: Not reported
Alt Fac Sign Date: Not reported
Mgmt Method Type Code: Not reported
EPA ID: NYD137908570
Facility Name: BLOCKERS CLEANERS
Facility Address: 840 SAINT NICHOLAS AVENUE
Facility City: NEW YORK
Facility Address 2: Not reported
Country: USA
County: RI
Mailing Name: BLOCKERS CLEANERS
Mailing Contact: BLOCKERS CLEANERS
Mailing Address: 840 SAINT NICHOLAS AVENUE
Mailing Address 2: Not reported
Mailing City: NEW YORK
Mailing State: NY
Mailing Zip: Not reported
Mailing Zip4: Not reported
Mailing Country: USA
Mailing Phone: 212-368-9228

Document ID: NJA1375886
Manifest Status: Completed copy
Trans1 State ID: NJDEPS869
Trans2 State ID: Not reported
Generator Ship Date: 920117
Trans1 Recv Date: 920117
Trans2 Recv Date: Not reported
TSD Site Recv Date: 920117
Part A Recv Date: 920131
Part B Recv Date: 920129
Generator EPA ID: NYD137908570
Trans1 EPA ID: ILD051060408
Trans2 EPA ID: Not reported
TSDF ID: NJD000768093
Waste Code: F002 - HALO SOLV + STILL BOTTOMS FM REC OF SOLV
Quantity: 00070

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s) EDR ID Number
EPA ID Number

BLOCKERS CLEANERS (Continued)

1004756540

Units:	P - Pounds
Number of Containers:	001
Container Type:	DM - Metal drums, barrels
Handling Method:	B Incineration, heat recovery, burning.
Specific Gravity:	100
Year:	92
Manifest Tracking Num:	Not reported
Import Ind:	Not reported
Export Ind:	Not reported
Discr Quantity Ind:	Not reported
Discr Type Ind:	Not reported
Discr Residue Ind:	Not reported
Discr Partial Reject Ind:	Not reported
Discr Full Reject Ind:	Not reported
Manifest Ref Num:	Not reported
Alt Fac RCRA Id:	Not reported
Alt Fac Sign Date:	Not reported
Mgmt Method Type Code:	Not reported
EPA ID:	NYD137908570
Facility Name:	BLOCKERS CLEANERS
Facility Address:	840 SAINT NICHOLAS AVENUE
Facility City:	NEW YORK
Facility Address 2:	Not reported
Country:	USA
County:	RI
Mailing Name:	BLOCKERS CLEANERS
Mailing Contact:	BLOCKERS CLEANERS
Mailing Address:	840 SAINT NICHOLAS AVENUE
Mailing Address 2:	Not reported
Mailing City:	NEW YORK
Mailing State:	NY
Mailing Zip:	Not reported
Mailing Zip4:	Not reported
Mailing Country:	USA
Mailing Phone:	212-368-9228
Document ID:	NJA1344597
Manifest Status:	Completed copy
Trans1 State ID:	NJDEPS869
Trans2 State ID:	Not reported
Generator Ship Date:	920214
Trans1 Recv Date:	920214
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	920214
Part A Recv Date:	920225
Part B Recv Date:	920302
Generator EPA ID:	NYD137908570
Trans1 EPA ID:	ILD051060408
Trans2 EPA ID:	Not reported
TSDF ID:	NJD000768093
Waste Code:	F002 - HALO SOLV + STILL BOTTOMS FM REC OF SOLV
Quantity:	00070
Units:	P - Pounds
Number of Containers:	001
Container Type:	DM - Metal drums, barrels
Handling Method:	B Incineration, heat recovery, burning.
Specific Gravity:	100

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BLOCKERS CLEANERS (Continued)

1004756540

Year: 92
Manifest Tracking Num: Not reported
Import Ind: Not reported
Export Ind: Not reported
Discr Quantity Ind: Not reported
Discr Type Ind: Not reported
Discr Residue Ind: Not reported
Discr Partial Reject Ind: Not reported
Discr Full Reject Ind: Not reported
Manifest Ref Num: Not reported
Alt Fac RCRA Id: Not reported
Alt Fac Sign Date: Not reported
Mgmt Method Type Code: Not reported
EPA ID: NYD137908570
Facility Name: BLOCKERS CLEANERS
Facility Address: 840 SAINT NICHOLAS AVENUE
Facility City: NEW YORK
Facility Address 2: Not reported
Country: USA
County: RI
Mailing Name: BLOCKERS CLEANERS
Mailing Contact: BLOCKERS CLEANERS
Mailing Address: 840 SAINT NICHOLAS AVENUE
Mailing Address 2: Not reported
Mailing City: NEW YORK
Mailing State: NY
Mailing Zip: Not reported
Mailing Zip4: Not reported
Mailing Country: USA
Mailing Phone: 212-368-9228

Document ID: NJA1351957
Manifest Status: Completed copy
Trans1 State ID: NJDEPS869
Trans2 State ID: Not reported
Generator Ship Date: 921201
Trans1 Recv Date: 921201
Trans2 Recv Date: Not reported
TSD Site Recv Date: 921201
Part A Recv Date: 921214
Part B Recv Date: 921215
Generator EPA ID: NYD137908570
Trans1 EPA ID: ILD051060408
Trans2 EPA ID: Not reported
TSDF ID: NJD000768093
Waste Code: F002 - HALO SOLV + STILL BOTTOMS FM REC OF SOLV
Quantity: 00070
Units: P - Pounds
Number of Containers: 001
Container Type: DM - Metal drums, barrels
Handling Method: B Incineration, heat recovery, burning.
Specific Gravity: 100
Year: 92
Manifest Tracking Num: Not reported
Import Ind: Not reported
Export Ind: Not reported
Discr Quantity Ind: Not reported

Map ID
 Direction
 Distance
 Distance (ft.)
 Elevation Site

MAP FINDINGS

Database(s) EDR ID Number
 EPA ID Number

BLOCKERS CLEANERS (Continued)

1004756540

Discr Type Ind:	Not reported
Discr Residue Ind:	Not reported
Discr Partial Reject Ind:	Not reported
Discr Full Reject Ind:	Not reported
Manifest Ref Num:	Not reported
Alt Fac RCRA Id:	Not reported
Alt Fac Sign Date:	Not reported
Mgmt Method Type Code:	Not reported
EPA ID:	NYD137908570
Facility Name:	BLOCKERS CLEANERS
Facility Address:	840 SAINT NICHOLAS AVENUE
Facility City:	NEW YORK
Facility Address 2:	Not reported
Country:	USA
County:	RI
Mailing Name:	BLOCKERS CLEANERS
Mailing Contact:	BLOCKERS CLEANERS
Mailing Address:	840 SAINT NICHOLAS AVENUE
Mailing Address 2:	Not reported
Mailing City:	NEW YORK
Mailing State:	NY
Mailing Zip:	Not reported
Mailing Zip4:	Not reported
Mailing Country:	USA
Mailing Phone:	212-368-9228
Document ID:	NJA1420120
Manifest Status:	Completed copy
Trans1 State ID:	NJDEPS869
Trans2 State ID:	Not reported
Generator Ship Date:	920909
Trans1 Recv Date:	920909
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	920909
Part A Recv Date:	920925
Part B Recv Date:	920922
Generator EPA ID:	NYD137908570
Trans1 EPA ID:	ILD051060408
Trans2 EPA ID:	Not reported
TSDF ID:	NJD000768093
Waste Code:	F002 - HALO SOLV + STILL BOTTOMS FM REC OF SOLV
Quantity:	00070
Units:	P - Pounds
Number of Containers:	001
Container Type:	DM - Metal drums, barrels
Handling Method:	B Incineration, heat recovery, burning.
Specific Gravity:	100
Year:	92
Manifest Tracking Num:	Not reported
Import Ind:	Not reported
Export Ind:	Not reported
Discr Quantity Ind:	Not reported
Discr Type Ind:	Not reported
Discr Residue Ind:	Not reported
Discr Partial Reject Ind:	Not reported
Discr Full Reject Ind:	Not reported
Manifest Ref Num:	Not reported

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s)
EDR ID Number
EPA ID Number

BLOCKERS CLEANERS (Continued)

1004756540

Alt Fac RCRA Id: Not reported
Alt Fac Sign Date: Not reported
Mgmt Method Type Code: Not reported
EPA ID: NYD137908570
Facility Name: BLOCKERS CLEANERS
Facility Address: 840 SAINT NICHOLAS AVENUE
Facility City: NEW YORK
Facility Address 2: Not reported
Country: USA
County: RI
Mailing Name: BLOCKERS CLEANERS
Mailing Contact: BLOCKERS CLEANERS
Mailing Address: 840 SAINT NICHOLAS AVENUE
Mailing Address 2: Not reported
Mailing City: NEW YORK
Mailing State: NY
Mailing Zip: Not reported
Mailing Zip4: Not reported
Mailing Country: USA
Mailing Phone: 212-368-9228

Document ID: NJA1413801
Manifest Status: Completed copy
Trans1 State ID: NJDEPS869
Trans2 State ID: Not reported
Generator Ship Date: 920730
Trans1 Recv Date: 920730
Trans2 Recv Date: Not reported
TSD Site Recv Date: 920730
Part A Recv Date: Not reported
Part B Recv Date: 920812
Generator EPA ID: NYD137908570
Trans1 EPA ID: ILD051060408
Trans2 EPA ID: Not reported
TSDF ID: NJD000768093
Waste Code: F002 - HALO SOLV + STILL BOTTOMS FM REC OF SOLV
Quantity: 00070
Units: P - Pounds
Number of Containers: 001
Container Type: DM - Metal drums, barrels
Handling Method: B Incineration, heat recovery, burning.
Specific Gravity: 100
Year: 92
Manifest Tracking Num: Not reported
Import Ind: Not reported
Export Ind: Not reported
Discr Quantity Ind: Not reported
Discr Type Ind: Not reported
Discr Residue Ind: Not reported
Discr Partial Reject Ind: Not reported
Discr Full Reject Ind: Not reported
Manifest Ref Num: Not reported
Alt Fac RCRA Id: Not reported
Alt Fac Sign Date: Not reported
Mgmt Method Type Code: Not reported
EPA ID: NYD137908570
Facility Name: BLOCKERS CLEANERS

Map ID
 Direction
 Distance
 Distance (ft.)
 Elevation Site

MAP FINDINGS

Database(s)
 EDR ID Number
 EPA ID Number

BLOCKERS CLEANERS (Continued)

1004756540

Facility Address: 840 SAINT NICHOLAS AVENUE
 Facility City: NEW YORK
 Facility Address 2: Not reported
 Country: USA
 County: RI
 Mailing Name: BLOCKERS CLEANERS
 Mailing Contact: BLOCKERS CLEANERS
 Mailing Address: 840 SAINT NICHOLAS AVENUE
 Mailing Address 2: Not reported
 Mailing City: NEW YORK
 Mailing State: NY
 Mailing Zip: Not reported
 Mailing Zip4: Not reported
 Mailing Country: USA
 Mailing Phone: 212-368-9228

Document ID: NJA1415970
 Manifest Status: Completed copy
 Trans1 State ID: NJDEPS869
 Trans2 State ID: Not reported
 Generator Ship Date: 921006
 Trans1 Recv Date: 921006
 Trans2 Recv Date: Not reported
 TSD Site Recv Date: 921006
 Part A Recv Date: 921104
 Part B Recv Date: 921023
 Generator EPA ID: NYD137908570
 Trans1 EPA ID: ILD051060408
 Trans2 EPA ID: Not reported
 TSDF ID: NJD000768093
 Waste Code: F002 - HALO SOLV + STILL BOTTOMS FM REC OF SOLV
 Quantity: 00070
 Units: P - Pounds
 Number of Containers: 001
 Container Type: DM - Metal drums, barrels
 Handling Method: B Incineration, heat recovery, burning.
 Specific Gravity: 100
 Year: 92
 Manifest Tracking Num: Not reported
 Import Ind: Not reported
 Export Ind: Not reported
 Discr Quantity Ind: Not reported
 Discr Type Ind: Not reported
 Discr Residue Ind: Not reported
 Discr Partial Reject Ind: Not reported
 Discr Full Reject Ind: Not reported
 Manifest Ref Num: Not reported
 Alt Fac RCRA Id: Not reported
 Alt Fac Sign Date: Not reported
 Mgmt Method Type Code: Not reported
 EPA ID: NYD137908570
 Facility Name: BLOCKERS CLEANERS
 Facility Address: 840 SAINT NICHOLAS AVENUE
 Facility City: NEW YORK
 Facility Address 2: Not reported
 Country: USA
 County: RI

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

BLOCKERS CLEANERS (Continued)

EDR ID Number
EPA ID Number

Database(s)

1004756540

Mailing Name: BLOCKERS CLEANERS
Mailing Contact: BLOCKERS CLEANERS
Mailing Address: 840 SAINT NICHOLAS AVENUE
Mailing Address 2: Not reported
Mailing City: NEW YORK
Mailing State: NY
Mailing Zip: Not reported
Mailing Zip4: Not reported
Mailing Country: USA
Mailing Phone: 212-368-9228

Document ID: NJA1545799
Manifest Status: Completed copy
Trans1 State ID: NJDEPS869
Trans2 State ID: Not reported
Generator Ship Date: 930420
Trans1 Recv Date: 930420
Trans2 Recv Date: Not reported
TSD Site Recv Date: 930420
Part A Recv Date: 930503
Part B Recv Date: 930503
Generator EPA ID: NYD137908570
Trans1 EPA ID: ILD051060408
Trans2 EPA ID: Not reported
TSDF ID: NJD000768093
Waste Code: F002 - HALO SOLV + STILL BOTTOMS FM REC OF SOLV
Quantity: 00070
Units: P - Pounds
Number of Containers: 001
Container Type: DM - Metal drums, barrels
Handling Method: B Incineration, heat recovery, burning.
Specific Gravity: 100
Year: 93
Manifest Tracking Num: Not reported
Import Ind: Not reported
Export Ind: Not reported
Discr Quantity Ind: Not reported
Discr Type Ind: Not reported
Discr Residue Ind: Not reported
Discr Partial Reject Ind: Not reported
Discr Full Reject Ind: Not reported
Manifest Ref Num: Not reported
Alt Fac RCRA Id: Not reported
Alt Fac Sign Date: Not reported
Mgmt Method Type Code: Not reported
EPA ID: NYD137908570
Facility Name: BLOCKERS CLEANERS
Facility Address: 840 SAINT NICHOLAS AVENUE
Facility City: NEW YORK
Facility Address 2: Not reported
Country: USA
County: RI
Mailing Name: BLOCKERS CLEANERS
Mailing Contact: BLOCKERS CLEANERS
Mailing Address: 840 SAINT NICHOLAS AVENUE
Mailing Address 2: Not reported
Mailing City: NEW YORK

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

BLOCKERS CLEANERS (Continued)

EDR ID Number
EPA ID Number

Database(s)

1004756540

Mailing State: NY
Mailing Zip: Not reported
Mailing Zip4: Not reported
Mailing Country: USA
Mailing Phone: 212-368-9228

Document ID: NJA0503562
Manifest Status: Completed copy
Trans1 State ID: NJDEPS869
Trans2 State ID: Not reported
Generator Ship Date: 880803
Trans1 Recv Date: 880803
Trans2 Recv Date: Not reported
TSD Site Recv Date: 880803
Part A Recv Date: 880819
Part B Recv Date: 880819
Generator EPA ID: NYD137908570
Trans1 EPA ID: ILD051060408
Trans2 EPA ID: Not reported
TSD ID: NJD000768093
Waste Code: F002 - HALO SOLV + STILL BOTTOMS FM REC OF SOLV
Quantity: 00070
Units: P - Pounds
Number of Containers: 001
Container Type: DM - Metal drums, barrels
Handling Method: R Material recovery of more than 75 percent of the total material.
Specific Gravity: 100
Year: 88
Manifest Tracking Num: Not reported
Import Ind: Not reported
Export Ind: Not reported
Discr Quantity Ind: Not reported
Discr Type Ind: Not reported
Discr Residue Ind: Not reported
Discr Partial Reject Ind: Not reported
Discr Full Reject Ind: Not reported
Manifest Ref Num: Not reported
Alt Fac RCRA Id: Not reported
Alt Fac Sign Date: Not reported
Mgmt Method Type Code: Not reported
EPA ID: NYD137908570
Facility Name: BLOCKERS CLEANERS
Facility Address: 840 SAINT NICHOLAS AVENUE
Facility City: NEW YORK
Facility Address 2: Not reported
Country: USA
County: RI
Mailing Name: BLOCKERS CLEANERS
Mailing Contact: BLOCKERS CLEANERS
Mailing Address: 840 SAINT NICHOLAS AVENUE
Mailing Address 2: Not reported
Mailing City: NEW YORK
Mailing State: NY
Mailing Zip: Not reported
Mailing Zip4: Not reported
Mailing Country: USA
Mailing Phone: 212-368-9228

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s)
EDR ID Number
EPA ID Number

BLOCKERS CLEANERS (Continued)

1004756540

Document ID: NJA0501401
Manifest Status: Completed copy
Trans1 State ID: NJDEPS869
Trans2 State ID: Not reported
Generator Ship Date: 880830
Trans1 Recv Date: 880830
Trans2 Recv Date: Not reported
TSD Site Recv Date: 880830
Part A Recv Date: 880922
Part B Recv Date: 880914
Generator EPA ID: NYD137908570
Trans1 EPA ID: ILD051060408
Trans2 EPA ID: Not reported
TSD ID: NJD000768093
Waste Code: F002 - HALO SOLV + STILL BOTTOMS FM REC OF SOLV
Quantity: 00070
Units: P - Pounds
Number of Containers: 001
Container Type: DM - Metal drums, barrels
Handling Method: R Material recovery of more than 75 percent of the total material.
Specific Gravity: 100
Year: 88
Manifest Tracking Num: Not reported
Import Ind: Not reported
Export Ind: Not reported
Discr Quantity Ind: Not reported
Discr Type Ind: Not reported
Discr Residue Ind: Not reported
Discr Partial Reject Ind: Not reported
Discr Full Reject Ind: Not reported
Manifest Ref Num: Not reported
Alt Fac RCRA Id: Not reported
Alt Fac Sign Date: Not reported
Mgmt Method Type Code: Not reported
EPA ID: NYD137908570
Facility Name: BLOCKERS CLEANERS
Facility Address: 840 SAINT NICHOLAS AVENUE
Facility City: NEW YORK
Facility Address 2: Not reported
Country: USA
County: RI
Mailing Name: BLOCKERS CLEANERS
Mailing Contact: BLOCKERS CLEANERS
Mailing Address: 840 SAINT NICHOLAS AVENUE
Mailing Address 2: Not reported
Mailing City: NEW YORK
Mailing State: NY
Mailing Zip: Not reported
Mailing Zip4: Not reported
Mailing Country: USA
Mailing Phone: 212-368-9228

Document ID: NJA1621463
Manifest Status: Completed copy
Trans1 State ID: NJDEPS869
Trans2 State ID: Not reported
Generator Ship Date: 930323

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s) EDR ID Number
EPA ID Number

BLOCKERS CLEANERS (Continued)

1004756540

Trans1 Recv Date: 930323
Trans2 Recv Date: Not reported
TSD Site Recv Date: 930323
Part A Recv Date: 930401
Part B Recv Date: 930402
Generator EPA ID: NYD137908570
Trans1 EPA ID: ILD051060408
Trans2 EPA ID: Not reported
TSDF ID: NJD000768093
Waste Code: F002 - HALO SOLV + STILL BOTTOMS FM REC OF SOLV
Quantity: 00070
Units: P - Pounds
Number of Containers: 001
Container Type: DM - Metal drums, barrels
Handling Method: B Incineration, heat recovery, burning.
Specific Gravity: 100
Year: 93
Manifest Tracking Num: Not reported
Import Ind: Not reported
Export Ind: Not reported
Discr Quantity Ind: Not reported
Discr Type Ind: Not reported
Discr Residue Ind: Not reported
Discr Partial Reject Ind: Not reported
Discr Full Reject Ind: Not reported
Manifest Ref Num: Not reported
Alt Fac RCRA Id: Not reported
Alt Fac Sign Date: Not reported
Mgmt Method Type Code: Not reported
EPA ID: NYD137908570
Facility Name: BLOCKERS CLEANERS
Facility Address: 840 SAINT NICHOLAS AVENUE
Facility City: NEW YORK
Facility Address 2: Not reported
Country: USA
County: RI
Mailing Name: BLOCKERS CLEANERS
Mailing Contact: BLOCKERS CLEANERS
Mailing Address: 840 SAINT NICHOLAS AVENUE
Mailing Address 2: Not reported
Mailing City: NEW YORK
Mailing State: NY
Mailing Zip: Not reported
Mailing Zip4: Not reported
Mailing Country: USA
Mailing Phone: 212-368-9228

Document ID: NJA1642378
Manifest Status: Completed copy
Trans1 State ID: NJDEPS869
Trans2 State ID: Not reported
Generator Ship Date: 930129
Trans1 Recv Date: 930129
Trans2 Recv Date: Not reported
TSD Site Recv Date: 930129
Part A Recv Date: 930212
Part B Recv Date: 930212

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

BLOCKERS CLEANERS (Continued)

EDR ID Number
EPA ID Number

Database(s)

1004756540

Generator EPA ID:	NYD137908570
Trans1 EPA ID:	ILD051060408
Trans2 EPA ID:	Not reported
TSD ID:	NJD000768093
Waste Code:	F002 - HALO SOLV + STILL BOTTOMS FM REC OF SOLV
Quantity:	00070
Units:	P - Pounds
Number of Containers:	001
Container Type:	DM - Metal drums, barrels
Handling Method:	B Incineration, heat recovery, burning.
Specific Gravity:	100
Year:	93
Manifest Tracking Num:	Not reported
Import Ind:	Not reported
Export Ind:	Not reported
Discr Quantity Ind:	Not reported
Discr Type Ind:	Not reported
Discr Residue Ind:	Not reported
Discr Partial Reject Ind:	Not reported
Discr Full Reject Ind:	Not reported
Manifest Ref Num:	Not reported
Alt Fac RCRA Id:	Not reported
Alt Fac Sign Date:	Not reported
Mgmt Method Type Code:	Not reported
EPA ID:	NYD137908570
Facility Name:	BLOCKERS CLEANERS
Facility Address:	840 SAINT NICHOLAS AVENUE
Facility City:	NEW YORK
Facility Address 2:	Not reported
Country:	USA
County:	RI
Mailing Name:	BLOCKERS CLEANERS
Mailing Contact:	BLOCKERS CLEANERS
Mailing Address:	840 SAINT NICHOLAS AVENUE
Mailing Address 2:	Not reported
Mailing City:	NEW YORK
Mailing State:	NY
Mailing Zip:	Not reported
Mailing Zip4:	Not reported
Mailing Country:	USA
Mailing Phone:	212-368-9228
Document ID:	NJA1630527
Manifest Status:	Completed after the designated time period for a TSD to get a copy to the DEC
Trans1 State ID:	NJDEPS869
Trans2 State ID:	Not reported
Generator Ship Date:	930520
Trans1 Recv Date:	930520
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	930520
Part A Recv Date:	930609
Part B Recv Date:	930616
Generator EPA ID:	NYD137908570
Trans1 EPA ID:	ILD051060408
Trans2 EPA ID:	Not reported
TSD ID:	NJD000768093
Waste Code:	F002 - HALO SOLV + STILL BOTTOMS FM REC OF SOLV

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s)
EDR ID Number
EPA ID Number

BLOCKERS CLEANERS (Continued)

1004756540

Quantity: 00070
Units: P - Pounds
Number of Containers: 001
Container Type: DM - Metal drums, barrels
Handling Method: B Incineration, heat recovery, burning.
Specific Gravity: 100
Year: 93
Manifest Tracking Num: Not reported
Import Ind: Not reported
Export Ind: Not reported
Discr Quantity Ind: Not reported
Discr Type Ind: Not reported
Discr Residue Ind: Not reported
Discr Partial Reject Ind: Not reported
Discr Full Reject Ind: Not reported
Manifest Ref Num: Not reported
Alt Fac RCRA Id: Not reported
Alt Fac Sign Date: Not reported
Mgmt Method Type Code: Not reported
EPA ID: NYD137908570
Facility Name: BLOCKERS CLEANERS
Facility Address: 840 SAINT NICHOLAS AVENUE
Facility City: NEW YORK
Facility Address 2: Not reported
Country: USA
County: RI
Mailing Name: BLOCKERS CLEANERS
Mailing Contact: BLOCKERS CLEANERS
Mailing Address: 840 SAINT NICHOLAS AVENUE
Mailing Address 2: Not reported
Mailing City: NEW YORK
Mailing State: NY
Mailing Zip: Not reported
Mailing Zip4: Not reported
Mailing Country: USA
Mailing Phone: 212-368-9228

Document ID: NJA0511509
Manifest Status: Completed copy
Trans1 State ID: NJDEPS869
Trans2 State ID: Not reported
Generator Ship Date: 881123
Trans1 Recv Date: 881123
Trans2 Recv Date: Not reported
TSD Site Recv Date: 881123
Part A Recv Date: 881130
Part B Recv Date: 881212
Generator EPA ID: NYD137908570
Trans1 EPA ID: ILD051060408
Trans2 EPA ID: Not reported
TSDF ID: NJD000768093
Waste Code: F002 - HALO SOLV + STILL BOTTOMS FM REC OF SOLV
Quantity: 00070
Units: P - Pounds
Number of Containers: 001
Container Type: DM - Metal drums, barrels
Handling Method: R Material recovery of more than 75 percent of the total material.

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

BLOCKERS CLEANERS (Continued)

EDR ID Number
EPA ID Number

Database(s)

1004756540

Specific Gravity: 100
Year: 88
Manifest Tracking Num: Not reported
Import Ind: Not reported
Export Ind: Not reported
Discr Quantity Ind: Not reported
Discr Type Ind: Not reported
Discr Residue Ind: Not reported
Discr Partial Reject Ind: Not reported
Discr Full Reject Ind: Not reported
Manifest Ref Num: Not reported
Alt Fac RCRA Id: Not reported
Alt Fac Sign Date: Not reported
Mgmt Method Type Code: Not reported
EPA ID: NYD137908570
Facility Name: BLOCKERS CLEANERS
Facility Address: 840 SAINT NICHOLAS AVENUE
Facility City: NEW YORK
Facility Address 2: Not reported
Country: USA
County: RI
Mailing Name: BLOCKERS CLEANERS
Mailing Contact: BLOCKERS CLEANERS
Mailing Address: 840 SAINT NICHOLAS AVENUE
Mailing Address 2: Not reported
Mailing City: NEW YORK
Mailing State: NY
Mailing Zip: Not reported
Mailing Zip4: Not reported
Mailing Country: USA
Mailing Phone: 212-368-9228

Document ID: NJA0506228
Manifest Status: Completed copy
Trans1 State ID: NJDEPS869
Trans2 State ID: Not reported
Generator Ship Date: 881004
Trans1 Recv Date: 881004
Trans2 Recv Date: Not reported
TSD Site Recv Date: 881004
Part A Recv Date: 881020
Part B Recv Date: 881025
Generator EPA ID: NYD137908570
Trans1 EPA ID: ILD051060408
Trans2 EPA ID: Not reported
TSDF ID: NJD000768093
Waste Code: F002 - HALO SOLV + STILL BOTTOMS FM REC OF SOLV
Quantity: 00070
Units: P - Pounds
Number of Containers: 001
Container Type: DM - Metal drums, barrels
Handling Method: R Material recovery of more than 75 percent of the total material.
Specific Gravity: 100
Year: 88
Manifest Tracking Num: Not reported
Import Ind: Not reported
Export Ind: Not reported

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s)
EDR ID Number
EPA ID Number

BLOCKERS CLEANERS (Continued)

1004756540

Discr Quantity Ind:	Not reported
Discr Type Ind:	Not reported
Discr Residue Ind:	Not reported
Discr Partial Reject Ind:	Not reported
Discr Full Reject Ind:	Not reported
Manifest Ref Num:	Not reported
Alt Fac RCRA Id:	Not reported
Alt Fac Sign Date:	Not reported
Mgmt Method Type Code:	Not reported
EPA ID:	NYD137908570
Facility Name:	BLOCKERS CLEANERS
Facility Address:	840 SAINT NICHOLAS AVENUE
Facility City:	NEW YORK
Facility Address 2:	Not reported
Country:	USA
County:	RI
Mailing Name:	BLOCKERS CLEANERS
Mailing Contact:	BLOCKERS CLEANERS
Mailing Address:	840 SAINT NICHOLAS AVENUE
Mailing Address 2:	Not reported
Mailing City:	NEW YORK
Mailing State:	NY
Mailing Zip:	Not reported
Mailing Zip4:	Not reported
Mailing Country:	USA
Mailing Phone:	212-368-9228
Document ID:	NJA0511868
Manifest Status:	Completed copy
Trans1 State ID:	NJDEPS869
Trans2 State ID:	Not reported
Generator Ship Date:	881230
Trans1 Recv Date:	881230
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	881230
Part A Recv Date:	890112
Part B Recv Date:	890110
Generator EPA ID:	NYD137908570
Trans1 EPA ID:	ILD051060408
Trans2 EPA ID:	Not reported
TSD ID:	NJD000768093
Waste Code:	F002 - HALO SOLV + STILL BOTTOMS FM REC OF SOLV
Quantity:	00140
Units:	P - Pounds
Number of Containers:	002
Container Type:	DM - Metal drums, barrels
Handling Method:	R Material recovery of more than 75 percent of the total material.
Specific Gravity:	100
Year:	88
Manifest Tracking Num:	Not reported
Import Ind:	Not reported
Export Ind:	Not reported
Discr Quantity Ind:	Not reported
Discr Type Ind:	Not reported
Discr Residue Ind:	Not reported
Discr Partial Reject Ind:	Not reported
Discr Full Reject Ind:	Not reported

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s) EDR ID Number
EPA ID Number

BLOCKERS CLEANERS (Continued)

1004756540

Manifest Ref Num:	Not reported
Alt Fac RCRA Id:	Not reported
Alt Fac Sign Date:	Not reported
Mgmt Method Type Code:	Not reported
EPA ID:	NYD137908570
Facility Name:	BLOCKERS CLEANERS
Facility Address:	840 SAINT NICHOLAS AVENUE
Facility City:	NEW YORK
Facility Address 2:	Not reported
Country:	USA
County:	RI
Mailing Name:	BLOCKERS CLEANERS
Mailing Contact:	BLOCKERS CLEANERS
Mailing Address:	840 SAINT NICHOLAS AVENUE
Mailing Address 2:	Not reported
Mailing City:	NEW YORK
Mailing State:	NY
Mailing Zip:	Not reported
Mailing Zip4:	Not reported
Mailing Country:	USA
Mailing Phone:	212-368-9228
Document ID:	NJA1612153
Manifest Status:	Completed after the designated time period for a TSDF to get a copy to the DEC
Trans1 State ID:	NJDEPS869
Trans2 State ID:	Not reported
Generator Ship Date:	930625
Trans1 Recv Date:	930625
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	930625
Part A Recv Date:	930709
Part B Recv Date:	930721
Generator EPA ID:	NYD137908570
Trans1 EPA ID:	ILD984908202
Trans2 EPA ID:	Not reported
TSDF ID:	NJD000768093
Waste Code:	F002 - HALO SOLV + STILL BOTTOMS FM REC OF SOLV
Quantity:	00070
Units:	P - Pounds
Number of Containers:	001
Container Type:	DM - Metal drums, barrels
Handling Method:	B Incineration, heat recovery, burning.
Specific Gravity:	100
Year:	93
Manifest Tracking Num:	Not reported
Import Ind:	Not reported
Export Ind:	Not reported
Discr Quantity Ind:	Not reported
Discr Type Ind:	Not reported
Discr Residue Ind:	Not reported
Discr Partial Reject Ind:	Not reported
Discr Full Reject Ind:	Not reported
Manifest Ref Num:	Not reported
Alt Fac RCRA Id:	Not reported
Alt Fac Sign Date:	Not reported
Mgmt Method Type Code:	Not reported
EPA ID:	NYD137908570

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

BLOCKERS CLEANERS (Continued)

EDR ID Number
EPA ID Number

Database(s)

1004756540

Facility Name: BLOCKERS CLEANERS
Facility Address: 840 SAINT NICHOLAS AVENUE
Facility City: NEW YORK
Facility Address 2: Not reported
Country: USA
County: RI
Mailing Name: BLOCKERS CLEANERS
Mailing Contact: BLOCKERS CLEANERS
Mailing Address: 840 SAINT NICHOLAS AVENUE
Mailing Address 2: Not reported
Mailing City: NEW YORK
Mailing State: NY
Mailing Zip: Not reported
Mailing Zip4: Not reported
Mailing Country: USA
Mailing Phone: 212-368-9228

[Click this hyperlink](#) while viewing on your computer to access
40 additional NY_MANIFEST: record(s) in the EDR Site Report.

62
NNE
1/8-1/4
757 ft.

515 EDGECOMBE AVENUE
515 EDGECOMBE AVENUE
NEW YORK, NY 10032

AST **U003383840**
HIST AST **N/A**

Relative:
Higher

AST:

AST:

Actual:
129 ft.

Region: STATE
Facility Id: 2-064106
UTM X: 589422.86831
UTM Y: 4520695.70292
Expiration Date: 03/10/12
Renewal Date: 11/13/01
Total Capacity: 3000
Facility Type: Not reported
Site Type Name: Apartment Building/Office Building
Site Type Status: Active
Mailing Company: 515 EDGECOMBE OWNERS CORP C/O J& M REALTY SERVICE
Mailing Title: Not reported
Mailing Contact: Not reported
Mailing Address: 21 WEST 86TH STREET
Mailing Address 2: Not reported
Mailing City: NEW YORK
Mailing State: NY
Mailing Zip Code: 10013
Mailing Phone No: 212) 210-424
Mailing Email: Not reported
Owner Title: AGENT
Owner Name: JERRY EDELMAN
Owner Address: P O BOX 51 CANAL ST STATION
Owner Address 2: Not reported
Owner State: NY
Owner Zip Code: 10013
Owner Phone: (212) 925-3987
Owner Company: 515 EDGECOMBE OWNERS CORP
Emergency Contact: SYED ALI
Emergency Phone: (917) 468-1382

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s)
EDR ID Number
EPA ID Number

515 EDGECOMBE AVENUE (Continued)

U003383840

Operator: SYED ALI
Operator Phone: (917) 468-1382
Owner City: NEW YORK
Owner Sub Type: Corporate or Commercial
Program Type: PBS

Tank Number: 001
Tank Location Name: Aboveground - in contact with soil
Tank Status: In Service
Tank Model: Not reported
Pipe Model: Not reported
Active Status: Active
Install Date: 01/27/26
Capacity Gallons: 3000
Material Name: #2 Fuel Oil
Percentage: 100.00
Tank Type Name: Steel/Carbon Steel/Iron
Tank Internal Protection: None
Tank Internal Protection 1: Jacketed
Tank Internal Protection 2: Not reported
Pipe Location Name: Aboveground/Underground Combination
Pipe Type Name: Steel/Carbon Steel/Iron
Pipe External Protection 1: Painted/Asphalt Coating
Pipe External Protection 2: Not reported
Tank Secondary Containment 1: Vault (w/o access)
Tank Secondary Containment 2: Not reported
Pipe Secondary Containment: Not reported
Tank Leak Detection 1: Other
Tank Leak Detection 2: Not reported
Pipe Leak Detection 1: Exempt Suction Piping
Pipe Leak Detection 2: Not reported
Type Of Overfill Prevention 1: Product Level Gauge (A/G)
Type Of Overfill Prevention 2: Not reported
Dispenser Method: Suction
Spill Prevention: Not reported
Tightness Test Method: Testing Not Required
Date Tested: / /
Next Test Date: / /
Date Tank Closed: / /

HIST AST:

PBS Number: 2-064106
SWIS Code: 6201
Operator: FRED WORLEY
Facility Phone: (212) 283-0593
Facility Addr2: 515 EDGECOMBE AVENUE
Facility Type: APARTMENT BUILDING
Emergency: FRED WORLEY
Emergency Tel: (212) 283-0593
Old PBSNO: Not reported
Date Inspected: Not reported
Inspector: Not reported
Result of Inspection: Not reported
Owner Name: 515 EDGECOMBE OWNERS CORP
Owner Address: P O BOX 51 CANAL ST STATION
Owner City,St,Zip: NEW YORK, NY 10013
Federal ID: Not reported

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

515 EDGECOMBE AVENUE (Continued)

EDR ID Number
EPA ID Number

Database(s)

U003383840

Owner Tel: (212) 925-3987
Owner Type: Corporate/Commercial
Owner Subtype: Not reported
Mailing Contact: Not reported
Mailing Name: 515 EDGECOMBE OWNERS CORP
Mailing Address: P O BOX 51
Mailing Address 2: CANAL STREET STATION
Mailing City,St,Zip: NEW YORK, NY 10013
Mailing Telephone: (212) 925-3987
Owner Mark: First Owner
Facility Status: 1 - Active PBS facility, i.e. total capacity of the PBS tanks is greater than 1,100 gallons, regardless if Subpart 360-14 tanks exist or not at the facility.

Certification Flag: True
Certification Date: Not reported
Expiration: 03/10/2007
Renew Flag: False
Renew Date: 20011113
Total Capacity: 3000
FAMT: True
Facility Screen: No Missing Data
Owner Screen: No Missing Data
Tank Screen: No Missing Data
Dead Letter: False
CBS Number: Not reported
Town or City: NEW YORK CITY
County Code: 62
Town or City Code: 01
Region: 2

Tank ID: 001
Tank Location: ABOVEGROUND
Tank Status: In Service
Install Date: Not reported
Capacity (Gal): 3000
Product Stored: NOS 1,2, OR 4 FUEL OIL
Tank Type: Steel/carbon steel
Tank Internal: 0
Tank External: 5
Pipe Location: Aboveground/Underground Combination
Pipe Type: STEEL/IRON
Pipe Internal: None
Pipe External: 1
Tank Containment: Diking
Leak Detection: 9
Overfill Protection: 4
Dispenser Method: Suction
Date Tested: Not reported
Next Test Date: Not reported
Missing Data for Tank: No Missing Data
Date Closed: Not reported
Test Method: Not reported
Deleted: False
Updated: True
SPDES Number: Not reported
Lat/Long: Not reported

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

Q63
SE
1/8-1/4
769 ft.

JGS PARKING GARAGE, INC.
250 BRADHURST AVENUE
NEW YORK, NY 10039

UST **U004047265**
N/A

Relative:
Lower

Site 1 of 2 in cluster Q

UST:

Actual:
22 ft.

UST:

Facility Id: 2-608783
Expiration Date: 04/03/08
Renewal Date: / /
Total Capacity: 0
Facility Type: Not reported
Mailing Company: KALEIDAPARK, INC.
Mailing Title: Not reported
Mailing Contact: SAMY BRAHIMY
Mailing Address: 139 SAINT FELIX STREET
Mailing Address 2: Not reported
Mailing City: BROOKLYN
Mailing State: NY
Mailing Zip Code: 11217-1432
Mailing Phone No: (718) 852-8553
Mailing Email: Not reported
Owner Title: Not reported
Owner Name: Not reported
Owner Address: 139 SAINT FELIX STREET
Owner Address 2: Not reported
Owner State: NY
Owner Zip Code: 11217
Owner Phone: (718) 852-8553
Owner Company: ADCO NCP USA LTD % KALEIDAPARK, INC
Emergency Contact: STELLA
Emergency Phone: (917) 887-3360
Operator: ED DISLA
Operator Phone: (212) 368-5899
Owner City: BROOKLYN
Owner Sub Type: Corporate or Commercial
UTM X: 589478.04054
UTM Y: 4520330.49747
Site Type Name: Other
Site Type Status: Unregulated
Comments: Not reported

Program Type: PBS

Tank Number: 01
Tank Location Name: Underground
Tank Status: Closed - Removed
Tank Model: Not reported
Pipe Model: Not reported
Active Status: Inactive
Install Date: / /
Capacity Gallons: 550
Material Name: Gasoline
Percentage: 100.00
Tank Type Name: Steel/Carbon Steel/Iron
Tank Internal Protection: None
Tank Internal Protection 1: Painted/Asphalt Coating
Tank Internal Protection 2: Not reported

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s)
EDR ID Number
EPA ID Number

JGS PARKING GARAGE, INC. (Continued)

U004047265

Pipe Location Name: Underground/On-ground
Pipe Type Name: Galvanized Steel
Pipe External Protection 1: Painted/Asphalt Coating
Pipe External Protection 2: Not reported
Tank Secondary Containment 1: None
Tank Secondary Containment 2: Not reported
Pipe Secondary Containment: Not reported
Tank Leak Detection 1: None
Tank Leak Detection 2: Not reported
Pipe Leak Detection 1: Not reported
Pipe Leak Detection 2: Not reported
Type Of Overfill Prevention 1: Product Level Gauge (A/G)
Type Of Overfill Prevention 2: Not reported
Dispenser Method: Suction
Spill Prevention: Not reported
Tightness Test Method: Testing Not Required
Date Tested: / /
Next Test Date: / /
Date Tank Closed: 03/01/03

Tank Number: 02
Tank Location Name: Underground
Tank Status: Closed - Removed
Tank Model: Not reported
Pipe Model: Not reported
Active Status: Inactive
Install Date: / /
Capacity Gallons: 550
Material Name: Gasoline
Percentage: 100.00
Tank Type Name: Steel/Carbon Steel/Iron
Tank Internal Protection: None
Tank Internal Protection 1: Painted/Asphalt Coating
Tank Internal Protection 2: Not reported
Pipe Location Name: Underground/On-ground
Pipe Type Name: Galvanized Steel
Pipe External Protection 1: Painted/Asphalt Coating
Pipe External Protection 2: Not reported
Tank Secondary Containment 1: None
Tank Secondary Containment 2: Not reported
Pipe Secondary Containment: Not reported
Tank Leak Detection 1: None
Tank Leak Detection 2: Not reported
Pipe Leak Detection 1: Not reported
Pipe Leak Detection 2: Not reported
Type Of Overfill Prevention 1: Product Level Gauge (A/G)
Type Of Overfill Prevention 2: Not reported
Dispenser Method: Suction
Spill Prevention: Not reported
Tightness Test Method: Testing Not Required
Date Tested: / /
Next Test Date: / /
Date Tank Closed: 03/01/03

Tank Number: 03

Map ID
 Direction
 Distance
 Distance (ft.)
 Elevation Site

MAP FINDINGS

Database(s)
 EDR ID Number
 EPA ID Number

JGS PARKING GARAGE, INC. (Continued)

U004047265

Tank Location Name: Underground
 Tank Status: Closed - Removed
 Tank Model: Not reported
 Pipe Model: Not reported
 Active Status: Inactive
 Install Date: / /
 Capacity Gallons: 550
 Material Name: Gasoline
 Percentage: 100.00
 Tank Type Name: Steel/Carbon Steel/Iron
 Tank Internal Protection: None
 Tank Internal Protection 1: Painted/Asphalt Coating
 Tank Internal Protection 2: Not reported
 Pipe Location Name: Underground/On-ground
 Pipe Type Name: Galvanized Steel
 Pipe External Protection 1: Painted/Asphalt Coating
 Pipe External Protection 2: Not reported
 Tank Secondary Containment 1: None
 Tank Secondary Containment 2: Not reported
 Pipe Secondary Containment: Not reported
 Tank Leak Detection 1: None
 Tank Leak Detection 2: Not reported
 Pipe Leak Detection 1: Not reported
 Pipe Leak Detection 2: Not reported
 Type Of Overfill Prevention 1: Product Level Gauge (A/G)
 Type Of Overfill Prevention 2: Not reported
 Dispenser Method: Suction
 Spill Prevention: Not reported
 Tightness Test Method: Testing Not Required
 Date Tested: / /
 Next Test Date: / /
 Date Tank Closed: 03/01/03

Tank Number: 04
 Tank Location Name: Underground
 Tank Status: Closed - Removed
 Tank Model: Not reported
 Pipe Model: Not reported
 Active Status: Inactive
 Install Date: / /
 Capacity Gallons: 550
 Material Name: Gasoline
 Percentage: 100.00
 Tank Type Name: Steel/Carbon Steel/Iron
 Tank Internal Protection: None
 Tank Internal Protection 1: Painted/Asphalt Coating
 Tank Internal Protection 2: Not reported
 Pipe Location Name: Underground/On-ground
 Pipe Type Name: Galvanized Steel
 Pipe External Protection 1: Painted/Asphalt Coating
 Pipe External Protection 2: Not reported
 Tank Secondary Containment 1: None
 Tank Secondary Containment 2: Not reported
 Pipe Secondary Containment: Not reported
 Tank Leak Detection 1: None
 Tank Leak Detection 2: Not reported

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

JGS PARKING GARAGE, INC. (Continued)

EDR ID Number
EPA ID Number

Database(s)

U004047265

Pipe Leak Detection 1: Not reported
Pipe Leak Detection 2: Not reported
Type Of Overfill Prevention 1: Product Level Gauge (A/G)
Type Of Overfill Prevention 2: Not reported
Dispenser Method: Suction
Spill Prevention: Not reported
Tightness Test Method: Testing Not Required
Date Tested: / /
Next Test Date: / /
Date Tank Closed: 03/01/03

Tank Number: 05
Tank Location Name: Underground
Tank Status: Closed - Removed
Tank Model: Not reported
Pipe Model: Not reported
Active Status: Inactive
Install Date: / /
Capacity Gallons: 550
Material Name: Gasoline
Percentage: 100.00
Tank Type Name: Steel/Carbon Steel/Iron
Tank Internal Protection: None
Tank Internal Protection 1: Painted/Asphalt Coating
Tank Internal Protection 2: Not reported
Pipe Location Name: Underground/On-ground
Pipe Type Name: Galvanized Steel
Pipe External Protection 1: Painted/Asphalt Coating
Pipe External Protection 2: Not reported
Tank Secondary Containment 1: None
Tank Secondary Containment 2: Not reported
Pipe Secondary Containment: Not reported
Tank Leak Detection 1: None
Tank Leak Detection 2: Not reported
Pipe Leak Detection 1: Not reported
Pipe Leak Detection 2: Not reported
Type Of Overfill Prevention 1: Product Level Gauge (A/G)
Type Of Overfill Prevention 2: Not reported
Dispenser Method: Suction
Spill Prevention: Not reported
Tightness Test Method: Testing Not Required
Date Tested: / /
Next Test Date: / /
Date Tank Closed: 03/01/03

P64 1946 AMSTERDAM AVE.
NNW 1946 AMSTERDAM AVENUE
1/8-1/4 NEW YORK, NY 10032
787 ft.

AST A100183553
N/A

Relative:
Higher

Site 3 of 9 in cluster P

AST:

Actual:
147 ft.

AST:

Region: STATE
Facility Id: 2-606990
UTM X: 589175.88957

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s)
EDR ID Number
EPA ID Number

1946 AMSTERDAM AVE. (Continued)

A100183553

UTM Y: 4520706.66154
Expiration Date: 09/24/11
Renewal Date: / /
Total Capacity: 5000
Facility Type: Not reported
Site Type Name: Apartment Building/Office Building
Site Type Status: Active
Mailing Company: JAVA DEL VALLE CORP.
Mailing Title: Not reported
Mailing Contact: JOSE SANCHEZ
Mailing Address: P.O. BOX 503
Mailing Address 2: COOPER STA.
Mailing City: NEW YORK
Mailing State: NY
Mailing Zip Code: 10276-0503
Mailing Phone No: (212) 777-8459
Mailing Email: Not reported
Owner Title: PRES
Owner Name: JOSE SANCHEZ
Owner Address: P.O. BOX 503
Owner Address 2: Not reported
Owner State: NY
Owner Zip Code: 10276-0503
Owner Phone: (212) 777-8459
Owner Company: JAVA DEL VALLE CORP.
Emergency Contact: VIRGINIA SANCHEZ
Emergency Phone: (917) 531-0748
Operator: JOSE SANCHEZ
Operator Phone: (212) 777-8459
Owner City: NEW YORK
Owner Sub Type: Corporate or Commercial
Program Type: PBS

Tank Number: 001
Tank Location Name: Aboveground - in contact with soil
Tank Status: In Service
Tank Model: Not reported
Pipe Model: Not reported
Active Status: Active
Install Date: / /
Capacity Gallons: 5000
Material Name: #2 Fuel Oil
Percentage: 100.00
Tank Type Name: Steel/Carbon Steel/Iron
Tank Internal Protection: None
Tank Internal Protection 1: Painted/Asphalt Coating
Tank Internal Protection 2: Not reported
Pipe Location Name: Aboveground/Underground Combination
Pipe Type Name: Steel/Carbon Steel/Iron
Pipe External Protection 1: Painted/Asphalt Coating
Pipe External Protection 2: Not reported
Tank Secondary Containment 1: Vault (w/o access)
Tank Secondary Containment 2: Not reported
Pipe Secondary Containment: Not reported
Tank Leak Detection 1: Interstitial - Electronic Monitoring
Tank Leak Detection 2: Not reported
Pipe Leak Detection 1: Exempt Suction Piping

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

1946 AMSTERDAM AVE. (Continued)

EDR ID Number
EPA ID Number

Database(s)

A100183553

Pipe Leak Detection 2: Not reported
Type Of Overfill Prevention 1: Vent Whistle
Type Of Overfill Prevention 2: Not reported
Dispenser Method: Suction
Spill Prevention: Not reported
Tightness Test Method: Testing Not Required
Date Tested: / /
Next Test Date: / /
Date Tank Closed: / /

P65
NNW
1/8-1/4
787 ft.

K&B CLEANERS
1946 AMSTERDAM AVE
NEW YORK, NY 10032

RCRA-SQG
FINDS
NY MANIFEST

1000103578
NYD981482417

Relative:
Higher

Site 4 of 9 in cluster P

Actual:
147 ft.

RCRAInfo:
Owner: OTHA BROWN
(212) 555-1212
EPA ID: NYD981482417
Contact: Not reported
Classification: Small Quantity Generator
TSDF Activities: Not reported
Violation Status: No violations found

FINDS:

Other Pertinent Environmental Activity Identified at Site

NJ-NJEMS (New Jersey - New Jersey Environmental Management System).
The Department of Environmental Protection (NJDEP) manages large
databases of environmental information in this integrated system.

RCRAInfo is a national information system that supports the Resource
Conservation and Recovery Act (RCRA) program through the tracking of
events and activities related to facilities that generate, transport,
and treat, store, or dispose of hazardous waste. RCRAInfo allows RCRA
program staff to track the notification, permit, compliance, and
corrective action activities required under RCRA.

NY MANIFEST:

Document ID: NJA0229476
Manifest Status: Completed copy
Trans1 State ID: NJDEPS869
Trans2 State ID: Not reported
Generator Ship Date: 860926
Trans1 Recv Date: 860926
Trans2 Recv Date: Not reported
TSD Site Recv Date: 860926
Part A Recv Date: 861006
Part B Recv Date: 861007
Generator EPA ID: NYD981482417
Trans1 EPA ID: ILD000805911
Trans2 EPA ID: Not reported
TSDF ID: NJD000768093

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s)
EDR ID Number
EPA ID Number

K&B CLEANERS (Continued)

1000103578

Waste Code: F002 - HALO SOLV + STILL BOTTOMS FM REC OF SOLV
Quantity: 00120
Units: P - Pounds
Number of Containers: 001
Container Type: CF - Fiber or plastic boxes, cartons
Handling Method: R Material recovery of more than 75 percent of the total material.
Specific Gravity: 100
Year: 86
Manifest Tracking Num: Not reported
Import Ind: Not reported
Export Ind: Not reported
Discr Quantity Ind: Not reported
Discr Type Ind: Not reported
Discr Residue Ind: Not reported
Discr Partial Reject Ind: Not reported
Discr Full Reject Ind: Not reported
Manifest Ref Num: Not reported
Alt Fac RCRA Id: Not reported
Alt Fac Sign Date: Not reported
Mgmt Method Type Code: Not reported
EPA ID: NYD981482417
Facility Name: K & B CLEANERS
Facility Address: 1946 AMSTERDAM AVENUE
Facility City: NEW YORK
Facility Address 2: Not reported
Country: USA
County: NE
Mailing Name: K & B CLEANERS
Mailing Contact: K & B CLEANERS
Mailing Address: 1946 AMSTERDAM AVENUE
Mailing Address 2: Not reported
Mailing City: NEW YORK
Mailing State: NY
Mailing Zip: Not reported
Mailing Zip4: Not reported
Mailing Country: USA
Mailing Phone: 212-926-6200

Document ID: NJA0233734
Manifest Status: Completed copy
Trans1 State ID: NJDEPS869
Trans2 State ID: Not reported
Generator Ship Date: 860925
Trans1 Recv Date: 860925
Trans2 Recv Date: Not reported
TSD Site Recv Date: 860925
Part A Recv Date: 861007
Part B Recv Date: 861007
Generator EPA ID: NYD981482417
Trans1 EPA ID: ILD000805911
Trans2 EPA ID: Not reported
TSD ID: NJD000768093
Waste Code: F002 - HALO SOLV + STILL BOTTOMS FM REC OF SOLV
Quantity: 00140
Units: P - Pounds
Number of Containers: 007
Container Type: CF - Fiber or plastic boxes, cartons

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s)

EDR ID Number
EPA ID Number

K&B CLEANERS (Continued)

1000103578

Handling Method:	R Material recovery of more than 75 percent of the total material.
Specific Gravity:	100
Year:	86
Manifest Tracking Num:	Not reported
Import Ind:	Not reported
Export Ind:	Not reported
Discr Quantity Ind:	Not reported
Discr Type Ind:	Not reported
Discr Residue Ind:	Not reported
Discr Partial Reject Ind:	Not reported
Discr Full Reject Ind:	Not reported
Manifest Ref Num:	Not reported
Alt Fac RCRA Id:	Not reported
Alt Fac Sign Date:	Not reported
Mgmt Method Type Code:	Not reported
EPA ID:	NYD981482417
Facility Name:	K & B CLEANERS
Facility Address:	1946 AMSTERDAM AVENUE
Facility City:	NEW YORK
Facility Address 2:	Not reported
Country:	USA
County:	NE
Mailing Name:	K & B CLEANERS
Mailing Contact:	K & B CLEANERS
Mailing Address:	1946 AMSTERDAM AVENUE
Mailing Address 2:	Not reported
Mailing City:	NEW YORK
Mailing State:	NY
Mailing Zip:	Not reported
Mailing Zip4:	Not reported
Mailing Country:	USA
Mailing Phone:	212-926-6200
Document ID:	NJA0364735
Manifest Status:	Completed after the designated time period for a TSDF to get a copy to the DEC
Trans1 State ID:	NJDEPS869
Trans2 State ID:	Not reported
Generator Ship Date:	871005
Trans1 Recv Date:	871005
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	871005
Part A Recv Date:	871118
Part B Recv Date:	871014
Generator EPA ID:	NYD981482417
Trans1 EPA ID:	NJD000768093
Trans2 EPA ID:	Not reported
TSDF ID:	NJD000768093
Waste Code:	F002 - HALO SOLV + STILL BOTTOMS FM REC OF SOLV
Quantity:	00080
Units:	P - Pounds
Number of Containers:	001
Container Type:	CF - Fiber or plastic boxes, cartons
Handling Method:	R Material recovery of more than 75 percent of the total material.
Specific Gravity:	100
Year:	87
Manifest Tracking Num:	Not reported
Import Ind:	Not reported

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s)
EDR ID Number
EPA ID Number

K&B CLEANERS (Continued)

1000103578

Export Ind:	Not reported
Discr Quantity Ind:	Not reported
Discr Type Ind:	Not reported
Discr Residue Ind:	Not reported
Discr Partial Reject Ind:	Not reported
Discr Full Reject Ind:	Not reported
Manifest Ref Num:	Not reported
Alt Fac RCRA Id:	Not reported
Alt Fac Sign Date:	Not reported
Mgmt Method Type Code:	Not reported
EPA ID:	NYD981482417
Facility Name:	K & B CLEANERS
Facility Address:	1946 AMSTERDAM AVENUE
Facility City:	NEW YORK
Facility Address 2:	Not reported
Country:	USA
County:	NE
Mailing Name:	K & B CLEANERS
Mailing Contact:	K & B CLEANERS
Mailing Address:	1946 AMSTERDAM AVENUE
Mailing Address 2:	Not reported
Mailing City:	NEW YORK
Mailing State:	NY
Mailing Zip:	Not reported
Mailing Zip4:	Not reported
Mailing Country:	USA
Mailing Phone:	212-926-6200
Document ID:	MNA5053775
Manifest Status:	Completed copy
Trans1 State ID:	000000000
Trans2 State ID:	Not reported
Generator Ship Date:	870416
Trans1 Recv Date:	870416
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	870416
Part A Recv Date:	870427
Part B Recv Date:	870429
Generator EPA ID:	NYD981482417
Trans1 EPA ID:	NJD000768093
Trans2 EPA ID:	Not reported
TSDF ID:	NJD000768093
Waste Code:	F002 - HALO SOLV + STILL BOTTOMS FM REC OF SOLV
Quantity:	00080
Units:	P - Pounds
Number of Containers:	001
Container Type:	CF - Fiber or plastic boxes, cartons
Handling Method:	R Material recovery of more than 75 percent of the total material.
Specific Gravity:	100
Waste Code:	Not reported
Quantity:	00195
Units:	P - Pounds
Number of Containers:	001
Container Type:	DF - Fiberboard or plastic drums (glass)
Handling Method:	R Material recovery of more than 75 percent of the total material.
Specific Gravity:	100
Year:	87

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s)
EDR ID Number
EPA ID Number

K&B CLEANERS (Continued)

1000103578

Manifest Tracking Num:	Not reported
Import Ind:	Not reported
Export Ind:	Not reported
Discr Quantity Ind:	Not reported
Discr Type Ind:	Not reported
Discr Residue Ind:	Not reported
Discr Partial Reject Ind:	Not reported
Discr Full Reject Ind:	Not reported
Manifest Ref Num:	Not reported
Alt Fac RCRA Id:	Not reported
Alt Fac Sign Date:	Not reported
Mgmt Method Type Code:	Not reported
EPA ID:	NYD981482417
Facility Name:	K & B CLEANERS
Facility Address:	1946 AMSTERDAM AVENUE
Facility City:	NEW YORK
Facility Address 2:	Not reported
Country:	USA
County:	NE
Mailing Name:	K & B CLEANERS
Mailing Contact:	K & B CLEANERS
Mailing Address:	1946 AMSTERDAM AVENUE
Mailing Address 2:	Not reported
Mailing City:	NEW YORK
Mailing State:	NY
Mailing Zip:	Not reported
Mailing Zip4:	Not reported
Mailing Country:	USA
Mailing Phone:	212-926-6200
Document ID:	NJA0244195
Manifest Status:	Completed copy
Trans1 State ID:	NJDEPS869
Trans2 State ID:	Not reported
Generator Ship Date:	861212
Trans1 Recv Date:	861212
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	861212
Part A Recv Date:	861229
Part B Recv Date:	861229
Generator EPA ID:	NYD981482417
Trans1 EPA ID:	ILD000805911
Trans2 EPA ID:	Not reported
TSD ID:	NJD000768093
Waste Code:	F002 - HALO SOLV + STILL BOTTOMS FM REC OF SOLV
Quantity:	00160
Units:	P - Pounds
Number of Containers:	002
Container Type:	CF - Fiber or plastic boxes, cartons
Handling Method:	R Material recovery of more than 75 percent of the total material.
Specific Gravity:	100
Waste Code:	Not reported
Quantity:	00150
Units:	P - Pounds
Number of Containers:	001
Container Type:	DM - Metal drums, barrels
Handling Method:	R Material recovery of more than 75 percent of the total material.

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

K&B CLEANERS (Continued)

EDR ID Number
EPA ID Number

Database(s)

1000103578

Specific Gravity: 100
Year: 86
Manifest Tracking Num: Not reported
Import Ind: Not reported
Export Ind: Not reported
Discr Quantity Ind: Not reported
Discr Type Ind: Not reported
Discr Residue Ind: Not reported
Discr Partial Reject Ind: Not reported
Discr Full Reject Ind: Not reported
Manifest Ref Num: Not reported
Alt Fac RCRA Id: Not reported
Alt Fac Sign Date: Not reported
Mgmt Method Type Code: Not reported
EPA ID: NYD981482417
Facility Name: K & B CLEANERS
Facility Address: 1946 AMSTERDAM AVENUE
Facility City: NEW YORK
Facility Address 2: Not reported
Country: USA
County: NE
Mailing Name: K & B CLEANERS
Mailing Contact: K & B CLEANERS
Mailing Address: 1946 AMSTERDAM AVENUE
Mailing Address 2: Not reported
Mailing City: NEW YORK
Mailing State: NY
Mailing Zip: Not reported
Mailing Zip4: Not reported
Mailing Country: USA
Mailing Phone: 212-926-6200

Document ID: NJA1343562
Manifest Status: Completed copy
Trans1 State ID: NJDEPS869
Trans2 State ID: Not reported
Generator Ship Date: 920309
Trans1 Recv Date: 920309
Trans2 Recv Date: Not reported
TSD Site Recv Date: 920309
Part A Recv Date: 920410
Part B Recv Date: 920323
Generator EPA ID: NYD981482417
Trans1 EPA ID: ILD051060408
Trans2 EPA ID: Not reported
TSDF ID: NJD000768093
Waste Code: F002 - HALO SOLV + STILL BOTTOMS FM REC OF SOLV
Quantity: 00195
Units: P - Pounds
Number of Containers: 001
Container Type: DF - Fiberboard or plastic drums (glass)
Handling Method: B Incineration, heat recovery, burning.
Specific Gravity: 100
Year: 92
Manifest Tracking Num: Not reported
Import Ind: Not reported
Export Ind: Not reported

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s)
EDR ID Number
EPA ID Number

K&B CLEANERS (Continued)

1000103578

Discr Quantity Ind: Not reported
Discr Type Ind: Not reported
Discr Residue Ind: Not reported
Discr Partial Reject Ind: Not reported
Discr Full Reject Ind: Not reported
Manifest Ref Num: Not reported
Alt Fac RCRA Id: Not reported
Alt Fac Sign Date: Not reported
Mgmt Method Type Code: Not reported
EPA ID: NYD981482417
Facility Name: K & B CLEANERS
Facility Address: 1946 AMSTERDAM AVENUE
Facility City: NEW YORK
Facility Address 2: Not reported
Country: USA
County: NE
Mailing Name: K & B CLEANERS
Mailing Contact: K & B CLEANERS
Mailing Address: 1946 AMSTERDAM AVENUE
Mailing Address 2: Not reported
Mailing City: NEW YORK
Mailing State: NY
Mailing Zip: Not reported
Mailing Zip4: Not reported
Mailing Country: USA
Mailing Phone: 212-926-6200

Document ID: NJA1416329
Manifest Status: Completed copy
Trans1 State ID: NJDEPS869
Trans2 State ID: Not reported
Generator Ship Date: 920403
Trans1 Recv Date: 920403
Trans2 Recv Date: Not reported
TSD Site Recv Date: 920403
Part A Recv Date: Not reported
Part B Recv Date: 920416
Generator EPA ID: NYD981482417
Trans1 EPA ID: ILD051060408
Trans2 EPA ID: Not reported
TSDF ID: NJD000768093
Waste Code: F002 - HALO SOLV + STILL BOTTOMS FM REC OF SOLV
Quantity: 00120
Units: P - Pounds
Number of Containers: 002
Container Type: DM - Metal drums, barrels
Handling Method: B Incineration, heat recovery, burning.
Specific Gravity: 100
Year: 92
Manifest Tracking Num: Not reported
Import Ind: Not reported
Export Ind: Not reported
Discr Quantity Ind: Not reported
Discr Type Ind: Not reported
Discr Residue Ind: Not reported
Discr Partial Reject Ind: Not reported
Discr Full Reject Ind: Not reported

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

K&B CLEANERS (Continued)

EDR ID Number
EPA ID Number

Database(s)

1000103578

Manifest Ref Num: Not reported
Alt Fac RCRA Id: Not reported
Alt Fac Sign Date: Not reported
Mgmt Method Type Code: Not reported
EPA ID: NYD981482417
Facility Name: K & B CLEANERS
Facility Address: 1946 AMSTERDAM AVENUE
Facility City: NEW YORK
Facility Address 2: Not reported
Country: USA
County: NE
Mailing Name: K & B CLEANERS
Mailing Contact: K & B CLEANERS
Mailing Address: 1946 AMSTERDAM AVENUE
Mailing Address 2: Not reported
Mailing City: NEW YORK
Mailing State: NY
Mailing Zip: Not reported
Mailing Zip4: Not reported
Mailing Country: USA
Mailing Phone: 212-926-6200

Document ID: NJA1463284
Manifest Status: Completed copy
Trans1 State ID: NJDEPS869
Trans2 State ID: Not reported
Generator Ship Date: 920630
Trans1 Recv Date: 920630
Trans2 Recv Date: Not reported
TSD Site Recv Date: 920630
Part A Recv Date: Not reported
Part B Recv Date: 920710
Generator EPA ID: NYD981482417
Trans1 EPA ID: ILD051060408
Trans2 EPA ID: Not reported
TSDF ID: NJD000768093
Waste Code: F002 - HALO SOLV + STILL BOTTOMS FM REC OF SOLV
Quantity: 00120
Units: P - Pounds
Number of Containers: 002
Container Type: DM - Metal drums, barrels
Handling Method: B Incineration, heat recovery, burning.
Specific Gravity: 100
Year: 92
Manifest Tracking Num: Not reported
Import Ind: Not reported
Export Ind: Not reported
Discr Quantity Ind: Not reported
Discr Type Ind: Not reported
Discr Residue Ind: Not reported
Discr Partial Reject Ind: Not reported
Discr Full Reject Ind: Not reported
Manifest Ref Num: Not reported
Alt Fac RCRA Id: Not reported
Alt Fac Sign Date: Not reported
Mgmt Method Type Code: Not reported
EPA ID: NYD981482417

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

K&B CLEANERS (Continued)

EDR ID Number
EPA ID Number

Database(s)

1000103578

Facility Name: K & B CLEANERS
Facility Address: 1946 AMSTERDAM AVENUE
Facility City: NEW YORK
Facility Address 2: Not reported
Country: USA
County: NE
Mailing Name: K & B CLEANERS
Mailing Contact: K & B CLEANERS
Mailing Address: 1946 AMSTERDAM AVENUE
Mailing Address 2: Not reported
Mailing City: NEW YORK
Mailing State: NY
Mailing Zip: Not reported
Mailing Zip4: Not reported
Mailing Country: USA
Mailing Phone: 212-926-6200

Document ID: NJA1632171
Manifest Status: Completed copy
Trans1 State ID: NJDEPS869
Trans2 State ID: Not reported
Generator Ship Date: 921211
Trans1 Recv Date: 921211
Trans2 Recv Date: Not reported
TSD Site Recv Date: 921211
Part A Recv Date: 930409
Part B Recv Date: 921229
Generator EPA ID: NYD981482417
Trans1 EPA ID: ILD051060408
Trans2 EPA ID: Not reported
TSDF ID: NJD000768093
Waste Code: F002 - HALO SOLV + STILL BOTTOMS FM REC OF SOLV
Quantity: 00120
Units: P - Pounds
Number of Containers: 002
Container Type: DM - Metal drums, barrels
Handling Method: B Incineration, heat recovery, burning.
Specific Gravity: 100
Year: 92
Manifest Tracking Num: Not reported
Import Ind: Not reported
Export Ind: Not reported
Discr Quantity Ind: Not reported
Discr Type Ind: Not reported
Discr Residue Ind: Not reported
Discr Partial Reject Ind: Not reported
Discr Full Reject Ind: Not reported
Manifest Ref Num: Not reported
Alt Fac RCRA Id: Not reported
Alt Fac Sign Date: Not reported
Mgmt Method Type Code: Not reported
EPA ID: NYD981482417
Facility Name: K & B CLEANERS
Facility Address: 1946 AMSTERDAM AVENUE
Facility City: NEW YORK
Facility Address 2: Not reported
Country: USA

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

K&B CLEANERS (Continued)

EDR ID Number
EPA ID Number

Database(s)

1000103578

County: NE
Mailing Name: K & B CLEANERS
Mailing Contact: K & B CLEANERS
Mailing Address: 1946 AMSTERDAM AVENUE
Mailing Address 2: Not reported
Mailing City: NEW YORK
Mailing State: NY
Mailing Zip: Not reported
Mailing Zip4: Not reported
Mailing Country: USA
Mailing Phone: 212-926-6200

Document ID: NJA1344255
Manifest Status: Completed copy
Trans1 State ID: NJDEPS869
Trans2 State ID: Not reported
Generator Ship Date: 920124
Trans1 Recv Date: 920124
Trans2 Recv Date: Not reported
TSD Site Recv Date: 920124
Part A Recv Date: 920410
Part B Recv Date: 920207
Generator EPA ID: NYD981482417
Trans1 EPA ID: ILD051060408
Trans2 EPA ID: Not reported
TSD ID: NJD000768093
Waste Code: F002 - HALO SOLV + STILL BOTTOMS FM REC OF SOLV
Quantity: 00195
Units: P - Pounds
Number of Containers: 001
Container Type: DF - Fiberboard or plastic drums (glass)
Handling Method: B Incineration, heat recovery, burning.
Specific Gravity: 100
Year: 92
Manifest Tracking Num: Not reported
Import Ind: Not reported
Export Ind: Not reported
Discr Quantity Ind: Not reported
Discr Type Ind: Not reported
Discr Residue Ind: Not reported
Discr Partial Reject Ind: Not reported
Discr Full Reject Ind: Not reported
Manifest Ref Num: Not reported
Alt Fac RCRA Id: Not reported
Alt Fac Sign Date: Not reported
Mgmt Method Type Code: Not reported
EPA ID: NYD981482417
Facility Name: K & B CLEANERS
Facility Address: 1946 AMSTERDAM AVENUE
Facility City: NEW YORK
Facility Address 2: Not reported
Country: USA
County: NE
Mailing Name: K & B CLEANERS
Mailing Contact: K & B CLEANERS
Mailing Address: 1946 AMSTERDAM AVENUE
Mailing Address 2: Not reported

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

K&B CLEANERS (Continued)

EDR ID Number
EPA ID Number

Database(s)

1000103578

Mailing City:	NEW YORK
Mailing State:	NY
Mailing Zip:	Not reported
Mailing Zip4:	Not reported
Mailing Country:	USA
Mailing Phone:	212-926-6200
Document ID:	NJA1344602
Manifest Status:	Completed after the designated time period for a TSDF to get a copy to the DEC
Trans1 State ID:	NJDEPS869
Trans2 State ID:	Not reported
Generator Ship Date:	920220
Trans1 Recv Date:	920220
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	920220
Part A Recv Date:	920410
Part B Recv Date:	921020
Generator EPA ID:	NYD981482417
Trans1 EPA ID:	ILD051060408
Trans2 EPA ID:	Not reported
TSDF ID:	NJD000768093
Waste Code:	F002 - HALO SOLV + STILL BOTTOMS FM REC OF SOLV
Quantity:	00060
Units:	P - Pounds
Number of Containers:	001
Container Type:	DM - Metal drums, barrels
Handling Method:	B Incineration, heat recovery, burning.
Specific Gravity:	100
Year:	92
Manifest Tracking Num:	Not reported
Import Ind:	Not reported
Export Ind:	Not reported
Discr Quantity Ind:	Not reported
Discr Type Ind:	Not reported
Discr Residue Ind:	Not reported
Discr Partial Reject Ind:	Not reported
Discr Full Reject Ind:	Not reported
Manifest Ref Num:	Not reported
Alt Fac RCRA Id:	Not reported
Alt Fac Sign Date:	Not reported
Mgmt Method Type Code:	Not reported
EPA ID:	NYD981482417
Facility Name:	K & B CLEANERS
Facility Address:	1946 AMSTERDAM AVENUE
Facility City:	NEW YORK
Facility Address 2:	Not reported
Country:	USA
County:	NE
Mailing Name:	K & B CLEANERS
Mailing Contact:	K & B CLEANERS
Mailing Address:	1946 AMSTERDAM AVENUE
Mailing Address 2:	Not reported
Mailing City:	NEW YORK
Mailing State:	NY
Mailing Zip:	Not reported
Mailing Zip4:	Not reported
Mailing Country:	USA

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

K&B CLEANERS (Continued)

EDR ID Number
EPA ID Number

Database(s)

1000103578

Mailing Phone: 212-926-6200

Document ID: NJA1375891
Manifest Status: Completed copy
Trans1 State ID: NJDEPS869
Trans2 State ID: Not reported
Generator Ship Date: 920220
Trans1 Recv Date: 920220
Trans2 Recv Date: Not reported
TSD Site Recv Date: 920220
Part A Recv Date: 920410
Part B Recv Date: 920303
Generator EPA ID: NYD981482417
Trans1 EPA ID: ILD051060408
Trans2 EPA ID: Not reported
TSDF ID: NJD000768093
Waste Code: F002 - HALO SOLV + STILL BOTTOMS FM REC OF SOLV
Quantity: 00060
Units: P - Pounds
Number of Containers: 001
Container Type: DM - Metal drums, barrels
Handling Method: B Incineration, heat recovery, burning.
Specific Gravity: 100
Year: 92
Manifest Tracking Num: Not reported
Import Ind: Not reported
Export Ind: Not reported
Discr Quantity Ind: Not reported
Discr Type Ind: Not reported
Discr Residue Ind: Not reported
Discr Partial Reject Ind: Not reported
Discr Full Reject Ind: Not reported
Manifest Ref Num: Not reported
Alt Fac RCRA Id: Not reported
Alt Fac Sign Date: Not reported
Mgmt Method Type Code: Not reported
EPA ID: NYD981482417
Facility Name: K & B CLEANERS
Facility Address: 1946 AMSTERDAM AVENUE
Facility City: NEW YORK
Facility Address 2: Not reported
Country: USA
County: NE
Mailing Name: K & B CLEANERS
Mailing Contact: K & B CLEANERS
Mailing Address: 1946 AMSTERDAM AVENUE
Mailing Address 2: Not reported
Mailing City: NEW YORK
Mailing State: NY
Mailing Zip: Not reported
Mailing Zip4: Not reported
Mailing Country: USA
Mailing Phone: 212-926-6200

Document ID: NYC4863183
Manifest Status: Completed after the designated time period for a TSDF to get a copy to the DEC
Trans1 State ID: 08690

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

K&B CLEANERS (Continued)

EDR ID Number
EPA ID Number

Database(s)

1000103578

Trans2 State ID:	Not reported
Generator Ship Date:	970926
Trans1 Recv Date:	970926
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	971001
Part A Recv Date:	Not reported
Part B Recv Date:	971029
Generator EPA ID:	NYD981482417
Trans1 EPA ID:	ILD984908202
Trans2 EPA ID:	Not reported
TSD ID:	OHD980587364
Waste Code:	F002 - HALO SOLV + STILL BOTTOMS FM REC OF SOLV
Quantity:	00195
Units:	P - Pounds
Number of Containers:	001
Container Type:	DF - Fiberboard or plastic drums (glass)
Handling Method:	B Incineration, heat recovery, burning.
Specific Gravity:	100
Year:	97
Manifest Tracking Num:	Not reported
Import Ind:	Not reported
Export Ind:	Not reported
Discr Quantity Ind:	Not reported
Discr Type Ind:	Not reported
Discr Residue Ind:	Not reported
Discr Partial Reject Ind:	Not reported
Discr Full Reject Ind:	Not reported
Manifest Ref Num:	Not reported
Alt Fac RCRA Id:	Not reported
Alt Fac Sign Date:	Not reported
Mgmt Method Type Code:	Not reported
EPA ID:	NYD981482417
Facility Name:	K & B CLEANERS
Facility Address:	1946 AMSTERDAM AVENUE
Facility City:	NEW YORK
Facility Address 2:	Not reported
Country:	USA
County:	NE
Mailing Name:	K & B CLEANERS
Mailing Contact:	K & B CLEANERS
Mailing Address:	1946 AMSTERDAM AVENUE
Mailing Address 2:	Not reported
Mailing City:	NEW YORK
Mailing State:	NY
Mailing Zip:	Not reported
Mailing Zip4:	Not reported
Mailing Country:	USA
Mailing Phone:	212-926-6200
Document ID:	MNA5044648
Manifest Status:	Completed after the designated time period for a TSD to get a copy to the DEC
Trans1 State ID:	000000000
Trans2 State ID:	Not reported
Generator Ship Date:	870212
Trans1 Recv Date:	870212
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	870212

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s)
EDR ID Number
EPA ID Number

K&B CLEANERS (Continued)

1000103578

Part A Recv Date: 870224
Part B Recv Date: 870410
Generator EPA ID: NYD981482417
Trans1 EPA ID: NJD000768093
Trans2 EPA ID: Not reported
TSD ID: NJD000768093
Waste Code: F002 - HALO SOLV + STILL BOTTOMS FM REC OF SOLV
Quantity: 00080
Units: P - Pounds
Number of Containers: 001
Container Type: CF - Fiber or plastic boxes, cartons
Handling Method: R Material recovery of more than 75 percent of the total material.
Specific Gravity: 100
Year: 87
Manifest Tracking Num: Not reported
Import Ind: Not reported
Export Ind: Not reported
Discr Quantity Ind: Not reported
Discr Type Ind: Not reported
Discr Residue Ind: Not reported
Discr Partial Reject Ind: Not reported
Discr Full Reject Ind: Not reported
Manifest Ref Num: Not reported
Alt Fac RCRA Id: Not reported
Alt Fac Sign Date: Not reported
Mgmt Method Type Code: Not reported
EPA ID: NYD981482417
Facility Name: K & B CLEANERS
Facility Address: 1946 AMSTERDAM AVENUE
Facility City: NEW YORK
Facility Address 2: Not reported
Country: USA
County: NE
Mailing Name: K & B CLEANERS
Mailing Contact: K & B CLEANERS
Mailing Address: 1946 AMSTERDAM AVENUE
Mailing Address 2: Not reported
Mailing City: NEW YORK
Mailing State: NY
Mailing Zip: Not reported
Mailing Zip4: Not reported
Mailing Country: USA
Mailing Phone: 212-926-6200

Document ID: NYA6939988
Manifest Status: Completed copy
Trans1 State ID: NJDEPS869
Trans2 State ID: Not reported
Generator Ship Date: 871130
Trans1 Recv Date: 871130
Trans2 Recv Date: Not reported
TSD Site Recv Date: 871130
Part A Recv Date: 871207
Part B Recv Date: 871215
Generator EPA ID: NYD981482417
Trans1 EPA ID: NJD000768093
Trans2 EPA ID: Not reported

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s)
EDR ID Number
EPA ID Number

K&B CLEANERS (Continued)

1000103578

TSD ID:	NJD000768093
Waste Code:	F002 - HALO SOLV + STILL BOTTOMS FM REC OF SOLV
Quantity:	00195
Units:	P - Pounds
Number of Containers:	001
Container Type:	DF - Fiberboard or plastic drums (glass)
Handling Method:	R Material recovery of more than 75 percent of the total material.
Specific Gravity:	100
Waste Code:	Not reported
Quantity:	00080
Units:	P - Pounds
Number of Containers:	001
Container Type:	CF - Fiber or plastic boxes, cartons
Handling Method:	R Material recovery of more than 75 percent of the total material.
Specific Gravity:	100
Year:	87
Manifest Tracking Num:	Not reported
Import Ind:	Not reported
Export Ind:	Not reported
Discr Quantity Ind:	Not reported
Discr Type Ind:	Not reported
Discr Residue Ind:	Not reported
Discr Partial Reject Ind:	Not reported
Discr Full Reject Ind:	Not reported
Manifest Ref Num:	Not reported
Alt Fac RCRA Id:	Not reported
Alt Fac Sign Date:	Not reported
Mgmt Method Type Code:	Not reported
EPA ID:	NYD981482417
Facility Name:	K & B CLEANERS
Facility Address:	1946 AMSTERDAM AVENUE
Facility City:	NEW YORK
Facility Address 2:	Not reported
Country:	USA
County:	NE
Mailing Name:	K & B CLEANERS
Mailing Contact:	K & B CLEANERS
Mailing Address:	1946 AMSTERDAM AVENUE
Mailing Address 2:	Not reported
Mailing City:	NEW YORK
Mailing State:	NY
Mailing Zip:	Not reported
Mailing Zip4:	Not reported
Mailing Country:	USA
Mailing Phone:	212-926-6200
Document ID:	NJA0300798
Manifest Status:	Completed after the designated time period for a TSD to get a copy to the DEC
Trans1 State ID:	NJDEPS869
Trans2 State ID:	Not reported
Generator Ship Date:	870521
Trans1 Recv Date:	870521
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	870521
Part A Recv Date:	870527
Part B Recv Date:	870617
Generator EPA ID:	NYD981482417

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

K&B CLEANERS (Continued)

EDR ID Number
EPA ID Number

Database(s)

1000103578

Trans1 EPA ID: ILD000805911
Trans2 EPA ID: Not reported
TSDF ID: NJD000768093
Waste Code: F002 - HALO SOLV + STILL BOTTOMS FM REC OF SOLV
Quantity: 00240
Units: P - Pounds
Number of Containers: 003
Container Type: CF - Fiber or plastic boxes, cartons
Handling Method: R Material recovery of more than 75 percent of the total material.
Specific Gravity: 100
Year: 87
Manifest Tracking Num: Not reported
Import Ind: Not reported
Export Ind: Not reported
Discr Quantity Ind: Not reported
Discr Type Ind: Not reported
Discr Residue Ind: Not reported
Discr Partial Reject Ind: Not reported
Discr Full Reject Ind: Not reported
Manifest Ref Num: Not reported
Alt Fac RCRA Id: Not reported
Alt Fac Sign Date: Not reported
Mgmt Method Type Code: Not reported
EPA ID: NYD981482417
Facility Name: K & B CLEANERS
Facility Address: 1946 AMSTERDAM AVENUE
Facility City: NEW YORK
Facility Address 2: Not reported
Country: USA
County: NE
Mailing Name: K & B CLEANERS
Mailing Contact: K & B CLEANERS
Mailing Address: 1946 AMSTERDAM AVENUE
Mailing Address 2: Not reported
Mailing City: NEW YORK
Mailing State: NY
Mailing Zip: Not reported
Mailing Zip4: Not reported
Mailing Country: USA
Mailing Phone: 212-926-6200

Document ID: NJA0362484
Manifest Status: Completed copy
Trans1 State ID: NJDEPS869
Trans2 State ID: Not reported
Generator Ship Date: 871110
Trans1 Recv Date: 871110
Trans2 Recv Date: Not reported
TSD Site Recv Date: 871110
Part A Recv Date: 871117
Part B Recv Date: 871124
Generator EPA ID: NYD981482417
Trans1 EPA ID: NJD000768093
Trans2 EPA ID: Not reported
TSDF ID: NJD000768093
Waste Code: F002 - HALO SOLV + STILL BOTTOMS FM REC OF SOLV
Quantity: 00160

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s)
EDR ID Number
EPA ID Number

K&B CLEANERS (Continued)

1000103578

Units: P - Pounds
Number of Containers: 002
Container Type: CF - Fiber or plastic boxes, cartons
Handling Method: R Material recovery of more than 75 percent of the total material.
Specific Gravity: 100
Year: 87
Manifest Tracking Num: Not reported
Import Ind: Not reported
Export Ind: Not reported
Discr Quantity Ind: Not reported
Discr Type Ind: Not reported
Discr Residue Ind: Not reported
Discr Partial Reject Ind: Not reported
Discr Full Reject Ind: Not reported
Manifest Ref Num: Not reported
Alt Fac RCRA Id: Not reported
Alt Fac Sign Date: Not reported
Mgmt Method Type Code: Not reported
EPA ID: NYD981482417
Facility Name: K & B CLEANERS
Facility Address: 1946 AMSTERDAM AVENUE
Facility City: NEW YORK
Facility Address 2: Not reported
Country: USA
County: NE
Mailing Name: K & B CLEANERS
Mailing Contact: K & B CLEANERS
Mailing Address: 1946 AMSTERDAM AVENUE
Mailing Address 2: Not reported
Mailing City: NEW YORK
Mailing State: NY
Mailing Zip: Not reported
Mailing Zip4: Not reported
Mailing Country: USA
Mailing Phone: 212-926-6200

Document ID: MNA5049309
Manifest Status: Completed copy
Trans1 State ID: NJDEPS869
Trans2 State ID: Not reported
Generator Ship Date: 870320
Trans1 Recv Date: 870320
Trans2 Recv Date: Not reported
TSD Site Recv Date: 870320
Part A Recv Date: 870327
Part B Recv Date: 870331
Generator EPA ID: NYD981482417
Trans1 EPA ID: NJD000768093
Trans2 EPA ID: Not reported
TSDF ID: NJD000768093
Waste Code: F002 - HALO SOLV + STILL BOTTOMS FM REC OF SOLV
Quantity: 00160
Units: P - Pounds
Number of Containers: 002
Container Type: CF - Fiber or plastic boxes, cartons
Handling Method: R Material recovery of more than 75 percent of the total material.
Specific Gravity: 100

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

K&B CLEANERS (Continued)

EDR ID Number
EPA ID Number

Database(s)

1000103578

Year: 87
Manifest Tracking Num: Not reported
Import Ind: Not reported
Export Ind: Not reported
Discr Quantity Ind: Not reported
Discr Type Ind: Not reported
Discr Residue Ind: Not reported
Discr Partial Reject Ind: Not reported
Discr Full Reject Ind: Not reported
Manifest Ref Num: Not reported
Alt Fac RCRA Id: Not reported
Alt Fac Sign Date: Not reported
Mgmt Method Type Code: Not reported
EPA ID: NYD981482417
Facility Name: K & B CLEANERS
Facility Address: 1946 AMSTERDAM AVENUE
Facility City: NEW YORK
Facility Address 2: Not reported
Country: USA
County: NE
Mailing Name: K & B CLEANERS
Mailing Contact: K & B CLEANERS
Mailing Address: 1946 AMSTERDAM AVENUE
Mailing Address 2: Not reported
Mailing City: NEW YORK
Mailing State: NY
Mailing Zip: Not reported
Mailing Zip4: Not reported
Mailing Country: USA
Mailing Phone: 212-926-6200

Document ID: NJA1413806
Manifest Status: Completed copy
Trans1 State ID: NJDEPS869
Trans2 State ID: Not reported
Generator Ship Date: 920730
Trans1 Recv Date: 920730
Trans2 Recv Date: Not reported
TSD Site Recv Date: 920730
Part A Recv Date: 930409
Part B Recv Date: 920812
Generator EPA ID: NYD981482417
Trans1 EPA ID: ILD051060408
Trans2 EPA ID: Not reported
TSDF ID: NJD000768093
Waste Code: F002 - HALO SOLV + STILL BOTTOMS FM REC OF SOLV
Quantity: 00140
Units: P - Pounds
Number of Containers: 002
Container Type: DM - Metal drums, barrels
Handling Method: B Incineration, heat recovery, burning.
Specific Gravity: 100
Year: 92
Manifest Tracking Num: Not reported
Import Ind: Not reported
Export Ind: Not reported
Discr Quantity Ind: Not reported

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s)
EDR ID Number
EPA ID Number

K&B CLEANERS (Continued)

1000103578

Discr Type Ind:	Not reported
Discr Residue Ind:	Not reported
Discr Partial Reject Ind:	Not reported
Discr Full Reject Ind:	Not reported
Manifest Ref Num:	Not reported
Alt Fac RCRA Id:	Not reported
Alt Fac Sign Date:	Not reported
Mgmt Method Type Code:	Not reported
EPA ID:	NYD981482417
Facility Name:	K & B CLEANERS
Facility Address:	1946 AMSTERDAM AVENUE
Facility City:	NEW YORK
Facility Address 2:	Not reported
Country:	USA
County:	NE
Mailing Name:	K & B CLEANERS
Mailing Contact:	K & B CLEANERS
Mailing Address:	1946 AMSTERDAM AVENUE
Mailing Address 2:	Not reported
Mailing City:	NEW YORK
Mailing State:	NY
Mailing Zip:	Not reported
Mailing Zip4:	Not reported
Mailing Country:	USA
Mailing Phone:	212-926-6200
Document ID:	NJA2683033
Manifest Status:	Completed copy
Trans1 State ID:	08690
Trans2 State ID:	Not reported
Generator Ship Date:	970603
Trans1 Recv Date:	970603
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	970603
Part A Recv Date:	970613
Part B Recv Date:	970620
Generator EPA ID:	NYD981482417
Trans1 EPA ID:	ILD984908202
Trans2 EPA ID:	Not reported
TSDF ID:	NJD000768093
Waste Code:	F002 - HALO SOLV + STILL BOTTOMS FM REC OF SOLV
Quantity:	00390
Units:	P - Pounds
Number of Containers:	002
Container Type:	DF - Fiberboard or plastic drums (glass)
Handling Method:	B Incineration, heat recovery, burning.
Specific Gravity:	100
Year:	97
Manifest Tracking Num:	Not reported
Import Ind:	Not reported
Export Ind:	Not reported
Discr Quantity Ind:	Not reported
Discr Type Ind:	Not reported
Discr Residue Ind:	Not reported
Discr Partial Reject Ind:	Not reported
Discr Full Reject Ind:	Not reported
Manifest Ref Num:	Not reported

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

K&B CLEANERS (Continued)

EDR ID Number
EPA ID Number

1000103578

Alt Fac RCRA Id: Not reported
Alt Fac Sign Date: Not reported
Mgmt Method Type Code: Not reported
EPA ID: NYD981482417
Facility Name: K & B CLEANERS
Facility Address: 1946 AMSTERDAM AVENUE
Facility City: NEW YORK
Facility Address 2: Not reported
Country: USA
County: NE
Mailing Name: K & B CLEANERS
Mailing Contact: K & B CLEANERS
Mailing Address: 1946 AMSTERDAM AVENUE
Mailing Address 2: Not reported
Mailing City: NEW YORK
Mailing State: NY
Mailing Zip: Not reported
Mailing Zip4: Not reported
Mailing Country: USA
Mailing Phone: 212-926-6200

[Click this hyperlink](#) while viewing on your computer to access
69 additional NY_MANIFEST: record(s) in the EDR Site Report.

**Q66
SE
1/8-1/4
789 ft.**

**242-246 BRADHURST HOLDING LLC
242-246 BRADHURST AVENUE
NEW YORK, NY 10039**

**AST A100175631
N/A**

**Relative:
Lower**

Site 2 of 2 in cluster Q

AST:

**Actual:
21 ft.**

AST:

Region: STATE
Facility Id: 2-605366
UTM X: 589453.07575
UTM Y: 4520322.15137
Expiration Date: 06/15/10
Renewal Date: / /
Total Capacity: 5000
Facility Type: Not reported
Site Type Name: Apartment Building/Office Building
Site Type Status: Active
Mailing Company: 242-246 BRADHURST HOLDING
Mailing Title: Not reported
Mailing Contact: LEWIS BARBANEL
Mailing Address: C/O BARBERRY ROSE
Mailing Address 2: 100 CEDARHURST AVE SUITE 202
Mailing City: CEDARHURST
Mailing State: NY
Mailing Zip Code: 11516
Mailing Phone No: (516) 374-6080
Mailing Email: Not reported
Owner Title: MANAGING AGENT
Owner Name: LEWIS BARBANEL
Owner Address: 100 CEDARHURST AVE SUITE 202
Owner Address 2: Not reported
Owner State: NY

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

242-246 BRADHURST HOLDING LLC (Continued)

EDR ID Number
EPA ID Number

Database(s)

A100175631

Owner Zip Code: 11516
Owner Phone: (516) 374-6080
Owner Company: 242-246 BRADHURST HOLDING C/O BARBERRY ROSE MGMT
Emergency Contact: MORDY OBERSTEIN
Emergency Phone: (516) 779-0915
Operator: JOSE DIAZ
Operator Phone: (516) 779-1270
Owner City: CEDAUHURST
Owner Sub Type: Corporate or Commercial
Program Type: PBS

Tank Number: 1
Tank Location Name: Aboveground - in contact with soil
Tank Status: In Service
Tank Model: Not reported
Pipe Model: Not reported
Active Status: Active
Install Date: / /
Capacity Gallons: 5000
Material Name: #6 Fuel Oil
Percentage: 100.00
Tank Type Name: Steel/Carbon Steel/Iron
Tank Internal Protection: None
Tank Internal Protection 1: None
Tank Internal Protection 2: Not reported
Pipe Location Name: No Piping
Pipe Type Name: No Piping
Pipe External Protection 1: None
Pipe External Protection 2: Not reported
Tank Secondary Containment 1: None
Tank Secondary Containment 2: Not reported
Pipe Secondary Containment: Not reported
Tank Leak Detection 1: None
Tank Leak Detection 2: Not reported
Pipe Leak Detection 1: Not reported
Pipe Leak Detection 2: Not reported
Type Of Overfill Prevention 1: None
Type Of Overfill Prevention 2: Not reported
Dispenser Method: None
Spill Prevention: Not reported
Tightness Test Method: Testing Not Required
Date Tested: / /
Next Test Date: / /
Date Tank Closed: / /

L67
WNW
1/8-1/4
789 ft.

509-517 WEST 155TH STREET
509-517 WEST 155TH STREET
NEW YORK, NY 10032

AST A100175101
N/A

Site 3 of 3 in cluster L

Relative:
Higher

AST:

Actual:
147 ft.

AST:

Region: STATE
Facility Id: 2-305626
UTM X: 589094.42173
UTM Y: 4520617.13894

Map ID
 Direction
 Distance
 Distance (ft.)
 Elevation Site

MAP FINDINGS

Database(s)
 EDR ID Number
 EPA ID Number

509-517 WEST 155TH STREET (Continued)

A100175101

Expiration Date: 03/29/11
 Renewal Date: / /
 Total Capacity: 5000
 Facility Type: Not reported
 Site Type Name: Apartment Building/Office Building
 Site Type Status: Active
 Mailing Company: PINNACLE GROUP
 Mailing Title: Not reported
 Mailing Contact: MEIR BOUSKLLA
 Mailing Address: P.O. BOX 1919
 Mailing Address 2: Not reported
 Mailing City: NEW YORK
 Mailing State: NY
 Mailing Zip Code: 10116
 Mailing Phone No: (212) 564-2111
 Mailing Email: Not reported
 Owner Title: AGENT
 Owner Name: MICHELLE MORALES
 Owner Address: P.O. BOX 1919
 Owner Address 2: Not reported
 Owner State: NY
 Owner Zip Code: 10116
 Owner Phone: (212) 564-2111
 Owner Company: 509 REALTY CO. LLC
 Emergency Contact: MICHELLE MORALES
 Emergency Phone: (212) 564-2111
 Operator: SAIT
 Operator Phone: (917) 641-9267
 Owner City: NEW YORK
 Owner Sub Type: Corporate or Commercial
 Program Type: PBS

 Tank Number: 01
 Tank Location Name: Aboveground - in contact with soil
 Tank Status: In Service
 Tank Model: Not reported
 Pipe Model: Not reported
 Active Status: Active
 Install Date: / /
 Capacity Gallons: 5000
 Material Name: #2 Fuel Oil
 Percentage: 100.00
 Tank Type Name: Steel/Carbon Steel/Iron
 Tank Internal Protection: None
 Tank Internal Protection 1: None
 Tank Internal Protection 2: Not reported
 Pipe Location Name: Aboveground/Underground Combination
 Pipe Type Name: Steel/Carbon Steel/Iron
 Pipe External Protection 1: None
 Pipe External Protection 2: Not reported
 Tank Secondary Containment 1: Vault (w/o access)
 Tank Secondary Containment 2: Not reported
 Pipe Secondary Containment: Not reported
 Tank Leak Detection 1: None
 Tank Leak Detection 2: Not reported
 Pipe Leak Detection 1: Exempt Suction Piping
 Pipe Leak Detection 2: Not reported

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

509-517 WEST 155TH STREET (Continued)

EDR ID Number
EPA ID Number

Database(s)

A100175101

Type Of Overfill Prevention 1: Product Level Gauge (A/G)
Type Of Overfill Prevention 2: Vent Whistle
Dispenser Method: Suction
Spill Prevention: Not reported
Tightness Test Method: Testing Not Required
Date Tested: / /
Next Test Date: / /
Date Tank Closed: / /

P68
NNW
1/8-1/4
798 ft.

BETHUNE (AUDUBON HOUSES)
1945 AMSTERDAM AVENUE
NEW YORK, NY 10032

UST
HIST UST

U000410770
N/A

Site 5 of 9 in cluster P

Relative:
Higher

UST:

Actual:
147 ft.

UST:

Facility Id: 2-474827
Expiration Date: 03/28/09
Renewal Date: / /
Total Capacity: 10000
Facility Type: Not reported
Mailing Company: NEW YORK CITY HOUSING AUTHORITY
Mailing Title: Not reported
Mailing Contact: FUEL OIL REMEDIATION COORDINATOR
Mailing Address: 23-02 49TH AVENUE
Mailing Address 2: Not reported
Mailing City: LONG ISLAND CITY
Mailing State: NY
Mailing Zip Code: 11101
Mailing Phone No: (718) 707-5725
Mailing Email: Not reported
Owner Title: FUEL OIL REMEDIATION COORD.
Owner Name: FUEL OIL REMEDIATION COORD.
Owner Address: 23-02 49TH AVE
Owner Address 2: Not reported
Owner State: NY
Owner Zip Code: 11101
Owner Phone: (718) 707-5725
Owner Company: NYC HOUSING AUTHORITY
Emergency Contact: EMERGENCY SERVICE DEPT.
Emergency Phone: (718) 707-5725
Operator: FUEL OIL REMEDIATION COORD.
Operator Phone: (718) 707-5725
Owner City: LONG ISLAND CITY
Owner Sub Type: NYC Housing Authority (Local Government)
UTM X: 589217.47979
UTM Y: 4520706.20887
Site Type Name: Apartment Building/Office Building
Site Type Status: Active
Comments: Not reported

Program Type: PBS

Tank Number: 1
Tank Location Name: Underground
Tank Status: In Service

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s)

EDR ID Number
EPA ID Number

BETHUNE (AUDUBON HOUSES) (Continued)

U000410770

Tank Model: Not reported
Pipe Model: Not reported
Active Status: Active
Install Date: 05/01/98
Capacity Gallons: 10000
Material Name: #2 Fuel Oil
Percentage: 100.00
Tank Type Name: Fiberglass Coated Steel
Tank Internal Protection: Glass Liner
Tank Internal Protection 1: Fiberglass
Tank Internal Protection 2: Not reported
Pipe Location Name: Underground/On-ground
Pipe Type Name: Equivalent Technology
Pipe External Protection 1: Other
Pipe External Protection 2: Not reported
Tank Secondary Containment 1: Double-Walled (Underground)
Tank Secondary Containment 2: Not reported
Pipe Secondary Containment: Not reported
Tank Leak Detection 1: Interstitial - Electronic Monitoring
Tank Leak Detection 2: Not reported
Pipe Leak Detection 1: Exempt Suction Piping
Pipe Leak Detection 2: Not reported
Type Of Overfill Prevention 1: High Level Alarm
Type Of Overfill Prevention 2: Product Level Gauge (A/G)
Dispenser Method: Suction
Spill Prevention: Not reported
Tightness Test Method: Horner EZ Check I or II
Date Tested: / /
Next Test Date: / /
Date Tank Closed: / /

Tank Number: OLD 1
Tank Location Name: Underground
Tank Status: Closed - Removed
Tank Model: Not reported
Pipe Model: Not reported
Active Status: Inactive
Install Date: / /
Capacity Gallons: 20000
Material Name: #2 Fuel Oil
Percentage: 100.00
Tank Type Name: Steel/Carbon Steel/Iron
Tank Internal Protection: None
Tank Internal Protection 1: None
Tank Internal Protection 2: Not reported
Pipe Location Name: No Piping
Pipe Type Name: No Piping
Pipe External Protection 1: None
Pipe External Protection 2: Not reported
Tank Secondary Containment 1: None
Tank Secondary Containment 2: Not reported
Pipe Secondary Containment: Not reported
Tank Leak Detection 1: None
Tank Leak Detection 2: Not reported
Pipe Leak Detection 1: Not reported
Pipe Leak Detection 2: Not reported

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s)
EDR ID Number
EPA ID Number

BETHUNE (AUDUBON HOUSES) (Continued)

U000410770

Type Of Overfill Prevention 1: None
Type Of Overfill Prevention 2: Not reported
Dispenser Method: None
Spill Prevention: Not reported
Tightness Test Method: Testing Not Required
Date Tested: / /
Next Test Date: / /
Date Tank Closed: 04/01/98

HIST UST:

PBS Number: 2-474827
SPDES Number: Not reported
Emergency Contact: EMERGENCY SERVICE SQUAD
Emergency Telephone: (212) 289-3940
Operator: RAFAEL VELEZ
Operator Telephone: (212) 306-3142
Owner Name: NYC HOUSING AUTHORITY
Owner Address: 250 BROADWAY
Owner City,St,Zip: NEW YORK, NY 10007
Owner Telephone: (212) 306-3142
Owner Type: Local Government
Owner Subtype: 51
Mailing Name: REMEDIATION SECTION
Mailing Address: NEW YORK CITY HOUSING AUTHORITY
Mailing Address 2: 250 BROADWAY-16TH FLOOR
Mailing City,St,Zip: NEW YORK, NY 10007
Mailing Contact: FRANK OCELLO
Mailing Telephone: (212) 306-3142
Owner Mark: First Owner
Facility Status: 1 - Active PBS facility, i.e. total capacity of the PBS tanks is
 greater than 1,100 gallons, regardless if Subpart 360-14 tanks exist
 or not at the facility.
Facility Addr2: 1945 AMSTERDAM AVENUE
SWIS ID: 6201
Old PBS Number: Not reported
Facility Type: APARTMENT BUILDING
Inspected Date: Not reported
Inspector: Not reported
Inspection Result: Not reported
Federal ID: Not reported
Certification Flag: False
Certification Date: 10/29/1999
Expiration Date: 03/28/2004
Renew Flag: False
Renewal Date: Not reported
Total Capacity: 10000
FAMT: True
Facility Screen: No Missing Data
Owner Screen: Minor Data Missing
Tank Screen: No Missing Data
Dead Letter: False
CBS Number: Not reported
Town or City: NEW YORK CITY
County Code: 62
Town or City: 01
Region: 2

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

BETHUNE (AUDUBON HOUSES) (Continued)

EDR ID Number
EPA ID Number

Database(s)

U000410770

Tank Id: 001
Tank Location: UNDERGROUND
Tank Status: In Service
Install Date: 19980501
Capacity (gals): 10000
Product Stored: NOS 1,2, OR 4 FUEL OIL
Tank Type: Fiberglass coated steel
Tank Internal: Glass Liner
Tank External: Fiberglass
Pipe Location: Underground
Pipe Type: FIBERGLASS REINFORCED PLASTIC
Pipe Internal: Other
Pipe External: Other
Second Containment: Vault (w/access)
Leak Detection: Electronic
Overfill Prot: High Level Alarm, Product Level Gauge
Dispenser: Suction
Date Tested: 04/01/1992
Next Test Date: Not reported
Missing Data for Tank: No Missing Data
Date Closed: 04/01/1998
Test Method: Horner EZ Check
Deleted: False
Updated: True
Lat/long: Not reported

Tank Id: OLD 001
Tank Location: UNDERGROUND
Tank Status: Closed-Removed
Install Date: Not reported
Capacity (gals): 20000
Product Stored: NOS 1,2, OR 4 FUEL OIL
Tank Type: Steel/carbon steel
Tank Internal: Not reported
Tank External: Not reported
Pipe Location: Not reported
Pipe Type: Not reported
Pipe Internal: Not reported
Pipe External: Not reported
Second Containment: Not reported
Leak Detection: Not reported
Overfill Prot: Not reported
Dispenser: Not reported
Date Tested: Not reported
Next Test Date: Not reported
Missing Data for Tank: Minor Data Missing
Date Closed: 04/01/1998
Test Method: Not reported
Deleted: False
Updated: True
Lat/long: Not reported

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

P69
NNW
1/8-1/4
798 ft.

BETHUNE HOUSES
1945 AMSTERDAM AVENUE
NEW YORK CITY, NY

LTANKS
HIST LTANKS

S104073518
N/A

Relative:
Higher

Site 6 of 9 in cluster P

Actual:
147 ft.

LTANKS:

Site ID: 210171
Spill Date: 04/23/91
Facility Addr2: Not reported
Facility ID: 9100898
Program Number: 9100898
SWIS: 3101
Region of Spill: 2
Investigator: SACCACIO
Referred To: Not reported
Reported to Dept: 04/23/91
CID: 15
Spill Cause: Tank Test Failure
Water Affected: Not reported
Spill Source: Institutional, Educational, Gov., Other
Spill Notifier: Tank Tester
Cleanup Ceased: 09/09/94
Cleanup Meets Standard: True
Last Inspection: / /
Recommended Penalty: Penalty Not Recommended
UST Involvement: False
Spill Class: Known release with minimal potential for fire or hazard. DEC Response.
Willing Responsible Party. Corrective action taken.
Spill Closed Dt: 09/09/94
Remediation Phase: 0
Date Entered In Computer: 04/25/91
Spill Record Last Update: 05/14/98
Spille Namer: Not reported
Spiller Company: NYC HOUSEING AUTHORITY
Spiller Phone: (212) 306-3142
Spiller Extention: Not reported
Spiller Address: 250 BROADWAY
Spiller City,St,Zip: NEW YORK, NY
Spiller County: 001
Spiller Contact: Not reported
Spiller Phone: Not reported
Spiller Extention: Not reported
DEC Region: 2
Program Number: 9100898
DER Facility ID: 174226
Site ID: 210171
Operable Unit ID: 954427
Operable Unit: 01
Material ID: 427064
Material Code: 0002
Material Name: #4 Fuel Oil
Case No.: Not reported
Material FA: Petroleum
Quantity: -1.00
Units: Pounds
Recovered: 0.00
Resource Affected: Soil
Oxygenate: False

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

BETHUNE HOUSES (Continued)

EDR ID Number
EPA ID Number

Database(s)

S104073518

Site ID: 210171
Spill Tank Test: 1538484
Tank Number: 001
Tank Size: 0
Test Method: 00
Leak Rate: 0.00
Gross Fail: Not reported
Modified By: Spills
Last Modified: 10/01/04
Test Method: Unknown
DEC Memo: Not reported
Remarks: Start CallerRemark - 9100898 20K TANK FAILED HORNER EZY CHECK,VISUAL LEAK, TO REPAIR & RETEST. END CallerRemark - 9100898

HIST LTANKS:

Region of Spill: 2
Spill Number: 9100898
Investigator: SACCACIO
Caller Name: Not reported
Caller Agency: Not reported
Caller Phone: Not reported
Caller Extension: Not reported
Notifier Name: Not reported
Notifier Agency: Not reported
Notifier Phone: Not reported
Notifier Extension: Not reported
Spill Date: 04/23/1991
Spill Time: 12:00
Reported to Department Date: 04/23/91
Reported to Department Time: 15:02
SWIS: 62
Spiller Contact: Not reported
Spiller Phone: Not reported
Spiller Extension: Not reported
Spiller Name: NYC HOUSEING AUTHORITY
Spiller Address: 250 BROADWAY
Spiller City,St,Zip: NEW YORK, N.Y.
Facility Contact: Not reported
Facility Phone: (212) 306-3142
Facility Extension: Not reported
Spill Cause: Tank Test Failure
Resource Affectd: On Land
Water Affected: Not reported
Spill Source: Other Non Commercial/Industrial
Spill Notifier: Tank Tester
PBS Number: 2-474827
Cleanup Ceased: 09/09/94
Cleanup Meets Standard: True
Last Inspection: / /
Recommended Penalty: Penalty Not Recommended
Spiller Cleanup Date: / /
Enforcement Date: / /
Investigation Complete: / /
UST Involvement: False
Spill Class: Known release with minimal potential for fire or hazard. DEC Response.
Willing Responsible Party. Corrective action taken.
Spill Closed Dt: 09/09/94

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s) EDR ID Number
EPA ID Number

BETHUNE HOUSES (Continued)

S104073518

Date Region Sent Summary to Central Office: / /
Corrective Action Plan Submitted: / /
Date Spill Entered In Computer Data File: 04/25/91
Time Spill Entered In Computer Data File: Not reported
Spill Record Last Update: 05/14/98
Is Updated: False
PBS Number: Not reported
Tank Number: 001
Tank Size: 0
Test Method: Not reported
Leak Rate Failed Tank: 0.00
Gross Leak Rate: Not reported
Material Class Type: Petroleum
Quantity Spilled: -1
Unkonwn Quantity Spilled: False
Units: Pounds
Quantity Recovered: 0
Unkonwn Quantity Recovered: False
Material: #4 FUEL OIL
Class Type: #4 FUEL OIL
Times Material Entry In File: 1751
CAS Number: Not reported
Last Date: 19941205
DEC Remarks: Not reported
Spill Cause: 20K TANK FAILED HORNER EZY CHECK,VISUAL LEAK, TO REPAIR RETEST.

70
SSW
1/8-1/4
798 ft.

MELROSE HOUSING ESTATES LP
408 EAST 152ND STREET
BRONX, NY 10455

AST A100295016
N/A

Relative:
Lower

AST:

AST:

Actual:
107 ft.

Region: STATE
Facility Id: 2-609254
UTM X: 591367.16613
UTM Y: 4519131.88769
Expiration Date: 09/25/08
Renewal Date: / /
Total Capacity: 2000
Facility Type: Not reported
Site Type Name: Unknown
Site Type Status: Active
Mailing Company: 2804 THIRD AVENUE
Mailing Title: Not reported
Mailing Contact: MARY C. RAMIREZ
Mailing Address: 4TH FLOOR
Mailing Address 2: Not reported
Mailing City: BRONX
Mailing State: NY
Mailing Zip Code: 10455
Mailing Phone No: (718) 401-7823
Mailing Email: Not reported
Owner Title: Not reported
Owner Name: Not reported
Owner Address: 2804 THIRD AVENUE 4TH FLOOR
Owner Address 2: Not reported

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

MELROSE HOUSING ESTATES LP (Continued)

EDR ID Number
EPA ID Number

Database(s)

A100295016

Owner State: NY
Owner Zip Code: 10455
Owner Phone: (718) 401-7823
Owner Company: MELROSE HOUSING ESTATES LP
Emergency Contact: MARY C. RAMIREZ
Emergency Phone: (718) 401-7823
Operator: MARY C. RAMIREZ
Operator Phone: (718) 401-7823
Owner City: BRONX
Owner Sub Type: Corporate or Commercial
Program Type: PBS

Tank Number: 001
Tank Location Name: Aboveground - in contact with soil
Tank Status: In Service
Tank Model: Not reported
Pipe Model: Not reported
Active Status: Active
Install Date: / /
Capacity Gallons: 2000
Material Name: #2 Fuel Oil
Percentage: 100.00
Tank Type Name: Steel/Carbon Steel/Iron
Tank Internal Protection: None
Tank Internal Protection 1: None
Tank Internal Protection 2: Not reported
Pipe Location Name: Aboveground
Pipe Type Name: Steel/Carbon Steel/Iron
Pipe External Protection 1: None
Pipe External Protection 2: Not reported
Tank Secondary Containment 1: Vault (w/o access)
Tank Secondary Containment 2: Not reported
Pipe Secondary Containment: Not reported
Tank Leak Detection 1: Impervious Barrier/Concrete Pad (A/G)
Tank Leak Detection 2: Not reported
Pipe Leak Detection 1: Exempt Suction Piping
Pipe Leak Detection 2: Not reported
Type Of Overfill Prevention 1: Vent Whistle
Type Of Overfill Prevention 2: Not reported
Dispenser Method: Suction
Spill Prevention: Not reported
Tightness Test Method: Testing Not Required
Date Tested: / /
Next Test Date: / /
Date Tank Closed: / /

R71 450-454 WEST 152ND STREET HDFC
SW 450 WEST 152ND STREET
1/8-1/4 NEW YORK, NY 10031
806 ft.

AST A100292386
N/A

Relative:
Higher

Site 1 of 3 in cluster R

AST:

Actual:
116 ft.

AST:

Region: STATE
Facility Id: 2-608797
UTM X: 589129.15599

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s) EDR ID Number
EPA ID Number

450-454 WEST 152ND STREET HDFC (Continued)

A100292386

UTM Y: 4520309.51571
 Expiration Date: 04/07/08
 Renewal Date: / /
 Total Capacity: 5000
 Facility Type: Not reported
 Site Type Name: Apartment Building/Office Building
 Site Type Status: Active
 Mailing Company: 450-454 WEST 152ND ST HDFC
 Mailing Title: Not reported
 Mailing Contact: JEANETTE WILLIAMS
 Mailing Address: 450 WEST 152ND STREET
 Mailing Address 2: 454 WEST 152ND STREET
 Mailing City: NEW YORK
 Mailing State: NY
 Mailing Zip Code: 10031
 Mailing Phone No: (646) 548-0484
 Mailing Email: Not reported
 Owner Title: Not reported
 Owner Name: Not reported
 Owner Address: P.O. BOX 2088, MANHATTANVILLE STATION
 Owner Address 2: Not reported
 Owner State: NY
 Owner Zip Code: 10027
 Owner Phone: (646) 548-0484
 Owner Company: JEANETTE WILLIAMS
 Emergency Contact: BARNEICE WILLIAMS
 Emergency Phone: (917) 507-6244
 Operator: MONTEBELLO OIL
 Operator Phone: (212) 744-7440
 Owner City: NEW YORK
 Owner Sub Type: Corporate or Commercial
 Program Type: PBS

Tank Number: 001
 Tank Location Name: Aboveground on crib, rack, or cradle
 Tank Status: In Service
 Tank Model: Not reported
 Pipe Model: Not reported
 Active Status: Active
 Install Date: / /
 Capacity Gallons: 5000
 Material Name: #2 Fuel Oil
 Percentage: 100.00
 Tank Type Name: Steel/Carbon Steel/Iron
 Tank Internal Protection: None
 Tank Internal Protection 1: Jacketed
 Tank Internal Protection 2: Not reported
 Pipe Location Name: Aboveground
 Pipe Type Name: Steel/Carbon Steel/Iron
 Pipe External Protection 1: None
 Pipe External Protection 2: Not reported
 Tank Secondary Containment 1: Vault (w/o access)
 Tank Secondary Containment 2: Not reported
 Pipe Secondary Containment: Not reported
 Tank Leak Detection 1: None
 Tank Leak Detection 2: Not reported
 Pipe Leak Detection 1: Exempt Suction Piping

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

450-454 WEST 152ND STREET HDFC (Continued)

EDR ID Number
EPA ID Number

Database(s)

A100292386

Pipe Leak Detection 2: Not reported
Type Of Overfill Prevention 1: Product Level Gauge (A/G)
Type Of Overfill Prevention 2: Not reported
Dispenser Method: Suction
Spill Prevention: Not reported
Tightness Test Method: Testing Not Required
Date Tested: / /
Next Test Date: / /
Date Tank Closed: / /

R72 453 W 152ND ST. LLC
SW 453 WEST 152ND STREET
1/8-1/4 NEW YORK, NY 10031
812 ft.

AST A100173349
N/A

Site 2 of 3 in cluster R

Relative:
Higher

AST:

Actual:
118 ft.

AST:

Region: STATE
Facility Id: 2-257249
UTM X: 589183.81956
UTM Y: 4520322.88298
Expiration Date: 12/21/10
Renewal Date: / /
Total Capacity: 3000
Facility Type: Not reported
Site Type Name: Apartment Building/Office Building
Site Type Status: Active
Mailing Company: REUSSI MANAGEMENT
Mailing Title: Not reported
Mailing Contact: PETER SIEGEL
Mailing Address: P.O. BOX 2198
Mailing Address 2: Not reported
Mailing City: NEW YORK
Mailing State: NY
Mailing Zip Code: 10101-2198
Mailing Phone No: (212) 265-3304
Mailing Email: Not reported
Owner Title: MANAGING MEMBER
Owner Name: PETER SIEGEL
Owner Address: P.O. BOX 2198
Owner Address 2: Not reported
Owner State: NY
Owner Zip Code: 10101-2198
Owner Phone: (212) 265-3304
Owner Company: 453 W 152ND, LLC
Emergency Contact: MAVREEN RUMPRASHAD
Emergency Phone: (212) 265-3304
Operator: COCO RIVERA
Operator Phone: (212) 265-3304
Owner City: NEW YORK
Owner Sub Type: Corporate or Commercial
Program Type: PBS

Tank Number: 001
Tank Location Name: Aboveground - in contact with soil
Tank Status: In Service

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

453 W 152ND ST. LLC (Continued)

EDR ID Number
EPA ID Number

Database(s)

A100173349

Tank Model: Not reported
Pipe Model: Not reported
Active Status: Active
Install Date: / /
Capacity Gallons: 3000
Material Name: #2 Fuel Oil
Percentage: 100.00
Tank Type Name: Steel/Carbon Steel/Iron
Tank Internal Protection: None
Tank Internal Protection 1: None
Tank Internal Protection 2: Not reported
Pipe Location Name: Aboveground
Pipe Type Name: Steel/Carbon Steel/Iron
Pipe External Protection 1: None
Pipe External Protection 2: Not reported
Tank Secondary Containment 1: None
Tank Secondary Containment 2: Not reported
Pipe Secondary Containment: Not reported
Tank Leak Detection 1: None
Tank Leak Detection 2: Not reported
Pipe Leak Detection 1: Not reported
Pipe Leak Detection 2: Not reported
Type Of Overfill Prevention 1: Product Level Gauge (A/G)
Type Of Overfill Prevention 2: Not reported
Dispenser Method: Submersible
Spill Prevention: Not reported
Tightness Test Method: Testing Not Required
Date Tested: / /
Next Test Date: / /
Date Tank Closed: / /

N73 CITY OF NY DEPARTMENT OF H.P.D
SSW 400 W 152 ST
1/8-1/4 MANHATTAN, NY 10031
821 ft.

AST U003395935
HIST AST N/A

Site 4 of 5 in cluster N

Relative:
Lower

AST:

Actual:
103 ft.

AST:

Region: STATE
Facility Id: 2-601060
UTM X: 589274.52962
UTM Y: 4520262.91588
Expiration Date: 10/21/97
Renewal Date: / /
Total Capacity: 3000
Facility Type: Not reported
Site Type Name: Unknown
Site Type Status: Active
Mailing Company: CITY OF NY DEPARTMENT OF H.P.D
Mailing Title: Not reported
Mailing Contact: IVAN SCHWARTZ
Mailing Address: 75 MAIDEN LANE
Mailing Address 2: 4TH FL- RM 427'
Mailing City: NEW YORK
Mailing State: NY
Mailing Zip Code: 10038

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s)
EDR ID Number
EPA ID Number

CITY OF NY DEPARTMENT OF H.P.D (Continued)

U003395935

Mailing Phone No: (212) 806-8037
Mailing Email: Not reported
Owner Title: Not reported
Owner Name: Not reported
Owner Address: 75 MAIDEN LANE
Owner Address 2: Not reported
Owner State: NY
Owner Zip Code: 10038
Owner Phone: (212) 806-8306
Owner Company: CITY OF NY DEPARTMENT OF H.P.D
Emergency Contact: LOUISE BECTON
Emergency Phone: (212) 234-3656
Operator: JOHN PRESAK
Operator Phone: (212) 234-1175
Owner City: NEW YORK
Owner Sub Type: Local Government
Program Type: PBS

Tank Number: 1
Tank Location Name: Aboveground - in contact with soil
Tank Status: In Service
Tank Model: Not reported
Pipe Model: Not reported
Active Status: Active
Install Date: / /
Capacity Gallons: 3000
Material Name: #2 Fuel Oil
Percentage: 100.00
Tank Type Name: Steel/Carbon Steel/Iron
Tank Internal Protection: None
Tank Internal Protection 1: Painted/Asphalt Coating
Tank Internal Protection 2: Not reported
Pipe Location Name: Aboveground/Underground Combination
Pipe Type Name: Steel/Carbon Steel/Iron
Pipe External Protection 1: Painted/Asphalt Coating
Pipe External Protection 2: Not reported
Tank Secondary Containment 1: Vault (w/o access)
Tank Secondary Containment 2: Not reported
Pipe Secondary Containment: Not reported
Tank Leak Detection 1: None
Tank Leak Detection 2: Not reported
Pipe Leak Detection 1: Exempt Suction Piping
Pipe Leak Detection 2: Not reported
Type Of Overfill Prevention 1: Vent Whistle
Type Of Overfill Prevention 2: Not reported
Dispenser Method: Suction
Spill Prevention: Not reported
Tightness Test Method: Testing Not Required
Date Tested: / /
Next Test Date: / /
Date Tank Closed: / /

HIST AST:

PBS Number: 2-601060
SWIS Code: 6201
Operator: JOHN PRESAK
Facility Phone: (212) 234-1175

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

CITY OF NY DEPARTMENT OF H.P.D (Continued)

EDR ID Number
EPA ID Number

Database(s)

U003395935

Facility Addr2: 400 W 152 ST
Facility Type: Not reported
Emergency: LOUISE BECTON
Emergency Tel: (212) 234-3654
Old PBSNO: Not reported
Date Inspected: Not reported
Inspector: Not reported
Result of Inspection: Not reported
Owner Name: CITY OF NY DEPARTMENT OF H.P.D
Owner Address: 75 MAIDEN LANE
Owner City,St,Zip: NEW YORK, NY 10038
Federal ID: Not reported
Owner Tel: (212) 806-8306
Owner Type: Local Government
Owner Subtype: Not reported
Mailing Contact: IVAN SCHWARTZ
Mailing Name: CITY OF NY DEPARTMENT OF H.P.D
Mailing Address: 75 MAIDEN LANE
Mailing Address 2: 4TH FL- RM 427'
Mailing City,St,Zip: NEW YORK, NY 10038
Mailing Telephone: (212) 806-8037
Owner Mark: First Owner
Facility Status: 1 - Active PBS facility, i.e. total capacity of the PBS tanks is greater than 1,100 gallons, regardless if Subpart 360-14 tanks exist or not at the facility.

Certification Flag: False
Certification Date: 10/23/1992
Expiration: 10/21/1997
Renew Flag: False
Renew Date: Not reported
Total Capacity: 3000
FAMT: True
Facility Screen: Minor Data Missing
Owner Screen: Minor Data Missing
Tank Screen: No Missing Data
Dead Letter: False
CBS Number: Not reported
Town or City: NEW YORK CITY
County Code: 62
Town or City Code: 01
Region: 2

Tank ID: 1
Tank Location: ABOVEGROUND
Tank Status: In Service
Install Date: Not reported
Capacity (Gal): 3000
Product Stored: NOS 1,2, OR 4 FUEL OIL
Tank Type: Steel/carbon steel
Tank Internal: 0
Tank External: 01
Pipe Location: Aboveground/Underground Combination
Pipe Type: STEEL/IRON
Pipe Internal: None
Pipe External: 01
Tank Containment: Diking
Leak Detection: 00

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

CITY OF NY DEPARTMENT OF H.P.D (Continued)

EDR ID Number
EPA ID Number

Database(s)

U003395935

Overfill Protection: 06
Dispenser Method: Suction
Date Tested: Not reported
Next Test Date: Not reported
Missing Data for Tank: No Missing Data
Date Closed: Not reported
Test Method: Not reported
Deleted: False
Updated: True
SPDES Number: Not reported
Lat/Long: Not reported

N74 401 WEST 152 ST HDFC
SSW 401 WEST 152 ST
1/8-1/4 NEW YORK, NY 10031
821 ft.

AST U003393878
HIST AST N/A

Site 5 of 5 in cluster N

Relative:
Lower

AST:

Actual:
103 ft.

AST:

Region: STATE
Facility Id: 2-346942
UTM X: 589278.69201
UTM Y: 4520274.40159
Expiration Date: 12/14/07
Renewal Date: 08/05/02
Total Capacity: 2000
Facility Type: Not reported
Site Type Name: Apartment Building/Office Building
Site Type Status: Active
Mailing Company: 401 WEST 152 ST HDFC
Mailing Title: Not reported
Mailing Contact: SUPER FACILITY MANAGER
Mailing Address: 401 WEST 152 ST
Mailing Address 2: C/O APARTMENT 1C
Mailing City: NEW YORK
Mailing State: NY
Mailing Zip Code: 10031
Mailing Phone No: (212) 862-4464
Mailing Email: Not reported
Owner Title: Not reported
Owner Name: Not reported
Owner Address: 401 WEST 152 ST C/O APARTMENT 1C
Owner Address 2: Not reported
Owner State: NY
Owner Zip Code: 10031
Owner Phone: (212) 862-4464
Owner Company: 401 WEST 152 ST HDFC
Emergency Contact: SAMUEL SIMON
Emergency Phone: (212) 283-7761
Operator: BASYL A. BRYAN
Operator Phone: (212) 862-4464
Owner City: NEW YORK
Owner Sub Type: Corporate or Commercial
Program Type: PBS

Tank Number: 001

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s)
EDR ID Number
EPA ID Number

401 WEST 152 ST HDFC (Continued)

U003393878

Tank Location Name: Aboveground - in contact with soil
Tank Status: In Service
Tank Model: Not reported
Pipe Model: Not reported
Active Status: Active
Install Date: 07/01/84
Capacity Gallons: 2000
Material Name: #2 Fuel Oil
Percentage: 100.00
Tank Type Name: Steel/Carbon Steel/Iron
Tank Internal Protection: None
Tank Internal Protection 1: Painted/Asphalt Coating
Tank Internal Protection 2: Not reported
Pipe Location Name: Aboveground
Pipe Type Name: Steel/Carbon Steel/Iron
Pipe External Protection 1: None
Pipe External Protection 2: Not reported
Tank Secondary Containment 1: Vault (w/o access)
Tank Secondary Containment 2: Not reported
Pipe Secondary Containment: Not reported
Tank Leak Detection 1: None
Tank Leak Detection 2: Not reported
Pipe Leak Detection 1: Exempt Suction Piping
Pipe Leak Detection 2: Not reported
Type Of Overfill Prevention 1: Product Level Gauge (A/G)
Type Of Overfill Prevention 2: Not reported
Dispenser Method: Suction
Spill Prevention: Not reported
Tightness Test Method: Testing Not Required
Date Tested: / /
Next Test Date: / /
Date Tank Closed: / /

HIST AST:

PBS Number: 2-346942
SWIS Code: 6201
Operator: BASYL A. BRYAN
Facility Phone: (212) 862-4464
Facility Addr2: 401 WEST 152 ST
Facility Type: APARTMENT BUILDING
Emergency: SAMUEL SIMON
Emergency Tel: (212) 283-7761
Old PBSNO: Not reported
Date Inspected: Not reported
Inspector: Not reported
Result of Inspection: Not reported
Owner Name: 401 WEST 152 ST HDFC
Owner Address: 401 WEST 152 ST C/O APARTMENT 1C
Owner City,St,Zip: NEW YORK, NY 10031
Federal ID: Not reported
Owner Tel: (212) 862-4464
Owner Type: Corporate/Commercial
Owner Subtype: Not reported
Mailing Contact: SUPER FACILITY MANAGER
Mailing Name: 401 WEST 152 ST HDFC
Mailing Address: 401 WEST 152 ST
Mailing Address 2: C/O APARTMENT 1C

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

401 WEST 152 ST HDFC (Continued)

EDR ID Number
EPA ID Number

Database(s)

U003393878

Mailing City,St,Zip: NEW YORK, NY 10031
Mailing Telephone: (212) 862-4464
Owner Mark: First Owner
Facility Status: 1 - Active PBS facility, i.e. total capacity of the PBS tanks is greater than 1,100 gallons, regardless if Subpart 360-14 tanks exist or not at the facility.

Certification Flag: False
Certification Date: 10/29/1999
Expiration: 12/14/2002
Renew Flag: False
Renew Date: Not reported
Total Capacity: 2000
FAMT: True
Facility Screen: No Missing Data
Owner Screen: No Missing Data
Tank Screen: No Missing Data
Dead Letter: False
CBS Number: Not reported
Town or City: NEW YORK CITY
County Code: 62
Town or City Code: 01
Region: 2

Tank ID: 001
Tank Location: ABOVEGROUND
Tank Status: In Service
Install Date: 19840701
Capacity (Gal): 2000
Product Stored: NOS 1,2, OR 4 FUEL OIL
Tank Type: Steel/carbon steel
Tank Internal: 0
Tank External: 01
Pipe Location: Aboveground
Pipe Type: STEEL/IRON
Pipe Internal: None
Pipe External: 00
Tank Containment: Diking
Leak Detection: 0
Overfill Protection: 4
Dispenser Method: Suction
Date Tested: Not reported
Next Test Date: Not reported
Missing Data for Tank: No Missing Data
Date Closed: Not reported
Test Method: Not reported
Deleted: False
Updated: True
SPDES Number: Not reported
Lat/Long: Not reported

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

O75
South
1/8-1/4
827 ft.

CHAMA HOLDING CORP
379-81 EDGECOMBE AVE
NEW YORK, NY 10031

AST
HIST AST **U003388953**
 N/A

Site 2 of 2 in cluster O

Relative:
Lower

AST:

Actual:
86 ft.

AST:

Region: STATE
Facility Id: 2-284130
UTM X: 589374.99589
UTM Y: 4520345.96778
Expiration Date: 07/14/12
Renewal Date: 03/06/02
Total Capacity: 5000
Facility Type: Not reported
Site Type Name: Apartment Building/Office Building
Site Type Status: Active
Mailing Company: CHAMA HOLDING CORP
Mailing Title: Not reported
Mailing Contact: Not reported
Mailing Address: P.O. BOX 191024
Mailing Address 2: Not reported
Mailing City: BROOKLYN
Mailing State: NY
Mailing Zip Code: 11219
Mailing Phone No: (718) 972-5010
Mailing Email: Not reported
Owner Title: Not reported
Owner Name: Not reported
Owner Address: P.O. BOX 191024
Owner Address 2: Not reported
Owner State: NY
Owner Zip Code: 11219
Owner Phone: (718) 972-5010
Owner Company: CHAMA HOLDING CORP
Emergency Contact: JAUN BACA
Emergency Phone: (718) 972-5010
Operator: JAUN BACA
Operator Phone: (212) 926-4546
Owner City: BROOKLYN
Owner Sub Type: Corporate or Commercial
Program Type: PBS

Tank Number: 001
Tank Location Name: Aboveground - in contact with soil
Tank Status: In Service
Tank Model: Not reported
Pipe Model: Not reported
Active Status: Active
Install Date: 01/01/49
Capacity Gallons: 5000
Material Name: #2 Fuel Oil
Percentage: 100.00
Tank Type Name: Steel/Carbon Steel/Iron
Tank Internal Protection: None
Tank Internal Protection 1: None
Tank Internal Protection 2: Not reported
Pipe Location Name: No Piping

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s)

EDR ID Number
EPA ID Number

CHAMA HOLDING CORP (Continued)

U003388953

Pipe Type Name: Steel/Carbon Steel/Iron
Pipe External Protection 1: None
Pipe External Protection 2: Not reported
Tank Secondary Containment 1: Vault (w/o access)
Tank Secondary Containment 2: Not reported
Pipe Secondary Containment: Not reported
Tank Leak Detection 1: None
Tank Leak Detection 2: Not reported
Pipe Leak Detection 1: Exempt Suction Piping
Pipe Leak Detection 2: Not reported
Type Of Overfill Prevention 1: Product Level Gauge (A/G)
Type Of Overfill Prevention 2: Not reported
Dispenser Method: Suction
Spill Prevention: Not reported
Tightness Test Method: Testing Not Required
Date Tested: / /
Next Test Date: / /
Date Tank Closed: / /

HIST AST:

PBS Number: 2-284130
SWIS Code: 6201
Operator: FIDEL GALANO
Facility Phone: (212) 862-2369
Facility Addr2: 379 EDGECOMBE AVE
Facility Type: APARTMENT BUILDING
Emergency: FIDEL GALANO
Emergency Tel: (212) 862-2369
Old PBSNO: Not reported
Date Inspected: Not reported
Inspector: Not reported
Result of Inspection: Not reported
Owner Name: CHAMA HOLDING CORP
Owner Address: P.O. BOX 191024
Owner City,St,Zip: BROOKLYN, NY 11219
Federal ID: Not reported
Owner Tel: (718) 972-5010
Owner Type: Corporate/Commercial
Owner Subtype: Not reported
Mailing Contact: Not reported
Mailing Name: CHAMA HOLDING CORP
Mailing Address: P.O. BOX 191024
Mailing Address 2: Not reported
Mailing City,St,Zip: BROOKLYN, NY 11219
Mailing Telephone: (718) 972-5010
Owner Mark: First Owner
Facility Status: 1 - Active PBS facility, i.e. total capacity of the PBS tanks is greater than 1,100 gallons, regardless if Subpart 360-14 tanks exist or not at the facility.

Certification Flag: False
Certification Date: 07/07/1997
Expiration: 07/14/2002
Renew Flag: False
Renew Date: Not reported
Total Capacity: 5000
FAMT: True
Facility Screen: No Missing Data

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

CHAMA HOLDING CORP (Continued)

EDR ID Number
EPA ID Number

Database(s)

U003388953

Owner Screen: No Missing Data
Tank Screen: Minor Data Missing
Dead Letter: False
CBS Number: Not reported
Town or City: NEW YORK CITY
County Code: 62
Town or City Code: 01
Region: 2

Tank ID: 001
Tank Location: ABOVEGROUND
Tank Status: In Service
Install Date: Not reported
Capacity (Gal): 5000
Product Stored: NOS 1,2, OR 4 FUEL OIL
Tank Type: Steel/carbon steel
Tank Internal: Not reported
Tank External: Not reported
Pipe Location: Not reported
Pipe Type: STEEL/IRON
Pipe Internal: Not reported
Pipe External: Not reported
Tank Containment: Diking
Leak Detection: 0
Overfill Protection: 4
Dispenser Method: Suction
Date Tested: Not reported
Next Test Date: Not reported
Missing Data for Tank: Minor Data Missing
Date Closed: Not reported
Test Method: Not reported
Deleted: False
Updated: False
SPDES Number: Not reported
Lat/Long: Not reported

S76 1885 AMSTERDAM AVE
West 1885 AMSTERDAM AVE
1/8-1/4 NEW YORK, NY 10032
831 ft.

UST U000397309
HIST UST N/A

Site 1 of 4 in cluster S

Relative:
Higher

UST:

Actual:
142 ft.

UST:

Facility Id: 2-270636
Expiration Date: 06/18/92
Renewal Date: / /
Total Capacity: 0
Facility Type: Not reported
Mailing Company: 1885 AMSTERDAM AVE
Mailing Title: Not reported
Mailing Contact: Not reported
Mailing Address: 34 34TH STREET
Mailing Address 2: Not reported
Mailing City: BROOKLYN
Mailing State: NY
Mailing Zip Code: 11232

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

1885 AMSTERDAM AVE (Continued)

EDR ID Number
EPA ID Number

Database(s)

U000397309

Mailing Phone No: (718) 832-6500
Mailing Email: Not reported
Owner Title: Not reported
Owner Name: Not reported
Owner Address: 110 E 23RD ST
Owner Address 2: Not reported
Owner State: NY
Owner Zip Code: 10010
Owner Phone: (212) 475-4263
Owner Company: DELTA MGMT-%COASTAL PETROL CO
Emergency Contact: COASTAL PETROLEUM TANK CORP
Emergency Phone: (212) 475-4263
Operator: L. AMSTERDAM RLTY CORP
Operator Phone: (212) 769-1344
Owner City: NEW YORK
Owner Sub Type: Not reported
UTM X: 589095.67021
UTM Y: 4520478.36204
Site Type Name: Unknown
Site Type Status: Unregulated
Comments: 08/10/92 - All attempts to contact this facility have failed. Mail is being returned as undeliverable, and no one is reachable by telephone. This site will not receive any future mailing correspondence, including registration renewal applications and tank testing overdue notices, until this problem has been resolved. A site inspection is necessary to determine the true status of this facility. For all intents and purposes, it's UNDELIVERABLE. This site, however, is still considered active until deemed otherwise.

Program Type: PBS

Tank Number: 001
Tank Location Name: Underground, vaulted, with access
Tank Status: Closed - In Place
Tank Model: Not reported
Pipe Model: Not reported
Active Status: Inactive
Install Date: / /
Capacity Gallons: 3000
Material Name: #2 Fuel Oil
Percentage: 100.00
Tank Type Name: Steel/Carbon Steel/Iron
Tank Internal Protection: None
Tank Internal Protection 1: None
Tank Internal Protection 2: Not reported
Pipe Location Name: No Piping
Pipe Type Name: Steel/Carbon Steel/Iron
Pipe External Protection 1: None
Pipe External Protection 2: Not reported
Tank Secondary Containment 1: Vault (w/o access)
Tank Secondary Containment 2: Not reported
Pipe Secondary Containment: Not reported
Tank Leak Detection 1: None
Tank Leak Detection 2: Not reported
Pipe Leak Detection 1: Not reported
Pipe Leak Detection 2: Not reported
Type Of Overfill Prevention 1: Product Level Gauge (A/G)
Type Of Overfill Prevention 2: Not reported

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

1885 AMSTERDAM AVE (Continued)

EDR ID Number
EPA ID Number

Database(s)

U000397309

Dispenser Method: Suction
Spill Prevention: Not reported
Tightness Test Method: Testing Not Required
Date Tested: / /
Next Test Date: / /
Date Tank Closed: 12/01/93

HIST UST:

PBS Number: 2-270636
SPDES Number: Not reported
Emergency Contact: COASTAL PETROLEUM TANK CORP
Emergency Telephone: (212) 475-4263
Operator: L. AMSTERDAM RLTY CORP
Operator Telephone: (212) 769-1344
Owner Name: DELTA MGMT-%COASTAL PETROL CO
Owner Address: 110 E 23RD ST
Owner City,St,Zip: NEW YORK, NY 10010
Owner Telephone: (212) 475-4263
Owner Type: Not reported
Owner Subtype: Not reported
Mailing Name: 1885 AMSTERDAM AVE
Mailing Address: 34 34TH STREET
Mailing Address 2: Not reported
Mailing City,St,Zip: BROOKLYN, NY 11232
Mailing Contact: Not reported
Mailing Telephone: (718) 832-6500
Owner Mark: First Owner
Facility Status: 2 - Unregulated by PBS (the total capacity is less than 1,101 gallons)
and Subpart 360-14.
Facility Addr2: 1885 AMSTERDAM AVE
SWIS ID: 6201
Old PBS Number: Not reported
Facility Type: Not reported
Inspected Date: Not reported
Inspector: Not reported
Inspection Result: Not reported
Federal ID: Not reported
Certification Flag: False
Certification Date: 06/18/1987
Expiration Date: 06/18/1992
Renew Flag: False
Renewal Date: Not reported
Total Capacity: 0
FAMT: True
Facility Screen: Minor Data Missing
Owner Screen: Minor Data Missing
Tank Screen: 0
Dead Letter: True
CBS Number: Not reported
Town or City: NEW YORK CITY
County Code: 62
Town or City: 01
Region: 2

Tank Id: 001
Tank Location: UNDERGROUND, VAULTED, WITH ACCESS
Tank Status: Closed-In Place

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

1885 AMSTERDAM AVE (Continued)

EDR ID Number
EPA ID Number

Database(s)

U000397309

Install Date: Not reported
Capacity (gals): 3000
Product Stored: NOS 1,2, OR 4 FUEL OIL
Tank Type: Steel/carbon steel
Tank Internal: Not reported
Tank External: Not reported
Pipe Location: Not reported
Pipe Type: STEEL/IRON
Pipe Internal: Not reported
Pipe External: Not reported
Second Containment: Diking
Leak Detection: None
Overfill Prot: Product Level Gauge
Dispenser: Suction
Date Tested: Not reported
Next Test Date: Not reported
Missing Data for Tank: Minor Data Missing
Date Closed: 12/01/1993
Test Method: Not reported
Deleted: False
Updated: True
Lat/long: Not reported

T77 464 WEST 152ND ST
SW 464 W 152ND ST
1/8-1/4 NEW YORK, NY 10031
843 ft.

AST U003388998
HIST AST N/A

Relative:
Higher

Site 1 of 3 in cluster T

AST:

Actual:
124 ft.

AST:

Region: STATE
Facility Id: 2-257087
UTM X: 589126.77038
UTM Y: 4520340.06917
Expiration Date: 07/14/07
Renewal Date: 03/06/02
Total Capacity: 2500
Facility Type: Not reported
Site Type Name: Apartment Building/Office Building
Site Type Status: Active
Mailing Company: 464 WEST 152ND STREET H.D.F.C.
Mailing Title: Not reported
Mailing Contact: EUNICE PARSONS
Mailing Address: 464 WEST 152 STREET
Mailing Address 2: Not reported
Mailing City: NEW YORK
Mailing State: NY
Mailing Zip Code: 10031
Mailing Phone No: Not reported
Mailing Email: Not reported
Owner Title: PRESIDENT
Owner Name: EUNICE PARSONS
Owner Address: 464 WEST 152 STREET
Owner Address 2: Not reported
Owner State: NY
Owner Zip Code: 10031

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s)
EDR ID Number
EPA ID Number

464 WEST 152ND ST (Continued)

U003388998

Owner Phone: Not reported
Owner Company: 464 WEST 152ND STREET H.D.F.C.
Emergency Contact: EUNICE PARSONS
Emergency Phone: Not reported
Operator: ROBERT BROWN
Operator Phone: Not reported
Owner City: NEW YORK
Owner Sub Type: Private Resident
Program Type: PBS

Tank Number: 001
Tank Location Name: Aboveground - in contact with soil
Tank Status: In Service
Tank Model: Not reported
Pipe Model: Not reported
Active Status: Active
Install Date: / /
Capacity Gallons: 2500
Material Name: #2 Fuel Oil
Percentage: 100.00
Tank Type Name: Steel/Carbon Steel/Iron
Tank Internal Protection: None
Tank Internal Protection 1: Painted/Asphalt Coating
Tank Internal Protection 2: Not reported
Pipe Location Name: Aboveground
Pipe Type Name: Steel/Carbon Steel/Iron
Pipe External Protection 1: Painted/Asphalt Coating
Pipe External Protection 2: Not reported
Tank Secondary Containment 1: Vault (w/access)
Tank Secondary Containment 2: Not reported
Pipe Secondary Containment: Vault (with Access)
Tank Leak Detection 1: None
Tank Leak Detection 2: Not reported
Pipe Leak Detection 1: None
Pipe Leak Detection 2: Not reported
Type Of Overfill Prevention 1: Vent Whistle
Type Of Overfill Prevention 2: Not reported
Dispenser Method: Suction
Spill Prevention: None
Tightness Test Method: Testing Not Required
Date Tested: / /
Next Test Date: / /
Date Tank Closed: / /

HIST AST:

PBS Number: 2-257087
SWIS Code: 6201
Operator: K. BRIGGS
Facility Phone: (212) 281-8657
Facility Addr2: 464 W 152ND ST
Facility Type: APARTMENT BUILDING
Emergency: ALAN R BUSH INC
Emergency Tel: (212) 795-1555
Old PBSNO: Not reported
Date Inspected: Not reported
Inspector: Not reported
Result of Inspection: Not reported

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

464 WEST 152ND ST (Continued)

EDR ID Number
EPA ID Number

Database(s)

U003388998

Owner Name: 464 WEST 152ND ST HDFC
Owner Address: 2460 LEMOINE AVENUE, 3RD FLOOR
Owner City,St,Zip: FORT LEE, NJ 07024
Federal ID: Not reported
Owner Tel: (212) 795-1555
Owner Type: Corporate/Commercial
Owner Subtype: Not reported
Mailing Contact: ALBERTA TUNISON
Mailing Name: ALAN BUSH INC.
Mailing Address: 2460 LEMOINE AVE. 3RD FL.
Mailing Address 2: Not reported
Mailing City,St,Zip: FORT LEE, NJ 07024
Mailing Telephone: (212) 795-1555
Owner Mark: First Owner
Facility Status: 1 - Active PBS facility, i.e. total capacity of the PBS tanks is greater than 1,100 gallons, regardless if Subpart 360-14 tanks exist or not at the facility.

Certification Flag: False
Certification Date: 07/09/1997
Expiration: 07/14/2002
Renew Flag: False
Renew Date: Not reported
Total Capacity: 2500
FAMT: True
Facility Screen: No Missing Data
Owner Screen: No Missing Data
Tank Screen: Minor Data Missing
Dead Letter: False
CBS Number: Not reported
Town or City: NEW YORK CITY
County Code: 62
Town or City Code: 01
Region: 2

Tank ID: 001
Tank Location: ABOVEGROUND
Tank Status: In Service
Install Date: Not reported
Capacity (Gal): 2500
Product Stored: NOS 1,2, OR 4 FUEL OIL
Tank Type: Steel/carbon steel
Tank Internal: Not reported
Tank External: Not reported
Pipe Location: Not reported
Pipe Type: STEEL/IRON
Pipe Internal: Not reported
Pipe External: Not reported
Tank Containment: None
Leak Detection: 0
Overfill Protection: 4
Dispenser Method: Suction
Date Tested: Not reported
Next Test Date: Not reported
Missing Data for Tank: Minor Data Missing
Date Closed: Not reported
Test Method: Not reported
Deleted: False

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

464 WEST 152ND ST (Continued)

EDR ID Number
EPA ID Number

Database(s)

U003388998

Updated: False
SPDES Number: Not reported
Lat/Long: Not reported

78
ESE
1/8-1/4
844 ft.

364 EAST 155TH STREET/ BR
364 EAST 155TH STREET
NEW YORK CITY, NY

LTANKS
HIST LTANKS

S100144740
N/A

Relative:
Lower

LTANKS:

Actual:
18 ft.

Site ID: 135234
Spill Date: 08/05/87
Facility Addr2: Not reported
Facility ID: 8703706
Program Number: 8703706
SWIS: 0301
Region of Spill: 2
Investigator: BATTISTA
Referred To: Not reported
Reported to Dept: 08/05/87
CID: Not reported
Spill Cause: Tank Test Failure
Water Affected: Not reported
Spill Source: Institutional, Educational, Gov., Other
Spill Notifier: Tank Tester
Cleanup Ceased: 10/07/92
Cleanup Meets Standard: False
Last Inspection: / /
Recommended Penalty: Penalty Not Recommended
UST Involvement: False
Spill Class: Known release with minimal potential for fire or hazard. DEC Response.
Willing Responsible Party. Corrective action taken.
Spill Closed Dt: 10/07/92
Remediation Phase: 0
Date Entered In Computer: 08/20/87
Spill Record Last Update: 02/15/94
Spille Namer: Not reported
Spiller Company: Not reported
Spiller Phone: (212) 292-6970
Spiller Extention: Not reported
Spiller Address: Not reported
Spiller City,St,Zip: ZZ
Spiller County: 001
Spiller Contact: Not reported
Spiller Phone: Not reported
Spiller Extention: Not reported
DEC Region: 2
Program Number: 8703706
DER Facility ID: 116111
Site ID: 135234
Operable Unit ID: 907590
Operable Unit: 01
Material ID: 469932
Material Code: 0001
Material Name: #2 Fuel Oil
Case No.: Not reported
Material FA: Petroleum
Quantity: 0.00

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

364 EAST 155TH STREET/ BR (Continued)

S100144740

Units: Not reported
Recovered: 0.00
Resource Affected: Groundwater
Oxygenate: False
Site ID: 135234
Spill Tank Test: 1531286
Tank Number: Not reported
Tank Size: 0
Test Method: 00
Leak Rate: 0.00
Gross Fail: Not reported
Modified By: Spills
Last Modified: 10/01/04
Test Method: Unknown
DEC Memo: Not reported
Remarks: Start CallerRemark - 8703706 -.225 GAL/HR. 1500 GALLON UNDERGROUND TANK
PETRO-TITE, WILL EXCAVATE AND RETEST THIS WEEK. END CallerRemark - 8703706

HIST LTANKS:

Region of Spill: 2
Spill Number: 8703706
Investigator: BATTISTA
Caller Name: Not reported
Caller Agency: Not reported
Caller Phone: Not reported
Caller Extension: Not reported
Notifier Name: Not reported
Notifier Agency: Not reported
Notifier Phone: Not reported
Notifier Extension: Not reported
Spill Date: 08/05/1987
Spill Time: 13:30
Reported to Department Date: 08/05/87
Reported to Department Time: 14:20
SWIS: 60
Spiller Contact: Not reported
Spiller Phone: Not reported
Spiller Extention: Not reported
Spiller Name: Not reported
Spiller Address: Not reported
Spiller City,St,Zip: Not reported
Facility Contact: Not reported
Facility Phone: (212) 292-6970
Facility Extention: Not reported
Spill Cause: Tank Test Failure
Resource Affectd: Groundwater
Water Affected: Not reported
Spill Source: Other Non Commercial/Industrial
Spill Notifier: Tank Tester
PBS Number: Not reported
Cleanup Ceased: 10/07/92
Cleanup Meets Standard: False
Last Inspection: / /
Recommended Penalty: Penalty Not Recommended
Spiller Cleanup Date: / /
Enforcement Date: / /
Investigation Complete: / /

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s)
EDR ID Number
EPA ID Number

364 EAST 155TH STREET/ BR (Continued)

S100144740

UST Involvement: False
Spill Class: Known release with minimal potential for fire or hazard. DEC Response.
Willing Responsible Party. Corrective action taken.
Spill Closed Dt: 10/07/92
Date Region Sent Summary to Central Office: / /
Corrective Action Plan Submitted: / /
Date Spill Entered In Computer Data File: 08/20/87
Time Spill Entered In Computer Data File: Not reported
Spill Record Last Update: 02/15/94
Is Updated: False
PBS Number: Not reported
Tank Number: Not reported
Tank Size: 0
Test Method: Not reported
Leak Rate Failed Tank: 0.00
Gross Leak Rate: Not reported
Material Class Type: Petroleum
Quantity Spilled: 0
Unkonwn Quantity Spilled: False
Units: Not reported
Quantity Recovered: 0
Unkonwn Quantity Recovered: False
Material: #2 FUEL OIL
Class Type: #2 FUEL OIL
Times Material Entry In File: 24464
CAS Number: Not reported
Last Date: 19941207
DEC Remarks: Not reported
Spill Cause: -.225 GAL/HR. 1500 GALLON UNDERGROUND TANK PETRO-TITE, WILL EXCAVATE AND RETEST THIS WEEK.

P79 SMH REALTY CORP.
NW 512 WEST 156TH STREET
1/8-1/4 NEW YORK, NY 10031
846 ft.

AST U003395088
HIST AST N/A

Site 7 of 9 in cluster P

Relative:
Higher

AST:

Actual:
144 ft.

AST:

Region: STATE
Facility Id: 2-471526
UTM X: 589161.43883
UTM Y: 4520695.98414
Expiration Date: 03/28/04
Renewal Date: / /
Total Capacity: 4000
Facility Type: Not reported
Site Type Name: Apartment Building/Office Building
Site Type Status: Active
Mailing Company: SMH REALTY CORP.
Mailing Title: Not reported
Mailing Contact: REAL STATE MGMT
Mailing Address: P.O. BOX 919 GPO
Mailing Address 2: Not reported
Mailing City: BRONX
Mailing State: NY
Mailing Zip Code: 10451

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s) EDR ID Number
EPA ID Number

SMH REALTY CORP. (Continued)

U003395088

Mailing Phone No: (718) 562-6860
Mailing Email: Not reported
Owner Title: Not reported
Owner Name: Not reported
Owner Address: P.O. BOX 919 GPO
Owner Address 2: Not reported
Owner State: NY
Owner Zip Code: 10451
Owner Phone: (718) 562-6860
Owner Company: SMH REALTY CORP.
Emergency Contact: PEDRO ROJA
Emergency Phone: (212) 690-2491
Operator: PEDRO ROJA
Operator Phone: (212) 690-2491
Owner City: BRONX
Owner Sub Type: Corporate or Commercial
Program Type: PBS

Tank Number: 001
Tank Location Name: Aboveground on crib, rack, or cradle
Tank Status: In Service
Tank Model: Not reported
Pipe Model: Not reported
Active Status: Active
Install Date: / /
Capacity Gallons: 4000
Material Name: #2 Fuel Oil
Percentage: 100.00
Tank Type Name: Steel/Carbon Steel/Iron
Tank Internal Protection: None
Tank Internal Protection 1: None
Tank Internal Protection 2: Not reported
Pipe Location Name: Aboveground
Pipe Type Name: Galvanized Steel
Pipe External Protection 1: None
Pipe External Protection 2: Not reported
Tank Secondary Containment 1: Vault (w/o access)
Tank Secondary Containment 2: Not reported
Pipe Secondary Containment: Not reported
Tank Leak Detection 1: In-Tank System (ATG)
Tank Leak Detection 2: Not reported
Pipe Leak Detection 1: Not reported
Pipe Leak Detection 2: Not reported
Type Of Overfill Prevention 1: Product Level Gauge (A/G)
Type Of Overfill Prevention 2: Not reported
Dispenser Method: Not reported
Spill Prevention: Not reported
Tightness Test Method: Testing Not Required
Date Tested: / /
Next Test Date: / /
Date Tank Closed: / /

HIST AST:

PBS Number: 2-471526
SWIS Code: 6201
Operator: PEDRO ROJA
Facility Phone: (212) 690-2491

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

SMH REALTY CORP. (Continued)

EDR ID Number
EPA ID Number

Database(s)

U003395088

Facility Addr2: 512 WEST 156TH STREET
Facility Type: APARTMENT BUILDING
Emergency: PEDRO ROJA
Emergency Tel: (212) 690-2491
Old PBSNO: Not reported
Date Inspected: Not reported
Inspector: Not reported
Result of Inspection: Not reported
Owner Name: SMH REALTY CORP.
Owner Address: P.O. BOX 919 GPO
Owner City,St,Zip: BRONX, NY 10451
Federal ID: Not reported
Owner Tel: (718) 562-6860
Owner Type: Corporate/Commercial
Owner Subtype: Not reported
Mailing Contact: REAL STATE MGMT
Mailing Name: SMH REALTY CORP.
Mailing Address: P.O. BOX 919 GPO
Mailing Address 2: Not reported
Mailing City,St,Zip: BRONX, NY 10451
Mailing Telephone: (718) 562-6860
Owner Mark: First Owner
Facility Status: 1 - Active PBS facility, i.e. total capacity of the PBS tanks is greater than 1,100 gallons, regardless if Subpart 360-14 tanks exist or not at the facility.

Certification Flag: False
Certification Date: 02/19/1999
Expiration: 03/28/2004
Renew Flag: False
Renew Date: Not reported
Total Capacity: 4000
FAMT: True
Facility Screen: No Missing Data
Owner Screen: No Missing Data
Tank Screen: Minor Data Missing
Dead Letter: False
CBS Number: Not reported
Town or City: NEW YORK CITY
County Code: 62
Town or City Code: 01
Region: 2

Tank ID: 001
Tank Location: ABOVEGROUND ON SADDLES LEGS, STILTS, RACK, OR CRADLE
Tank Status: In Service
Install Date: Not reported
Capacity (Gal): 4000
Product Stored: NOS 1,2, OR 4 FUEL OIL
Tank Type: Steel/carbon steel
Tank Internal: 0
Tank External: 0
Pipe Location: Aboveground
Pipe Type: GALVANIZED STEEL
Pipe Internal: Not reported
Pipe External: Not reported
Tank Containment: Diking
Leak Detection: 4

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

SMH REALTY CORP. (Continued)

EDR ID Number
EPA ID Number

U003395088

Overfill Protection: 4
Dispenser Method: Gravity
Date Tested: Not reported
Next Test Date: Not reported
Missing Data for Tank: Minor Data Missing
Date Closed: Not reported
Test Method: Not reported
Deleted: False
Updated: True
SPDES Number: Not reported
Lat/Long: Not reported

T80
SW
1/8-1/4
851 ft.

465 W 152ND ST.
465 WEST 152ND STREET
NEW YORK, NY 10031

AST A100173526
N/A

Relative:
Higher

Site 2 of 3 in cluster T

AST:

Actual:
125 ft.

AST:

Region: STATE
Facility Id: 2-604739
UTM X: 589148.84552
UTM Y: 4520341.77886
Expiration Date: 01/13/11
Renewal Date: / /
Total Capacity: 4000
Facility Type: Not reported
Site Type Name: Apartment Building/Office Building
Site Type Status: Active
Mailing Company: REUSSI MGT, LLC FOR 465 W. 152ND STREET
Mailing Title: Not reported
Mailing Contact: PETER SIEGEL
Mailing Address: P.O. BOX 2198
Mailing Address 2: Not reported
Mailing City: NEW YORK
Mailing State: NY
Mailing Zip Code: 10101-2198
Mailing Phone No: (212) 388-8088
Mailing Email: Not reported
Owner Title: MANAGING MEMBER
Owner Name: PETER SIEGEL
Owner Address: P.O. BOX 2198
Owner Address 2: Not reported
Owner State: NY
Owner Zip Code: 10101-2198
Owner Phone: (212) 388-8088
Owner Company: 465 W. 152ND, LLC
Emergency Contact: MAUREEN RAMPRASHAD
Emergency Phone: (212) 388-8088
Operator: JUAN RIVERA
Operator Phone: (347) 321-5047
Owner City: NEW YORK
Owner Sub Type: Corporate or Commercial
Program Type: PBS

Tank Number: 1

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

465 W 152ND ST. (Continued)

EDR ID Number
EPA ID Number

Database(s)

A100173526

Tank Location Name: Aboveground - in contact with impervious barrier
Tank Status: In Service
Tank Model: Not reported
Pipe Model: Not reported
Active Status: Active
Install Date: 01/01/80
Capacity Gallons: 4000
Material Name: #2 Fuel Oil
Percentage: 100.00
Tank Type Name: Steel/Carbon Steel/Iron
Tank Internal Protection: None
Tank Internal Protection 1: None
Tank Internal Protection 2: Not reported
Pipe Location Name: No Piping
Pipe Type Name: Steel/Carbon Steel/Iron
Pipe External Protection 1: None
Pipe External Protection 2: Not reported
Tank Secondary Containment 1: None
Tank Secondary Containment 2: Not reported
Pipe Secondary Containment: None
Tank Leak Detection 1: None
Tank Leak Detection 2: Not reported
Pipe Leak Detection 1: None
Pipe Leak Detection 2: Not reported
Type Of Overfill Prevention 1: Product Level Gauge (A/G)
Type Of Overfill Prevention 2: Not reported
Dispenser Method: None
Spill Prevention: None
Tightness Test Method: Testing Not Required
Date Tested: / /
Next Test Date: / /
Date Tank Closed: / /

T81 DANCE THEATRE OF HARLEM
SW 466 WEST 152ND ST
1/8-1/4 NY, NY 10031
851 ft.

AST U003390345
HIST AST N/A

Site 3 of 3 in cluster T

Relative:
Higher

AST:

Actual:
125 ft.

AST:

Region: STATE
Facility Id: 2-213497
UTM X: 589121.93320
UTM Y: 4520342.56435
Expiration Date: 07/28/08
Renewal Date: / /
Total Capacity: 3035
Facility Type: Not reported
Site Type Name: School
Site Type Status: Active
Mailing Company: DANCE THEATRE OF HARLEM
Mailing Title: Not reported
Mailing Contact: SHARON WILLIAMS
Mailing Address: 466 WEST 152ND STREET
Mailing Address 2: Not reported
Mailing City: NEW YORK

Map ID
Direction
Distance
Distance (ft.)
Elevation

Site

MAP FINDINGS

Database(s)

EDR ID Number
EPA ID Number

DANCE THEATRE OF HARLEM (Continued)

U003390345

Mailing State: NY
Mailing Zip Code: 10031
Mailing Phone No: (212) 690-2800
Mailing Email: Not reported
Owner Title: Not reported
Owner Name: Not reported
Owner Address: 466 WEST 152ND ST
Owner Address 2: Not reported
Owner State: NY
Owner Zip Code: 10031
Owner Phone: (212) 690-2800
Owner Company: DANCE THEATRE OF HARLEM
Emergency Contact: OLGA L. CANO
Emergency Phone: (212) 690-2800
Operator: OLGA L. CANO
Operator Phone: (212) 690-2800
Owner City: NEW YORK
Owner Sub Type: Corporate or Commercial
Program Type: PBS

Tank Number: 466
Tank Location Name: Aboveground - in contact with soil
Tank Status: In Service
Tank Model: Not reported
Pipe Model: Not reported
Active Status: Active
Install Date: / /
Capacity Gallons: 3035
Material Name: #2 Fuel Oil
Percentage: 100.00
Tank Type Name: Steel/Carbon Steel/Iron
Tank Internal Protection: None
Tank Internal Protection 1: None
Tank Internal Protection 2: Not reported
Pipe Location Name: Aboveground/Underground Combination
Pipe Type Name: Steel/Carbon Steel/Iron
Pipe External Protection 1: None
Pipe External Protection 2: Not reported
Tank Secondary Containment 1: Other
Tank Secondary Containment 2: Not reported
Pipe Secondary Containment: Not reported
Tank Leak Detection 1: None
Tank Leak Detection 2: Not reported
Pipe Leak Detection 1: Exempt Suction Piping
Pipe Leak Detection 2: Not reported
Type Of Overfill Prevention 1: Product Level Gauge (A/G)
Type Of Overfill Prevention 2: Not reported
Dispenser Method: Suction
Spill Prevention: Not reported
Tightness Test Method: Testing Not Required
Date Tested: / /
Next Test Date: / /
Date Tank Closed: / /

HIST AST:

PBS Number: 2-213497
SWIS Code: 6201

Map ID
 Direction
 Distance
 Distance (ft.)
 Elevation Site

MAP FINDINGS

Database(s)
 EDR ID Number
 EPA ID Number

DANCE THEATRE OF HARLEM (Continued)

U003390345

Operator: OLGA L. CANO
 Facility Phone: (212) 690-2800
 Facility Addr2: 466 WEST 152ND ST
 Facility Type: SCHOOL
 Emergency: OLGA L. CANO
 Emergency Tel: (908) 354-6689
 Old PBSNO: Not reported
 Date Inspected: Not reported
 Inspector: Not reported
 Result of Inspection: Not reported
 Owner Name: DANCE THEATRE OF HARLEM
 Owner Address: 466 WEST 152ND ST
 Owner City,St,Zip: NEW YORK, NY 10031
 Federal ID: Not reported
 Owner Tel: (212) 690-2800
 Owner Type: Corporate/Commercial
 Owner Subtype: Not reported
 Mailing Contact: OLGA L. CANO
 Mailing Name: DANCE THEATRE OF HARLEM
 Mailing Address: 466 WEST 152ND ST
 Mailing Address 2: Not reported
 Mailing City,St,Zip: NEW YORK, NY 10031
 Mailing Telephone: (212) 690-2800
 Owner Mark: First Owner
 Facility Status: 1 - Active PBS facility, i.e. total capacity of the PBS tanks is greater than 1,100 gallons, regardless if Subpart 360-14 tanks exist or not at the facility.
 Certification Flag: False
 Certification Date: 05/30/2000
 Expiration: 07/28/2003
 Renew Flag: False
 Renew Date: Not reported
 Total Capacity: 3035
 FAMT: True
 Facility Screen: No Missing Data
 Owner Screen: No Missing Data
 Tank Screen: No Missing Data
 Dead Letter: False
 CBS Number: Not reported
 Town or City: NEW YORK CITY
 County Code: 62
 Town or City Code: 01
 Region: 2
 Tank ID: 466
 Tank Location: ABOVEGROUND
 Tank Status: In Service
 Install Date: Not reported
 Capacity (Gal): 3035
 Product Stored: NOS 1,2, OR 4 FUEL OIL
 Tank Type: Steel/carbon steel
 Tank Internal: 0
 Tank External: 0
 Pipe Location: Aboveground/Underground Combination
 Pipe Type: STEEL/IRON
 Pipe Internal: None
 Pipe External: 0

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

DANCE THEATRE OF HARLEM (Continued)

EDR ID Number
EPA ID Number

Database(s)

U003390345

Tank Containment: Double-Walled
Leak Detection: 0
Overfill Protection: 4
Dispenser Method: Suction
Date Tested: Not reported
Next Test Date: Not reported
Missing Data for Tank: No Missing Data
Date Closed: Not reported
Test Method: Not reported
Deleted: False
Updated: True
SPDES Number: Not reported
Lat/Long: Not reported

U82 234 BRADHURST AVENUE
SE 234 BRADHURST AVENUE
1/8-1/4 NEW YORK, NY 10039
856 ft.

AST A100129131
N/A

Site 1 of 2 in cluster U

Relative:
Lower

AST:

Actual:
22 ft.

AST:

Region: STATE
Facility Id: 2-603812
UTM X: 589493.45515
UTM Y: 4520291.65540
Expiration Date: 12/10/08
Renewal Date: / /
Total Capacity: 2000
Facility Type: Not reported
Site Type Name: Unknown
Site Type Status: Active
Mailing Company: LEMLE & WOLFF, INC.
Mailing Title: Not reported
Mailing Contact: W. EGAN
Mailing Address: 5925 BROADWAY
Mailing Address 2: Not reported
Mailing City: BRONX
Mailing State: NY
Mailing Zip Code: 10463
Mailing Phone No: (718) 884-7676
Mailing Email: Not reported
Owner Title: Not reported
Owner Name: Not reported
Owner Address: 5925 BROADWAY
Owner Address 2: Not reported
Owner State: NY
Owner Zip Code: 10463
Owner Phone: (718) 884-7676
Owner Company: CENTRAL HARLEM MUTUAL H.D.F.C.
Emergency Contact: LEMLE & WOLFF, INC.
Emergency Phone: (718) 884-7676
Operator: LEMLE & WOLFF, INC.
Operator Phone: (718) 884-7676
Owner City: BRONX
Owner Sub Type: Corporate or Commercial
Program Type: PBS

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

234 BRADHURST AVENUE (Continued)

EDR ID Number
EPA ID Number

Database(s)

A100129131

Tank Number: 001
Tank Location Name: Aboveground - in contact with soil
Tank Status: In Service
Tank Model: Not reported
Pipe Model: Not reported
Active Status: Active
Install Date: / /
Capacity Gallons: 2000
Material Name: #2 Fuel Oil
Percentage: 100.00
Tank Type Name: Steel/Carbon Steel/Iron
Tank Internal Protection: None
Tank Internal Protection 1: Painted/Asphalt Coating
Tank Internal Protection 2: Not reported
Pipe Location Name: Aboveground/Underground Combination
Pipe Type Name: Steel/Carbon Steel/Iron
Pipe External Protection 1: None
Pipe External Protection 2: Not reported
Tank Secondary Containment 1: None
Tank Secondary Containment 2: Not reported
Pipe Secondary Containment: Not reported
Tank Leak Detection 1: None
Tank Leak Detection 2: Not reported
Pipe Leak Detection 1: Exempt Suction Piping
Pipe Leak Detection 2: Not reported
Type Of Overfill Prevention 1: Vent Whistle
Type Of Overfill Prevention 2: Not reported
Dispenser Method: Suction
Spill Prevention: Not reported
Tightness Test Method: Testing Not Required
Date Tested: / /
Next Test Date: / /
Date Tank Closed: / /

V83
South
1/8-1/4
858 ft.

377 EDGECOMBE AVE
377 EDGECOMBE AVE
NEW YORK, NY 10031

AST A100292271
N/A

Site 1 of 2 in cluster V

Relative:
Lower

AST:

Actual:
87 ft.

AST:

Region: STATE
Facility Id: 2-607335
UTM X: 589378.15306
UTM Y: 4520291.76192
Expiration Date: 01/23/12
Renewal Date: / /
Total Capacity: 2000
Facility Type: Not reported
Site Type Name: Apartment Building/Office Building
Site Type Status: Active
Mailing Company: Not reported
Mailing Title: Not reported
Mailing Contact: WESTHAB INC.
Mailing Address: 85 EXECUTIVE BLVD
Mailing Address 2: Not reported

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

377 EDGECOMBE AVE (Continued)

A100292271

Mailing City: ELMSFORD
Mailing State: NY
Mailing Zip Code: 10523
Mailing Phone No: Not reported
Mailing Email: Not reported
Owner Title: DIRECTOR OF FACILITIES
Owner Name: KEVIN MCAULIFFE
Owner Address: 121 6TH AVE
Owner Address 2: Not reported
Owner State: NY
Owner Zip Code: 10013
Owner Phone: Not reported
Owner Company: NEIGHBORHOOD RESTORE H.D.F.C C/O CATCH CORP.
Emergency Contact: JULIO FUENTES
Emergency Phone: Not reported
Operator: JULIO FUENTES
Operator Phone: Not reported
Owner City: NEW YORK
Owner Sub Type: Private Resident
Program Type: PBS

Tank Number: 001
Tank Location Name: Aboveground - in contact with soil
Tank Status: In Service
Tank Model: Not reported
Pipe Model: Not reported
Active Status: Active
Install Date: 01/01/65
Capacity Gallons: 2000
Material Name: #2 Fuel Oil
Percentage: 100.00
Tank Type Name: Steel/Carbon Steel/Iron
Tank Internal Protection: None
Tank Internal Protection 1: None
Tank Internal Protection 2: Not reported
Pipe Location Name: Aboveground
Pipe Type Name: No Piping
Pipe External Protection 1: Wrapped
Pipe External Protection 2: Not reported
Tank Secondary Containment 1: Other
Tank Secondary Containment 2: Not reported
Pipe Secondary Containment: Not reported
Tank Leak Detection 1: None
Tank Leak Detection 2: Not reported
Pipe Leak Detection 1: Exempt Suction Piping
Pipe Leak Detection 2: Not reported
Type Of Overfill Prevention 1: Vent Whistle
Type Of Overfill Prevention 2: Not reported
Dispenser Method: Suction
Spill Prevention: Not reported
Tightness Test Method: Testing Not Required
Date Tested: / /
Next Test Date: / /
Date Tank Closed: / /

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

P84
NW
1/8-1/4
860 ft.

514-516 W 156TH ST
514-516 W 156TH ST
MANHATTAN, NY

Site 8 of 9 in cluster P

LTANKS
HIST LTANKS

EDR ID Number
EPA ID Number

S104275665
N/A

Relative:
Higher

Actual:
144 ft.

LTANKS:

Site ID: 296109
Spill Date: 06/26/91
Facility Addr2: Not reported
Facility ID: 9104009
Program Number: 9104009
SWIS: 3101
Region of Spill: 2
Investigator: SIGONA
Referred To: Not reported
Reported to Dept: 07/05/91
CID: 15
Spill Cause: Tank Overfill
Water Affected: Not reported
Spill Source: Non Major Facility > 1,100 gal
Spill Notifier: Citizen
Cleanup Ceased: 11/18/94
Cleanup Meets Standard: True
Last Inspection: / /
Recommended Penalty: Penalty Not Recommended
UST Involvement: False
Spill Class: Known release that creates potential for fire or hazard. DEC Response.
Willing Responsible Party. Corrective action taken.
Spill Closed Dt: 11/18/94
Remediation Phase: 0
Date Entered In Computer: 07/15/91
Spill Record Last Update: 11/18/94
Spille Namer: Not reported
Spiller Company: CAISI MGMT CO
Spiller Phone: (516) 233-5673
Spiller Extention: Not reported
Spiller Address: PO BOX 4116
Spiller City,St,Zip: FARMINGDALE, NY 11735
Spiller County: 001
Spiller Contact: Not reported
Spiller Phone: Not reported
Spiller Extention: Not reported
DEC Region: 2
Program Number: 9104009
DER Facility ID: 239624
Site ID: 296109
Operable Unit ID: 954785
Operable Unit: 01
Material ID: 423119
Material Code: 0001
Material Name: #2 Fuel Oil
Case No.: Not reported
Material FA: Petroleum
Quantity: 200.00
Units: Not reported
Recovered: 0.00
Resource Affected: Sewer
Oxygenate: False

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

514-516 W 156TH ST (Continued)

EDR ID Number
EPA ID Number

Database(s)

S104275665

Site ID: Not reported
Spill Tank Test: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate: Not reported
Gross Fail: Not reported
Modified By: Not reported
Last Modified: Not reported
Test Method: Not reported
DEC Memo: Not reported
Remarks: Start CallerRemark - 9104009 OIL IN COURTYARD AND AROUND STORAGE TANK END
CallerRemark - 9104009

HIST LTANKS:

Region of Spill: 2
Spill Number: 9104009
Investigator: SIGONA
Caller Name: Not reported
Caller Agency: Not reported
Caller Phone: Not reported
Caller Extension: Not reported
Notifier Name: Not reported
Notifier Agency: Not reported
Notifier Phone: Not reported
Notifier Extension: Not reported
Spill Date: 06/26/1991
Spill Time: 00:01
Reported to Department Date: 07/05/91
Reported to Department Time: 11:00
SWIS: 62
Spiller Contact: Not reported
Spiller Phone: Not reported
Spiller Extension: Not reported
Spiller Name: CAISI MGMT CO
Spiller Address: PO BOX 4116
Spiller City,St,Zip: FARMINGDALE, NY 11735
Facility Contact: Not reported
Facility Phone: (516) 233-5673
Facility Extension: Not reported
Spill Cause: Tank Overfill
Resource Affectd: In Sewer
Water Affected: Not reported
Spill Source: Non Major Facility > 1,100 gallons
Spill Notifier: Citizen
PBS Number: Not reported
Cleanup Ceased: 11/18/94
Cleanup Meets Standard: True
Last Inspection: / /
Recommended Penalty: Penalty Not Recommended
Spiller Cleanup Date: / /
Enforcement Date: / /
Investigation Complete: / /
UST Involvement: False
Spill Class: Known release that creates potential for fire or hazard. DEC Response.
Willing Responsible Party. Corrective action taken.
Spill Closed Dt: 11/18/94

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

514-516 W 156TH ST (Continued)

EDR ID Number
EPA ID Number

Database(s)

S104275665

Date Region Sent Summary to Central Office: / /
Corrective Action Plan Submitted: / /
Date Spill Entered In Computer Data File: 07/15/91
Time Spill Entered In Computer Data File: Not reported
Spill Record Last Update: 11/18/94
Is Updated: False
PBS Number: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate Failed Tank: Not reported
Gross Leak Rate: Not reported
Material Class Type: Petroleum
Quantity Spilled: 200
Unkonwn Quantity Spilled: False
Units: Not reported
Quantity Recovered: 0
Unkonwn Quantity Recovered: False
Material: #2 FUEL OIL
Class Type: #2 FUEL OIL
Times Material Entry In File: 24464
CAS Number: Not reported
Last Date: 19941207
DEC Remarks: / / : OWNER HIRED TYREE BROS INC TO RESPOND CLEAN UP.
Spill Cause: OIL IN COURTYARD AND AROUND STORAGE TANK

P85 J & TE REALTH CORP
NW 515-519 WEST 156 ST
1/8-1/4 MANHATTAN, NY 10032
864 ft.

AST U003387069
HIST AST N/A

Site 9 of 9 in cluster P

Relative:
Higher

AST:

Actual:
144 ft.

AST:

Region: STATE
Facility Id: 2-287830
UTM X: 589122.34311
UTM Y: 4520699.29283
Expiration Date: 06/22/10
Renewal Date: 03/06/02
Total Capacity: 5000
Facility Type: Not reported
Site Type Name: Apartment Building/Office Building
Site Type Status: Active
Mailing Company: MUS REALTY LLC
Mailing Title: Not reported
Mailing Contact: MORWIN SCHMOOKLER
Mailing Address: PO BOX 1568 FDR STATION
Mailing Address 2: Not reported
Mailing City: NEW YORK
Mailing State: NY
Mailing Zip Code: 10150-1568
Mailing Phone No: (917) 710-8403
Mailing Email: Not reported
Owner Title: MEMBER
Owner Name: JANE UPTON
Owner Address: PO BOX 1568 FDR STATION

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s)
EDR ID Number
EPA ID Number

J & TE REALTH CORP (Continued)

U003387069

Owner Address 2: Not reported
Owner State: NY
Owner Zip Code: 10150-1568
Owner Phone: (917) 710-8403
Owner Company: MUS REALTY LLC
Emergency Contact: UZI EVRON
Emergency Phone: (917) 295-1565
Operator: UZI EVRON
Operator Phone: (917) 295-1565
Owner City: NEW YORK
Owner Sub Type: Corporate or Commercial
Program Type: PBS

Tank Number: 001
Tank Location Name: Aboveground - in contact with soil
Tank Status: In Service
Tank Model: Not reported
Pipe Model: Not reported
Active Status: Active
Install Date: 01/01/25
Capacity Gallons: 5000
Material Name: #2 Fuel Oil
Percentage: 100.00
Tank Type Name: Steel/Carbon Steel/Iron
Tank Internal Protection: None
Tank Internal Protection 1: None
Tank Internal Protection 2: Not reported
Pipe Location Name: No Piping
Pipe Type Name: Steel/Carbon Steel/Iron
Pipe External Protection 1: None
Pipe External Protection 2: Not reported
Tank Secondary Containment 1: Vault (w/o access)
Tank Secondary Containment 2: Not reported
Pipe Secondary Containment: Not reported
Tank Leak Detection 1: None
Tank Leak Detection 2: Not reported
Pipe Leak Detection 1: Exempt Suction Piping
Pipe Leak Detection 2: Not reported
Type Of Overfill Prevention 1: Product Level Gauge (A/G)
Type Of Overfill Prevention 2: Not reported
Dispenser Method: Suction
Spill Prevention: Not reported
Tightness Test Method: Testing Not Required
Date Tested: / /
Next Test Date: / /
Date Tank Closed: / /

HIST AST:

PBS Number: 2-287830
SWIS Code: 6201
Operator: TONI ROBIOU
Facility Phone: (212) 862-7060
Facility Addr2: 515 WEST 156 ST
Facility Type: APARTMENT BUILDING
Emergency: TONI ROBIOU
Emergency Tel: (212) 862-7060
Old PBSNO: Not reported

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s)
EDR ID Number
EPA ID Number

J & TE REALTH CORP (Continued)

U003387069

Date Inspected: Not reported
Inspector: Not reported
Result of Inspection: Not reported
Owner Name: J & TE REALTY CORP
Owner Address: P.O. BOX 919 GPO
Owner City,St,Zip: BRONX, NY 10451
Federal ID: Not reported
Owner Tel: (212) 562-6860
Owner Type: Corporate/Commercial
Owner Subtype: Not reported
Mailing Contact: Not reported
Mailing Name: REAL ESTATE MANAGEMENT
Mailing Address: P. O. BOX 919
Mailing Address 2: Not reported
Mailing City,St,Zip: BRONX, NY 10451-0919
Mailing Telephone: (212) 562-6860
Owner Mark: First Owner
Facility Status: 1 - Active PBS facility, i.e. total capacity of the PBS tanks is greater than 1,100 gallons, regardless if Subpart 360-14 tanks exist or not at the facility.

Certification Flag: False
Certification Date: 07/15/1997
Expiration: 07/07/2002
Renew Flag: False
Renew Date: Not reported
Total Capacity: 5000
FAMT: True
Facility Screen: No Missing Data
Owner Screen: No Missing Data
Tank Screen: Minor Data Missing
Dead Letter: False
CBS Number: Not reported
Town or City: NEW YORK CITY
County Code: 62
Town or City Code: 01
Region: 2

Tank ID: 001
Tank Location: ABOVEGROUND
Tank Status: In Service
Install Date: Not reported
Capacity (Gal): 5000
Product Stored: NOS 1,2, OR 4 FUEL OIL
Tank Type: Steel/carbon steel
Tank Internal: Not reported
Tank External: Not reported
Pipe Location: Not reported
Pipe Type: STEEL/IRON
Pipe Internal: Not reported
Pipe External: Not reported
Tank Containment: Diking
Leak Detection: 0
Overfill Protection: 4
Dispenser Method: Suction
Date Tested: Not reported
Next Test Date: Not reported
Missing Data for Tank: Minor Data Missing

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

J & TE REALTH CORP (Continued)

U003387069

Date Closed: Not reported
Test Method: Not reported
Deleted: False
Updated: False
SPDES Number: Not reported
Lat/Long: Not reported

W86
North
1/8-1/4
871 ft.

ROGER MORRIS APT. CORP.
474-8 WEST 158TH STREET
NEW YORK, NY 10032

AST
HIST AST

U003388087
N/A

Relative:
Higher

Site 1 of 3 in cluster W

AST:

Actual:
148 ft.

AST:

Region: STATE
Facility Id: 2-256080
UTM X: 589331.73680
UTM Y: 4520759.54564
Expiration Date: 07/10/12
Renewal Date: 03/06/02
Total Capacity: 4500
Facility Type: Not reported
Site Type Name: Apartment Building/Office Building
Site Type Status: Active
Mailing Company: Z & R MANAGEMENT CORPORATION
Mailing Title: Not reported
Mailing Contact: ROGER MORRIS APT. CORP.
Mailing Address: 1751 SECOND AVE
Mailing Address 2: Not reported
Mailing City: NEW YORK
Mailing State: NY
Mailing Zip Code: 10128
Mailing Phone No: Not reported
Mailing Email: Not reported
Owner Title: MANAGING AGENT
Owner Name: MARK ZWEIBON
Owner Address: Z & R MANAGEMENT, 1623 3RD AVENUE
Owner Address 2: Not reported
Owner State: NY
Owner Zip Code: 10128
Owner Phone: Not reported
Owner Company: ROGER MORRIS APT. CORP
Emergency Contact: MARK ZWEIBON
Emergency Phone: Not reported
Operator: BERL BROWN
Operator Phone: Not reported
Owner City: NEW YORK
Owner Sub Type: Private Resident
Program Type: PBS

Tank Number: 001
Tank Location Name: Aboveground - in contact with soil
Tank Status: In Service
Tank Model: Not reported
Pipe Model: Not reported
Active Status: Active

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s)
EDR ID Number
EPA ID Number

ROGER MORRIS APT. CORP. (Continued)

U003388087

Install Date: 07/01/40
Capacity Gallons: 4500
Material Name: #2 Fuel Oil
Percentage: 100.00
Tank Type Name: Steel/Carbon Steel/Iron
Tank Internal Protection: None
Tank Internal Protection 1: None
Tank Internal Protection 2: Not reported
Pipe Location Name: No Piping
Pipe Type Name: Steel/Carbon Steel/Iron
Pipe External Protection 1: None
Pipe External Protection 2: Not reported
Tank Secondary Containment 1: Vault (w/o access)
Tank Secondary Containment 2: Not reported
Pipe Secondary Containment: Not reported
Tank Leak Detection 1: None
Tank Leak Detection 2: Not reported
Pipe Leak Detection 1: Exempt Suction Piping
Pipe Leak Detection 2: Not reported
Type Of Overfill Prevention 1: Product Level Gauge (A/G)
Type Of Overfill Prevention 2: Not reported
Dispenser Method: Suction
Spill Prevention: Not reported
Tightness Test Method: Testing Not Required
Date Tested: / /
Next Test Date: / /
Date Tank Closed: / /

HIST AST:

PBS Number: 2-256080
SWIS Code: 6201
Operator: BERL BROWN
Facility Phone: (212) 491-3610
Facility Addr2: 474 WEST 158 STREET
Facility Type: Not reported
Emergency: ROGER MORRIS
Emergency Tel: (212) 926-6000
Old PBSNO: Not reported
Date Inspected: Not reported
Inspector: Not reported
Result of Inspection: Not reported
Owner Name: IRWIN RIKOON
Owner Address: Z & R MANAGEMENT, 1623 3RD AVENUE
Owner City,St,Zip: NEW YORK, NY 10128
Federal ID: Not reported
Owner Tel: (212) 926-6000
Owner Type: Private Resident
Owner Subtype: Not reported
Mailing Contact: ROGER MORRIS APT. CORP.
Mailing Name: Z & R MANAGEMENT CORPORATION
Mailing Address: 1623 3RD AVENUE
Mailing Address 2: SUITE 201
Mailing City,St,Zip: NEW YORK, NY 10128
Mailing Telephone: (212) 926-6000
Owner Mark: First Owner
Facility Status: 1 - Active PBS facility, i.e. total capacity of the PBS tanks is greater than 1,100 gallons, regardless if Subpart 360-14 tanks exist

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

ROGER MORRIS APT. CORP. (Continued)

EDR ID Number
EPA ID Number

Database(s)

U003388087

or not at the facility.
Certification Flag: False
Certification Date: 09/25/1998
Expiration: 07/10/2002
Renew Flag: False
Renew Date: Not reported
Total Capacity: 4500
FAMT: True
Facility Screen: Minor Data Missing
Owner Screen: No Missing Data
Tank Screen: Minor Data Missing
Dead Letter: False
CBS Number: Not reported
Town or City: NEW YORK CITY
County Code: 62
Town or City Code: 01
Region: 2

Tank ID: 001
Tank Location: ABOVEGROUND
Tank Status: In Service
Install Date: Not reported
Capacity (Gal): 4500
Product Stored: NOS 1,2, OR 4 FUEL OIL
Tank Type: Steel/carbon steel
Tank Internal: Not reported
Tank External: Not reported
Pipe Location: Not reported
Pipe Type: STEEL/IRON
Pipe Internal: Not reported
Pipe External: Not reported
Tank Containment: Diking
Leak Detection: 0
Overfill Protection: 4
Dispenser Method: Suction
Date Tested: Not reported
Next Test Date: Not reported
Missing Data for Tank: Minor Data Missing
Date Closed: Not reported
Test Method: Not reported
Deleted: False
Updated: False
SPDES Number: Not reported
Lat/Long: Not reported

W87 473 WEST 158TH ST
North 473 W 158TH ST
1/8-1/4 NEW YORK, NY 10032
872 ft.

Site 2 of 3 in cluster W

Relative:
Higher

AST:

Actual:
148 ft.

AST:

Region: STATE
Facility Id: 2-206199
UTM X: 589369.01774
UTM Y: 4520776.32029

AST U003386231
HIST AST N/A

Map ID
 Direction
 Distance
 Distance (ft.)
 Elevation Site

MAP FINDINGS

Database(s)
 EDR ID Number
 EPA ID Number

473 WEST 158TH ST (Continued)

U003386231

Expiration Date: 06/30/12
 Renewal Date: 02/05/02
 Total Capacity: 5000
 Facility Type: Not reported
 Site Type Name: Apartment Building/Office Building
 Site Type Status: Active
 Mailing Company: 473 W 158TH REALTY CORPORATION
 Mailing Title: Not reported
 Mailing Contact: M. RAHBAR
 Mailing Address: P.O. BOX 159
 Mailing Address 2: Not reported
 Mailing City: ALBERTSON
 Mailing State: NY
 Mailing Zip Code: 11507
 Mailing Phone No: (516) 484-5932
 Mailing Email: Not reported
 Owner Title: Not reported
 Owner Name: Not reported
 Owner Address: P.O. BOX 159
 Owner Address 2: Not reported
 Owner State: NY
 Owner Zip Code: 11507
 Owner Phone: (212) 926-5611
 Owner Company: 473 W 158TH REALTY CORPORATION
 Emergency Contact: LUIS OLAN
 Emergency Phone: (212) 491-6594
 Operator: LUIS OLAN
 Operator Phone: (212) 491-6594
 Owner City: ALBERTSON
 Owner Sub Type: Corporate or Commercial
 Program Type: PBS

Tank Number: 001
 Tank Location Name: Aboveground on crib, rack, or cradle
 Tank Status: In Service
 Tank Model: Not reported
 Pipe Model: Not reported
 Active Status: Active
 Install Date: 01/01/20
 Capacity Gallons: 5000
 Material Name: #2 Fuel Oil
 Percentage: 100.00
 Tank Type Name: Steel/Carbon Steel/Iron
 Tank Internal Protection: None
 Tank Internal Protection 1: None
 Tank Internal Protection 2: Not reported
 Pipe Location Name: No Piping
 Pipe Type Name: Steel/Carbon Steel/Iron
 Pipe External Protection 1: None
 Pipe External Protection 2: Not reported
 Tank Secondary Containment 1: None
 Tank Secondary Containment 2: Not reported
 Pipe Secondary Containment: Not reported
 Tank Leak Detection 1: None
 Tank Leak Detection 2: Not reported
 Pipe Leak Detection 1: Exempt Suction Piping
 Pipe Leak Detection 2: Not reported

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s)
EDR ID Number
EPA ID Number

473 WEST 158TH ST (Continued)

U003386231

Type Of Overfill Prevention 1: Product Level Gauge (A/G)
Type Of Overfill Prevention 2: Not reported
Dispenser Method: Suction
Spill Prevention: Not reported
Tightness Test Method: Testing Not Required
Date Tested: / /
Next Test Date: / /
Date Tank Closed: / /

HIST AST:

PBS Number: 2-206199
SWIS Code: 6201
Operator: LUIS OLAN
Facility Phone: (212) 491-6594
Facility Addr2: 473 W 158TH ST
Facility Type: APARTMENT BUILDING
Emergency: LUIS OLAN
Emergency Tel: (212) 491-6594
Old PBSNO: Not reported
Date Inspected: Not reported
Inspector: Not reported
Result of Inspection: Not reported
Owner Name: 473 W 158TH REALTY CORPORATION
Owner Address: P.O. BOX 159
Owner City,St,Zip: ALBERTSON, NY 11507
Federal ID: Not reported
Owner Tel: (212) 926-5611
Owner Type: Corporate/Commercial
Owner Subtype: Not reported
Mailing Contact: M. RAHBAR
Mailing Name: 473 W 158TH REALTY CORPORATION
Mailing Address: P.O. BOX 159
Mailing Address 2: Not reported
Mailing City,St,Zip: ALBERTSON, NY 11507
Mailing Telephone: (212) 926-5611
Owner Mark: First Owner
Facility Status: 1 - Active PBS facility, i.e. total capacity of the PBS tanks is greater than 1,100 gallons, regardless if Subpart 360-14 tanks exist or not at the facility.

Certification Flag: False
Certification Date: 05/07/1998
Expiration: 06/30/2002
Renew Flag: False
Renew Date: Not reported
Total Capacity: 5000
FAMT: True
Facility Screen: No Missing Data
Owner Screen: No Missing Data
Tank Screen: Minor Data Missing
Dead Letter: False
CBS Number: Not reported
Town or City: NEW YORK CITY
County Code: 62
Town or City Code: 01
Region: 2

Tank ID: 001

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

473 WEST 158TH ST (Continued)

EDR ID Number
EPA ID Number

Database(s)

U003386231

Tank Location: ABOVEGROUND ON SADDLES LEGS, STILTS, RACK, OR CRADLE
Tank Status: In Service
Install Date: Not reported
Capacity (Gal): 5000
Product Stored: NOS 1,2, OR 4 FUEL OIL
Tank Type: Steel/carbon steel
Tank Internal: Not reported
Tank External: Not reported
Pipe Location: Not reported
Pipe Type: STEEL/IRON
Pipe Internal: Not reported
Pipe External: Not reported
Tank Containment: None
Leak Detection: 0
Overfill Protection: 4
Dispenser Method: Suction
Date Tested: Not reported
Next Test Date: Not reported
Missing Data for Tank: Minor Data Missing
Date Closed: Not reported
Test Method: Not reported
Deleted: False
Updated: False
SPDES Number: Not reported
Lat/Long: Not reported

X88
NW
1/8-1/4
877 ft.

PRANA NINE PROPERTIES, LLC
516 WEST 156TH STREET
NEW YORK, NY 10032

AST A100175575
N/A

Site 1 of 4 in cluster X

Relative:
Higher

AST:

Actual:
143 ft.

AST:

Region: STATE
Facility Id: 2-605300
UTM X: 589152.18649
UTM Y: 4520700.97953
Expiration Date: 11/02/09
Renewal Date: / /
Total Capacity: 2000
Facility Type: Not reported
Site Type Name: Apartment Building/Office Building
Site Type Status: Active
Mailing Company: PRANA NINE PROPERTIES, LLC
Mailing Title: Not reported
Mailing Contact: WILLIAM STANLEY
Mailing Address: 542 MAIN STREET
Mailing Address 2: SUITE 2
Mailing City: NEW ROCHELLE
Mailing State: NY
Mailing Zip Code: 10801
Mailing Phone No: (914) 380-8220
Mailing Email: Not reported
Owner Title: MANAGING AGENT
Owner Name: WILLIAM STANLEY
Owner Address: 542 MAIN STREET, STE 2

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

PRANA NINE PROPERTIES, LLC (Continued)

EDR ID Number
EPA ID Number

Database(s)

A100175575

Owner Address 2: Not reported
Owner State: NY
Owner Zip Code: 10801
Owner Phone: (914) 380-8220
Owner Company: PRANA NINE PROPERTIES, LLC
Emergency Contact: MARIZED SIERRA
Emergency Phone: (914) 380-8220
Operator: LUIS SANTANA
Operator Phone: (914) 973-3500
Owner City: NEW ROCHELLE
Owner Sub Type: Corporate or Commercial
Program Type: PBS

Tank Number: 001
Tank Location Name: Aboveground - in contact with soil
Tank Status: In Service
Tank Model: Not reported
Pipe Model: Not reported
Active Status: Active
Install Date: 01/01/01
Capacity Gallons: 2000
Material Name: #2 Fuel Oil
Percentage: 100.00
Tank Type Name: Steel/Carbon Steel/Iron
Tank Internal Protection: Epoxy Liner
Tank Internal Protection 1: Painted/Asphalt Coating
Tank Internal Protection 2: Not reported
Pipe Location Name: No Piping
Pipe Type Name: Steel/Carbon Steel/Iron
Pipe External Protection 1: None
Pipe External Protection 2: Not reported
Tank Secondary Containment 1: Vault (w/o access)
Tank Secondary Containment 2: Not reported
Pipe Secondary Containment: Not reported
Tank Leak Detection 1: None
Tank Leak Detection 2: Not reported
Pipe Leak Detection 1: Not reported
Pipe Leak Detection 2: Not reported
Type Of Overfill Prevention 1: None
Type Of Overfill Prevention 2: Not reported
Dispenser Method: None
Spill Prevention: Not reported
Tightness Test Method: Testing Not Required
Date Tested: / /
Next Test Date: / /
Date Tank Closed: / /

W89
North
1/8-1/4
898 ft.

961 ST. NICHOLAS AVENUE
961 SAINT NICHOLAS AVE
NEW YORK, NY 10032

AST **A100173353**
N/A

Relative:
Higher

Site 3 of 3 in cluster W

AST:

Actual:
151 ft.

AST:

Region: STATE
Facility Id: 2-267392

Map ID
 Direction
 Distance
 Distance (ft.)
 Elevation Site

MAP FINDINGS

Database(s) EDR ID Number
 EPA ID Number

961 ST. NICHOLAS AVENUE (Continued)

A100173353

UTM X: 589347.78796
 UTM Y: 4520788.49806
 Expiration Date: 10/26/10
 Renewal Date: / /
 Total Capacity: 5000
 Facility Type: Not reported
 Site Type Name: Apartment Building/Office Building
 Site Type Status: Active
 Mailing Company: BROOKE TOWER LLC
 Mailing Title: Not reported
 Mailing Contact: BOYSIE SIEW
 Mailing Address: 115 VERMILYEA AVENUE
 Mailing Address 2: 1A
 Mailing City: NEW YORK
 Mailing State: NY
 Mailing Zip Code: 10034
 Mailing Phone No: Not reported
 Mailing Email: Not reported
 Owner Title: MEMBER OF LLC
 Owner Name: BOYSIE SIEW
 Owner Address: 115 VERMILYEA AVENUE, APT. 1A
 Owner Address 2: Not reported
 Owner State: NY
 Owner Zip Code: 10034
 Owner Phone: Not reported
 Owner Company: BROOKE TOWERS LLC
 Emergency Contact: BOYSIE SIEW
 Emergency Phone: Not reported
 Operator: MANUAL DIAZ
 Operator Phone: Not reported
 Owner City: NEW YORK
 Owner Sub Type: Private Resident
 Program Type: PBS

 Tank Number: 001
 Tank Location Name: Aboveground on crib, rack, or cradle
 Tank Status: In Service
 Tank Model: Not reported
 Pipe Model: Not reported
 Active Status: Active
 Install Date: / /
 Capacity Gallons: 5000
 Material Name: #2 Fuel Oil
 Percentage: 100.00
 Tank Type Name: Steel/Carbon Steel/Iron
 Tank Internal Protection: None
 Tank Internal Protection 1: None
 Tank Internal Protection 2: Not reported
 Pipe Location Name: Aboveground/Underground Combination
 Pipe Type Name: Steel/Carbon Steel/Iron
 Pipe External Protection 1: None
 Pipe External Protection 2: Not reported
 Tank Secondary Containment 1: None
 Tank Secondary Containment 2: Not reported
 Pipe Secondary Containment: Not reported
 Tank Leak Detection 1: None
 Tank Leak Detection 2: Not reported

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

961 ST. NICHOLAS AVENUE (Continued)

EDR ID Number
EPA ID Number

Database(s)

A100173353

Pipe Leak Detection 1: Not reported
Pipe Leak Detection 2: Not reported
Type Of Overfill Prevention 1: Product Level Gauge (A/G)
Type Of Overfill Prevention 2: Not reported
Dispenser Method: None
Spill Prevention: Not reported
Tightness Test Method: Testing Not Required
Date Tested: / /
Next Test Date: / /
Date Tank Closed: / /

Y90
WNW
1/8-1/4
898 ft.

NORTH PRESBYTERIAN CHURCH
525 WEST 155TH STREET
NEW YORK, NY 10032

AST A100183571
N/A

Site 1 of 3 in cluster Y

Relative:
Higher

AST:

Actual:
146 ft.

AST:

Region: STATE
Facility Id: 2-607010
UTM X: 589065.62146
UTM Y: 4520633.94212
Expiration Date: 09/26/11
Renewal Date: / /
Total Capacity: 3000
Facility Type: Not reported
Site Type Name: Other
Site Type Status: Active
Mailing Company: NORTH PRESBYTERIAN CHURCH
Mailing Title: Not reported
Mailing Contact: ETHEL CRAWFORD
Mailing Address: 525 WEST 155TH STREET
Mailing Address 2: Not reported
Mailing City: NEW YORK,
Mailing State: NY
Mailing Zip Code: 10032
Mailing Phone No: (212) 926-5162
Mailing Email: Not reported
Owner Title: Not reported
Owner Name: Not reported
Owner Address: 525 WEST 155TH STREET
Owner Address 2: Not reported
Owner State: NY
Owner Zip Code: 10032
Owner Phone: (212) 926-5162
Owner Company: NORTH PRESBYTERIAN CHURCH
Emergency Contact: ETHEL CRAWFORD
Emergency Phone: (212) 926-5142
Operator: ETHEL CRAWFORD
Operator Phone: (212) 862-2660
Owner City: NEW YORK
Owner Sub Type: Corporate or Commercial
Program Type: PBS

Tank Number: 001
Tank Location Name: Aboveground - in contact with soil

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s) EDR ID Number
EPA ID Number

NORTH PRESBYTERIAN CHURCH (Continued)

A100183571

Tank Status: In Service
Tank Model: Not reported
Pipe Model: Not reported
Active Status: Active
Install Date: / /
Capacity Gallons: 3000
Material Name: #2 Fuel Oil
Percentage: 100.00
Tank Type Name: Steel/Carbon Steel/Iron
Tank Internal Protection: None
Tank Internal Protection 1: None
Tank Internal Protection 2: Not reported
Pipe Location Name: Aboveground/Underground Combination
Pipe Type Name: Steel/Carbon Steel/Iron
Pipe External Protection 1: None
Pipe External Protection 2: Not reported
Tank Secondary Containment 1: Vault (w/o access)
Tank Secondary Containment 2: Not reported
Pipe Secondary Containment: Not reported
Tank Leak Detection 1: None
Tank Leak Detection 2: Not reported
Pipe Leak Detection 1: Exempt Suction Piping
Pipe Leak Detection 2: Not reported
Type Of Overfill Prevention 1: Product Level Gauge (A/G)
Type Of Overfill Prevention 2: Vent Whistle
Dispenser Method: Suction
Spill Prevention: Not reported
Tightness Test Method: Testing Not Required
Date Tested: / /
Next Test Date: / /
Date Tank Closed: / /

U91 230 BRADHURST AVE.
SSE 230 BRADHURST AVE.
1/8-1/4 NYC, NY 10039
907 ft.

AST S107782749
HIST AST N/A

Site 2 of 2 in cluster U

Relative:
Lower

AST:

Actual:
21 ft.

AST:

Region: STATE
Facility Id: 2-601015
UTM X: 589488.27217
UTM Y: 4520273.93989
Expiration Date: 10/21/02
Renewal Date: 05/31/02
Total Capacity: 0
Facility Type: Not reported
Site Type Name: Apartment Building/Office Building
Site Type Status: Unregulated
Mailing Company: NYC/HPD/DAMP
Mailing Title: Not reported
Mailing Contact: ASST. COMMISSIONER/DAMP
Mailing Address: Not reported
Mailing Address 2: 100 GOLD ST #7Z5
Mailing City: NEW YORK
Mailing State: NY

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s)
EDR ID Number
EPA ID Number

230 BRADHURST AVE. (Continued)

S107782749

Mailing Zip Code: 10038
Mailing Phone No: (212) 863-7301
Mailing Email: Not reported
Owner Title: Not reported
Owner Name: Not reported
Owner Address: 100 GOLD ST #7Z5
Owner Address 2: Not reported
Owner State: NY
Owner Zip Code: 10038
Owner Phone: (212) 863-7301
Owner Company: NYC/HPD/DAMP
Emergency Contact: 213/215 MOTT ST. H.D.F.C.
Emergency Phone: (646) 613-0908
Operator: ASST. COMMISSIONER/DAMP
Operator Phone: (212) 863-7301
Owner City: NEW YORK
Owner Sub Type: Local Government
Program Type: PBS

Tank Number: 1
Tank Location Name: Aboveground - in contact with soil
Tank Status: Closed - Removed
Tank Model: Not reported
Pipe Model: Not reported
Active Status: Inactive
Install Date: / /
Capacity Gallons: 2000
Material Name: #2 Fuel Oil
Percentage: 100.00
Tank Type Name: Steel/Carbon Steel/Iron
Tank Internal Protection: None
Tank Internal Protection 1: Painted/Asphalt Coating
Tank Internal Protection 2: Not reported
Pipe Location Name: Aboveground/Underground Combination
Pipe Type Name: Steel/Carbon Steel/Iron
Pipe External Protection 1: None
Pipe External Protection 2: Not reported
Tank Secondary Containment 1: Vault (w/o access)
Tank Secondary Containment 2: Not reported
Pipe Secondary Containment: Not reported
Tank Leak Detection 1: None
Tank Leak Detection 2: Not reported
Pipe Leak Detection 1: Exempt Suction Piping
Pipe Leak Detection 2: Not reported
Type Of Overfill Prevention 1: Vent Whistle
Type Of Overfill Prevention 2: Not reported
Dispenser Method: Suction
Spill Prevention: Not reported
Tightness Test Method: Testing Not Required
Date Tested: / /
Next Test Date: / /
Date Tank Closed: 09/17/02

HIST AST:

PBS Number: 2-601015
SWIS Code: 6201
Operator: ASST. COMMISSIONER/DAMP

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

230 BRADHURST AVE. (Continued)

EDR ID Number
EPA ID Number

Database(s)

S107782749

Facility Phone: (212) 863-7301
Facility Addr2: 230 BRADHURST AVE.
Facility Type: APARTMENT BUILDING
Emergency: ASST. COMMISSIONER/DAMP
Emergency Tel: (212) 863-7301
Old PBSNO: Not reported
Date Inspected: Not reported
Inspector: Not reported
Result of Inspection: Not reported
Owner Name: NYC/HPD/DAMP
Owner Address: 100 GOLD ST #7Z5
Owner City,St,Zip: NEW YORK, NY 10038
Federal ID: Not reported
Owner Tel: (212) 863-7301
Owner Type: Local Government
Owner Subtype: Not reported
Mailing Contact: ASST. COMMISSIONER/DAMP
Mailing Name: NYC/HPD/DAMP
Mailing Address: Not reported
Mailing Address 2: 100 GOLD ST #7Z5
Mailing City,St,Zip: NEW YORK, NY 10038
Mailing Telephone: (212) 863-7301
Owner Mark: First Owner
Facility Status: 1 - Active PBS facility, i.e. total capacity of the PBS tanks is greater than 1,100 gallons, regardless if Subpart 360-14 tanks exist or not at the facility.

Certification Flag: False
Certification Date: 03/09/2001
Expiration: 10/21/2002
Renew Flag: False
Renew Date: Not reported
Total Capacity: 1500
FAMT: True
Facility Screen: No Missing Data
Owner Screen: No Missing Data
Tank Screen: No Missing Data
Dead Letter: False
CBS Number: Not reported
Town or City: NEW YORK CITY
County Code: 62
Town or City Code: 01
Region: 2

Tank ID: 1
Tank Location: ABOVEGROUND
Tank Status: In Service
Install Date: Not reported
Capacity (Gal): 1500
Product Stored: NOS 1,2, OR 4 FUEL OIL
Tank Type: Steel/carbon steel
Tank Internal: 0
Tank External: 1
Pipe Location: Aboveground/Underground Combination
Pipe Type: STEEL/IRON
Pipe Internal: None
Pipe External: 0
Tank Containment: Diking

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

230 BRADHURST AVE. (Continued)

EDR ID Number
EPA ID Number

Database(s)

S107782749

Leak Detection: 0
Overfill Protection: 6
Dispenser Method: Suction
Date Tested: Not reported
Next Test Date: Not reported
Missing Data for Tank: No Missing Data
Date Closed: Not reported
Test Method: Not reported
Deleted: False
Updated: True
SPDES Number: Not reported
Lat/Long: Not reported

S92
West
1/8-1/4
914 ft.

ST.CATHERINE OF GENOA CHURCH
506 WEST 153RD STREET
NEW YORK, NY 10031

UST U004078701
N/A

Site 2 of 4 in cluster S

Relative:
Higher

UST:

Actual:
142 ft.

UST:

Facility Id: 2-510556
Expiration Date: 02/05/06
Renewal Date: / /
Total Capacity: 3000
Facility Type: Not reported
Mailing Company: ST.CATHERINE OF GENOA
Mailing Title: Not reported
Mailing Contact: PASTOR DAVID NOLAN
Mailing Address: 502 WEST 153RD STREET
Mailing Address 2: Not reported
Mailing City: NEW YORK
Mailing State: NY
Mailing Zip Code: 10031
Mailing Phone No: (212) 862-6130
Mailing Email: Not reported
Owner Title: Not reported
Owner Name: Not reported
Owner Address: 506 WEST 153RD STREET
Owner Address 2: Not reported
Owner State: NY
Owner Zip Code: 10031
Owner Phone: (212) 862-6130
Owner Company: ST.CATHERINE_OF GENOA CHURCH
Emergency Contact: PASTOR NOLAN
Emergency Phone: (212) 862-6130
Operator: PASTOR NOLAN
Operator Phone: (212) 862-6130
Owner City: NEW YORK
Owner Sub Type: Not reported
UTM X: 589057.42048
UTM Y: 4520468.24175
Site Type Name: Other
Site Type Status: Active
Comments: Not reported

Program Type: PBS

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s)
EDR ID Number
EPA ID Number

ST.CATHERINE OF GENOA CHURCH (Continued)

U004078701

Tank Number: 001
Tank Location Name: Underground
Tank Status: Closed - In Place
Tank Model: Not reported
Pipe Model: Not reported
Active Status: Inactive
Install Date: / /
Capacity Gallons: 5000
Material Name: #2 Fuel Oil
Percentage: 100.00
Tank Type Name: Steel/Carbon Steel/Iron
Tank Internal Protection: None
Tank Internal Protection 1: None
Tank Internal Protection 2: Not reported
Pipe Location Name: Underground/On-ground
Pipe Type Name: Steel/Carbon Steel/Iron
Pipe External Protection 1: None
Pipe External Protection 2: Not reported
Tank Secondary Containment 1: None
Tank Secondary Containment 2: Not reported
Pipe Secondary Containment: Not reported
Tank Leak Detection 1: None
Tank Leak Detection 2: Not reported
Pipe Leak Detection 1: Not reported
Pipe Leak Detection 2: Not reported
Type Of Overfill Prevention 1: Vent Whistle
Type Of Overfill Prevention 2: Not reported
Dispenser Method: Suction
Spill Prevention: Not reported
Tightness Test Method: Testing Not Required
Date Tested: / /
Next Test Date: / /
Date Tank Closed: 05/01/01

Tank Number: 002
Tank Location Name: Underground
Tank Status: Closed - In Place
Tank Model: Not reported
Pipe Model: Not reported
Active Status: Inactive
Install Date: / /
Capacity Gallons: 2000
Material Name: #2 Fuel Oil
Percentage: 100.00
Tank Type Name: Steel/Carbon Steel/Iron
Tank Internal Protection: None
Tank Internal Protection 1: None
Tank Internal Protection 2: Not reported
Pipe Location Name: Underground/On-ground
Pipe Type Name: Steel/Carbon Steel/Iron
Pipe External Protection 1: None
Pipe External Protection 2: Not reported
Tank Secondary Containment 1: None
Tank Secondary Containment 2: Not reported
Pipe Secondary Containment: Not reported
Tank Leak Detection 1: None

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

ST.CATHERINE OF GENOA CHURCH (Continued)

EDR ID Number
EPA ID Number

Database(s)

U004078701

Tank Leak Detection 2: Not reported
Pipe Leak Detection 1: Not reported
Pipe Leak Detection 2: Not reported
Type Of Overfill Prevention 1: Vent Whistle
Type Of Overfill Prevention 2: Not reported
Dispenser Method: Suction
Spill Prevention: Not reported
Tightness Test Method: Testing Not Required
Date Tested: / /
Next Test Date: / /
Date Tank Closed: 05/01/01

S93
West
1/8-1/4
916 ft.

ST.CATHERINE OF GENOA CHURCH
506 WEST 153RD STREET
NEW YORK, NY 10031

AST
HIST AST
HIST UST

U001841187
N/A

Site 3 of 4 in cluster S

Relative:
Higher

AST:

Actual:
142 ft.

AST:

Region: STATE
Facility Id: 2-510556
UTM X: 589057.42048
UTM Y: 4520468.24175
Expiration Date: 02/05/06
Renewal Date: / /
Total Capacity: 3000
Facility Type: Not reported
Site Type Name: Other
Site Type Status: Active
Mailing Company: ST.CATHERINE OF GENOA
Mailing Title: Not reported
Mailing Contact: PASTOR DAVID NOLAN
Mailing Address: 502 WEST 153RD STREET
Mailing Address 2: Not reported
Mailing City: NEW YORK
Mailing State: NY
Mailing Zip Code: 10031
Mailing Phone No: (212) 862-6130
Mailing Email: Not reported
Owner Title: Not reported
Owner Name: Not reported
Owner Address: 506 WEST 153RD STREET
Owner Address 2: Not reported
Owner State: NY
Owner Zip Code: 10031
Owner Phone: (212) 862-6130
Owner Company: ST.CATHERINE_OF GENOA CHURCH
Emergency Contact: PASTOR NOLAN
Emergency Phone: (212) 862-6130
Operator: PASTOR NOLAN
Operator Phone: (212) 862-6130
Owner City: NEW YORK
Owner Sub Type: Not reported
Program Type: PBS

Tank Number: 003

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

ST.CATHERINE OF GENOA CHURCH (Continued)

EDR ID Number
EPA ID Number

Database(s)

U001841187

Tank Location Name: Aboveground - in contact with soil
Tank Status: In Service
Tank Model: Not reported
Pipe Model: Not reported
Active Status: Active
Install Date: 05/01/01
Capacity Gallons: 3000
Material Name: #2 Fuel Oil
Percentage: 100.00
Tank Type Name: Steel/Carbon Steel/Iron
Tank Internal Protection: None
Tank Internal Protection 1: None
Tank Internal Protection 2: Not reported
Pipe Location Name: Aboveground
Pipe Type Name: Copper
Pipe External Protection 1: Painted/Asphalt Coating
Pipe External Protection 2: Wrapped
Tank Secondary Containment 1: Other
Tank Secondary Containment 2: Not reported
Pipe Secondary Containment: Not reported
Tank Leak Detection 1: Impervious Barrier/Concrete Pad (A/G)
Tank Leak Detection 2: Not reported
Pipe Leak Detection 1: Exempt Suction Piping
Pipe Leak Detection 2: Not reported
Type Of Overfill Prevention 1: Product Level Gauge (A/G)
Type Of Overfill Prevention 2: Vent Whistle
Dispenser Method: Suction
Spill Prevention: Not reported
Tightness Test Method: Testing Not Required
Date Tested: / /
Next Test Date: / /
Date Tank Closed: / /

HIST AST:

PBS Number: 2-510556
SWIS Code: 6201
Operator: PASTOR NOLAN
Facility Phone: (212) 862-6130
Facility Addr2: 506 WEST 153RD STREET
Facility Type: OTHER
Emergency: PASTOR NOLAN
Emergency Tel: (212) 862-6130
Old PBSNO: Not reported
Date Inspected: Not reported
Inspector: Not reported
Result of Inspection: Not reported
Owner Name: ST.CATHERINE_OF GENOA CHURCH
Owner Address: 506 WEST 153RD STREET
Owner City,St,Zip: NEW YORK, NY 10031
Federal ID: Not reported
Owner Tel: (212) 862-6130
Owner Type: Not reported
Owner Subtype: Not reported
Mailing Contact: PASTOR DAVID NOLAN
Mailing Name: ST.CATHERINE OF GENOA
Mailing Address: 502 WEST 153RD STREET
Mailing Address 2: Not reported

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

ST.CATHERINE OF GENOA CHURCH (Continued)

EDR ID Number
EPA ID Number

Database(s)

U001841187

Mailing City,St,Zip: NEW YORK, NY 10031
Mailing Telephone: (212) 862-6130
Owner Mark: First Owner
Facility Status: 1 - Active PBS facility, i.e. total capacity of the PBS tanks is greater than 1,100 gallons, regardless if Subpart 360-14 tanks exist or not at the facility.

Certification Flag: False
Certification Date: 08/24/2001
Expiration: 02/05/2006
Renew Flag: False
Renew Date: Not reported
Total Capacity: 3000
FAMT: True
Facility Screen: No Missing Data
Owner Screen: Minor Data Missing
Tank Screen: No Missing Data
Dead Letter: False
CBS Number: Not reported
Town or City: NEW YORK CITY
County Code: 62
Town or City Code: 01
Region: 2

Tank ID: 003
Tank Location: ABOVEGROUND
Tank Status: In Service
Install Date: 20010501
Capacity (Gal): 3000
Product Stored: NOS 1,2, OR 4 FUEL OIL
Tank Type: Steel/carbon steel
Tank Internal: 0
Tank External: 0
Pipe Location: Aboveground
Pipe Type: FIBERGLASS COATED STEEL
Pipe Internal: None
Pipe External: 61
Tank Containment: Double-Walled
Leak Detection: 5
Overfill Protection: 46
Dispenser Method: Suction
Date Tested: Not reported
Next Test Date: Not reported
Missing Data for Tank: No Missing Data
Date Closed: Not reported
Test Method: Not reported
Deleted: False
Updated: True
SPDES Number: Not reported
Lat/Long: Not reported

HIST UST:

PBS Number: 2-510556
SPDES Number: Not reported
Emergency Contact: PASTOR NOLAN
Emergency Telephone: (212) 862-6130
Operator: PASTOR NOLAN
Operator Telephone: (212) 862-6130

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s)

EDR ID Number
EPA ID Number

ST.CATHERINE OF GENOA CHURCH (Continued)

U001841187

Owner Name: ST.CATHERINE_OF GENOA CHURCH
Owner Address: 506 WEST 153RD STREET
Owner City,St,Zip: NEW YORK, NY 10031
Owner Telephone: (212) 862-6130
Owner Type: Not reported
Owner Subtype: Not reported
Mailing Name: ST.CATHERINE OF GENOA
Mailing Address: 502 WEST 153RD STREET
Mailing Address 2: Not reported
Mailing City,St,Zip: NEW YORK, NY 10031
Mailing Contact: PASTOR DAVID NOLAN
Mailing Telephone: (212) 862-6130
Owner Mark: First Owner
Facility Status: 1 - Active PBS facility, i.e. total capacity of the PBS tanks is greater than 1,100 gallons, regardless if Subpart 360-14 tanks exist or not at the facility.

Facility Addr2: 506 WEST 153RD STREET
SWIS ID: 6201
Old PBS Number: Not reported
Facility Type: OTHER
Inspected Date: Not reported
Inspector: Not reported
Inspection Result: Not reported
Federal ID: Not reported
Certification Flag: False
Certification Date: 08/24/2001
Expiration Date: 02/05/2006
Renew Flag: False
Renewal Date: Not reported
Total Capacity: 3000
FAMT: True
Facility Screen: No Missing Data
Owner Screen: Minor Data Missing
Tank Screen: No Missing Data
Dead Letter: False
CBS Number: Not reported
Town or City: NEW YORK CITY
County Code: 62
Town or City: 01
Region: 2

Tank Id: 001
Tank Location: UNDERGROUND
Tank Status: Closed-In Place
Install Date: Not reported
Capacity (gals): 5000
Product Stored: NOS 1,2, OR 4 FUEL OIL
Tank Type: Steel/carbon steel
Tank Internal: None
Tank External: None
Pipe Location: Underground
Pipe Type: STEEL/IRON
Pipe Internal: None
Pipe External: None
Second Containment: None
Leak Detection: None
Overfill Prot: Vent Whistle

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

ST.CATHERINE OF GENOA CHURCH (Continued)

EDR ID Number
EPA ID Number

Database(s)

U001841187

Dispenser: Suction
Date Tested: Not reported
Next Test Date: Not reported
Missing Data for Tank: No Missing Data
Date Closed: 05/01/2001
Test Method: Not reported
Deleted: False
Updated: True
Lat/long: Not reported

Tank Id: 002
Tank Location: UNDERGROUND
Tank Status: Closed-In Place
Install Date: Not reported
Capacity (gals): 2000
Product Stored: NOS 1,2, OR 4 FUEL OIL
Tank Type: Steel/carbon steel
Tank Internal: None
Tank External: None
Pipe Location: Underground
Pipe Type: STEEL/IRON
Pipe Internal: None
Pipe External: None
Second Containment: None
Leak Detection: None
Overfill Prot: Vent Whistle
Dispenser: Suction
Date Tested: Not reported
Next Test Date: Not reported
Missing Data for Tank: No Missing Data
Date Closed: 05/01/2001
Test Method: Not reported
Deleted: False
Updated: True
Lat/long: Not reported

S94
West
1/8-1/4
916 ft.

ST CATHERINE OF GENOA
506 WEST 153 RD ST
MANHATTAN, NY

LTANKS S105054664
HIST LTANKS N/A

Site 4 of 4 in cluster S

Relative:
Higher

LTANKS:
Site ID: 276466
Spill Date: 04/18/01
Facility Addr2: Not reported
Facility ID: 0100674
Program Number: 0100674
SWIS: 3101
Region of Spill: 2
Investigator: VRNATTAN
Referred To: Not reported
Reported to Dept: 04/18/01
CID: 15
Spill Cause: Tank Failure
Water Affected: Not reported
Spill Source: Institutional, Educational, Gov., Other

Actual:
142 ft.

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

ST CATHERINE OF GENOA (Continued)

EDR ID Number
EPA ID Number

Database(s)

S105054664

Spill Notifier: Other
Cleanup Ceased: / /
Cleanup Meets Standard: False
Last Inspection: / /
Recommended Penalty: Penalty Not Recommended
UST Involvement: False
Spill Class: Known release with minimal potential for fire or hazard. DEC Response.
Willing Responsible Party. Corrective action taken.
Spill Closed Dt: 01/19/06
Remediation Phase: 0
Date Entered In Computer: 04/18/01
Spill Record Last Update: 01/19/06
Spille Namer: PASTOR DAVID NOLAN
Spiller Company: ST CATHERINE OF GENOA
Spiller Phone: (212) 862-6130
Spiller Extention: Not reported
Spiller Address: 506 WEST 153RD ST
Spiller City,St,Zip: MANHATTAN, NY
Spiller County: 001
Spiller Contact: PASTOR DAVID NOLAN
Spiller Phone: (212) 862-6130
Spiller Extention: Not reported
DEC Region: 2
Program Number: 0100674
DER Facility ID: 224769
Site ID: 276466
Operable Unit ID: 837582
Operable Unit: 01
Material ID: 536386
Material Code: 0001
Material Name: #2 Fuel Oil
Case No.: Not reported
Material FA: Petroleum
Quantity: 0.00
Units: Gallons
Recovered: 0.00
Resource Affected: Soil
Oxygenate: False
Site ID: Not reported
Spill Tank Test: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate: Not reported
Gross Fail: Not reported
Modified By: Not reported
Last Modified: Not reported
Test Method: Not reported
DEC Memo: Start DECRemark - 0100674 Vivek Nattanmai. December 29, 2005 Reviewed the spill report, identified the property owner and sent a letter dated 12/30/05 to the property owner requesting for information. Vivek Nattanmai. January 19, 2006 Based on the information provided by Pastor Kenneth J. Smith and based on the information found on PBS (#2-510556), no action is required. The PBS report states that two underground tanks (5,000 and 2,000 gal.) tanks closed in-place on May 01, 2001 and a new above ground tank (3,000 gal.) was installed on May 01, 2001. SPILL REPORT CLOSED ON JANUARY 19, 2006. END DECRemark - 0100674

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s)
EDR ID Number
EPA ID Number

ST CATHERINE OF GENOA (Continued)

S105054664

Remarks: Start CallerRemark - 0100674 TANK WAS CLEANED YESTERDAY AND TODAY UPON INSPECTION OIL HAD SEEPED OUT FROM TANK. END CallerRemark - 0100674

HIST LTANKS:

Region of Spill: 2
Spill Number: 0100674
Investigator: SIGONA
Caller Name: Not reported
Caller Agency: Not reported
Caller Phone: Not reported
Caller Extension: Not reported
Notifier Name: Not reported
Notifier Agency: Not reported
Notifier Phone: Not reported
Notifier Extension: Not reported
Spill Date: 04/18/2001
Spill Time: 09:00
Reported to Department Date: 04/18/01
Reported to Department Time: 10:15
SWIS: 62
Spiller Contact: PASTOR DAVID NOLAN
Spiller Phone: (212) 862-6130
Spiller Extension: Not reported
Spiller Name: ST CATHERINE OF GENOA
Spiller Address: 506 WEST 153 RD ST
Spiller City,St,Zip: MANHATTAN, NY
Facility Contact: PASTOR DAVID NOLAN
Facility Phone: (212) 862-6130
Facility Extension: Not reported
Spill Cause: Tank Failure
Resource Affectd: On Land
Water Affected: Not reported
Spill Source: Other Non Commercial/Industrial
Spill Notifier: Other
PBS Number: Not reported
Cleanup Ceased: / /
Cleanup Meets Standard: False
Last Inspection: / /
Recommended Penalty: Penalty Not Recommended
Spiller Cleanup Date: / /
Enforcement Date: / /
Investigation Complete: / /
UST Involvement: False
Spill Class: Known release with minimal potential for fire or hazard. DEC Response.
Willing Responsible Party. Corrective action taken.
Spill Closed Dt: / /
Date Region Sent Summary to Central Office: / /
Corrective Action Plan Submitted: / /
Date Spill Entered In Computer Data File: 04/18/01
Time Spill Entered In Computer Data File: Not reported
Spill Record Last Update: 04/19/01
Is Updated: False
PBS Number: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate Failed Tank: Not reported

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

ST CATHERINE OF GENOA (Continued)

EDR ID Number
EPA ID Number

Database(s)

S105054664

Gross Leak Rate: Not reported
Material Class Type: Petroleum
Quantity Spilled: 0
Unkonwn Quantity Spilled: True
Units: Gallons
Quantity Recovered: 0
Unkonwn Quantity Recovered: False
Material: #2 FUEL OIL
Class Type: #2 FUEL OIL
Times Material Entry In File: 24464
CAS Number: Not reported
Last Date: 19941207
DEC Remarks: Not reported
Spill Cause: TANK WAS CLEANED YESTERDAY AND TODAY UPON INSPECTION OIL HAD SEEPED OUT FROM TANK.

X95 523 WEST 156TH STREET
NW 523 WEST 156 STREET
1/8-1/4 NEW YORK, NY 10032
928 ft.

AST A100292499
N/A

Site 2 of 4 in cluster X

Relative:
Higher

AST:

Actual:
141 ft.

AST:

Region: STATE
Facility Id: 2-609976
UTM X: 589109.84862
UTM Y: 4520707.64104
Expiration Date: 08/23/11
Renewal Date: / /
Total Capacity: 2000
Facility Type: Not reported
Site Type Name: Apartment Building/Office Building
Site Type Status: Active
Mailing Company: C/O COLTOWN PROPERTIES LLC
Mailing Title: Not reported
Mailing Contact: HARLEM 521-156 ASSOCIATES, LLC
Mailing Address: 95 DELANCEY STREET
Mailing Address 2: Not reported
Mailing City: NEW YORK
Mailing State: NY
Mailing Zip Code: 10002
Mailing Phone No: (212) 671-1060
Mailing Email: CUSTOMERSERVICE@COLTOWN.COM
Owner Title: PRINCIPAL
Owner Name: ISREAL WEINBERSER
Owner Address: 95 DELANCEY STREET
Owner Address 2: Not reported
Owner State: NY
Owner Zip Code: 10002
Owner Phone: (212) 671-1060
Owner Company: HARLEM 521-156 ASSOCIATES, LLC
Emergency Contact: COLTOWN PROPERTIES LLC
Emergency Phone: (212) 671-1060
Operator: BROOKLYN HEATING
Operator Phone: (718) 444-7771
Owner City: NEW YORK

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

523 WEST 156TH STREET (Continued)

EDR ID Number
EPA ID Number

Database(s)

A100292499

Owner Sub Type: Corporate or Commercial
Program Type: PBS

Tank Number: 01
Tank Location Name: Aboveground on crib, rack, or cradle
Tank Status: In Service
Tank Model: Not reported
Pipe Model: Not reported
Active Status: Active
Install Date: 04/20/00
Capacity Gallons: 2000
Material Name: #2 Fuel Oil
Percentage: 100.00
Tank Type Name: Steel Tank Encased in Concrete
Tank Internal Protection: Not reported
Tank Internal Protection 1: Painted/Asphalt Coating
Tank Internal Protection 2: Not reported
Pipe Location Name: Aboveground
Pipe Type Name: Steel/Carbon Steel/Iron
Pipe External Protection 1: None
Pipe External Protection 2: Not reported
Tank Secondary Containment 1: None
Tank Secondary Containment 2: Not reported
Pipe Secondary Containment: None
Tank Leak Detection 1: None
Tank Leak Detection 2: Not reported
Pipe Leak Detection 1: Exempt Suction Piping
Pipe Leak Detection 2: Not reported
Type Of Overfill Prevention 1: Vent Whistle
Type Of Overfill Prevention 2: Not reported
Dispenser Method: Suction
Spill Prevention: None
Tightness Test Method: Testing Not Required
Date Tested: / /
Next Test Date: / /
Date Tank Closed: / /

R96 484 CONVENT AVENUE
SW 484 CONVENT AVENUE
1/8-1/4 NEW YORK, NY 10031
931 ft.

AST A100182999
N/A

Site 3 of 3 in cluster R

Relative:
Higher

AST:

Actual:
113 ft.

AST:

Region: STATE
Facility Id: 2-601021
UTM X: 589182.77736
UTM Y: 4520276.46267
Expiration Date: 10/21/07
Renewal Date: 05/31/02
Total Capacity: 0
Facility Type: Not reported
Site Type Name: Apartment Building/Office Building
Site Type Status: Unregulated
Mailing Company: NYC/HPD/DAMP
Mailing Title: Not reported

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s)
EDR ID Number
EPA ID Number

484 CONVENT AVENUE (Continued)

A100182999

Mailing Contact: ASST. COMMISSIONER/DAMP
Mailing Address: 100 GOLD STREET
Mailing Address 2: #7Z5
Mailing City: NEW YORK
Mailing State: NY
Mailing Zip Code: 10038
Mailing Phone No: (212) 863-7301
Mailing Email: Not reported
Owner Title: ASST COMMISSIONER DAMP
Owner Name: WILLA H. PADGETT
Owner Address: 100 GOLD ST., #7Z5
Owner Address 2: Not reported
Owner State: NY
Owner Zip Code: 10038
Owner Phone: (212) 863-7301
Owner Company: NYC/HPD/DAMP
Emergency Contact: 213/215 MOTT ST. H.D.F.C.
Emergency Phone: (646) 613-0908
Operator: ASST. COMMISSIONER/DAMP
Operator Phone: (212) 863-7301
Owner City: NEW YORK
Owner Sub Type: Local Government
Program Type: PBS

Tank Number: 1
Tank Location Name: Aboveground - in contact with soil
Tank Status: Closed - Removed
Tank Model: Not reported
Pipe Model: Not reported
Active Status: Inactive
Install Date: / /
Capacity Gallons: 2500
Material Name: Gasoline
Percentage: 100.00
Tank Type Name: Steel/Carbon Steel/Iron
Tank Internal Protection: None
Tank Internal Protection 1: Painted/Asphalt Coating
Tank Internal Protection 2: Not reported
Pipe Location Name: Aboveground/Underground Combination
Pipe Type Name: Steel/Carbon Steel/Iron
Pipe External Protection 1: None
Pipe External Protection 2: Not reported
Tank Secondary Containment 1: None
Tank Secondary Containment 2: Not reported
Pipe Secondary Containment: Not reported
Tank Leak Detection 1: None
Tank Leak Detection 2: Not reported
Pipe Leak Detection 1: Not reported
Pipe Leak Detection 2: Not reported
Type Of Overfill Prevention 1: Vent Whistle
Type Of Overfill Prevention 2: Not reported
Dispenser Method: Suction
Spill Prevention: Not reported
Tightness Test Method: Testing Not Required
Date Tested: / /
Next Test Date: / /
Date Tank Closed: 12/26/06

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

X97
NW
1/8-1/4
951 ft.

525 WEST 156TH STREET
525 W 156TH ST
NEW YORK, NY 10032

AST
HIST AST **U003388289**
 N/A

Relative:
Higher

Site 3 of 4 in cluster X

AST:

Actual:
141 ft.

AST:

Region: STATE
Facility Id: 2-269174
UTM X: 589138.18412
UTM Y: 4520722.23803
Expiration Date: 05/28/08
Renewal Date: 05/06/02
Total Capacity: 3000
Facility Type: Not reported
Site Type Name: Apartment Building/Office Building
Site Type Status: Active
Mailing Company: PRANA SEVEN PROPERTIES, LP
Mailing Title: Not reported
Mailing Contact: CELESTE VASQUEZ-RUGEL
Mailing Address: % JMG MANAGEMENT PLUS, INC.
Mailing Address 2: 542 MAIN STREET, SUITE 2
Mailing City: NEW ROCHELLE
Mailing State: NY
Mailing Zip Code: 10801
Mailing Phone No: (914) 380-8220
Mailing Email: Not reported
Owner Title: Not reported
Owner Name: Not reported
Owner Address: P.O. BOX 949
Owner Address 2: Not reported
Owner State: NY
Owner Zip Code: 10704
Owner Phone: (914) 667-4500
Owner Company: PRANA SEVEN PROPERTIES, LP
Emergency Contact: MARIZED SIERRA
Emergency Phone: (914) 667-4500
Operator: JUAN GARCIA
Operator Phone: (917) 632-7703
Owner City: MT. VERNON
Owner Sub Type: Not reported
Program Type: PBS

Tank Number: 001
Tank Location Name: Aboveground - in contact with soil
Tank Status: In Service
Tank Model: Not reported
Pipe Model: Not reported
Active Status: Active
Install Date: / /
Capacity Gallons: 3000
Material Name: #2 Fuel Oil
Percentage: 100.00
Tank Type Name: Steel/Carbon Steel/Iron
Tank Internal Protection: None
Tank Internal Protection 1: None
Tank Internal Protection 2: Not reported
Pipe Location Name: No Piping

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s)
EDR ID Number
EPA ID Number

525 WEST 156TH STREET (Continued)

U003388289

Pipe Type Name: Steel/Carbon Steel/Iron
Pipe External Protection 1: None
Pipe External Protection 2: Not reported
Tank Secondary Containment 1: None
Tank Secondary Containment 2: Not reported
Pipe Secondary Containment: Not reported
Tank Leak Detection 1: None
Tank Leak Detection 2: Not reported
Pipe Leak Detection 1: Exempt Suction Piping
Pipe Leak Detection 2: Not reported
Type Of Overfill Prevention 1: Product Level Gauge (A/G)
Type Of Overfill Prevention 2: Not reported
Dispenser Method: Suction
Spill Prevention: Not reported
Tightness Test Method: Testing Not Required
Date Tested: / /
Next Test Date: / /
Date Tank Closed: / /

HIST AST:

PBS Number: 2-269174
SWIS Code: 6201
Operator: EFULVIO DIAZ
Facility Phone: (212) 977-8828
Facility Addr2: 525 W 156TH ST
Facility Type: APARTMENT BUILDING
Emergency: JOEL ARAGONA
Emergency Tel: (212) 977-8828
Old PBSNO: Not reported
Date Inspected: Not reported
Inspector: Not reported
Result of Inspection: Not reported
Owner Name: WADSWORTH ASSOCIATES VII
Owner Address: C/O ARAGONA MGT 1780 BROADWAY
Owner City,St,Zip: NEW YORK, NY 10019
Federal ID: Not reported
Owner Tel: (212) 977-8828
Owner Type: Corporate/Commercial
Owner Subtype: Not reported
Mailing Contact: JOEL ARAGONA
Mailing Name: ARAGONA MGT
Mailing Address: 1780 BROADWAY
Mailing Address 2: Not reported
Mailing City,St,Zip: NEW YORK, NY 10019
Mailing Telephone: (212) 977-8828
Owner Mark: First Owner
Facility Status: 1 - Active PBS facility, i.e. total capacity of the PBS tanks is greater than 1,100 gallons, regardless if Subpart 360-14 tanks exist or not at the facility.

Certification Flag: False
Certification Date: 09/11/1998
Expiration: 09/19/2002
Renew Flag: False
Renew Date: Not reported
Total Capacity: 3000
FAMT: True
Facility Screen: No Missing Data

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

525 WEST 156TH STREET (Continued)

EDR ID Number
EPA ID Number

Database(s)

U003388289

Owner Screen: No Missing Data
Tank Screen: Minor Data Missing
Dead Letter: False
CBS Number: Not reported
Town or City: NEW YORK CITY
County Code: 62
Town or City Code: 01
Region: 2

Tank ID: 001
Tank Location: ABOVEGROUND
Tank Status: In Service
Install Date: Not reported
Capacity (Gal): 3000
Product Stored: NOS 1,2, OR 4 FUEL OIL
Tank Type: Steel/carbon steel
Tank Internal: Not reported
Tank External: Not reported
Pipe Location: Not reported
Pipe Type: STEEL/IRON
Pipe Internal: Not reported
Pipe External: Not reported
Tank Containment: Not reported
Leak Detection: 0
Overfill Protection: 4
Dispenser Method: Suction
Date Tested: Not reported
Next Test Date: Not reported
Missing Data for Tank: Minor Data Missing
Date Closed: Not reported
Test Method: Not reported
Deleted: False
Updated: False
SPDES Number: Not reported
Lat/Long: Not reported

V98
South
1/8-1/4
953 ft.

371 EDGECOMBE AVENUE, HDFC
371 EDGECOMBE AVENUE
NEW YORK, NY 10030

AST
HIST AST
U003395031
N/A

Site 2 of 2 in cluster V

Relative:
Lower

AST:

Actual:
86 ft.

AST:

Region: STATE
Facility Id: 2-471224
UTM X: 589442.25232
UTM Y: 4520376.19018
Expiration Date: 02/08/09
Renewal Date: / /
Total Capacity: 4000
Facility Type: Not reported
Site Type Name: Apartment Building/Office Building
Site Type Status: Active
Mailing Company: 371 EDGECOMBE AVENUE, HDFC
Mailing Title: Not reported
Mailing Contact: JUNE SARTOR, PRESIDENT

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s)
EDR ID Number
EPA ID Number

371 EDGECOMBE AVENUE, HDFC (Continued)

U003395031

Mailing Address: C/O 371 EDGECOMBE AVENUE
Mailing Address 2: 371 EDGECOMBE AVENUE, #5D
Mailing City: NEW YORK
Mailing State: NY
Mailing Zip Code: 10031
Mailing Phone No: (212) 491-9039
Mailing Email: Not reported
Owner Title: PRESIDENT
Owner Name: JUNE SARTOR
Owner Address: 371 EDGECOMBE AVENUE
Owner Address 2: Not reported
Owner State: NY
Owner Zip Code: 10031
Owner Phone: (212) 491-9039
Owner Company: 371 EDGECOMBE AVENUE, HDFC
Emergency Contact: RHONDA MCLEAN
Emergency Phone: (212) 491-7285
Operator: JUNE SARTOR, PRESIDENT
Operator Phone: (212) 491-9039
Owner City: NEW YORK
Owner Sub Type: Corporate or Commercial
Program Type: PBS

Tank Number: 001
Tank Location Name: Aboveground - in contact with impervious barrier
Tank Status: In Service
Tank Model: Not reported
Pipe Model: Not reported
Active Status: Active
Install Date: / /
Capacity Gallons: 4000
Material Name: #2 Fuel Oil
Percentage: 100.00
Tank Type Name: Steel/Carbon Steel/Iron
Tank Internal Protection: None
Tank Internal Protection 1: Painted/Asphalt Coating
Tank Internal Protection 2: Not reported
Pipe Location Name: Aboveground/Underground Combination
Pipe Type Name: Steel/Carbon Steel/Iron
Pipe External Protection 1: None
Pipe External Protection 2: Not reported
Tank Secondary Containment 1: Vault (w/access)
Tank Secondary Containment 2: Not reported
Pipe Secondary Containment: None
Tank Leak Detection 1: Impervious Barrier/Concrete Pad (A/G)
Tank Leak Detection 2: Not reported
Pipe Leak Detection 1: None
Pipe Leak Detection 2: Not reported
Type Of Overfill Prevention 1: Vent Whistle
Type Of Overfill Prevention 2: Not reported
Dispenser Method: Suction
Spill Prevention: None
Tightness Test Method: Testing Not Required
Date Tested: / /
Next Test Date: / /
Date Tank Closed: / /

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

371 EDGECOMBE AVENUE, HDFC (Continued)

EDR ID Number
EPA ID Number

Database(s)

U003395031

HIST AST:

PBS Number: 2-471224
SWIS Code: 6201
Operator: JUNE SARTOR, PRESIDENT
Facility Phone: (212) 491-9039
Facility Addr2: 371 EDGECOMBE AVENUE
Facility Type: Not reported
Emergency: JUNE SARTOR, PRESIDENT
Emergency Tel: (212) 491-9039
Old PBSNO: Not reported
Date Inspected: Not reported
Inspector: Not reported
Result of Inspection: Not reported
Owner Name: 371 EDGECOMBE AVENUE, HDFC
Owner Address: 371 EDGECOMBE AVENUE
Owner City,St,Zip: NEW YORK, NY 10031
Federal ID: Not reported
Owner Tel: (212) 491-9039
Owner Type: Corporate/Commercial
Owner Subtype: Not reported
Mailing Contact: MS. JANE SARTOR, PRESID.
Mailing Name: 371 EDGECOMBE AVENUE, HDFC
Mailing Address: 371 EDGECOMBE AVENUE
Mailing Address 2: Not reported
Mailing City,St,Zip: NEW YORK, NY 10031
Mailing Telephone: (212) 491-9039
Owner Mark: Second Owner
Facility Status: 1 - Active PBS facility, i.e. total capacity of the PBS tanks is greater than 1,100 gallons, regardless if Subpart 360-14 tanks exist or not at the facility.

Certification Flag: False
Certification Date: 02/19/1999
Expiration: 02/08/2004
Renew Flag: False
Renew Date: Not reported
Total Capacity: 4000
FAMT: True
Facility Screen: Minor Data Missing
Owner Screen: Minor Data Missing
Tank Screen: No Missing Data
Dead Letter: False
CBS Number: Not reported
Town or City: NEW YORK CITY
County Code: 62
Town or City Code: 01
Region: 2

Tank ID: 001
Tank Location: ABOVEGROUND
Tank Status: In Service
Install Date: Not reported
Capacity (Gal): 4000
Product Stored: NOS 1,2, OR 4 FUEL OIL
Tank Type: Steel/carbon steel
Tank Internal: 0
Tank External: 01
Pipe Location: Aboveground/Underground Combination

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

371 EDGECOMBE AVENUE, HDFC (Continued)

EDR ID Number
EPA ID Number

Database(s)

U003395031

Pipe Type: STEEL/IRON
Pipe Internal: None
Pipe External: 00
Tank Containment: Diking
Leak Detection: 00
Overfill Protection: 06
Dispenser Method: Suction
Date Tested: Not reported
Next Test Date: Not reported
Missing Data for Tank: No Missing Data
Date Closed: Not reported
Test Method: Not reported
Deleted: False
Updated: True
SPDES Number: Not reported
Lat/Long: Not reported

Z99
SSW
1/8-1/4
969 ft.

40 ST. NICHOLAS LLC
40 ST. NICHOLAS PLACE
NEW YORK, NY 10031

AST A100193928
N/A

Site 1 of 3 in cluster Z

Relative:
Lower

AST:

Actual:
99 ft.

AST:

Region: STATE
Facility Id: 2-251089
UTM X: 589270.50295
UTM Y: 4520226.22953
Expiration Date: 10/10/11
Renewal Date: / /
Total Capacity: 4500
Facility Type: Not reported
Site Type Name: Apartment Building/Office Building
Site Type Status: Active
Mailing Company: FRIEDMAN MANAGEMENT CORP.
Mailing Title: Not reported
Mailing Contact: ADAM STRYKER
Mailing Address: 225 WEST 34TH STREET
Mailing Address 2: SUITE 1305
Mailing City: NEW YORK
Mailing State: NY
Mailing Zip Code: 10122
Mailing Phone No: (212) 736-6888
Mailing Email: Not reported
Owner Title: MANAGING AGENT
Owner Name: ADAM STRYKER
Owner Address: 225 WEST 34TH STREET
Owner Address 2: Not reported
Owner State: NY
Owner Zip Code: 10122
Owner Phone: (212) 736-6888
Owner Company: 40 ST. NICHOLAS LLC % FRIEDMAN MGMT. CORP.
Emergency Contact: ADAM STRYKER
Emergency Phone: (212) 736-6888
Operator: DANIEL MARTINEZ
Operator Phone: (212) 368-6757

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

40 ST. NICHOLAS LLC (Continued)

EDR ID Number
EPA ID Number

Database(s)

A100193928

Owner City: NEW YORK
Owner Sub Type: Corporate or Commercial
Program Type: PBS

Tank Number: 001
Tank Location Name: Aboveground - in contact with soil
Tank Status: In Service
Tank Model: Not reported
Pipe Model: Not reported
Active Status: Active
Install Date: / /
Capacity Gallons: 4500
Material Name: #2 Fuel Oil
Percentage: 100.00
Tank Type Name: Steel/Carbon Steel/Iron
Tank Internal Protection: None
Tank Internal Protection 1: None
Tank Internal Protection 2: Not reported
Pipe Location Name: No Piping
Pipe Type Name: Steel/Carbon Steel/Iron
Pipe External Protection 1: None
Pipe External Protection 2: Not reported
Tank Secondary Containment 1: Vault (w/o access)
Tank Secondary Containment 2: Not reported
Pipe Secondary Containment: Not reported
Tank Leak Detection 1: None
Tank Leak Detection 2: Not reported
Pipe Leak Detection 1: Exempt Suction Piping
Pipe Leak Detection 2: Not reported
Type Of Overfill Prevention 1: Product Level Gauge (A/G)
Type Of Overfill Prevention 2: Not reported
Dispenser Method: Suction
Spill Prevention: Not reported
Tightness Test Method: Testing Not Required
Date Tested: / /
Next Test Date: / /
Date Tank Closed: / /

Y100 535 WEST 155TH STREET
WNW 535 WEST 155TH STREET
1/8-1/4 NEW YORK, NY 10032
987 ft.

AST A100292509
N/A

Relative:
Higher

Site 2 of 3 in cluster Y

Actual:
143 ft.

AST:

AST:

Region: STATE
Facility Id: 2-609719
UTM X: 589043.29491
UTM Y: 4520646.21883
Expiration Date: 09/30/09
Renewal Date: / /
Total Capacity: 4000
Facility Type: Not reported
Site Type Name: Apartment Building/Office Building
Site Type Status: Active
Mailing Company: ELH MGMT. LLC

Map ID
 Direction
 Distance
 Distance (ft.)
 Elevation Site

MAP FINDINGS

Database(s)
 EDR ID Number
 EPA ID Number

535 WEST 155TH STREET (Continued)

A100292509

Mailing Title:	Not reported
Mailing Contact:	ALEX TORRES
Mailing Address:	98 ROCKWELL PLACE
Mailing Address 2:	Not reported
Mailing City:	BROOKLYN
Mailing State:	NY
Mailing Zip Code:	11217
Mailing Phone No:	(718) 855-5620
Mailing Email:	Not reported
Owner Title:	PROPERTY MANAGER
Owner Name:	ALEX TORRES
Owner Address:	98 ROCKWELL PLACE
Owner Address 2:	Not reported
Owner State:	NY
Owner Zip Code:	11217
Owner Phone:	(718) 855-5620
Owner Company:	LH 155 REALTY LLC
Emergency Contact:	ALEX TORRES
Emergency Phone:	(718) 855-5620
Operator:	FABIO MARTINEZ
Operator Phone:	(718) 974-0996
Owner City:	BROOKLYN
Owner Sub Type:	Corporate or Commercial
Program Type:	PBS
Tank Number:	1
Tank Location Name:	Aboveground - in contact with impervious barrier
Tank Status:	In Service
Tank Model:	Not reported
Pipe Model:	Not reported
Active Status:	Active
Install Date:	05/20/90
Capacity Gallons:	4000
Material Name:	#2 Fuel Oil
Percentage:	100.00
Tank Type Name:	Steel Tank Encased in Concrete
Tank Internal Protection:	None
Tank Internal Protection 1:	Original Impressed Current
Tank Internal Protection 2:	Not reported
Pipe Location Name:	Aboveground
Pipe Type Name:	Other
Pipe External Protection 1:	Original Impressed Current
Pipe External Protection 2:	Not reported
Tank Secondary Containment 1:	None
Tank Secondary Containment 2:	Not reported
Pipe Secondary Containment:	Not reported
Tank Leak Detection 1:	Impervious Barrier/Concrete Pad (A/G)
Tank Leak Detection 2:	Not reported
Pipe Leak Detection 1:	Not reported
Pipe Leak Detection 2:	Not reported
Type Of Overfill Prevention 1:	Vent Whistle
Type Of Overfill Prevention 2:	Not reported
Dispenser Method:	Suction
Spill Prevention:	None
Tightness Test Method:	Testing Not Required
Date Tested:	/ /
Next Test Date:	/ /

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

535 WEST 155TH STREET (Continued)

EDR ID Number
EPA ID Number

Database(s)

Date Tank Closed: / /

A100292509

X101
NW
1/8-1/4
995 ft.

531 WEST 156 STREET
531 WEST 156TH STREET
NEW YORK, NY 10032

AST A100292508
N/A

Site 4 of 4 in cluster X

Relative:
Higher

AST:

Actual:
140 ft.

AST:

Region: STATE
Facility Id: 2-607671
UTM X: 589091.68850
UTM Y: 4520717.08121
Expiration Date: 04/18/12
Renewal Date: / /
Total Capacity: 3000
Facility Type: Not reported
Site Type Name: Apartment Building/Office Building
Site Type Status: Active
Mailing Company: NYC/HPD/DAMP
Mailing Title: Not reported
Mailing Contact: ASST. COMMISSIONER/DAMP
Mailing Address: 100 GOLD STREET, #7-L2
Mailing Address 2: Not reported
Mailing City: NEW YORK
Mailing State: NY
Mailing Zip Code: 10038
Mailing Phone No: (212) 863-7305
Mailing Email: Not reported
Owner Title: ASST. COMMISSIONER
Owner Name: WILLA PADGETT
Owner Address: 100 GOLD STREET, #7-L2
Owner Address 2: Not reported
Owner State: NY
Owner Zip Code: 10038
Owner Phone: (212) 863-7305
Owner Company: NYC/HPD/DAMP
Emergency Contact: ASST. COMMISSIONER/DAMP
Emergency Phone: (212) 863-7305
Operator: ASST. COMMISSIONER/DAMP
Operator Phone: (212) 863-7305
Owner City: NEW YORK
Owner Sub Type: Local Government
Program Type: PBS

Tank Number: 001
Tank Location Name: Aboveground - in contact with soil
Tank Status: In Service
Tank Model: Not reported
Pipe Model: Not reported
Active Status: Active
Install Date: 01/01/83
Capacity Gallons: 3000
Material Name: #2 Fuel Oil
Percentage: 100.00
Tank Type Name: Steel/Carbon Steel/Iron

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

531 WEST 156 STREET (Continued)

EDR ID Number
EPA ID Number

Database(s)

A100292508

Tank Internal Protection: None
Tank Internal Protection 1: Painted/Asphalt Coating
Tank Internal Protection 2: Not reported
Pipe Location Name: Aboveground/Underground Combination
Pipe Type Name: Steel/Carbon Steel/Iron
Pipe External Protection 1: Painted/Asphalt Coating
Pipe External Protection 2: Not reported
Tank Secondary Containment 1: None
Tank Secondary Containment 2: Not reported
Pipe Secondary Containment: None
Tank Leak Detection 1: None
Tank Leak Detection 2: Not reported
Pipe Leak Detection 1: None
Pipe Leak Detection 2: Not reported
Type Of Overfill Prevention 1: Vent Whistle
Type Of Overfill Prevention 2: Not reported
Dispenser Method: Suction
Spill Prevention: None
Tightness Test Method: Testing Not Required
Date Tested: / /
Next Test Date: / /
Date Tank Closed: / /

AA102 824 ST NICHOLAS AVE
SSW 824 SAINT NICHOLAS AVENUE
1/8-1/4 NEW YORK, NY 10031
995 ft.

UST U003835907
HIST UST N/A

Site 1 of 4 in cluster AA

Relative:
Lower

UST:

Actual:
110 ft.

UST:

Facility Id: 2-470317
Expiration Date: 03/28/09
Renewal Date: / /
Total Capacity: 4000
Facility Type: Not reported
Mailing Company: NYC/HPD/DAMP
Mailing Title: Not reported
Mailing Contact: ASST. COMMISSIONER/DAMP
Mailing Address: 100 GOLD STREET
Mailing Address 2: #7Z5
Mailing City: NEW YORK
Mailing State: NY
Mailing Zip Code: 10038
Mailing Phone No: (212) 863-7301
Mailing Email: Not reported
Owner Title: Not reported
Owner Name: Not reported
Owner Address: 100 GOLD ST #7Z5
Owner Address 2: Not reported
Owner State: NY
Owner Zip Code: 10038
Owner Phone: (212) 863-7301
Owner Company: NYC/HPD/DAMP
Emergency Contact: 213/215 MOTT ST. H.D.F.C.
Emergency Phone: (646) 613-0908
Operator: ASST. COMMISSIONER/DAMP

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

824 ST NICHOLAS AVE (Continued)

EDR ID Number
EPA ID Number

Database(s)

U003835907

Operator Phone: (212) 863-7301
Owner City: NEW YORK
Owner Sub Type: Local Government
UTM X: 589212.51750
UTM Y: 4520223.08652
Site Type Name: Apartment Building/Office Building
Site Type Status: Active
Comments: Not reported

Program Type: PBS

Tank Number: 001
Tank Location Name: Underground
Tank Status: In Service
Tank Model: Not reported
Pipe Model: Not reported
Active Status: Active
Install Date: / /
Capacity Gallons: 4000
Material Name: #2 Fuel Oil
Percentage: 100.00
Tank Type Name: Steel/Carbon Steel/Iron
Tank Internal Protection: None
Tank Internal Protection 1: Painted/Asphalt Coating
Tank Internal Protection 2: Not reported
Pipe Location Name: Aboveground/Underground Combination
Pipe Type Name: Steel/Carbon Steel/Iron
Pipe External Protection 1: None
Pipe External Protection 2: Not reported
Tank Secondary Containment 1: None
Tank Secondary Containment 2: Not reported
Pipe Secondary Containment: Not reported
Tank Leak Detection 1: None
Tank Leak Detection 2: Not reported
Pipe Leak Detection 1: Exempt Suction Piping
Pipe Leak Detection 2: Not reported
Type Of Overfill Prevention 1: Vent Whistle
Type Of Overfill Prevention 2: Not reported
Dispenser Method: Suction
Spill Prevention: Not reported
Tightness Test Method: Horner EYZ3/EZY3 Locator Plus
Date Tested: 04/26/01
Next Test Date: 04/26/06
Date Tank Closed: / /

HIST UST:

PBS Number: 2-470317
SPDES Number: Not reported
Emergency Contact: ASST. COMMISSIONER/DAMP
Emergency Telephone: (212) 863-7301
Operator: ASST. COMMISSIONER/DAMP
Operator Telephone: (212) 863-7301
Owner Name: NYC/HPD/DAMP
Owner Address: 100 GOLD ST #7Z5
Owner City,St,Zip: NEW YORK, NY 10038
Owner Telephone: (212) 863-7301
Owner Type: Local Government

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

824 ST NICHOLAS AVE (Continued)

EDR ID Number
EPA ID Number

Database(s)

U003835907

Owner Subtype: Not reported
Mailing Name: NYC/HPD/DAMP
Mailing Address: 100 GOLD ST #7Z5
Mailing Address 2: 100 GOLD ST #7Z5
Mailing City,St,Zip: NEW YORK, NY 10038
Mailing Contact: ASST. COMMISSIONER/DAMP
Mailing Telephone: (212) 863-7301
Owner Mark: First Owner
Facility Status: 1 - Active PBS facility, i.e. total capacity of the PBS tanks is greater than 1,100 gallons, regardless if Subpart 360-14 tanks exist or not at the facility.

Facility Addr2: 824 SAINT NICHOLAS AV
SWIS ID: 6201
Old PBS Number: Not reported
Facility Type: APARTMENT BUILDING
Inspected Date: Not reported
Inspector: Not reported
Inspection Result: Not reported
Federal ID: Not reported
Certification Flag: False
Certification Date: 06/08/2001
Expiration Date: 03/28/2004
Renew Flag: False
Renewal Date: Not reported
Total Capacity: 4000
FAMT: True
Facility Screen: No Missing Data
Owner Screen: No Missing Data
Tank Screen: No Missing Data
Dead Letter: False
CBS Number: Not reported
Town or City: NEW YORK CITY
County Code: 62
Town or City: 01
Region: 2

Tank Id: 001
Tank Location: UNDERGROUND
Tank Status: In Service
Install Date: Not reported
Capacity (gals): 4000
Product Stored: NOS 1,2, OR 4 FUEL OIL
Tank Type: Steel/carbon steel
Tank Internal: None
Tank External: Painted/Asphalt Coating
Pipe Location: Aboveground/Underground Combination
Pipe Type: STEEL/IRON
Pipe Internal: None
Pipe External: None
Second Containment: None
Leak Detection: None
Overfill Prot: Vent Whistle
Dispenser: Suction
Date Tested: 04/26/2001
Next Test Date: 04/26/2006
Missing Data for Tank: No Missing Data
Date Closed: Not reported

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

824 ST NICHOLAS AVE (Continued)

EDR ID Number
EPA ID Number

Database(s)

U003835907

Test Method: 21
Deleted: False
Updated: True
Lat/long: Not reported

Z103
SSW
1/8-1/4
1015 ft.

N.K.P. REALTY CORP.
26 ST NICHOLAS PL
NEW YORK CITY, NY 10031

AST
HIST AST U003391674
N/A

Site 2 of 3 in cluster Z

Relative:
Lower

AST:

Actual:
97 ft.

AST:

Region: STATE
Facility Id: 2-404055
UTM X: 589232.40569
UTM Y: 4520154.49230
Expiration Date: 12/14/07
Renewal Date: 08/05/02
Total Capacity: 5000
Facility Type: Not reported
Site Type Name: Unknown
Site Type Status: Active
Mailing Company: N.K.P. REALTY CORP.
Mailing Title: Not reported
Mailing Contact: Not reported
Mailing Address: 5414 NEW UTRECHT AVE
Mailing Address 2: Not reported
Mailing City: BROOKLYN
Mailing State: NY
Mailing Zip Code: 11219
Mailing Phone No: (718) 438-6200
Mailing Email: Not reported
Owner Title: Not reported
Owner Name: Not reported
Owner Address: 5414 NEW UTRECHT AVE
Owner Address 2: Not reported
Owner State: NY
Owner Zip Code: 11219
Owner Phone: (718) 438-6200
Owner Company: N.K.P. REALTY CORP.
Emergency Contact: MARVIN HELLMAN
Emergency Phone: (718) 438-6200
Operator: JAMIE CHANDLER
Operator Phone: (718) 438-6200
Owner City: BROOKLYN
Owner Sub Type: Not reported
Program Type: PBS

Tank Number: 001
Tank Location Name: Aboveground - in contact with soil
Tank Status: In Service
Tank Model: Not reported
Pipe Model: Not reported
Active Status: Active
Install Date: / /
Capacity Gallons: 5000

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s)
EDR ID Number
EPA ID Number

N.K.P. REALTY CORP. (Continued)

U003391674

Material Name: #2 Fuel Oil
Percentage: 100.00
Tank Type Name: Steel/Carbon Steel/Iron
Tank Internal Protection: None
Tank Internal Protection 1: None
Tank Internal Protection 2: Not reported
Pipe Location Name: No Piping
Pipe Type Name: Steel/Carbon Steel/Iron
Pipe External Protection 1: None
Pipe External Protection 2: Not reported
Tank Secondary Containment 1: Vault (w/o access)
Tank Secondary Containment 2: Not reported
Pipe Secondary Containment: Not reported
Tank Leak Detection 1: None
Tank Leak Detection 2: Not reported
Pipe Leak Detection 1: Exempt Suction Piping
Pipe Leak Detection 2: Not reported
Type Of Overfill Prevention 1: Product Level Gauge (A/G)
Type Of Overfill Prevention 2: Not reported
Dispenser Method: Suction
Spill Prevention: Not reported
Tightness Test Method: Testing Not Required
Date Tested: / /
Next Test Date: / /
Date Tank Closed: / /

HIST AST:

PBS Number: 2-404055
SWIS Code: 6201
Operator: JAMIE CHANDLER
Facility Phone: (718) 438-6200
Facility Addr2: 26 ST NICHOLAS PL
Facility Type: Not reported
Emergency: MARVIN HELLMAN
Emergency Tel: (718) 438-6200
Old PBSNO: Not reported
Date Inspected: Not reported
Inspector: Not reported
Result of Inspection: Not reported
Owner Name: N.K.P. REALTY CORP.
Owner Address: 5414 NEW UTRECHT AVE
Owner City,St,Zip: BROOKLYN, NY 11219
Federal ID: Not reported
Owner Tel: (718) 438-6200
Owner Type: Not reported
Owner Subtype: Not reported
Mailing Contact: Not reported
Mailing Name: N.K.P. REALTY CORP.
Mailing Address: 5414 NEW UTRECHT AVE
Mailing Address 2: Not reported
Mailing City,St,Zip: BROOKLYN, NY 11219
Mailing Telephone: (718) 438-6200
Owner Mark: First Owner
Facility Status: 1 - Active PBS facility, i.e. total capacity of the PBS tanks is greater than 1,100 gallons, regardless if Subpart 360-14 tanks exist or not at the facility.
Certification Flag: False

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

N.K.P. REALTY CORP. (Continued)

EDR ID Number
EPA ID Number

Database(s)

U003391674

Certification Date: 12/01/1997
Expiration: 12/14/2002
Renew Flag: False
Renew Date: Not reported
Total Capacity: 5000
FAMT: True
Facility Screen: Minor Data Missing
Owner Screen: Minor Data Missing
Tank Screen: Minor Data Missing
Dead Letter: False
CBS Number: Not reported
Town or City: NEW YORK CITY
County Code: 62
Town or City Code: 01
Region: 2

Tank ID: 001
Tank Location: ABOVEGROUND
Tank Status: In Service
Install Date: Not reported
Capacity (Gal): 5000
Product Stored: NOS 1,2, OR 4 FUEL OIL
Tank Type: Steel/carbon steel
Tank Internal: Not reported
Tank External: Not reported
Pipe Location: Not reported
Pipe Type: STEEL/IRON
Pipe Internal: Not reported
Pipe External: Not reported
Tank Containment: Diking
Leak Detection: 0
Overfill Protection: 4
Dispenser Method: Suction
Date Tested: Not reported
Next Test Date: Not reported
Missing Data for Tank: Minor Data Missing
Date Closed: Not reported
Test Method: Not reported
Deleted: False
Updated: False
SPDES Number: Not reported
Lat/Long: Not reported

**AB104
NNW
1/8-1/4
1019 ft.**

**513-515 157TH ST
MANHATTEN, NY**

**LTANKS S105230103
HIST LTANKS N/A**

Site 1 of 5 in cluster AB

**Relative:
Higher**

LTANKS:
Site ID: 95579
Spill Date: 12/03/01
Facility Addr2: Not reported
Facility ID: 0108759
Program Number: 0108759
SWIS: 3101
Region of Spill: 2
Investigator: JMKRIMGO

**Actual:
138 ft.**

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

(Continued)

S105230103

Referred To: Not reported
Reported to Dept: 12/03/01
CID: 15
Spill Cause: Tank Test Failure
Water Affected: Not reported
Spill Source: Private Dwelling
Spill Notifier: Tank Tester
Cleanup Ceased: / /
Cleanup Meets Standard: False
Last Inspection: / /
Recommended Penalty: Penalty Not Recommended
UST Involvement: False
Spill Class: Known release with minimal potential for fire or hazard. DEC Response.
Willing Responsible Party. Corrective action taken.
Spill Closed Dt: 12/04/01
Remediation Phase: 0
Date Entered In Computer: 12/03/01
Spill Record Last Update: 12/04/01
Spille Namer: UNKNOWN
Spiller Company: NYC HOUSING AUTHORITY
Spiller Phone: Not reported
Spiller Extention: Not reported
Spiller Address: 23-02 49TH AVE
Spiller City,St,Zip: LONG ISLAND CITY, NY 11011-
Spiller County: 001
Spiller Contact: GREGORY SUHR
Spiller Phone: (631) 586-4900
Spiller Extention: Not reported
DEC Region: 2
Program Number: 0108759
DER Facility ID: 85480
Site ID: 95579
Operable Unit ID: 846153
Operable Unit: 01
Material ID: 529992
Material Code: 0001
Material Name: #2 Fuel Oil
Case No.: Not reported
Material FA: Petroleum
Quantity: 0.00
Units: Gallons
Recovered: 0.00
Resource Affected: Soil
Oxygenate: False
Site ID: 95579
Spill Tank Test: 1526742
Tank Number: 1
Tank Size: 2000
Test Method: 00
Leak Rate: 0.00
Gross Fail: F
Modified By: Spills
Last Modified: 10/01/04
Test Method: Unknown
DEC Memo: Start DECRemark - 0108759 Prior to Sept, 2004 data translation this spill Lead
DEC Field was "KRIMGOLD" AST tank. No visible leaks. Will check the tank and
fix if necessary END DECRemark - 0108759

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

(Continued)

S105230103

Remarks: Start CallerRemark - 0108759 TANK TEST FAILURE AT ABOVE LOCATION. NYC CITY HOUSING AUTHORITY TO BE ADVISED OF TEST RESULTS. END CallerRemark - 0108759

HIST LTANKS:

Region of Spill: 2
Spill Number: 0108759
Investigator: KRIMGOLD
Caller Name: Not reported
Caller Agency: Not reported
Caller Phone: Not reported
Caller Extension: Not reported
Notifier Name: Not reported
Notifier Agency: Not reported
Notifier Phone: Not reported
Notifier Extension: Not reported
Spill Date: 12/03/2001
Spill Time: 11:20
Reported to Department Date: 12/03/01
Reported to Department Time: 11:33
SWIS: 62
Spiller Contact: GREGORY SUHR
Spiller Phone: (631) 586-4900
Spiller Extension: Not reported
Spiller Name: NYC HOUSING AUTHORITY
Spiller Address: 23-02 49TH AVE
Spiller City,St,Zip: LONG ISLAND CITY, NY 11011-
Facility Contact: UNKNOWN
Facility Phone: () -
Facility Extension: Not reported
Spill Cause: Tank Test Failure
Resource Affectd: On Land
Water Affected: Not reported
Spill Source: Private Dwelling
Spill Notifier: Tank Tester
PBS Number: 2-471569
Cleanup Ceased: / /
Cleanup Meets Standard: False
Last Inspection: / /
Recommended Penalty: Penalty Not Recommended
Spiller Cleanup Date: / /
Enforcement Date: / /
Investigation Complete: / /
UST Involvement: False
Spill Class: Known release with minimal potential for fire or hazard. DEC Response.
Willing Responsible Party. Corrective action taken.
Spill Closed Dt: 12/04/01
Date Region Sent Summary to Central Office: / /
Corrective Action Plan Submitted: / /
Date Spill Entered In Computer Data File: 12/03/01
Time Spill Entered In Computer Data File: Not reported
Spill Record Last Update: 12/04/01
Is Updated: False
PBS Number: Not reported
Tank Number: 1
Tank Size: 2000
Test Method: Unknown
Leak Rate Failed Tank: 0.00

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

(Continued)

S105230103

Gross Leak Rate: Talk Test Failures only pass or fail
Material Class Type: Petroleum
Quantity Spilled: 0
Unkonwn Quantity Spilled: False
Units: Gallons
Quantity Recovered: 0
Unkonwn Quantity Recovered: False
Material: #2 FUEL OIL
Class Type: #2 FUEL OIL
Times Material Entry In File: 24464
CAS Number: Not reported
Last Date: 19941207
DEC Remarks: AST tank. No visible leaks. Will check the tank and fix if necessary
Spill Cause: TANK TEST FAILURE AT ABOVE LOCATION. NYC CITY HOUSING AUTHORITY TO BE ADVISED OF TEST RESULTS.

AB105 513-515 WEST 157 ST
NNW 513-515 WEST 157TH STREET
1/8-1/4 NEW YORK, NY 10032
1019 ft.

AST A100300975
N/A

Site 2 of 5 in cluster AB

Relative:
Higher

AST:

Actual:
138 ft.

AST:

Region: STATE
Facility Id: 2-606781
UTM X: 589170.70930
UTM Y: 4520765.55340
Expiration Date: 08/22/11
Renewal Date: / /
Total Capacity: 0
Facility Type: Not reported
Site Type Name: Apartment Building/Office Building
Site Type Status: Unregulated
Mailing Company: NYC/HPD/DAMP
Mailing Title: Not reported
Mailing Contact: ASST. COMMISSIONER/DAMP
Mailing Address: 100 GOLD STREET
Mailing Address 2: #7Z5
Mailing City: NEW YORK
Mailing State: NY
Mailing Zip Code: 10038
Mailing Phone No: (212) 863-7301
Mailing Email: Not reported
Owner Title: ASST COMMISSIONER DAMP
Owner Name: WILLA H. PADGETT
Owner Address: 100 GOLD ST., #7Z5
Owner Address 2: Not reported
Owner State: NY
Owner Zip Code: 10038
Owner Phone: (212) 863-7301
Owner Company: NYC/HPD/DAMP
Emergency Contact: SUNDAY WEST 513-515 W 157TH ST HDFC
Emergency Phone: (212) 781-3658
Operator: ASST. COMM. PADGETT
Operator Phone: (212) 863-7301
Owner City: NEW YORK

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

513-515 WEST 157 ST (Continued)

EDR ID Number
EPA ID Number

Database(s)

A100300975

Owner Sub Type: Local Government
Program Type: PBS

Tank Number: 1
Tank Location Name: Aboveground - in contact with soil
Tank Status: Closed - Removed
Tank Model: Not reported
Pipe Model: Not reported
Active Status: Inactive
Install Date: / /
Capacity Gallons: 2500
Material Name: #2 Fuel Oil
Percentage: 100.00
Tank Type Name: Steel/Carbon Steel/Iron
Tank Internal Protection: None
Tank Internal Protection 1: None
Tank Internal Protection 2: Not reported
Pipe Location Name: Aboveground
Pipe Type Name: Steel/Carbon Steel/Iron
Pipe External Protection 1: None
Pipe External Protection 2: Not reported
Tank Secondary Containment 1: None
Tank Secondary Containment 2: Not reported
Pipe Secondary Containment: None
Tank Leak Detection 1: None
Tank Leak Detection 2: Not reported
Pipe Leak Detection 1: Exempt Suction Piping
Pipe Leak Detection 2: Not reported
Type Of Overfill Prevention 1: Vent Whistle
Type Of Overfill Prevention 2: Not reported
Dispenser Method: Submersible
Spill Prevention: None
Tightness Test Method: Testing Not Required
Date Tested: / /
Next Test Date: / /
Date Tank Closed: 12/10/06

AB106 513 WEST 157 STREET
NNW 513 WEST 157TH STREET
1/8-1/4 NEW YORK, NY 10032
1019 ft.

HIST UST U003835981
N/A

Relative:
Higher

Site 3 of 5 in cluster AB

Actual:
138 ft.

HIST UST:
PBS Number: 2-606781
SPDES Number: Not reported
Emergency Contact: ASST. COMMISSIONER/DAMP
Emergency Telephone: (212) 863-7301
Operator: ASST. COMMISSIONER/DAMP
Operator Telephone: (212) 863-7301
Owner Name: NYC/HPD/DAMP
Owner Address: 100 GOLD ST., #7Z5
Owner City,St,Zip: NEW YORK, NY 10038
Owner Telephone: (212) 863-7301
Owner Type: Local Government
Owner Subtype: Not reported
Mailing Name: NYC/HPD/DAMP
Mailing Address: 100 GOLD STREET

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s) EDR ID Number
EPA ID Number

513 WEST 157 STREET (Continued)

U003835981

Mailing Address 2: #7Z5
Mailing City,St,Zip: NEW YORK, NY 10038
Mailing Contact: ASST. COMMISSIONER/DAMP
Mailing Telephone: (212) 863-7301
Owner Mark: First Owner
Facility Status: 1 - Active PBS facility, i.e. total capacity of the PBS tanks is greater than 1,100 gallons, regardless if Subpart 360-14 tanks exist or not at the facility.

Facility Addr2: Not reported
SWIS ID: 6201
Old PBS Number: Not reported
Facility Type: APARTMENT BUILDING
Inspected Date: Not reported
Inspector: Not reported
Inspection Result: Not reported
Federal ID: Not reported
Certification Flag: False
Certification Date: 08/24/2001
Expiration Date: 08/22/2006
Renew Flag: False
Renewal Date: Not reported
Total Capacity: 2500
FAMT: True
Facility Screen: No Missing Data
Owner Screen: No Missing Data
Tank Screen: Minor Data Missing
Dead Letter: False
CBS Number: Not reported
Town or City: NEW YORK CITY
County Code: 62
Town or City: 01
Region: 2

Tank Id: 001
Tank Location: UNDERGROUND
Tank Status: In Service
Install Date: Not reported
Capacity (gals): 2500
Product Stored: UNLEADED GASOLINE
Tank Type: Steel/carbon steel
Tank Internal: None
Tank External: Painted/Asphalt Coating
Pipe Location: Aboveground/Underground Combination
Pipe Type: STEEL/IRON
Pipe Internal: None
Pipe External: None
Second Containment: Not reported
Leak Detection: None
Overfill Prot: Vent Whistle
Dispenser: Suction
Date Tested: Not reported
Next Test Date: 12/27/1987
Missing Data for Tank: Minor Data Missing
Date Closed: Not reported
Test Method: Not reported
Deleted: False
Updated: True

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

513 WEST 157 STREET (Continued)

U003835981

Lat/long: Not reported

AC107
South
1/8-1/4
1019 ft.

367 EDGECOMBE AVE. CORP.
367 EDGECOMBE AVENUE
NEW YORK, NY 10031

AST **A100300196**
N/A

Site 1 of 2 in cluster AC

Relative:
Lower

AST:

Actual:
86 ft.

AST:

Region: STATE
Facility Id: 2-610430
UTM X: 589309.79595
UTM Y: 4520191.01266
Expiration Date: 03/03/10
Renewal Date: / /
Total Capacity: 1500
Facility Type: Not reported
Site Type Name: Apartment Building/Office Building
Site Type Status: Active
Mailing Company: RF EDGECOMBE LLC
Mailing Title: PRESIDENT
Mailing Contact: CHRISTOPHER BISGAARD
Mailing Address: 164 W 128TH ST - SUITE 1C
Mailing Address 2: Not reported
Mailing City: NEW YORK
Mailing State: NY
Mailing Zip Code: 10027
Mailing Phone No: (212) 671-1201
Mailing Email: Not reported
Owner Title: PRESIDENT
Owner Name: CHRISTOPHER BISGAARD
Owner Address: 164 W 128TH ST - SUITE 1C
Owner Address 2: Not reported
Owner State: NY
Owner Zip Code: 10027
Owner Phone: (212) 671-1201
Owner Company: RF EDGECOMBE LLC
Emergency Contact: ANDREW HOROWITZ
Emergency Phone: (212) 671-1201
Operator: CHRISTOPHER BISGAARD
Operator Phone: (212) 671-1201
Owner City: NEW YORK
Owner Sub Type: Corporate or Commercial
Program Type: PBS

Tank Number: 001
Tank Location Name: Aboveground - in contact with impervious barrier
Tank Status: In Service
Tank Model: Not reported
Pipe Model: Not reported
Active Status: Active
Install Date: 01/01/07
Capacity Gallons: 1500
Material Name: #2 Fuel Oil
Percentage: 100.00
Tank Type Name: Steel/Carbon Steel/Iron

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

367 EDGECOMBE AVE. CORP. (Continued)

EDR ID Number
EPA ID Number

Database(s)

A100300196

Tank Internal Protection: None
Tank Internal Protection 1: Painted/Asphalt Coating
Tank Internal Protection 2: Not reported
Pipe Location Name: Aboveground
Pipe Type Name: Steel/Carbon Steel/Iron
Pipe External Protection 1: None
Pipe External Protection 2: Not reported
Tank Secondary Containment 1: Other
Tank Secondary Containment 2: Not reported
Pipe Secondary Containment: None
Tank Leak Detection 1: None
Tank Leak Detection 2: Not reported
Pipe Leak Detection 1: None
Pipe Leak Detection 2: Not reported
Type Of Overfill Prevention 1: Vent Whistle
Type Of Overfill Prevention 2: Not reported
Dispenser Method: Submersible
Spill Prevention: None
Tightness Test Method: Testing Not Required
Date Tested: / /
Next Test Date: / /
Date Tank Closed: / /

Y108
WNW
1/8-1/4
1022 ft.

539 WEST 155TH STREET
539 W 155TH ST
NEW YORK, NY 10032

AST U003385275
HIST AST N/A

Site 3 of 3 in cluster Y

Relative:
Higher

AST:

Actual:
142 ft.

AST:

Region: STATE
Facility Id: 2-108804
UTM X: 589065.75980
UTM Y: 4520664.96450
Expiration Date: 06/25/03
Renewal Date: / /
Total Capacity: 4000
Facility Type: Not reported
Site Type Name: Unknown
Site Type Status: Active
Mailing Company: LH 155 REALTY
Mailing Title: Not reported
Mailing Contact: SHAWN NURSE
Mailing Address: 186 ADELPHI STREET
Mailing Address 2: Not reported
Mailing City: BROOKLYN
Mailing State: NY
Mailing Zip Code: 11205
Mailing Phone No: Not reported
Mailing Email: Not reported
Owner Title: Not reported
Owner Name: Not reported
Owner Address: 186 ADELPHI STREET
Owner Address 2: Not reported
Owner State: NY
Owner Zip Code: 11205

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

539 WEST 155TH STREET (Continued)

U003385275

Owner Phone: Not reported
Owner Company: LH 155 REALTY INC.
Emergency Contact: JOE PIETRI
Emergency Phone: Not reported
Operator: JUAN RUIZ
Operator Phone: Not reported
Owner City: BROOKLYN
Owner Sub Type: Private Resident
Program Type: PBS

Tank Number: 001
Tank Location Name: Aboveground - in contact with soil
Tank Status: In Service
Tank Model: Not reported
Pipe Model: Not reported
Active Status: Active
Install Date: 07/01/69
Capacity Gallons: 4000
Material Name: #2 Fuel Oil
Percentage: 100.00
Tank Type Name: Steel/Carbon Steel/Iron
Tank Internal Protection: None
Tank Internal Protection 1: None
Tank Internal Protection 2: Not reported
Pipe Location Name: No Piping
Pipe Type Name: Steel/Carbon Steel/Iron
Pipe External Protection 1: None
Pipe External Protection 2: Not reported
Tank Secondary Containment 1: Vault (w/o access)
Tank Secondary Containment 2: Not reported
Pipe Secondary Containment: Not reported
Tank Leak Detection 1: None
Tank Leak Detection 2: Not reported
Pipe Leak Detection 1: Exempt Suction Piping
Pipe Leak Detection 2: Not reported
Type Of Overfill Prevention 1: Product Level Gauge (A/G)
Type Of Overfill Prevention 2: Not reported
Dispenser Method: Suction
Spill Prevention: Not reported
Tightness Test Method: Testing Not Required
Date Tested: / /
Next Test Date: / /
Date Tank Closed: / /

HIST AST:

PBS Number: 2-108804
SWIS Code: 6201
Operator: JUAN RUIZ
Facility Phone: (212) 395-8474
Facility Addr2: 539 W 155TH ST
Facility Type: Not reported
Emergency: JOE PIETRI
Emergency Tel: (917) 298-7759
Old PBSNO: Not reported
Date Inspected: Not reported
Inspector: Not reported
Result of Inspection: Not reported

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

539 WEST 155TH STREET (Continued)

EDR ID Number
EPA ID Number

Database(s)

U003385275

Owner Name: LH 155 REALTY INC.
Owner Address: 186 ADELPHI STREET
Owner City,St,Zip: BROOKLYN, NY 11205
Federal ID: Not reported
Owner Tel: (718) 855-5620
Owner Type: Private Resident
Owner Subtype: Not reported
Mailing Contact: SHAWN NURSE
Mailing Name: LH 155 REALTY
Mailing Address: 186 ADELPHI STREET
Mailing Address 2: Not reported
Mailing City,St,Zip: BROOKLYN, NY 11205
Mailing Telephone: (718) 855-3620
Owner Mark: Second Owner
Facility Status: 1 - Active PBS facility, i.e. total capacity of the PBS tanks is greater than 1,100 gallons, regardless if Subpart 360-14 tanks exist or not at the facility.

Certification Flag: False
Certification Date: 06/29/1998
Expiration: 06/25/2003
Renew Flag: False
Renew Date: Not reported
Total Capacity: 4000
FAMT: True
Facility Screen: Minor Data Missing
Owner Screen: No Missing Data
Tank Screen: Minor Data Missing
Dead Letter: False
CBS Number: Not reported
Town or City: NEW YORK CITY
County Code: 62
Town or City Code: 01
Region: 2

Tank ID: 001
Tank Location: ABOVEGROUND
Tank Status: In Service
Install Date: 19690701
Capacity (Gal): 4000
Product Stored: NOS 1,2, OR 4 FUEL OIL
Tank Type: Steel/carbon steel
Tank Internal: Not reported
Tank External: Not reported
Pipe Location: Not reported
Pipe Type: STEEL/IRON
Pipe Internal: Not reported
Pipe External: Not reported
Tank Containment: Diking
Leak Detection: 0
Overfill Protection: 4
Dispenser Method: Suction
Date Tested: Not reported
Next Test Date: Not reported
Missing Data for Tank: Minor Data Missing
Date Closed: Not reported
Test Method: Not reported
Deleted: False

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

539 WEST 155TH STREET (Continued)

EDR ID Number
EPA ID Number

Database(s)

U003385275

Updated: False
SPDES Number: Not reported
Lat/Long: Not reported

AD109 535 WEST 156TH STREET
NW 535 WEST 156TH STREET
1/8-1/4 NEW YORK, NY 10032
1028 ft.

AST U003395091
HIST AST N/A

Site 1 of 4 in cluster AD

Relative:
Higher

AST:

Actual:
139 ft.

AST:

Region: STATE
Facility Id: 2-471534
UTM X: 589115.00992
UTM Y: 4520734.83709
Expiration Date: 03/28/94
Renewal Date: / /
Total Capacity: 2500
Facility Type: Not reported
Site Type Name: Unknown
Site Type Status: Active
Mailing Company: NYC HOUSING PRESERV & DEVEL
Mailing Title: Not reported
Mailing Contact: Not reported
Mailing Address: 2089-2091 ARTHUR AVENUE
Mailing Address 2: Not reported
Mailing City: BRONX
Mailing State: NY
Mailing Zip Code: 10457
Mailing Phone No: (718) 295-2178
Mailing Email: Not reported
Owner Title: Not reported
Owner Name: Not reported
Owner Address: 2089-2091 ARTHUR AVENUE
Owner Address 2: Not reported
Owner State: NY
Owner Zip Code: 10457
Owner Phone: (718) 295-2178
Owner Company: NYC HOUSING PRESERV & DEVEL
Emergency Contact: JUANITA ARSENEC
Emergency Phone: (212) 360-7900
Operator: NYC HOUSING PRESERV & DEVEL
Operator Phone: (212) 806-8565
Owner City: BRONX
Owner Sub Type: Not reported
Program Type: PBS

Tank Number: 001
Tank Location Name: Aboveground - in contact with soil
Tank Status: In Service
Tank Model: Not reported
Pipe Model: Not reported
Active Status: Active
Install Date: / /
Capacity Gallons: 2500
Material Name: #2 Fuel Oil

Map ID
 Direction
 Distance
 Distance (ft.)
 Elevation Site

MAP FINDINGS

Database(s)
 EDR ID Number
 EPA ID Number

535 WEST 156TH STREET (Continued)

U003395091

Percentage: 100.00
 Tank Type Name: Steel/Carbon Steel/Iron
 Tank Internal Protection: None
 Tank Internal Protection 1: None
 Tank Internal Protection 2: Not reported
 Pipe Location Name: No Piping
 Pipe Type Name: Steel/Carbon Steel/Iron
 Pipe External Protection 1: None
 Pipe External Protection 2: Not reported
 Tank Secondary Containment 1: None
 Tank Secondary Containment 2: Not reported
 Pipe Secondary Containment: Not reported
 Tank Leak Detection 1: None
 Tank Leak Detection 2: Not reported
 Pipe Leak Detection 1: Not reported
 Pipe Leak Detection 2: Not reported
 Type Of Overfill Prevention 1: Product Level Gauge (A/G)
 Type Of Overfill Prevention 2: Not reported
 Dispenser Method: Not reported
 Spill Prevention: Not reported
 Tightness Test Method: Testing Not Required
 Date Tested: / /
 Next Test Date: / /
 Date Tank Closed: / /

HIST AST:

PBS Number: 2-471534
 SWIS Code: 6201
 Operator: NYC HOUSING PRESERV & DEVEL
 Facility Phone: (212) 806-8565
 Facility Addr2: 535 WEST 156TH STREET
 Facility Type: Not reported
 Emergency: JUANITA ARSENEC
 Emergency Tel: (212) 360-7900
 Old PBSNO: Not reported
 Date Inspected: Not reported
 Inspector: Not reported
 Result of Inspection: Not reported
 Owner Name: NYC HOUSING PRESERV & DEVEL
 Owner Address: 75 MAIDEN LANE
 Owner City,St,Zip: NEW YORK, NY 10038
 Federal ID: Not reported
 Owner Tel: (212) 806-8565
 Owner Type: Not reported
 Owner Subtype: Not reported
 Mailing Contact: Not reported
 Mailing Name: NYC HOUSING PRESERV & DEVEL
 Mailing Address: 75 MAIDEN LANE
 Mailing Address 2: Not reported
 Mailing City,St,Zip: NEW YORK, NY 10038
 Mailing Telephone: (212) 806-8565
 Owner Mark: First Owner
 Facility Status: 1 - Active PBS facility, i.e. total capacity of the PBS tanks is greater than 1,100 gallons, regardless if Subpart 360-14 tanks exist or not at the facility.
 Certification Flag: False
 Certification Date: 03/28/1989

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

535 WEST 156TH STREET (Continued)

EDR ID Number
EPA ID Number

Database(s)

U003395091

Expiration: 03/28/1994
Renew Flag: False
Renew Date: Not reported
Total Capacity: 2500
FAMT: True
Facility Screen: Minor Data Missing
Owner Screen: Minor Data Missing
Tank Screen: Minor Data Missing
Dead Letter: False
CBS Number: Not reported
Town or City: NEW YORK CITY
County Code: 62
Town or City Code: 01
Region: 2

Tank ID: 001
Tank Location: ABOVEGROUND
Tank Status: In Service
Install Date: Not reported
Capacity (Gal): 2500
Product Stored: NOS 1,2, OR 4 FUEL OIL
Tank Type: Steel/carbon steel
Tank Internal: Not reported
Tank External: Not reported
Pipe Location: Not reported
Pipe Type: STEEL/IRON
Pipe Internal: Not reported
Pipe External: Not reported
Tank Containment: None
Leak Detection: 0
Overfill Protection: 4
Dispenser Method: Gravity
Date Tested: Not reported
Next Test Date: Not reported
Missing Data for Tank: Minor Data Missing
Date Closed: Not reported
Test Method: Not reported
Deleted: False
Updated: False
SPDES Number: Not reported
Lat/Long: Not reported

Z110 18-20 ST NICHOLAS PL.
SSW 18-20 ST NICHOLAS PL
1/8-1/4 MANHATTAN, NY
1035 ft.

Relative:
Lower

Actual:
96 ft.

Site 3 of 3 in cluster Z

AST:

AST:

Region: STATE
Facility Id: 2-331058
UTM X: 589198.13692
UTM Y: 4520176.69887
Expiration Date: 09/30/07
Renewal Date: / /
Total Capacity: 4000

AST S102672363
LTANKS N/A
HIST AST
HIST LTANKS

Map ID
 Direction
 Distance
 Distance (ft.)
 Elevation Site

MAP FINDINGS

Database(s)
 EDR ID Number
 EPA ID Number

18-20 ST NICHOLAS PL. (Continued)

S102672363

Facility Type:	Not reported
Site Type Name:	Apartment Building/Office Building
Site Type Status:	Active
Mailing Company:	FRIEDMAN MANAGEMENT CORP
Mailing Title:	Not reported
Mailing Contact:	ADAM STRYKER
Mailing Address:	14 PENN PLAZA SUITE 1305
Mailing Address 2:	Not reported
Mailing City:	NEW YORK
Mailing State:	NY
Mailing Zip Code:	10122
Mailing Phone No:	(212) 736-6888
Mailing Email:	Not reported
Owner Title:	Not reported
Owner Name:	Not reported
Owner Address:	14PENN PLAZA SUITE 1305
Owner Address 2:	Not reported
Owner State:	NY
Owner Zip Code:	10122
Owner Phone:	(212) 736-6888
Owner Company:	FRIEDMAN MANAGEMENT CORP
Emergency Contact:	ADAM STRYKER
Emergency Phone:	(212) 736-6888
Operator:	WILLIAM GUZMAN
Operator Phone:	(347) 538-6269
Owner City:	NEW YORK
Owner Sub Type:	Corporate or Commercial
Program Type:	PBS
Tank Number:	001
Tank Location Name:	Aboveground - in contact with soil
Tank Status:	In Service
Tank Model:	Not reported
Pipe Model:	Not reported
Active Status:	Active
Install Date:	/ /
Capacity Gallons:	4000
Material Name:	#2 Fuel Oil
Percentage:	100.00
Tank Type Name:	Steel/Carbon Steel/Iron
Tank Internal Protection:	None
Tank Internal Protection 1:	None
Tank Internal Protection 2:	Not reported
Pipe Location Name:	No Piping
Pipe Type Name:	Steel/Carbon Steel/Iron
Pipe External Protection 1:	None
Pipe External Protection 2:	Not reported
Tank Secondary Containment 1:	Vault (w/o access)
Tank Secondary Containment 2:	Not reported
Pipe Secondary Containment:	Not reported
Tank Leak Detection 1:	Other
Tank Leak Detection 2:	Not reported
Pipe Leak Detection 1:	Not reported
Pipe Leak Detection 2:	Not reported
Type Of Overfill Prevention 1:	Product Level Gauge (A/G)
Type Of Overfill Prevention 2:	Not reported
Dispenser Method:	Not reported

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s) EDR ID Number
EPA ID Number

18-20 ST NICHOLAS PL. (Continued)

S102672363

Spill Prevention: Not reported
Tightness Test Method: Testing Not Required
Date Tested: / /
Next Test Date: / /
Date Tank Closed: / /

LTANKS:

Site ID: 324000
Spill Date: 02/01/94
Facility Addr2: Not reported
Facility ID: 9312944
Program Number: 9312944
SWIS: 3101
Region of Spill: 2
Investigator: CAMMISA
Referred To: Not reported
Reported to Dept: 02/02/94
CID: 15
Spill Cause: Tank Overfill
Water Affected: Not reported
Spill Source: Commercial/Industrial
Spill Notifier: Other
Cleanup Ceased: 02/02/94
Cleanup Meets Standard: True
Last Inspection: / /
Recommended Penalty: Penalty Not Recommended
UST Involvement: False
Spill Class: Known release with minimal potential for fire or hazard. DEC Response.
Willing Responsible Party. Corrective action taken.
Spill Closed Dt: 02/02/94
Remediation Phase: 0
Date Entered In Computer: 02/03/94
Spill Record Last Update: 09/30/04
Spille Namer: Not reported
Spiller Company: SAME
Spiller Phone: Not reported
Spiller Extention: Not reported
Spiller Address: Not reported
Spiller City,St,Zip: NN
Spiller County: 999
Spiller Contact: Not reported
Spiller Phone: Not reported
Spiller Extention: Not reported
DEC Region: 2
Program Number: 9312944
DER Facility ID: 260986
Site ID: 324000
Operable Unit ID: 991451
Operable Unit: 01
Material ID: 388348
Material Code: 0002
Material Name: #4 Fuel Oil
Case No.: Not reported
Material FA: Petroleum
Quantity: 50.00
Units: Gallons
Recovered: 0.00

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

18-20 ST NICHOLAS PL. (Continued)

EDR ID Number
EPA ID Number

Database(s)

S102672363

Resource Affected: Soil
Oxygenate: False
Site ID: Not reported
Spill Tank Test: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate: Not reported
Gross Fail: Not reported
Modified By: Not reported
Last Modified: Not reported
Test Method: Not reported
DEC Memo: Not reported
Remarks: Start CallerRemark - 9312944 SUSPECT INCORRECT TANK-SITE WAS GIVEN TO OIL CO. - CUST. ORDERED 3000 GALS. OIL CAME OUT VENT 3,001 GALS - CUST. ARRANGING CLEAN UP - WILL NOTIFY NY DEP AL EASTMAN CLEANING SPILL - END CallerRemark - 9312944

HIST AST:

PBS Number: 2-331058
SWIS Code: 6201
Operator: TOMES
Facility Phone: (917) 785-0191
Facility Addr2: 18 ST NICHOLAS PLACE
Facility Type: APARTMENT BUILDING
Emergency: DANAY CABRERA
Emergency Tel: (718) 796-9595
Old PBSNO: Not reported
Date Inspected: Not reported
Inspector: Not reported
Result of Inspection: Not reported
Owner Name: PRANA ASSOC. 19
Owner Address: 3154 ALBANY CRESCENT
Owner City,St,Zip: BRONX, NY 10463
Federal ID: Not reported
Owner Tel: (718) 796-9595
Owner Type: Corporate/Commercial
Owner Subtype: Not reported
Mailing Contact: JONATHAN HOCHHAUSER
Mailing Name: PMG
Mailing Address: 3154 ALBANY CRESCENT, 2ND FLOOR
Mailing Address 2: Not reported
Mailing City,St,Zip: BRONX, NY 10463
Mailing Telephone: (718) 796-9595
Owner Mark: First Owner
Facility Status: 1 - Active PBS facility, i.e. total capacity of the PBS tanks is greater than 1,100 gallons, regardless if Subpart 360-14 tanks exist or not at the facility.

Certification Flag: False
Certification Date: 12/07/1999
Expiration: 02/25/2003
Renew Flag: False
Renew Date: Not reported
Total Capacity: 4000
FAMT: True
Facility Screen: No Missing Data
Owner Screen: No Missing Data
Tank Screen: Minor Data Missing

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

18-20 ST NICHOLAS PL. (Continued)

EDR ID Number
EPA ID Number

Database(s)

S102672363

Dead Letter: False
CBS Number: Not reported
Town or City: NEW YORK CITY
County Code: 62
Town or City Code: 01
Region: 2

Tank ID: 001
Tank Location: ABOVEGROUND
Tank Status: In Service
Install Date: Not reported
Capacity (Gal): 4000
Product Stored: NOS 1,2, OR 4 FUEL OIL
Tank Type: Steel/carbon steel
Tank Internal: Not reported
Tank External: Not reported
Pipe Location: Not reported
Pipe Type: STEEL/IRON
Pipe Internal: Not reported
Pipe External: Not reported
Tank Containment: Diking
Leak Detection: 9
Overfill Protection: 4
Dispenser Method: Gravity
Date Tested: Not reported
Next Test Date: Not reported
Missing Data for Tank: Minor Data Missing
Date Closed: Not reported
Test Method: Not reported
Deleted: False
Updated: True
SPDES Number: Not reported
Lat/Long: Not reported

HIST LTANKS:

Region of Spill: 2
Spill Number: 9312944
Investigator: CAMMISA
Caller Name: Not reported
Caller Agency: Not reported
Caller Phone: Not reported
Caller Extension: Not reported
Notifier Name: Not reported
Notifier Agency: Not reported
Notifier Phone: Not reported
Notifier Extension: Not reported
Spill Date: 02/01/1994
Spill Time: 16:00
Reported to Department Date: 02/02/94
Reported to Department Time: 14:01
SWIS: 62
Spiller Contact: Not reported
Spiller Phone: Not reported
Spiller Extension: Not reported
Spiller Name: SAME
Spiller Address: Not reported
Spiller City,St,Zip: Not reported

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s)
EDR ID Number
EPA ID Number

18-20 ST NICHOLAS PL. (Continued)

S102672363

Facility Contact:	Not reported
Facility Phone:	Not reported
Facility Extension:	Not reported
Spill Cause:	Tank Overfill
Resource Affectd:	On Land
Water Affected:	Not reported
Spill Source:	Other Commercial/Industrial
Spill Notifier:	Other
PBS Number:	Not reported
Cleanup Ceased:	02/02/94
Cleanup Meets Standard:	True
Last Inspection:	/ /
Recommended Penalty:	Penalty Not Recommended
Spiller Cleanup Date:	/ /
Enforcement Date:	/ /
Investigation Complete:	/ /
UST Involvement:	False
Spill Class:	Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken.
Spill Closed Dt:	02/02/94
Date Region Sent Summary to Central Office:	/ /
Corrective Action Plan Submitted:	/ /
Date Spill Entered In Computer Data File:	02/03/94
Time Spill Entered In Computer Data File:	Not reported
Spill Record Last Update:	/ /
Is Updated:	False
PBS Number:	Not reported
Tank Number:	Not reported
Tank Size:	Not reported
Test Method:	Not reported
Leak Rate Failed Tank:	Not reported
Gross Leak Rate:	Not reported
Material Class Type:	Petroleum
Quantity Spilled:	50
Unkonwn Quantity Spilled:	False
Units:	Gallons
Quantity Recovered:	0
Unkonwn Quantity Recovered:	False
Material:	#4 FUEL OIL
Class Type:	#4 FUEL OIL
Times Material Entry In File:	1751
CAS Number:	Not reported
Last Date:	19941205
DEC Remarks:	Not reported
Spill Cause:	SUSPECT INCORRECT TANK-SITE WAS GIVEN TO OIL CO. - CUST. ORDERED 3000 GALS. OIL CAME OUT VENT 3,001 GALS - CUST. ARRANGING CLEAN UP - WILL NOTIFY NY DEP AL EASTMAN CLEANING SPILL -

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

AB111
NNW
1/8-1/4
1044 ft.

Site 4 of 5 in cluster AB

AST **U004067686**
N/A

Relative:
Higher

AST:

Actual:
138 ft.

AST:

Region: STATE
Facility Id: 2-471569
UTM X: 589200.02875
UTM Y: 4520782.60421
Expiration Date: 03/28/09
Renewal Date: / /
Total Capacity: 0
Facility Type: Not reported
Site Type Name: Apartment Building/Office Building
Site Type Status: Administratively Closed
Mailing Company: NYC/HPD/DAMP
Mailing Title: Not reported
Mailing Contact: ASST. COMMISSIONER/DAMP
Mailing Address: 100 GOLD STREET
Mailing Address 2: #7Z5
Mailing City: NEW YORK
Mailing State: NY
Mailing Zip Code: 10038
Mailing Phone No: (212) 863-7301
Mailing Email: Not reported
Owner Title: Not reported
Owner Name: Not reported
Owner Address: 100 GOLD ST., #7Z5
Owner Address 2: Not reported
Owner State: NY
Owner Zip Code: 10038
Owner Phone: (212) 863-7301
Owner Company: NYC/HPD/DAMP
Emergency Contact: 213/215 MOTT ST. H.D.F.C.
Emergency Phone: (646) 613-0908
Operator: ASST. COMMISSIONER/DAMP
Operator Phone: (212) 863-7301
Owner City: NEW YORK
Owner Sub Type: Local Government
Program Type: PBS

Tank Number: 001
Tank Location Name: Aboveground - in contact with soil
Tank Status: Administratively Closed
Tank Model: Not reported
Pipe Model: Not reported
Active Status: Inactive
Install Date: / /
Capacity Gallons: 2500
Material Name: Gasoline
Percentage: 100.00
Tank Type Name: Steel/Carbon Steel/Iron
Tank Internal Protection: None
Tank Internal Protection 1: Painted/Asphalt Coating
Tank Internal Protection 2: Not reported
Pipe Location Name: Aboveground/Underground Combination

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

515 WEST 157TH STREET (Continued)

EDR ID Number
EPA ID Number

Database(s)

U004067686

Pipe Type Name: Steel/Carbon Steel/Iron
Pipe External Protection 1: None
Pipe External Protection 2: Not reported
Tank Secondary Containment 1: None
Tank Secondary Containment 2: Not reported
Pipe Secondary Containment: Not reported
Tank Leak Detection 1: None
Tank Leak Detection 2: Not reported
Pipe Leak Detection 1: Not reported
Pipe Leak Detection 2: Not reported
Type Of Overfill Prevention 1: Vent Whistle
Type Of Overfill Prevention 2: Not reported
Dispenser Method: Suction
Spill Prevention: Not reported
Tightness Test Method: Testing Not Required
Date Tested: / /
Next Test Date: / /
Date Tank Closed: / /

AE112 P. S. 93M
WSW 501-503 WEST 152ND ST.
1/8-1/4 NEW YORK, NY 10031
1047 ft.

UST U004047869
N/A

Site 1 of 3 in cluster AE

Relative:
Higher

UST:

Actual:
134 ft.

UST:

Facility Id: 2-609649
Expiration Date: 07/15/09
Renewal Date: / /
Total Capacity: 0
Facility Type: Not reported
Mailing Company: N Y C SCHOOL CONSTRUCTION AUTHUORITY
Mailing Title: Not reported
Mailing Contact: MS. LEE GUTERMAN
Mailing Address: 30-30 THOMSON AVENUE
Mailing Address 2: Not reported
Mailing City: LONG ISLAND CITY
Mailing State: NY
Mailing Zip Code: 11101
Mailing Phone No: (718) 472-8502
Mailing Email: Not reported
Owner Title: PRINCIPAL GEOLOGIST
Owner Name: RICHARD WETHERBEE
Owner Address: 30-30 THOMSON AVENUE
Owner Address 2: Not reported
Owner State: NY
Owner Zip Code: 11101
Owner Phone: (718) 472-8502
Owner Company: N Y C SCHOOL CONSTRUCTION AUTHUORITY
Emergency Contact: NYCSCA
Emergency Phone: (718) 472-8502
Operator: NYCSCA
Operator Phone: (718) 472-8502
Owner City: LONG ISLAND CITY
Owner Sub Type: Other State Agency (State Government)
UTM X: 589004.69555

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

P. S. 93M (Continued)

EDR ID Number
EPA ID Number

Database(s)

U004047869

UTM Y: 4520392.28338
Site Type Name: School
Site Type Status: Unregulated
Comments: Not reported

Program Type: PBS

Tank Number: 01
Tank Location Name: Underground
Tank Status: Closed - In Place
Tank Model: Not reported
Pipe Model: Not reported
Active Status: Inactive
Install Date: 01/01/43
Capacity Gallons: 5000
Material Name: Empty
Percentage: 100.00
Tank Type Name: Steel/Carbon Steel/Iron
Tank Internal Protection: None
Tank Internal Protection 1: None
Tank Internal Protection 2: Not reported
Pipe Location Name: Underground/On-ground
Pipe Type Name: Steel/Carbon Steel/Iron
Pipe External Protection 1: None
Pipe External Protection 2: Not reported
Tank Secondary Containment 1: None
Tank Secondary Containment 2: Not reported
Pipe Secondary Containment: Not reported
Tank Leak Detection 1: None
Tank Leak Detection 2: Not reported
Pipe Leak Detection 1: Not reported
Pipe Leak Detection 2: Not reported
Type Of Overfill Prevention 1: None
Type Of Overfill Prevention 2: Not reported
Dispenser Method: None
Spill Prevention: None
Tightness Test Method: Unknown
Date Tested: / /
Next Test Date: / /
Date Tank Closed: 09/29/03

AA113
SSW
1/8-1/4
1048 ft.

CONVENT GARDEN FOR WOMEN
821 ST. NICHOLAS AVE
NEW YORK, NY 10031

UST
HIST UST
U003241898
N/A

Site 2 of 4 in cluster AA

Relative:
Lower

UST:

Actual:
105 ft.

UST:

Facility Id: 2-603282
Expiration Date: 12/31/02
Renewal Date: / /
Total Capacity: 0
Facility Type: Not reported
Mailing Company: NYC - DDC - UST PROGRAM
Mailing Title: Not reported
Mailing Contact: ANTHONY MARINO

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s) EDR ID Number
EPA ID Number

CONVENT GARDEN FOR WOMEN (Continued)

U003241898

Mailing Address: 30-30 THOMSON AVENUE, 5TH FLOOR
Mailing Address 2: Not reported
Mailing City: LIC
Mailing State: NY
Mailing Zip Code: 11101
Mailing Phone No: (718) 391-1062
Mailing Email: Not reported
Owner Title: Not reported
Owner Name: Not reported
Owner Address: 16 WEST 61ST STREET
Owner Address 2: Not reported
Owner State: NY
Owner Zip Code: 10023
Owner Phone: (212) 408-0294
Owner Company: NYC DEPARTMENT OF PARKS & RECREATION
Emergency Contact: LEE T. HENRY
Emergency Phone: (212) 408-0215
Operator: NYC DEPT. OF PARKS
Operator Phone: (212) 408-0215
Owner City: NEW YORK
Owner Sub Type: Local Government
UTM X: 589194.67980
UTM Y: 4520205.66251
Site Type Name: Retail Gasoline Sales
Site Type Status: Unregulated
Comments: Not reported

Program Type: PBS

Tank Number: 1
Tank Location Name: Underground
Tank Status: Closed - In Place
Tank Model: Not reported
Pipe Model: Not reported
Active Status: Inactive
Install Date: / /
Capacity Gallons: 550
Material Name: Gasoline
Percentage: 100.00
Tank Type Name: Steel/Carbon Steel/Iron
Tank Internal Protection: None
Tank Internal Protection 1: None
Tank Internal Protection 2: Not reported
Pipe Location Name: Underground/On-ground
Pipe Type Name: Steel/Carbon Steel/Iron
Pipe External Protection 1: None
Pipe External Protection 2: Not reported
Tank Secondary Containment 1: None
Tank Secondary Containment 2: Not reported
Pipe Secondary Containment: Not reported
Tank Leak Detection 1: None
Tank Leak Detection 2: Not reported
Pipe Leak Detection 1: Not reported
Pipe Leak Detection 2: Not reported
Type Of Overfill Prevention 1: None
Type Of Overfill Prevention 2: Not reported
Dispenser Method: None

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s)
EDR ID Number
EPA ID Number

CONVENT GARDEN FOR WOMEN (Continued)

U003241898

Spill Prevention: Not reported
Tightness Test Method: Testing Not Required
Date Tested: / /
Next Test Date: / /
Date Tank Closed: 10/01/97

Tank Number: 10
Tank Location Name: Underground
Tank Status: Closed - In Place
Tank Model: Not reported
Pipe Model: Not reported
Active Status: Inactive
Install Date: / /
Capacity Gallons: 4000
Material Name: Gasoline
Percentage: 100.00
Tank Type Name: Steel/Carbon Steel/Iron
Tank Internal Protection: None
Tank Internal Protection 1: None
Tank Internal Protection 2: Not reported
Pipe Location Name: Underground/On-ground
Pipe Type Name: Steel/Carbon Steel/Iron
Pipe External Protection 1: None
Pipe External Protection 2: Not reported
Tank Secondary Containment 1: None
Tank Secondary Containment 2: Not reported
Pipe Secondary Containment: Not reported
Tank Leak Detection 1: None
Tank Leak Detection 2: Not reported
Pipe Leak Detection 1: Not reported
Pipe Leak Detection 2: Not reported
Type Of Overfill Prevention 1: None
Type Of Overfill Prevention 2: Not reported
Dispenser Method: None
Spill Prevention: Not reported
Tightness Test Method: Testing Not Required
Date Tested: / /
Next Test Date: / /
Date Tank Closed: 10/01/97

Tank Number: 11
Tank Location Name: Underground
Tank Status: Closed - In Place
Tank Model: Not reported
Pipe Model: Not reported
Active Status: Inactive
Install Date: / /
Capacity Gallons: 4000
Material Name: Gasoline
Percentage: 100.00
Tank Type Name: Steel/Carbon Steel/Iron
Tank Internal Protection: None
Tank Internal Protection 1: None
Tank Internal Protection 2: Not reported
Pipe Location Name: Underground/On-ground

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s)
EDR ID Number
EPA ID Number

CONVENT GARDEN FOR WOMEN (Continued)

U003241898

Pipe Type Name: Steel/Carbon Steel/Iron
Pipe External Protection 1: None
Pipe External Protection 2: Not reported
Tank Secondary Containment 1: None
Tank Secondary Containment 2: Not reported
Pipe Secondary Containment: Not reported
Tank Leak Detection 1: None
Tank Leak Detection 2: Not reported
Pipe Leak Detection 1: Not reported
Pipe Leak Detection 2: Not reported
Type Of Overfill Prevention 1: None
Type Of Overfill Prevention 2: Not reported
Dispenser Method: None
Spill Prevention: Not reported
Tightness Test Method: Testing Not Required
Date Tested: / /
Next Test Date: / /
Date Tank Closed: 10/01/97

Tank Number: 2
Tank Location Name: Underground
Tank Status: Closed - In Place
Tank Model: Not reported
Pipe Model: Not reported
Active Status: Inactive
Install Date: / /
Capacity Gallons: 550
Material Name: Gasoline
Percentage: 100.00
Tank Type Name: Steel/Carbon Steel/Iron
Tank Internal Protection: None
Tank Internal Protection 1: None
Tank Internal Protection 2: Not reported
Pipe Location Name: Underground/On-ground
Pipe Type Name: Steel/Carbon Steel/Iron
Pipe External Protection 1: None
Pipe External Protection 2: Not reported
Tank Secondary Containment 1: None
Tank Secondary Containment 2: Not reported
Pipe Secondary Containment: Not reported
Tank Leak Detection 1: None
Tank Leak Detection 2: Not reported
Pipe Leak Detection 1: Not reported
Pipe Leak Detection 2: Not reported
Type Of Overfill Prevention 1: None
Type Of Overfill Prevention 2: Not reported
Dispenser Method: None
Spill Prevention: Not reported
Tightness Test Method: Testing Not Required
Date Tested: / /
Next Test Date: / /
Date Tank Closed: 10/01/97

Tank Number: 3
Tank Location Name: Underground

Map ID
 Direction
 Distance
 Distance (ft.)
 Elevation Site

MAP FINDINGS

Database(s)
 EDR ID Number
 EPA ID Number

CONVENT GARDEN FOR WOMEN (Continued)

U003241898

Tank Status: Closed - In Place
 Tank Model: Not reported
 Pipe Model: Not reported
 Active Status: Inactive
 Install Date: / /
 Capacity Gallons: 550
 Material Name: Gasoline
 Percentage: 100.00
 Tank Type Name: Steel/Carbon Steel/Iron
 Tank Internal Protection: None
 Tank Internal Protection 1: None
 Tank Internal Protection 2: Not reported
 Pipe Location Name: Underground/On-ground
 Pipe Type Name: Steel/Carbon Steel/Iron
 Pipe External Protection 1: None
 Pipe External Protection 2: Not reported
 Tank Secondary Containment 1: None
 Tank Secondary Containment 2: Not reported
 Pipe Secondary Containment: Not reported
 Tank Leak Detection 1: None
 Tank Leak Detection 2: Not reported
 Pipe Leak Detection 1: Not reported
 Pipe Leak Detection 2: Not reported
 Type Of Overfill Prevention 1: None
 Type Of Overfill Prevention 2: Not reported
 Dispenser Method: None
 Spill Prevention: Not reported
 Tightness Test Method: Testing Not Required
 Date Tested: / /
 Next Test Date: / /
 Date Tank Closed: 10/01/97

Tank Number: 4
 Tank Location Name: Underground
 Tank Status: Closed - In Place
 Tank Model: Not reported
 Pipe Model: Not reported
 Active Status: Inactive
 Install Date: / /
 Capacity Gallons: 550
 Material Name: Gasoline
 Percentage: 100.00
 Tank Type Name: Steel/Carbon Steel/Iron
 Tank Internal Protection: None
 Tank Internal Protection 1: None
 Tank Internal Protection 2: Not reported
 Pipe Location Name: Underground/On-ground
 Pipe Type Name: Steel/Carbon Steel/Iron
 Pipe External Protection 1: None
 Pipe External Protection 2: Not reported
 Tank Secondary Containment 1: None
 Tank Secondary Containment 2: Not reported
 Pipe Secondary Containment: Not reported
 Tank Leak Detection 1: None
 Tank Leak Detection 2: Not reported
 Pipe Leak Detection 1: Not reported

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s)
EDR ID Number
EPA ID Number

CONVENT GARDEN FOR WOMEN (Continued)

U003241898

Pipe Leak Detection 2: Not reported
Type Of Overfill Prevention 1: None
Type Of Overfill Prevention 2: Not reported
Dispenser Method: None
Spill Prevention: Not reported
Tightness Test Method: Testing Not Required
Date Tested: / /
Next Test Date: / /
Date Tank Closed: 10/01/97

Tank Number: 5
Tank Location Name: Underground
Tank Status: Closed - In Place
Tank Model: Not reported
Pipe Model: Not reported
Active Status: Inactive
Install Date: / /
Capacity Gallons: 550
Material Name: Gasoline
Percentage: 100.00
Tank Type Name: Steel/Carbon Steel/Iron
Tank Internal Protection: None
Tank Internal Protection 1: None
Tank Internal Protection 2: Not reported
Pipe Location Name: Underground/On-ground
Pipe Type Name: Steel/Carbon Steel/Iron
Pipe External Protection 1: None
Pipe External Protection 2: Not reported
Tank Secondary Containment 1: None
Tank Secondary Containment 2: Not reported
Pipe Secondary Containment: Not reported
Tank Leak Detection 1: None
Tank Leak Detection 2: Not reported
Pipe Leak Detection 1: Not reported
Pipe Leak Detection 2: Not reported
Type Of Overfill Prevention 1: None
Type Of Overfill Prevention 2: Not reported
Dispenser Method: None
Spill Prevention: Not reported
Tightness Test Method: Testing Not Required
Date Tested: / /
Next Test Date: / /
Date Tank Closed: 10/01/97

Tank Number: 6
Tank Location Name: Underground
Tank Status: Closed - In Place
Tank Model: Not reported
Pipe Model: Not reported
Active Status: Inactive
Install Date: / /
Capacity Gallons: 550
Material Name: Gasoline
Percentage: 100.00
Tank Type Name: Steel/Carbon Steel/Iron

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s)
EDR ID Number
EPA ID Number

CONVENT GARDEN FOR WOMEN (Continued)

U003241898

Tank Internal Protection: None
Tank Internal Protection 1: None
Tank Internal Protection 2: Not reported
Pipe Location Name: Underground/On-ground
Pipe Type Name: Steel/Carbon Steel/Iron
Pipe External Protection 1: None
Pipe External Protection 2: Not reported
Tank Secondary Containment 1: None
Tank Secondary Containment 2: Not reported
Pipe Secondary Containment: Not reported
Tank Leak Detection 1: None
Tank Leak Detection 2: Not reported
Pipe Leak Detection 1: Not reported
Pipe Leak Detection 2: Not reported
Type Of Overfill Prevention 1: None
Type Of Overfill Prevention 2: Not reported
Dispenser Method: None
Spill Prevention: Not reported
Tightness Test Method: Testing Not Required
Date Tested: / /
Next Test Date: / /
Date Tank Closed: 10/01/97

Tank Number: 7
Tank Location Name: Underground
Tank Status: Closed - In Place
Tank Model: Not reported
Pipe Model: Not reported
Active Status: Inactive
Install Date: / /
Capacity Gallons: 550
Material Name: Gasoline
Percentage: 100.00
Tank Type Name: Steel/Carbon Steel/Iron
Tank Internal Protection: None
Tank Internal Protection 1: None
Tank Internal Protection 2: Not reported
Pipe Location Name: Underground/On-ground
Pipe Type Name: Steel/Carbon Steel/Iron
Pipe External Protection 1: None
Pipe External Protection 2: Not reported
Tank Secondary Containment 1: None
Tank Secondary Containment 2: Not reported
Pipe Secondary Containment: Not reported
Tank Leak Detection 1: None
Tank Leak Detection 2: Not reported
Pipe Leak Detection 1: Not reported
Pipe Leak Detection 2: Not reported
Type Of Overfill Prevention 1: None
Type Of Overfill Prevention 2: Not reported
Dispenser Method: None
Spill Prevention: Not reported
Tightness Test Method: Testing Not Required
Date Tested: / /
Next Test Date: / /
Date Tank Closed: 10/01/97

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s)
EDR ID Number
EPA ID Number

CONVENT GARDEN FOR WOMEN (Continued)

U003241898

Tank Number: 8
Tank Location Name: Underground
Tank Status: Closed - In Place
Tank Model: Not reported
Pipe Model: Not reported
Active Status: Inactive
Install Date: / /
Capacity Gallons: 550
Material Name: Gasoline
Percentage: 100.00
Tank Type Name: Steel/Carbon Steel/Iron
Tank Internal Protection: None
Tank Internal Protection 1: None
Tank Internal Protection 2: Not reported
Pipe Location Name: Underground/On-ground
Pipe Type Name: Steel/Carbon Steel/Iron
Pipe External Protection 1: None
Pipe External Protection 2: Not reported
Tank Secondary Containment 1: None
Tank Secondary Containment 2: Not reported
Pipe Secondary Containment: Not reported
Tank Leak Detection 1: None
Tank Leak Detection 2: Not reported
Pipe Leak Detection 1: Not reported
Pipe Leak Detection 2: Not reported
Type Of Overfill Prevention 1: None
Type Of Overfill Prevention 2: Not reported
Dispenser Method: None
Spill Prevention: Not reported
Tightness Test Method: Testing Not Required
Date Tested: / /
Next Test Date: / /
Date Tank Closed: 10/01/97

Tank Number: 9
Tank Location Name: Underground
Tank Status: Closed - In Place
Tank Model: Not reported
Pipe Model: Not reported
Active Status: Inactive
Install Date: / /
Capacity Gallons: 4000
Material Name: Gasoline
Percentage: 100.00
Tank Type Name: Steel/Carbon Steel/Iron
Tank Internal Protection: None
Tank Internal Protection 1: None
Tank Internal Protection 2: Not reported
Pipe Location Name: Underground/On-ground
Pipe Type Name: Steel/Carbon Steel/Iron
Pipe External Protection 1: None
Pipe External Protection 2: Not reported
Tank Secondary Containment 1: None
Tank Secondary Containment 2: Not reported
Pipe Secondary Containment: Not reported
Tank Leak Detection 1: None

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

CONVENT GARDEN FOR WOMEN (Continued)

EDR ID Number
EPA ID Number

Database(s)

U003241898

Tank Leak Detection 2: Not reported
Pipe Leak Detection 1: Not reported
Pipe Leak Detection 2: Not reported
Type Of Overfill Prevention 1: None
Type Of Overfill Prevention 2: Not reported
Dispenser Method: None
Spill Prevention: Not reported
Tightness Test Method: Testing Not Required
Date Tested: / /
Next Test Date: / /
Date Tank Closed: 10/01/97

HIST UST:

PBS Number: 2-603282
SPDES Number: Not reported
Emergency Contact: LEE T. HENRY
Emergency Telephone: (212) 408-0215
Operator: NYC DEPT. OF PARKS
Operator Telephone: (212) 408-0215
Owner Name: NYC DEPARTMENT OF PARKS & RECREATION
Owner Address: 16 WEST 61ST STREET
Owner City,St,Zip: NEW YORK, NY 10023
Owner Telephone: (212) 408-0294
Owner Type: Local Government
Owner Subtype: Not reported
Mailing Name: NYC - DDC - UST PROGRAM
Mailing Address: 30-30 THOMSON AVENUE, 5TH FLOOR
Mailing Address 2: Not reported
Mailing City,St,Zip: LIC, NY 11101
Mailing Contact: ANTHONY MARINO
Mailing Telephone: (718) 391-1062
Owner Mark: First Owner
Facility Status: 2 - Unregulated by PBS (the total capacity is less than 1,101 gallons)
and Subpart 360-14.
Facility Addr2: Not reported
SWIS ID: 6201
Old PBS Number: Not reported
Facility Type: RETAIL GASOLINE SALES
Inspected Date: Not reported
Inspector: Not reported
Inspection Result: Not reported
Federal ID: Not reported
Certification Flag: False
Certification Date: Not reported
Expiration Date: 12/31/2002
Renew Flag: False
Renewal Date: Not reported
Total Capacity: 0
FAMT: True
Facility Screen: No Missing Data
Owner Screen: No Missing Data
Tank Screen: 0
Dead Letter: False
CBS Number: Not reported
Town or City: NEW YORK CITY
County Code: 62
Town or City: 01

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

CONVENT GARDEN FOR WOMEN (Continued)

EDR ID Number
EPA ID Number

Database(s)

U003241898

Region: 2

Tank Id: 1
Tank Location: UNDERGROUND
Tank Status: Closed-In Place
Install Date: Not reported
Capacity (gals): 550
Product Stored: LEADED GASOLINE
Tank Type: Steel/carbon steel
Tank Internal: None
Tank External: None
Pipe Location: Underground
Pipe Type: STEEL/IRON
Pipe Internal: None
Pipe External: None
Second Containment: None
Leak Detection: None
Overfill Prot: None
Dispenser: Not reported
Date Tested: Not reported
Next Test Date: Not reported
Missing Data for Tank: Minor Data Missing
Date Closed: 10/01/1997
Test Method: Not reported
Deleted: False
Updated: True
Lat/long: Not reported

Tank Id: 10
Tank Location: UNDERGROUND
Tank Status: Closed-In Place
Install Date: Not reported
Capacity (gals): 4000
Product Stored: LEADED GASOLINE
Tank Type: Steel/carbon steel
Tank Internal: None
Tank External: None
Pipe Location: Underground
Pipe Type: STEEL/IRON
Pipe Internal: None
Pipe External: None
Second Containment: None
Leak Detection: None
Overfill Prot: None
Dispenser: Not reported
Date Tested: Not reported
Next Test Date: Not reported
Missing Data for Tank: Minor Data Missing
Date Closed: 10/01/1997
Test Method: Not reported
Deleted: False
Updated: True
Lat/long: Not reported

Tank Id: 11

Map ID
 Direction
 Distance
 Distance (ft.)
 Elevation Site

MAP FINDINGS

Database(s) EDR ID Number
 EPA ID Number

CONVENT GARDEN FOR WOMEN (Continued)

U003241898

Tank Location: UNDERGROUND
 Tank Status: Closed-In Place
 Install Date: Not reported
 Capacity (gals): 4000
 Product Stored: LEADED GASOLINE
 Tank Type: Steel/carbon steel
 Tank Internal: None
 Tank External: None
 Pipe Location: Underground
 Pipe Type: STEEL/IRON
 Pipe Internal: None
 Pipe External: None
 Second Containment: None
 Leak Detection: None
 Overfill Prot: None
 Dispenser: Not reported
 Date Tested: Not reported
 Next Test Date: Not reported
 Missing Data for Tank: Minor Data Missing
 Date Closed: 10/01/1997
 Test Method: Not reported
 Deleted: False
 Updated: True
 Lat/long: Not reported

Tank Id: 2
 Tank Location: UNDERGROUND
 Tank Status: Closed-In Place
 Install Date: Not reported
 Capacity (gals): 550
 Product Stored: LEADED GASOLINE
 Tank Type: Steel/carbon steel
 Tank Internal: None
 Tank External: None
 Pipe Location: Underground
 Pipe Type: STEEL/IRON
 Pipe Internal: None
 Pipe External: None
 Second Containment: None
 Leak Detection: None
 Overfill Prot: None
 Dispenser: Not reported
 Date Tested: Not reported
 Next Test Date: Not reported
 Missing Data for Tank: Minor Data Missing
 Date Closed: 10/01/1997
 Test Method: Not reported
 Deleted: False
 Updated: True
 Lat/long: Not reported

Tank Id: 3
 Tank Location: UNDERGROUND
 Tank Status: Closed-In Place
 Install Date: Not reported

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s)
EDR ID Number
EPA ID Number

CONVENT GARDEN FOR WOMEN (Continued)

U003241898

Capacity (gals): 550
Product Stored: LEADED GASOLINE
Tank Type: Steel/carbon steel
Tank Internal: None
Tank External: None
Pipe Location: Underground
Pipe Type: STEEL/IRON
Pipe Internal: None
Pipe External: None
Second Containment: None
Leak Detection: None
Overfill Prot: None
Dispenser: Not reported
Date Tested: Not reported
Next Test Date: Not reported
Missing Data for Tank: Minor Data Missing
Date Closed: 10/01/1997
Test Method: Not reported
Deleted: False
Updated: True
Lat/long: Not reported

Tank Id: 4
Tank Location: UNDERGROUND
Tank Status: Closed-In Place
Install Date: Not reported
Capacity (gals): 550
Product Stored: LEADED GASOLINE
Tank Type: Steel/carbon steel
Tank Internal: None
Tank External: None
Pipe Location: Underground
Pipe Type: STEEL/IRON
Pipe Internal: None
Pipe External: None
Second Containment: None
Leak Detection: None
Overfill Prot: None
Dispenser: Not reported
Date Tested: Not reported
Next Test Date: Not reported
Missing Data for Tank: Minor Data Missing
Date Closed: 10/01/1997
Test Method: Not reported
Deleted: False
Updated: True
Lat/long: Not reported

Tank Id: 5
Tank Location: UNDERGROUND
Tank Status: Closed-In Place
Install Date: Not reported
Capacity (gals): 550
Product Stored: LEADED GASOLINE
Tank Type: Steel/carbon steel

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

CONVENT GARDEN FOR WOMEN (Continued)

U003241898

Tank Internal:	None
Tank External:	None
Pipe Location:	Underground
Pipe Type:	STEEL/IRON
Pipe Internal:	None
Pipe External:	None
Second Containment:	None
Leak Detection:	None
Overfill Prot:	None
Dispenser:	Not reported
Date Tested:	Not reported
Next Test Date:	Not reported
Missing Data for Tank:	Minor Data Missing
Date Closed:	10/01/1997
Test Method:	Not reported
Deleted:	False
Updated:	True
Lat/long:	Not reported
Tank Id:	6
Tank Location:	UNDERGROUND
Tank Status:	Closed-In Place
Install Date:	Not reported
Capacity (gals):	550
Product Stored:	LEADED GASOLINE
Tank Type:	Steel/carbon steel
Tank Internal:	None
Tank External:	None
Pipe Location:	Underground
Pipe Type:	STEEL/IRON
Pipe Internal:	None
Pipe External:	None
Second Containment:	None
Leak Detection:	None
Overfill Prot:	None
Dispenser:	Not reported
Date Tested:	Not reported
Next Test Date:	Not reported
Missing Data for Tank:	Minor Data Missing
Date Closed:	10/01/1997
Test Method:	Not reported
Deleted:	False
Updated:	True
Lat/long:	Not reported
Tank Id:	7
Tank Location:	UNDERGROUND
Tank Status:	Closed-In Place
Install Date:	Not reported
Capacity (gals):	550
Product Stored:	LEADED GASOLINE
Tank Type:	Steel/carbon steel
Tank Internal:	None
Tank External:	None
Pipe Location:	Underground

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

CONVENT GARDEN FOR WOMEN (Continued)

EDR ID Number
EPA ID Number

Database(s)

U003241898

Pipe Type: STEEL/IRON
Pipe Internal: None
Pipe External: None
Second Containment: None
Leak Detection: None
Overfill Prot: None
Dispenser: Not reported
Date Tested: Not reported
Next Test Date: Not reported
Missing Data for Tank: Minor Data Missing
Date Closed: 10/01/1997
Test Method: Not reported
Deleted: False
Updated: True
Lat/long: Not reported

Tank Id: 8
Tank Location: UNDERGROUND
Tank Status: Closed-In Place
Install Date: Not reported
Capacity (gals): 550
Product Stored: LEADED GASOLINE
Tank Type: Steel/carbon steel
Tank Internal: None
Tank External: None
Pipe Location: Underground
Pipe Type: STEEL/IRON
Pipe Internal: None
Pipe External: None
Second Containment: None
Leak Detection: None
Overfill Prot: None
Dispenser: Not reported
Date Tested: Not reported
Next Test Date: Not reported
Missing Data for Tank: Minor Data Missing
Date Closed: 10/01/1997
Test Method: Not reported
Deleted: False
Updated: True
Lat/long: Not reported

Tank Id: 9
Tank Location: UNDERGROUND
Tank Status: Closed-In Place
Install Date: Not reported
Capacity (gals): 4000
Product Stored: LEADED GASOLINE
Tank Type: Steel/carbon steel
Tank Internal: None
Tank External: None
Pipe Location: Underground
Pipe Type: STEEL/IRON
Pipe Internal: None
Pipe External: None

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

CONVENT GARDEN FOR WOMEN (Continued)

EDR ID Number
EPA ID Number

Database(s)

U003241898

Second Containment: None
Leak Detection: None
Overfill Prot: None
Dispenser: Not reported
Date Tested: Not reported
Next Test Date: Not reported
Missing Data for Tank: Minor Data Missing
Date Closed: 10/01/1997
Test Method: Not reported
Deleted: False
Updated: True
Lat/long: Not reported

AA114 400 WEST 151ST STREET
SSW 400 WEST 151ST STREET
1/8-1/4 NEW YORK, NY 10031
1054 ft.

AST U003394983
HIST AST N/A

Site 3 of 4 in cluster AA

Relative:
Lower

AST:

Actual:
104 ft.

AST:

Region: STATE
Facility Id: 2-470643
UTM X: 589195.82275
UTM Y: 4520215.77943
Expiration Date: 03/28/99
Renewal Date: / /
Total Capacity: 3000
Facility Type: Not reported
Site Type Name: Unknown
Site Type Status: Active
Mailing Company: CITY OF NEW HOUS. PRES. & DEV.
Mailing Title: Not reported
Mailing Contact: IVAN SCHWARTZ
Mailing Address: 75 MAIDEN LANE
Mailing Address 2: 4TH FLOOR - ROOM 427
Mailing City: NEW YORK
Mailing State: NY
Mailing Zip Code: 10038
Mailing Phone No: (212) 806-8037
Mailing Email: Not reported
Owner Title: Not reported
Owner Name: Not reported
Owner Address: 75 MAIDEN LANE
Owner Address 2: Not reported
Owner State: NY
Owner Zip Code: 10038
Owner Phone: (212) 806-8091
Owner Company: CITY OF NEW HOUS. PRES. & DEV.
Emergency Contact: L. BELTON
Emergency Phone: (212) 234-3656
Operator: J. PRASEK
Operator Phone: (212) 234-1175
Owner City: NEW YORK
Owner Sub Type: Local Government
Program Type: PBS

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s)
EDR ID Number
EPA ID Number

400 WEST 151ST STREET (Continued)

U003394983

Tank Number: 001
Tank Location Name: Aboveground - in contact with soil
Tank Status: In Service
Tank Model: Not reported
Pipe Model: Not reported
Active Status: Active
Install Date: / /
Capacity Gallons: 3000
Material Name: #2 Fuel Oil
Percentage: 100.00
Tank Type Name: Steel/Carbon Steel/Iron
Tank Internal Protection: None
Tank Internal Protection 1: None
Tank Internal Protection 2: Not reported
Pipe Location Name: No Piping
Pipe Type Name: Steel/Carbon Steel/Iron
Pipe External Protection 1: None
Pipe External Protection 2: Not reported
Tank Secondary Containment 1: Vault (w/o access)
Tank Secondary Containment 2: Not reported
Pipe Secondary Containment: Not reported
Tank Leak Detection 1: None
Tank Leak Detection 2: Not reported
Pipe Leak Detection 1: Exempt Suction Piping
Pipe Leak Detection 2: Not reported
Type Of Overfill Prevention 1: Product Level Gauge (A/G)
Type Of Overfill Prevention 2: Not reported
Dispenser Method: Suction
Spill Prevention: Not reported
Tightness Test Method: Testing Not Required
Date Tested: / /
Next Test Date: / /
Date Tank Closed: / /

HIST AST:

PBS Number: 2-470643
SWIS Code: 6201
Operator: J. PRASEK
Facility Phone: (212) 234-1175
Facility Addr2: 400 WEST 151ST STREET
Facility Type: Not reported
Emergency: L. BELTON
Emergency Tel: (212) 234-3656
Old PBSNO: Not reported
Date Inspected: Not reported
Inspector: Not reported
Result of Inspection: Not reported
Owner Name: CITY OF NEW HOUS. PRES. & DEV.
Owner Address: 75 MAIDEN LANE
Owner City,St,Zip: NEW YORK, NY 10038
Federal ID: Not reported
Owner Tel: (212) 806-8091
Owner Type: Local Government
Owner Subtype: Not reported
Mailing Contact: IVAN SCHWARTZ
Mailing Name: CITY OF NEW HOUS. PRES. & DEV.
Mailing Address: 75 MAIDEN LANE

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

400 WEST 151ST STREET (Continued)

EDR ID Number
EPA ID Number

Database(s)

U003394983

Mailing Address 2: 4TH FLOOR - ROOM 427
Mailing City,St,Zip: NEW YORK, NY 10038
Mailing Telephone: (212) 806-8037
Owner Mark: First Owner
Facility Status: 1 - Active PBS facility, i.e. total capacity of the PBS tanks is greater than 1,100 gallons, regardless if Subpart 360-14 tanks exist or not at the facility.

Certification Flag: False
Certification Date: 03/17/1994
Expiration: 03/28/1999
Renew Flag: False
Renew Date: Not reported
Total Capacity: 3000
FAMT: True
Facility Screen: Minor Data Missing
Owner Screen: Minor Data Missing
Tank Screen: Minor Data Missing
Dead Letter: False
CBS Number: Not reported
Town or City: NEW YORK CITY
County Code: 62
Town or City Code: 01
Region: 2

Tank ID: 001
Tank Location: ABOVEGROUND
Tank Status: In Service
Install Date: Not reported
Capacity (Gal): 3000
Product Stored: NOS 1,2, OR 4 FUEL OIL
Tank Type: Steel/carbon steel
Tank Internal: Not reported
Tank External: Not reported
Pipe Location: Not reported
Pipe Type: STEEL/IRON
Pipe Internal: Not reported
Pipe External: Not reported
Tank Containment: Diking
Leak Detection: 0
Overfill Protection: 4
Dispenser Method: Suction
Date Tested: Not reported
Next Test Date: Not reported
Missing Data for Tank: Minor Data Missing
Date Closed: Not reported
Test Method: Not reported
Deleted: False
Updated: False
SPDES Number: Not reported
Lat/Long: Not reported

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

AA115
SSW
1/8-1/4
1055 ft.

MELROSE HOUSING ESTATES LP
389 EAST 151ST STREET
BRONX, NY 10455

AST **A100295015**
N/A

Site 4 of 4 in cluster AA

Relative:
Lower

AST:

Actual:
100 ft.

AST:

Region: STATE
Facility Id: 2-609253
UTM X: 591285.37455
UTM Y: 4519082.02571
Expiration Date: 09/25/08
Renewal Date: / /
Total Capacity: 5000
Facility Type: Not reported
Site Type Name: Unknown
Site Type Status: Active
Mailing Company: 2804 THIRD AVENUE
Mailing Title: Not reported
Mailing Contact: MARY C. RAMIREZ
Mailing Address: 4TH FLOOR
Mailing Address 2: Not reported
Mailing City: BRONX
Mailing State: NY
Mailing Zip Code: 10455
Mailing Phone No: (718) 401-7823
Mailing Email: Not reported
Owner Title: Not reported
Owner Name: Not reported
Owner Address: 2804 THIRD AVENUE 4TH FLOOR
Owner Address 2: Not reported
Owner State: NY
Owner Zip Code: 10455
Owner Phone: (718) 401-7823
Owner Company: MELROSE HOUSING ESTATES LP
Emergency Contact: MARY C. RAMIREZ
Emergency Phone: (718) 401-7823
Operator: MR. ALMADEVA
Operator Phone: (718) 401-7823
Owner City: BRONX
Owner Sub Type: Corporate or Commercial
Program Type: PBS

Tank Number: 001
Tank Location Name: Aboveground - in contact with soil
Tank Status: In Service
Tank Model: Not reported
Pipe Model: Not reported
Active Status: Active
Install Date: / /
Capacity Gallons: 5000
Material Name: #2 Fuel Oil
Percentage: 100.00
Tank Type Name: Steel/Carbon Steel/Iron
Tank Internal Protection: None
Tank Internal Protection 1: None
Tank Internal Protection 2: Not reported
Pipe Location Name: Aboveground

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

MELROSE HOUSING ESTATES LP (Continued)

EDR ID Number
EPA ID Number

Database(s)

A100295015

Pipe Type Name: Steel/Carbon Steel/Iron
Pipe External Protection 1: None
Pipe External Protection 2: Not reported
Tank Secondary Containment 1: Vault (w/o access)
Tank Secondary Containment 2: Not reported
Pipe Secondary Containment: Not reported
Tank Leak Detection 1: Impervious Barrier/Concrete Pad (A/G)
Tank Leak Detection 2: Not reported
Pipe Leak Detection 1: Exempt Suction Piping
Pipe Leak Detection 2: Not reported
Type Of Overfill Prevention 1: Vent Whistle
Type Of Overfill Prevention 2: Not reported
Dispenser Method: Suction
Spill Prevention: Not reported
Tightness Test Method: Testing Not Required
Date Tested: / /
Next Test Date: / /
Date Tank Closed: / /

116
SSW
1/8-1/4
1057 ft.

417 E 151 ST
417 EAST 151ST STREET
BRONX, NY 10455

AST A100292338
N/A

Relative:
Equal

AST:

Actual:
111 ft.

AST:

Region: STATE
Facility Id: 2-609256
UTM X: 591348.30029
UTM Y: 4519061.37514
Expiration Date: 09/25/08
Renewal Date: / /
Total Capacity: 2000
Facility Type: Not reported
Site Type Name: Unknown
Site Type Status: Active
Mailing Company: MELROSE ESTATES HOUSING LP
Mailing Title: Not reported
Mailing Contact: MARY C. RAMIREZ
Mailing Address: 2804 THIRD AVENUE
Mailing Address 2: Not reported
Mailing City: BRONX
Mailing State: NY
Mailing Zip Code: 10455
Mailing Phone No: Not reported
Mailing Email: Not reported
Owner Title: Not reported
Owner Name: Not reported
Owner Address: 2804 THIRD AVE
Owner Address 2: Not reported
Owner State: NY
Owner Zip Code: 10455
Owner Phone: Not reported
Owner Company: MELROSE ESTATES HOUSING LP
Emergency Contact: MARY C. RAMIREZ
Emergency Phone: Not reported
Operator: MR. PRADO

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

417 E 151 ST (Continued)

EDR ID Number
EPA ID Number

Database(s)

A100292338

Operator Phone: Not reported
Owner City: BRONX
Owner Sub Type: Private Resident
Program Type: PBS

Tank Number: 001
Tank Location Name: Aboveground - in contact with soil
Tank Status: In Service
Tank Model: Not reported
Pipe Model: Not reported
Active Status: Active
Install Date: / /
Capacity Gallons: 2000
Material Name: #2 Fuel Oil
Percentage: 100.00
Tank Type Name: Steel/Carbon Steel/Iron
Tank Internal Protection: None
Tank Internal Protection 1: None
Tank Internal Protection 2: Not reported
Pipe Location Name: Aboveground
Pipe Type Name: Steel/Carbon Steel/Iron
Pipe External Protection 1: None
Pipe External Protection 2: Not reported
Tank Secondary Containment 1: Vault (w/o access)
Tank Secondary Containment 2: Not reported
Pipe Secondary Containment: Not reported
Tank Leak Detection 1: Impervious Barrier/Concrete Pad (A/G)
Tank Leak Detection 2: Not reported
Pipe Leak Detection 1: Exempt Suction Piping
Pipe Leak Detection 2: Not reported
Type Of Overfill Prevention 1: Vent Whistle
Type Of Overfill Prevention 2: Not reported
Dispenser Method: Suction
Spill Prevention: Not reported
Tightness Test Method: Testing Not Required
Date Tested: / /
Next Test Date: / /
Date Tank Closed: / /

AE117 502 WEST 152 LLC
WSW 502 WEST 152ND STREET
1/8-1/4 NEW YORK, NY 10031
1060 ft.

AST A100168913
N/A

Site 2 of 3 in cluster AE

Relative:
Higher

AST:

Actual:
135 ft.

AST:

Region: STATE
Facility Id: 2-334073
UTM X: 589027.11225
UTM Y: 4520393.93493
Expiration Date: 02/06/12
Renewal Date: / /
Total Capacity: 3000
Facility Type: Not reported
Site Type Name: Apartment Building/Office Building
Site Type Status: Active

Map ID
 Direction
 Distance
 Distance (ft.)
 Elevation Site

MAP FINDINGS

Database(s) EDR ID Number
 EPA ID Number

502 WEST 152 LLC (Continued)

A100168913

Mailing Company: 502 WEST 152 LLC
 Mailing Title: Not reported
 Mailing Contact: SHAMSY BARADARIAN
 Mailing Address: PO BOX 1393
 Mailing Address 2: Not reported
 Mailing City: ENGLEWOOD CLIFFS,
 Mailing State: NJ
 Mailing Zip Code: 07632
 Mailing Phone No: (917) 806-2915
 Mailing Email: SHAMSYB@HOTMAIL.COM
 Owner Title: MEMBER
 Owner Name: SHAMSY BARADARIAN
 Owner Address: PO BOX 1393
 Owner Address 2: Not reported
 Owner State: NJ
 Owner Zip Code: 07632
 Owner Phone: (201) 569-0014
 Owner Company: 502 WEST 152 LLC
 Emergency Contact: SHAMSY BARADARIAN
 Emergency Phone: (917) 806-2915
 Operator: SHAMSY BARADARIAN
 Operator Phone: (212) 569-0014
 Owner City: ENGLEWOOD CLIFFS
 Owner Sub Type: Not reported
 Program Type: PBS

Tank Number: 001
 Tank Location Name: Aboveground - in contact with soil
 Tank Status: In Service
 Tank Model: Not reported
 Pipe Model: Not reported
 Active Status: Active
 Install Date: 01/01/00
 Capacity Gallons: 3000
 Material Name: Gasoline
 Percentage: 100.00
 Tank Type Name: Steel/Carbon Steel/Iron
 Tank Internal Protection: None
 Tank Internal Protection 1: None
 Tank Internal Protection 2: Not reported
 Pipe Location Name: Aboveground
 Pipe Type Name: Steel/Carbon Steel/Iron
 Pipe External Protection 1: None
 Pipe External Protection 2: Not reported
 Tank Secondary Containment 1: None
 Tank Secondary Containment 2: Not reported
 Pipe Secondary Containment: Not reported
 Tank Leak Detection 1: Other
 Tank Leak Detection 2: Not reported
 Pipe Leak Detection 1: Not reported
 Pipe Leak Detection 2: Not reported
 Type Of Overfill Prevention 1: Float Vent Valve
 Type Of Overfill Prevention 2: Not reported
 Dispenser Method: Not reported
 Spill Prevention: Not reported
 Tightness Test Method: Testing Not Required
 Date Tested: / /

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

502 WEST 152 LLC (Continued)

EDR ID Number
EPA ID Number

Database(s)

A100168913

Next Test Date: / /
Date Tank Closed: / /

AD118 539156 LLC
NW 539-541 WEST 156TH STREET
1/8-1/4 NEW YORK, NY 10032
1062 ft.

AST A100159776
N/A

Site 2 of 4 in cluster AD

Relative:
Higher

AST:

Actual:
137 ft.

AST:

Region: STATE
Facility Id: 2-604395
UTM X: 589069.38071
UTM Y: 4520727.81690
Expiration Date: 08/19/10
Renewal Date: / /
Total Capacity: 2000
Facility Type: Not reported
Site Type Name: Apartment Building/Office Building
Site Type Status: Active
Mailing Company: SOLAR REALTY MANAGEMENT
Mailing Title: Not reported
Mailing Contact: LUIS DIAZ
Mailing Address: P.O. BOX 1970
Mailing Address 2: JAF STATION
Mailing City: NEW YORK
Mailing State: NY
Mailing Zip Code: 10031
Mailing Phone No: (212) 633-9985
Mailing Email: Not reported
Owner Title: MANAGING MEMBER
Owner Name: SARUHAN DINGIL
Owner Address: 236 WEST 26TH STREET, SUITE 801
Owner Address 2: Not reported
Owner State: NY
Owner Zip Code: 10001
Owner Phone: (212) 633-9985
Owner Company: 539156 LLC
Emergency Contact: LUIS DIAZ
Emergency Phone: (347) 245-4333
Operator: ISIDORO RODRIGUEZ
Operator Phone: (646) 492-2706
Owner City: NEW YORK
Owner Sub Type: Corporate or Commercial
Program Type: PBS

Tank Number: 001
Tank Location Name: Aboveground - in contact with soil
Tank Status: In Service
Tank Model: Not reported
Pipe Model: Not reported
Active Status: Active
Install Date: / /
Capacity Gallons: 2000
Material Name: #2 Fuel Oil
Percentage: 100.00

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

539156 LLC (Continued)

EDR ID Number
EPA ID Number

Database(s)

A100159776

Tank Type Name: Steel/Carbon Steel/Iron
Tank Internal Protection: None
Tank Internal Protection 1: Jacketed
Tank Internal Protection 2: Not reported
Pipe Location Name: Aboveground
Pipe Type Name: Steel/Carbon Steel/Iron
Pipe External Protection 1: None
Pipe External Protection 2: Not reported
Tank Secondary Containment 1: Vault (w/access)
Tank Secondary Containment 2: Not reported
Pipe Secondary Containment: None
Tank Leak Detection 1: None
Tank Leak Detection 2: Not reported
Pipe Leak Detection 1: None
Pipe Leak Detection 2: Not reported
Type Of Overfill Prevention 1: Vent Whistle
Type Of Overfill Prevention 2: Not reported
Dispenser Method: Suction
Spill Prevention: None
Tightness Test Method: Testing Not Required
Date Tested: / /
Next Test Date: / /
Date Tank Closed: / /

AF119
NNW
1/8-1/4
1064 ft.

AP AMSTERDAM - 1973 AMSTERDAM LLC
498 W. 158TH STREET
NEW YORK, NY 10032

AST A100292449
N/A

Site 1 of 5 in cluster AF

Relative:
Higher

AST:

Actual:
148 ft.

AST:

Region: STATE
Facility Id: 2-609629
UTM X: 589244.20202
UTM Y: 4520803.85638
Expiration Date: 03/08/11
Renewal Date: / /
Total Capacity: 3000
Facility Type: Not reported
Site Type Name: Apartment Building/Office Building
Site Type Status: Active
Mailing Company: TOWNHOUSE MGMT CO.
Mailing Title: Not reported
Mailing Contact: MICHAEL J. CALANDRA
Mailing Address: 70 E 55TH STREET - SUITE B100
Mailing Address 2: Not reported
Mailing City: NEW YORK
Mailing State: NY
Mailing Zip Code: 10022
Mailing Phone No: (212) 755-6556
Mailing Email: Not reported
Owner Title: VICE PRESIDENT
Owner Name: MICHAEL J. CALANDRA
Owner Address: 70 E 55TH STREET
Owner Address 2: Not reported
Owner State: NY

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

AP AMSTERDAM - 1973 AMSTERDAM LLC (Continued)

EDR ID Number
EPA ID Number

Database(s)

A100292449

Owner Zip Code: 10022
Owner Phone: (212) 755-6556
Owner Company: 1973 AMSTERDAM LLC - C/O TOWNHOUSE MGMT CO.
Emergency Contact: WILLIE MIRANDA
Emergency Phone: (646) 996-0418
Operator: RAFAEL BLANCO
Operator Phone: (347) 386-6798
Owner City: NEW YORK
Owner Sub Type: Corporate or Commercial
Program Type: PBS

Tank Number: 001
Tank Location Name: Aboveground on crib, rack, or cradle
Tank Status: In Service
Tank Model: Not reported
Pipe Model: Not reported
Active Status: Active
Install Date: 05/01/04
Capacity Gallons: 3000
Material Name: #2 Fuel Oil
Percentage: 100.00
Tank Type Name: Steel/Carbon Steel/Iron
Tank Internal Protection: None
Tank Internal Protection 1: None
Tank Internal Protection 2: Not reported
Pipe Location Name: Aboveground
Pipe Type Name: Steel/Carbon Steel/Iron
Pipe External Protection 1: None
Pipe External Protection 2: Not reported
Tank Secondary Containment 1: Vault (w/access)
Tank Secondary Containment 2: Not reported
Pipe Secondary Containment: Not reported
Tank Leak Detection 1: None
Tank Leak Detection 2: Not reported
Pipe Leak Detection 1: Not reported
Pipe Leak Detection 2: Not reported
Type Of Overfill Prevention 1: Vent Whistle
Type Of Overfill Prevention 2: Not reported
Dispenser Method: Suction
Spill Prevention: Not reported
Tightness Test Method: Testing Not Required
Date Tested: / /
Next Test Date: / /
Date Tank Closed: / /

120
SSE
1/8-1/4
1071 ft.

VARAE ROYAL REALTY
216 BRADHURST AVENUE
NEW YORK, NY 10039

AST A100183574
N/A

Relative:
Lower

AST:

AST:

Actual:
20 ft.

Region: STATE
Facility Id: 2-607014
UTM X: 589426.54468
UTM Y: 4520188.53888
Expiration Date: 09/27/06

Map ID
 Direction
 Distance
 Distance (ft.)
 Elevation Site

MAP FINDINGS

Database(s) EDR ID Number
 EPA ID Number

VARAE ROYAL REALTY (Continued)

A100183574

Renewal Date: / /
 Total Capacity: 5000
 Facility Type: Not reported
 Site Type Name: Apartment Building/Office Building
 Site Type Status: Active
 Mailing Company: VARAE ROYAL REALTY INC
 Mailing Title: Not reported
 Mailing Contact: Not reported
 Mailing Address: 45 LENOX ROAD
 Mailing Address 2: Not reported
 Mailing City: BROOKLYN
 Mailing State: NY
 Mailing Zip Code: 11226
 Mailing Phone No: (212) 690-4792
 Mailing Email: Not reported
 Owner Title: Not reported
 Owner Name: Not reported
 Owner Address: 45 LENOX ROAD
 Owner Address 2: Not reported
 Owner State: NY
 Owner Zip Code: 11226
 Owner Phone: (212) 690-4792
 Owner Company: VARAE ROYAL REALTY INC.
 Emergency Contact: ROY DANIELS
 Emergency Phone: (212) 690-4792
 Operator: ROY DANIELS
 Operator Phone: (212) 234-1476
 Owner City: BROOKLYN
 Owner Sub Type: Corporate or Commercial
 Program Type: PBS

 Tank Number: 01
 Tank Location Name: Aboveground - in contact with soil
 Tank Status: In Service
 Tank Model: Not reported
 Pipe Model: Not reported
 Active Status: Active
 Install Date: / /
 Capacity Gallons: 5000
 Material Name: #2 Fuel Oil
 Percentage: 100.00
 Tank Type Name: Steel/Carbon Steel/Iron
 Tank Internal Protection: None
 Tank Internal Protection 1: Other
 Tank Internal Protection 2: Not reported
 Pipe Location Name: Aboveground
 Pipe Type Name: Steel/Carbon Steel/Iron
 Pipe External Protection 1: None
 Pipe External Protection 2: Not reported
 Tank Secondary Containment 1: None
 Tank Secondary Containment 2: Not reported
 Pipe Secondary Containment: Not reported
 Tank Leak Detection 1: None
 Tank Leak Detection 2: Not reported
 Pipe Leak Detection 1: Not reported
 Pipe Leak Detection 2: Not reported
 Type Of Overfill Prevention 1: High Level Alarm

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

VARAE ROYAL REALTY (Continued)

EDR ID Number
EPA ID Number

Database(s)

A100183574

Type Of Overfill Prevention 2: Not reported
Dispenser Method: Not reported
Spill Prevention: Not reported
Tightness Test Method: Testing Not Required
Date Tested: / /
Next Test Date: / /
Date Tank Closed: / /

121 SALVATION ARMY CITADEL CORPS
NNE 425 EAST 159TH STREET
1/8-1/4 BRONX, NY 10451
1085 ft.

AST A100295926
N/A

Relative:
Higher

AST:

AST:

Actual:
143 ft.

Region: STATE
Facility Id: 2-609160
UTM X: 591609.69510
UTM Y: 4519646.60863
Expiration Date: 07/30/08
Renewal Date: / /
Total Capacity: 2000
Facility Type: Not reported
Site Type Name: Other
Site Type Status: Active
Mailing Company: THE SALVATION ARMY
Mailing Title: Not reported
Mailing Contact: LT. COL. GERRY GAINES
Mailing Address: 120 WEST 14TH STREET
Mailing Address 2: Not reported
Mailing City: NEW YORK
Mailing State: NY
Mailing Zip Code: 10011
Mailing Phone No: (212) 337-7200
Mailing Email: Not reported
Owner Title: Not reported
Owner Name: Not reported
Owner Address: 120 WEST 14TH STREET
Owner Address 2: Not reported
Owner State: NY
Owner Zip Code: 10011
Owner Phone: (212) 337-7200
Owner Company: THE SALVATION ARMY
Emergency Contact: SCHILDWACHTER OIL
Emergency Phone: (718) 665-8472
Operator: SCHILDWACHTER OIL
Operator Phone: (718) 665-8472
Owner City: NEW YORK
Owner Sub Type: Corporate or Commercial
Program Type: PBS

Tank Number: 001
Tank Location Name: Aboveground on crib, rack, or cradle
Tank Status: In Service
Tank Model: Not reported
Pipe Model: Not reported
Active Status: Active

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

SALVATION ARMY CITADEL CORPS (Continued)

EDR ID Number
EPA ID Number

Database(s)

A100295926

Install Date: 05/01/67
Capacity Gallons: 2000
Material Name: #2 Fuel Oil
Percentage: 100.00
Tank Type Name: Steel/Carbon Steel/Iron
Tank Internal Protection: None
Tank Internal Protection 1: Painted/Asphalt Coating
Tank Internal Protection 2: Not reported
Pipe Location Name: Aboveground
Pipe Type Name: Steel/Carbon Steel/Iron
Pipe External Protection 1: Painted/Asphalt Coating
Pipe External Protection 2: Not reported
Tank Secondary Containment 1: Vault (w/o access)
Tank Secondary Containment 2: Not reported
Pipe Secondary Containment: Not reported
Tank Leak Detection 1: None
Tank Leak Detection 2: Not reported
Pipe Leak Detection 1: Exempt Suction Piping
Pipe Leak Detection 2: Not reported
Type Of Overfill Prevention 1: High Level Alarm
Type Of Overfill Prevention 2: Not reported
Dispenser Method: Suction
Spill Prevention: Not reported
Tightness Test Method: Testing Not Required
Date Tested: / /
Next Test Date: / /
Date Tank Closed: / /

AC122
South
1/8-1/4
1086 ft.

363 EDGECOMBE AVE CORP.
363 EDGECOMBE AVENUE
NEW YORK, NY 10031

AST A100292241
N/A

Site 2 of 2 in cluster AC

Relative:
Lower

AST:

Actual:
82 ft.

AST:

Region: STATE
Facility Id: 2-609790
UTM X: 589309.79595
UTM Y: 4520191.01266
Expiration Date: 03/03/10
Renewal Date: / /
Total Capacity: 1500
Facility Type: Not reported
Site Type Name: Apartment Building/Office Building
Site Type Status: Active
Mailing Company: RF EDGECOMBE LLC
Mailing Title: PRESIDENT
Mailing Contact: CHRISTOPHER BISGAARD
Mailing Address: 164 W 128TH ST., SUITE 1C
Mailing Address 2: Not reported
Mailing City: NEW YORK
Mailing State: NY
Mailing Zip Code: 10027
Mailing Phone No: (212) 671-1201
Mailing Email: Not reported
Owner Title: PRESIDENT

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s) EDR ID Number
EPA ID Number

363 EDGECOMBE AVE CORP. (Continued)

A100292241

Owner Name: CHRISTOPHER BISGAARD
Owner Address: 164 W 128TH ST., SUITE 1C
Owner Address 2: Not reported
Owner State: NY
Owner Zip Code: 10027
Owner Phone: (212) 671-1201
Owner Company: RF EDGECOMBE LLC
Emergency Contact: ANDREW HOROWITZ
Emergency Phone: (212) 671-1201
Operator: CHRISTOPHER BISGAARD
Operator Phone: (212) 671-1201
Owner City: NEW YORK
Owner Sub Type: Corporate or Commercial
Program Type: PBS

Tank Number: 001
Tank Location Name: Aboveground - in contact with impervious barrier
Tank Status: In Service
Tank Model: Not reported
Pipe Model: Not reported
Active Status: Active
Install Date: 01/01/46
Capacity Gallons: 1500
Material Name: #2 Fuel Oil
Percentage: 100.00
Tank Type Name: Steel/Carbon Steel/Iron
Tank Internal Protection: None
Tank Internal Protection 1: Painted/Asphalt Coating
Tank Internal Protection 2: Not reported
Pipe Location Name: Aboveground
Pipe Type Name: Steel/Carbon Steel/Iron
Pipe External Protection 1: None
Pipe External Protection 2: Not reported
Tank Secondary Containment 1: Other
Tank Secondary Containment 2: Not reported
Pipe Secondary Containment: None
Tank Leak Detection 1: None
Tank Leak Detection 2: Not reported
Pipe Leak Detection 1: None
Pipe Leak Detection 2: Not reported
Type Of Overfill Prevention 1: Vent Whistle
Type Of Overfill Prevention 2: Not reported
Dispenser Method: Submersible
Spill Prevention: None
Tightness Test Method: Testing Not Required
Date Tested: / /
Next Test Date: / /
Date Tank Closed: / /

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

AB123
NNW
1/8-1/4
1093 ft.

519 WEST 157 STREET
519 WEST 157TH STREET
NEW YORK, NY 10032

AST **A100183356**
N/A

Site 5 of 5 in cluster AB

Relative:
Higher

AST:

Actual:
137 ft.

AST:

Region: STATE
Facility Id: 2-606777
UTM X: 589157.21338
UTM Y: 4520772.82919
Expiration Date: 08/22/06
Renewal Date: / /
Total Capacity: 2500
Facility Type: Not reported
Site Type Name: Apartment Building/Office Building
Site Type Status: Active
Mailing Company: NYC/HPD/DAMP
Mailing Title: Not reported
Mailing Contact: ASST. COMMISSIONER/DAMP
Mailing Address: 100 GOLD STREET
Mailing Address 2: #7Z5
Mailing City: NEW YORK
Mailing State: NY
Mailing Zip Code: 10038
Mailing Phone No: (212) 863-7301
Mailing Email: Not reported
Owner Title: Not reported
Owner Name: Not reported
Owner Address: 100 GOLD ST., #7Z5
Owner Address 2: Not reported
Owner State: NY
Owner Zip Code: 10038
Owner Phone: (212) 863-7301
Owner Company: NYC/HPD/DAMP
Emergency Contact: 213/215 MOTT ST. H.D.F.C.
Emergency Phone: (646) 613-0908
Operator: ASST. COMMISSIONER/DAMP
Operator Phone: (212) 863-7301
Owner City: NEW YORK
Owner Sub Type: Local Government
Program Type: PBS

Tank Number: 001
Tank Location Name: Aboveground - in contact with soil
Tank Status: In Service
Tank Model: Not reported
Pipe Model: Not reported
Active Status: Active
Install Date: / /
Capacity Gallons: 2500
Material Name: Gasoline
Percentage: 100.00
Tank Type Name: Steel/Carbon Steel/Iron
Tank Internal Protection: None
Tank Internal Protection 1: Painted/Asphalt Coating
Tank Internal Protection 2: Not reported
Pipe Location Name: Aboveground/Underground Combination

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

519 WEST 157 STREET (Continued)

EDR ID Number
EPA ID Number

Database(s)

A100183356

Pipe Type Name: Steel/Carbon Steel/Iron
Pipe External Protection 1: None
Pipe External Protection 2: Not reported
Tank Secondary Containment 1: None
Tank Secondary Containment 2: Not reported
Pipe Secondary Containment: Not reported
Tank Leak Detection 1: None
Tank Leak Detection 2: Not reported
Pipe Leak Detection 1: Not reported
Pipe Leak Detection 2: Not reported
Type Of Overfill Prevention 1: Vent Whistle
Type Of Overfill Prevention 2: Not reported
Dispenser Method: Suction
Spill Prevention: Not reported
Tightness Test Method: Testing Not Required
Date Tested: / /
Next Test Date: / /
Date Tank Closed: / /

AF124 507 W 158 ST
NNW 507 WEST 158TH STREET
1/8-1/4 NEW YORK, NY 10032
1098 ft.

UST U003835941
HIST UST N/A

Site 2 of 5 in cluster AF

Relative:
Higher

UST:

Actual:
148 ft.

UST:

Facility Id: 2-601098
Expiration Date: 10/21/07
Renewal Date: 05/31/02
Total Capacity: 2500
Facility Type: Not reported
Mailing Company: NYC/HPD/DAMP
Mailing Title: Not reported
Mailing Contact: ASST. COMMISSIONER/DAMP
Mailing Address: 100 GOLD STREET
Mailing Address 2: #7Z5
Mailing City: NEW YORK
Mailing State: NY
Mailing Zip Code: 10038
Mailing Phone No: (212) 863-7301
Mailing Email: Not reported
Owner Title: Not reported
Owner Name: Not reported
Owner Address: 100 GOLD ST # 7Z5
Owner Address 2: Not reported
Owner State: NY
Owner Zip Code: 10038
Owner Phone: (212) 863-7301
Owner Company: NYC/HPD/DAMP
Emergency Contact: 213/215 MOTT ST. H.D.F.C.
Emergency Phone: (646) 613-0908
Operator: ASST. COMMISSIONER/DAMP
Operator Phone: (212) 863-7301
Owner City: NEW YORK
Owner Sub Type: Local Government
UTM X: 589253.74858

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s)
EDR ID Number
EPA ID Number

507 W 158 ST (Continued)

U003835941

UTM Y: 4520838.32078
Site Type Name: Apartment Building/Office Building
Site Type Status: Active
Comments: Not reported

Program Type: PBS

Tank Number: 1
Tank Location Name: Underground
Tank Status: In Service
Tank Model: Not reported
Pipe Model: Not reported
Active Status: Active
Install Date: / /
Capacity Gallons: 2500
Material Name: #2 Fuel Oil
Percentage: 100.00
Tank Type Name: Steel/Carbon Steel/Iron
Tank Internal Protection: None
Tank Internal Protection 1: Painted/Asphalt Coating
Tank Internal Protection 2: Not reported
Pipe Location Name: Aboveground/Underground Combination
Pipe Type Name: Steel/Carbon Steel/Iron
Pipe External Protection 1: None
Pipe External Protection 2: Not reported
Tank Secondary Containment 1: Vault (w/o access)
Tank Secondary Containment 2: Not reported
Pipe Secondary Containment: Not reported
Tank Leak Detection 1: None
Tank Leak Detection 2: Not reported
Pipe Leak Detection 1: Exempt Suction Piping
Pipe Leak Detection 2: Not reported
Type Of Overfill Prevention 1: Vent Whistle
Type Of Overfill Prevention 2: Not reported
Dispenser Method: Suction
Spill Prevention: Not reported
Tightness Test Method: Horner EYZ3/EYZ3 Locator Plus
Date Tested: 06/14/01
Next Test Date: 06/14/06
Date Tank Closed: / /

HIST UST:

PBS Number: 2-601098
SPDES Number: Not reported
Emergency Contact: ASST. COMMISSIONER/DPM
Emergency Telephone: (212) 863-7087
Operator: ASST. COMMISSIONER/DPM
Operator Telephone: (212) 863-7087
Owner Name: NYC/HPD/DPM
Owner Address: 100 GOLD ST # 6Z1
Owner City,St,Zip: NY, NY 10038
Owner Telephone: (212) 863-7087
Owner Type: Local Government
Owner Subtype: Not reported
Mailing Name: NYC/HPD/DPM
Mailing Address: Not reported
Mailing Address 2: 100 GOLD ST # 6Z1

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

507 W 158 ST (Continued)

EDR ID Number
EPA ID Number

Database(s)

U003835941

Mailing City,St,Zip: NY, NY 10038
Mailing Contact: ASST. COMMISSIONER/DPM
Mailing Telephone: (212) 863-7087
Owner Mark: First Owner
Facility Status: 1 - Active PBS facility, i.e. total capacity of the PBS tanks is greater than 1,100 gallons, regardless if Subpart 360-14 tanks exist or not at the facility.

Facility Addr2: 507 W 158 ST
SWIS ID: 6201
Old PBS Number: Not reported
Facility Type: APARTMENT BUILDING
Inspected Date: Not reported
Inspector: Not reported
Inspection Result: Not reported
Federal ID: Not reported
Certification Flag: False
Certification Date: 03/09/2001
Expiration Date: 10/21/2002
Renew Flag: False
Renewal Date: Not reported
Total Capacity: 2000
FAMT: True
Facility Screen: No Missing Data
Owner Screen: No Missing Data
Tank Screen: No Missing Data
Dead Letter: False
CBS Number: Not reported
Town or City: NEW YORK CITY
County Code: 62
Town or City: 01
Region: 2

Tank Id: 1
Tank Location: UNDERGROUND
Tank Status: In Service
Install Date: Not reported
Capacity (gals): 2000
Product Stored: NOS 1,2, OR 4 FUEL OIL
Tank Type: Steel/carbon steel
Tank Internal: None
Tank External: Painted/Asphalt Coating
Pipe Location: Aboveground/Underground Combination
Pipe Type: STEEL/IRON
Pipe Internal: None
Pipe External: None
Second Containment: Diking
Leak Detection: None
Overfill Prot: Vent Whistle
Dispenser: Suction
Date Tested: Not reported
Next Test Date: 12/27/1987
Missing Data for Tank: No Missing Data
Date Closed: Not reported
Test Method: Not reported
Deleted: False
Updated: True
Lat/long: Not reported

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

125
ESE
1/8-1/4
1101 ft.

MANDE COMPLETE AUTO REPAIR
304 WEST 155TH STREET
NEW YORK, NY 10039

AST **A100298703**
N/A

Relative:
Lower

AST:

AST:

Actual:
17 ft.

Region: STATE
Facility Id: 2-610262
UTM X: 0.00000
UTM Y: 0.00000
Expiration Date: 06/22/11
Renewal Date: / /
Total Capacity: 270
Facility Type: AUTO REPAIR
Site Type Name: Other
Site Type Status: Waste Oil Storer
Mailing Company: MANDE COMPLETE AUTO REPAIR
Mailing Title: Not reported
Mailing Contact: BOURAHIMA KEITA
Mailing Address: 304 WEST 155TH STREET
Mailing Address 2: Not reported
Mailing City: NEW YORK
Mailing State: NY
Mailing Zip Code: 10039
Mailing Phone No: (212) 690-4894
Mailing Email: Not reported
Owner Title: OWNER
Owner Name: BOURAHIMA KEITA
Owner Address: 304 WEST 155TH STREET
Owner Address 2: Not reported
Owner State: NY
Owner Zip Code: 10039
Owner Phone: (212) 690-4894
Owner Company: BOURAHIMA KEITA
Emergency Contact: BOURAHIMA KEITA
Emergency Phone: (917) 560-4532
Operator: BOURAHIMA KEITA
Operator Phone: (212) 690-4894
Owner City: NEW YORK
Owner Sub Type: Corporate or Commercial
Program Type: PBS

Tank Number: 001
Tank Location Name: Aboveground on crib, rack, or cradle
Tank Status: In Service
Tank Model: Not reported
Pipe Model: Not reported
Active Status: Active
Install Date: / /
Capacity Gallons: 270
Material Name: Waste Oil/Used Oil
Percentage: 100.00
Tank Type Name: Steel/Carbon Steel/Iron
Tank Internal Protection: Other
Tank Internal Protection 1: Not reported
Tank Internal Protection 2: Not reported
Pipe Location Name: Aboveground
Pipe Type Name: Not reported

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

MANDE COMPLETE AUTO REPAIR (Continued)

EDR ID Number
EPA ID Number

Database(s)

A100298703

Pipe External Protection 1: Not reported
Pipe External Protection 2: Not reported
Tank Secondary Containment 1: Not reported
Tank Secondary Containment 2: Not reported
Pipe Secondary Containment: Not reported
Tank Leak Detection 1: Impervious Barrier/Concrete Pad (A/G)
Tank Leak Detection 2: Not reported
Pipe Leak Detection 1: None
Pipe Leak Detection 2: Not reported
Type Of Overfill Prevention 1: Float Vent Valve
Type Of Overfill Prevention 2: Not reported
Dispenser Method: Suction
Spill Prevention: Catch Basin
Tightness Test Method: Testing Not Required
Date Tested: / /
Next Test Date: / /
Date Tank Closed: / /

AG126
SW
1/8-1/4
1106 ft.

30TH POLICE PRECINCT
451 WEST 151ST STREET
NEW YORK, NY 10028

UST
HIST UST

U001837716
N/A

Relative:
Higher

Site 1 of 2 in cluster AG

UST:

Actual:
116 ft.

UST:

Facility Id: 2-217328
Expiration Date: 10/15/07
Renewal Date: 06/04/02
Total Capacity: 14000
Facility Type: Not reported
Mailing Company: NYCPD BUILDING MAINTENANCE SECTION
Mailing Title: Not reported
Mailing Contact: SGT. MIKE SMITH
Mailing Address: 59-06 BROOKLYN-QUEENS EXPRESSWAY
Mailing Address 2: Not reported
Mailing City: QUEENS
Mailing State: NY
Mailing Zip Code: 11377
Mailing Phone No: (718) 476-6828
Mailing Email: Not reported
Owner Title: Not reported
Owner Name: Not reported
Owner Address: 1 POLICE PLAZA, ROOM 800
Owner Address 2: Not reported
Owner State: NY
Owner Zip Code: 10038
Owner Phone: (212) 374-7650
Owner Company: N.Y.C.P.D./ASD
Emergency Contact: FUEL CONTROL UNIT
Emergency Phone: (718) 476-7524
Operator: N.Y.C.P.D.
Operator Phone: (212) 690-8811
Owner City: NEW YORK
Owner Sub Type: Local Government
UTM X: 589104.91872
UTM Y: 4520277.85459

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s) EDR ID Number
EPA ID Number

30TH POLICE PRECINCT (Continued)

U001837716

Site Type Name: Other
Site Type Status: Active
Comments: Not reported

Program Type: PBS

Tank Number: 001
Tank Location Name: Underground
Tank Status: Closed - Removed
Tank Model: Not reported
Pipe Model: Not reported
Active Status: Inactive
Install Date: 07/01/69
Capacity Gallons: 550
Material Name: Gasoline
Percentage: 100.00
Tank Type Name: Steel/Carbon Steel/Iron
Tank Internal Protection: None
Tank Internal Protection 1: Painted/Asphalt Coating
Tank Internal Protection 2: Not reported
Pipe Location Name: No Piping
Pipe Type Name: Galvanized Steel
Pipe External Protection 1: None
Pipe External Protection 2: Not reported
Tank Secondary Containment 1: None
Tank Secondary Containment 2: Not reported
Pipe Secondary Containment: Not reported
Tank Leak Detection 1: None
Tank Leak Detection 2: Not reported
Pipe Leak Detection 1: Not reported
Pipe Leak Detection 2: Not reported
Type Of Overfill Prevention 1: Product Level Gauge (A/G)
Type Of Overfill Prevention 2: Not reported
Dispenser Method: Suction
Spill Prevention: Not reported
Tightness Test Method: Testing Not Required
Date Tested: / /
Next Test Date: / /
Date Tank Closed: 03/01/96

Tank Number: 002
Tank Location Name: Underground
Tank Status: Closed - Removed
Tank Model: Not reported
Pipe Model: Not reported
Active Status: Inactive
Install Date: 07/01/69
Capacity Gallons: 550
Material Name: Gasoline
Percentage: 100.00
Tank Type Name: Steel/Carbon Steel/Iron
Tank Internal Protection: None
Tank Internal Protection 1: Painted/Asphalt Coating
Tank Internal Protection 2: Not reported
Pipe Location Name: No Piping
Pipe Type Name: Galvanized Steel

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s)
EDR ID Number
EPA ID Number

30TH POLICE PRECINCT (Continued)

U001837716

Pipe External Protection 1: None
Pipe External Protection 2: Not reported
Tank Secondary Containment 1: None
Tank Secondary Containment 2: Not reported
Pipe Secondary Containment: Not reported
Tank Leak Detection 1: None
Tank Leak Detection 2: Not reported
Pipe Leak Detection 1: Not reported
Pipe Leak Detection 2: Not reported
Type Of Overfill Prevention 1: Product Level Gauge (A/G)
Type Of Overfill Prevention 2: Not reported
Dispenser Method: Suction
Spill Prevention: Not reported
Tightness Test Method: Testing Not Required
Date Tested: / /
Next Test Date: / /
Date Tank Closed: 03/01/96

Tank Number: 003
Tank Location Name: Underground
Tank Status: Closed - Removed
Tank Model: Not reported
Pipe Model: Not reported
Active Status: Inactive
Install Date: 07/01/69
Capacity Gallons: 550
Material Name: Gasoline
Percentage: 100.00
Tank Type Name: Steel/Carbon Steel/Iron
Tank Internal Protection: None
Tank Internal Protection 1: Painted/Asphalt Coating
Tank Internal Protection 2: Not reported
Pipe Location Name: No Piping
Pipe Type Name: Galvanized Steel
Pipe External Protection 1: None
Pipe External Protection 2: Not reported
Tank Secondary Containment 1: None
Tank Secondary Containment 2: Not reported
Pipe Secondary Containment: Not reported
Tank Leak Detection 1: None
Tank Leak Detection 2: Not reported
Pipe Leak Detection 1: Not reported
Pipe Leak Detection 2: Not reported
Type Of Overfill Prevention 1: Product Level Gauge (A/G)
Type Of Overfill Prevention 2: Not reported
Dispenser Method: Suction
Spill Prevention: Not reported
Tightness Test Method: Testing Not Required
Date Tested: / /
Next Test Date: / /
Date Tank Closed: 03/01/96

Tank Number: 004
Tank Location Name: Underground
Tank Status: Closed - Removed

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s) EDR ID Number
EPA ID Number

30TH POLICE PRECINCT (Continued)

U001837716

Tank Model: Not reported
Pipe Model: Not reported
Active Status: Inactive
Install Date: 07/01/69
Capacity Gallons: 550
Material Name: Gasoline
Percentage: 100.00
Tank Type Name: Steel/Carbon Steel/Iron
Tank Internal Protection: None
Tank Internal Protection 1: Painted/Asphalt Coating
Tank Internal Protection 2: Not reported
Pipe Location Name: No Piping
Pipe Type Name: Galvanized Steel
Pipe External Protection 1: None
Pipe External Protection 2: Not reported
Tank Secondary Containment 1: None
Tank Secondary Containment 2: Not reported
Pipe Secondary Containment: Not reported
Tank Leak Detection 1: None
Tank Leak Detection 2: Not reported
Pipe Leak Detection 1: Not reported
Pipe Leak Detection 2: Not reported
Type Of Overfill Prevention 1: Product Level Gauge (A/G)
Type Of Overfill Prevention 2: Not reported
Dispenser Method: Suction
Spill Prevention: Not reported
Tightness Test Method: Testing Not Required
Date Tested: / /
Next Test Date: / /
Date Tank Closed: 03/01/96

Tank Number: 005
Tank Location Name: Underground
Tank Status: Closed - Removed
Tank Model: Not reported
Pipe Model: Not reported
Active Status: Inactive
Install Date: 02/01/62
Capacity Gallons: 6000
Material Name: #2 Fuel Oil
Percentage: 100.00
Tank Type Name: Steel/Carbon Steel/Iron
Tank Internal Protection: None
Tank Internal Protection 1: Painted/Asphalt Coating
Tank Internal Protection 2: Not reported
Pipe Location Name: No Piping
Pipe Type Name: Steel/Carbon Steel/Iron
Pipe External Protection 1: None
Pipe External Protection 2: Not reported
Tank Secondary Containment 1: None
Tank Secondary Containment 2: Not reported
Pipe Secondary Containment: Not reported
Tank Leak Detection 1: None
Tank Leak Detection 2: Not reported
Pipe Leak Detection 1: Not reported
Pipe Leak Detection 2: Not reported

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s)
EDR ID Number
EPA ID Number

30TH POLICE PRECINCT (Continued)

U001837716

Type Of Overfill Prevention 1: Product Level Gauge (A/G)
Type Of Overfill Prevention 2: Not reported
Dispenser Method: Suction
Spill Prevention: Not reported
Tightness Test Method: Testing Not Required
Date Tested: / /
Next Test Date: / /
Date Tank Closed: 03/01/02

Tank Number: 006
Tank Location Name: Underground
Tank Status: Closed - In Place
Tank Model: Not reported
Pipe Model: Not reported
Active Status: Inactive
Install Date: / /
Capacity Gallons: 4000
Material Name: #2 Fuel Oil
Percentage: 100.00
Tank Type Name: Steel/Carbon Steel/Iron
Tank Internal Protection: None
Tank Internal Protection 1: Painted/Asphalt Coating
Tank Internal Protection 2: Not reported
Pipe Location Name: No Piping
Pipe Type Name: Steel/Carbon Steel/Iron
Pipe External Protection 1: None
Pipe External Protection 2: Not reported
Tank Secondary Containment 1: None
Tank Secondary Containment 2: Not reported
Pipe Secondary Containment: Not reported
Tank Leak Detection 1: None
Tank Leak Detection 2: Not reported
Pipe Leak Detection 1: Not reported
Pipe Leak Detection 2: Not reported
Type Of Overfill Prevention 1: Product Level Gauge (A/G)
Type Of Overfill Prevention 2: Not reported
Dispenser Method: Suction
Spill Prevention: Not reported
Tightness Test Method: Testing Not Required
Date Tested: / /
Next Test Date: / /
Date Tank Closed: 03/01/02

Tank Number: 007
Tank Location Name: Underground
Tank Status: In Service
Tank Model: Not reported
Pipe Model: Not reported
Active Status: Active
Install Date: 03/01/96
Capacity Gallons: 4000
Material Name: Gasoline
Percentage: 100.00
Tank Type Name: Fiberglass Reinforced Plastic (FRP)
Tank Internal Protection: Fiberglass Liner (FRP)

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s) EDR ID Number
EPA ID Number

30TH POLICE PRECINCT (Continued)

U001837716

Tank Internal Protection 1:	Fiberglass
Tank Internal Protection 2:	Not reported
Pipe Location Name:	Underground/On-ground
Pipe Type Name:	Fiberglass Reinforced Plastic (FRP)
Pipe External Protection 1:	Fiberglass
Pipe External Protection 2:	Not reported
Tank Secondary Containment 1:	Double-Walled (Underground)
Tank Secondary Containment 2:	Not reported
Pipe Secondary Containment:	Not reported
Tank Leak Detection 1:	Interstitial - Electronic Monitoring
Tank Leak Detection 2:	Not reported
Pipe Leak Detection 1:	Not reported
Pipe Leak Detection 2:	Not reported
Type Of Overfill Prevention 1:	High Level Alarm
Type Of Overfill Prevention 2:	Product Level Gauge (A/G)
Dispenser Method:	Suction
Spill Prevention:	Not reported
Tightness Test Method:	Testing Not Required
Date Tested:	/ /
Next Test Date:	03/01/11
Date Tank Closed:	/ /
Tank Number:	008
Tank Location Name:	Underground
Tank Status:	In Service
Tank Model:	Not reported
Pipe Model:	Not reported
Active Status:	Active
Install Date:	03/01/02
Capacity Gallons:	10000
Material Name:	#2 Fuel Oil
Percentage:	100.00
Tank Type Name:	Fiberglass Coated Steel
Tank Internal Protection:	None
Tank Internal Protection 1:	Fiberglass
Tank Internal Protection 2:	Not reported
Pipe Location Name:	Aboveground/Underground Combination
Pipe Type Name:	No Piping
Pipe External Protection 1:	Fiberglass
Pipe External Protection 2:	Not reported
Tank Secondary Containment 1:	Double-Walled (Underground)
Tank Secondary Containment 2:	Not reported
Pipe Secondary Containment:	Not reported
Tank Leak Detection 1:	Interstitial - Electronic Monitoring
Tank Leak Detection 2:	In-Tank System (ATG)
Pipe Leak Detection 1:	Exempt Suction Piping
Pipe Leak Detection 2:	Not reported
Type Of Overfill Prevention 1:	High Level Alarm
Type Of Overfill Prevention 2:	Not reported
Dispenser Method:	Suction
Spill Prevention:	Not reported
Tightness Test Method:	Testing Not Required
Date Tested:	/ /
Next Test Date:	/ /
Date Tank Closed:	/ /

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

30TH POLICE PRECINCT (Continued)

U001837716

HIST UST:

PBS Number: 2-217328
SPDES Number: Not reported
Emergency Contact: FUEL CONTROL UNIT
Emergency Telephone: (718) 476-7524
Operator: N.Y.C.P.D.
Operator Telephone: (212) 690-8811
Owner Name: N.Y.C.P.D./ASD
Owner Address: 1 POLICE PLAZA, ROOM 800
Owner City,St,Zip: NEW YORK, NY 10038
Owner Telephone: (212) 374-7650
Owner Type: Local Government
Owner Subtype: Not reported
Mailing Name: BUILDING MAINTENANCE SECTION
Mailing Address: 59-06 BROOKLYN-QUEENS EXPRESSWAY
Mailing Address 2: Not reported
Mailing City,St,Zip: QUEENS, NY 11377
Mailing Contact: COMMANDING OFFICER
Mailing Telephone: (718) 476-7576
Owner Mark: First Owner
Facility Status: 1 - Active PBS facility, i.e. total capacity of the PBS tanks is greater than 1,100 gallons, regardless if Subpart 360-14 tanks exist or not at the facility.

Facility Addr2: 451 W 151ST ST
SWIS ID: 6201
Old PBS Number: Not reported
Facility Type: OTHER
Inspected Date: Not reported
Inspector: Not reported
Inspection Result: Not reported
Federal ID: Not reported
Certification Flag: False
Certification Date: 03/11/1998
Expiration Date: 10/15/2002
Renew Flag: False
Renewal Date: Not reported
Total Capacity: 14000
FAMT: True
Facility Screen: No Missing Data
Owner Screen: No Missing Data
Tank Screen: Minor Data Missing
Dead Letter: False
CBS Number: Not reported
Town or City: NEW YORK CITY
County Code: 62
Town or City: 01
Region: 2

Tank Id: 001
Tank Location: UNDERGROUND
Tank Status: Closed-Removed
Install Date: 19690701
Capacity (gals): 550
Product Stored: UNLEADED GASOLINE
Tank Type: Steel/carbon steel
Tank Internal: None
Tank External: Painted/Asphalt Coating

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

30TH POLICE PRECINCT (Continued)

U001837716

Pipe Location: Not reported
Pipe Type: GALVANIZED STEEL
Pipe Internal: Not reported
Pipe External: None
Second Containment: None
Leak Detection: None
Overfill Prot: Product Level Gauge
Dispenser: Suction
Date Tested: Not reported
Next Test Date: Not reported
Missing Data for Tank: Minor Data Missing
Date Closed: 03/01/1996
Test Method: Not reported
Deleted: False
Updated: True
Lat/long: Not reported

Tank Id: 002
Tank Location: UNDERGROUND
Tank Status: Closed-Removed
Install Date: 19690701
Capacity (gals): 550
Product Stored: UNLEADED GASOLINE
Tank Type: Steel/carbon steel
Tank Internal: None
Tank External: Painted/Asphalt Coating
Pipe Location: Not reported
Pipe Type: GALVANIZED STEEL
Pipe Internal: Not reported
Pipe External: None
Second Containment: None
Leak Detection: None
Overfill Prot: Product Level Gauge
Dispenser: Suction
Date Tested: Not reported
Next Test Date: Not reported
Missing Data for Tank: Minor Data Missing
Date Closed: 03/01/1996
Test Method: Not reported
Deleted: False
Updated: True
Lat/long: Not reported

Tank Id: 003
Tank Location: UNDERGROUND
Tank Status: Closed-Removed
Install Date: 19690701
Capacity (gals): 550
Product Stored: UNLEADED GASOLINE
Tank Type: Steel/carbon steel
Tank Internal: None
Tank External: Painted/Asphalt Coating
Pipe Location: Not reported
Pipe Type: GALVANIZED STEEL
Pipe Internal: Not reported

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

30TH POLICE PRECINCT (Continued)

U001837716

Pipe External: None
Second Containment: None
Leak Detection: None
Overfill Prot: Product Level Gauge
Dispenser: Suction
Date Tested: Not reported
Next Test Date: Not reported
Missing Data for Tank: Minor Data Missing
Date Closed: 03/01/1996
Test Method: Not reported
Deleted: False
Updated: True
Lat/long: Not reported

Tank Id: 004
Tank Location: UNDERGROUND
Tank Status: Closed-Removed
Install Date: 19690701
Capacity (gals): 550
Product Stored: UNLEADED GASOLINE
Tank Type: Steel/carbon steel
Tank Internal: None
Tank External: Painted/Asphalt Coating
Pipe Location: Not reported
Pipe Type: GALVANIZED STEEL
Pipe Internal: Not reported
Pipe External: None
Second Containment: None
Leak Detection: None
Overfill Prot: Product Level Gauge
Dispenser: Suction
Date Tested: Not reported
Next Test Date: Not reported
Missing Data for Tank: Minor Data Missing
Date Closed: 03/01/1996
Test Method: Not reported
Deleted: False
Updated: True
Lat/long: Not reported

Tank Id: 005
Tank Location: UNDERGROUND
Tank Status: In Service
Install Date: 19620201
Capacity (gals): 6000
Product Stored: NOS 1,2, OR 4 FUEL OIL
Tank Type: Steel/carbon steel
Tank Internal: None
Tank External: Painted/Asphalt Coating
Pipe Location: Not reported
Pipe Type: STEEL/IRON
Pipe Internal: Not reported
Pipe External: None
Second Containment: None
Leak Detection: None

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

30TH POLICE PRECINCT (Continued)

U001837716

Overfill Prot: Product Level Gauge
Dispenser: Suction
Date Tested: Not reported
Next Test Date: 12/27/1987
Missing Data for Tank: Minor Data Missing
Date Closed: Not reported
Test Method: Not reported
Deleted: False
Updated: True
Lat/long: Not reported

Tank Id: 006
Tank Location: UNDERGROUND
Tank Status: In Service
Install Date: Not reported
Capacity (gals): 4000
Product Stored: NOS 1,2, OR 4 FUEL OIL
Tank Type: Steel/carbon steel
Tank Internal: None
Tank External: Painted/Asphalt Coating
Pipe Location: Not reported
Pipe Type: STEEL/IRON
Pipe Internal: Not reported
Pipe External: None
Second Containment: None
Leak Detection: None
Overfill Prot: Product Level Gauge
Dispenser: Suction
Date Tested: Not reported
Next Test Date: 12/27/1987
Missing Data for Tank: Minor Data Missing
Date Closed: Not reported
Test Method: Not reported
Deleted: False
Updated: True
Lat/long: Not reported

Tank Id: 007
Tank Location: UNDERGROUND
Tank Status: In Service
Install Date: 19960301
Capacity (gals): 4000
Product Stored: UNLEADED GASOLINE
Tank Type: Fiberglass reinforced plastic [FRP]
Tank Internal: Fiberglass Liner (FRP)
Tank External: Fiberglass
Pipe Location: Underground
Pipe Type: STAINLESS STEEL ALLOY
Pipe Internal: Fiberglass Liner (FRP)
Pipe External: Fiberglass
Second Containment: Vault (w/access)
Leak Detection: Electronic
Overfill Prot: High Level Alarm, Product Level Gauge
Dispenser: Suction
Date Tested: Not reported

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

30TH POLICE PRECINCT (Continued)

U001837716

Next Test Date: Not reported
Missing Data for Tank: No Missing Data
Date Closed: Not reported
Test Method: Not reported
Deleted: False
Updated: True
Lat/long: Not reported

AG127 30TH PRECINCT NYPD
SW 451 W 151ST ST
1/8-1/4 MANHATTAN, NY
1106 ft.

LTANKS S102233312
HIST LTANKS N/A

Relative:
Higher

Site 2 of 2 in cluster AG

Actual:
116 ft.

LTANKS:
Site ID: 142140
Spill Date: 04/18/96
Facility Addr2: Not reported
Facility ID: 9600861
Program Number: 9600861
SWIS: 3101
Region of Spill: 2
Investigator: jamaison
Referred To: Not reported
Reported to Dept: 04/18/96
CID: 15
Spill Cause: Tank Failure
Water Affected: Not reported
Spill Source: Commercial/Industrial
Spill Notifier: Other
Cleanup Ceased: / /
Cleanup Meets Standard: False
Last Inspection: / /
Recommended Penalty: Penalty Not Recommended
UST Involvement: True
Spill Class: Known release that creates potential for fire or hazard. DEC Response.
Willing Responsible Party. Corrective action taken.
Spill Closed Dt: 09/26/06
Remediation Phase: 0
Date Entered In Computer: 04/18/96
Spill Record Last Update: 09/27/06
Spille Namer: YOUNG LEE
Spiller Company: 30TH PRECINCT NYPD
Spiller Phone: (212) 545-7440
Spiller Extention: Not reported
Spiller Address: 451 W 151ST ST
Spiller City,St,Zip: MANHATTAN, NY
Spiller County: 001
Spiller Contact: YOUNG LEE
Spiller Phone: (212) 545-7440
Spiller Extention: Not reported
DEC Region: 2
Program Number: 9600861
DER Facility ID: 270708
Site ID: 142140
Operable Unit ID: 1028554
Operable Unit: 01
Material ID: 350696

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

30TH PRECINCT NYPD (Continued)

S102233312

Material Code: 0009
Material Name: Gasoline
Case No.: Not reported
Material FA: Petroleum
Quantity: 0.00
Units: Gallons
Recovered: 0.00
Resource Affected: Soil
Oxygenate: False
Site ID: Not reported
Spill Tank Test: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate: Not reported
Gross Fail: Not reported
Modified By: Not reported
Last Modified: Not reported
Test Method: Not reported
DEC Memo: Start DECRemark - 9600861 Prior to Sept, 2004 data translation this spill Lead DEC Field was "KOLLEENY" TRANSFERRED FROM Y.KRIMGOLD TO KOLLEENY TO I. ISLAM. 6/6/05- Site's only GW contamination is being treated by injecting Permeox Plus and monitoring the GW sampling results for VOCs, Napthalene and DO by URS Corp. since 2003.The VOCs in GW has reduced substantially but still persits in two wells exceeding GW quality guidance values. Routine monitoring to continue. - II 8/29/05- Reviewed Apr.-June/05 monitoring report. Wells MW-04 and MW-10 still show exceedances of VOCs. Well MW-03 had a s history of minor exceedances of VOCs and couldn't be sampled in the sampling event(Apr/05) due to inaccessibility. But MW-03 is excluded fromthe contamination plume as per Fig. 2D of this report. It is indicated in the report that some of the injection wells have plugged resulting in decrease in in-take of the injected Permeox Plus, and URS plans to install two new injection wells in the vicinity of wells MW-04 & MW-10 which exhibit elevated contaminant levels. The Dept. concurs with URS's plan but advises to include MW-03 for GW sampling and monitoring as well.- II 3/09/06: This spill transferred from I. Islam to Q. Abidi.5/04/06: Contacted to Ms. Jane Staten (URS) on phone. For this site drillers are on board, they plan to over drill some of the ORC injection well to help delineate the dissolve phase. MW-4 and MW-10 had high concentration when last sampled in August2005, but they decreased from previous round. The drilling work probably start in June 2006 by Envirotrac, when they get the lab contract approved. -QA 8/18/06 DEC lead transferred from Q. Abidi to J.A. Maisonave. - JAM 9/26/06 Received Request of Spill Closure dated Sept. 15, 2006. GW samples were taken on June 6 and July 31, 2006. Although the latest GW analytical data showed that three compounds exceeded criteria in wells MW-4 and MW-10, the contamination is very minor and will naturally attenuate over time. No exceedances of criteria were detected in the previous GW samples collected at these wells. GW is not a source of potable water, and there are no apparent exposure pathways since its an asphalt covered parking lot. This spill case will be closed and a NFA letter will be issued. - JAM END DECRemark - 9600861
Remarks: Start CallerRemark - 9600861 caller is removing tanks from site and found contaminated soil. Also see spill # 9515344. END CallerRemark - 9600861
HIST LTANKS:
Region of Spill: 2
Spill Number: 9600861
Investigator: KRIMGOLD
Caller Name: Not reported

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s)
EDR ID Number
EPA ID Number

30TH PRECINCT NYPD (Continued)

S102233312

Caller Agency: Not reported
Caller Phone: Not reported
Caller Extension: Not reported
Notifier Name: Not reported
Notifier Agency: Not reported
Notifier Phone: Not reported
Notifier Extension: Not reported
Spill Date: 04/18/1996
Spill Time: 11:00
Reported to Department Date: 04/18/96
Reported to Department Time: 12:29
SWIS: 62
Spiller Contact: YOUNG LEE
Spiller Phone: (212) 545-7440
Spiller Extension: Not reported
Spiller Name: 30TH PRECINCT NYPD
Spiller Address: 451 W 151ST ST
Spiller City,St,Zip: MANHATTAN, NY
Facility Contact: YOUNG LEE
Facility Phone: (212) 545-7440
Facility Extension: Not reported
Spill Cause: Tank Failure
Resource Affectd: On Land
Water Affected: Not reported
Spill Source: Other Commercial/Industrial
Spill Notifier: Other
PBS Number: Not reported
Cleanup Ceased: / /
Cleanup Meets Standard: False
Last Inspection: / /
Recommended Penalty: Penalty Not Recommended
Spiller Cleanup Date: / /
Enforcement Date: / /
Investigation Complete: / /
UST Involvement: False
Spill Class: Known release that creates potential for fire or hazard. DEC Response.
Willing Responsible Party. Corrective action taken.
Spill Closed Dt: / /
Date Region Sent Summary to Central Office: / /
Corrective Action Plan Submitted: / /
Date Spill Entered In Computer Data File: 04/18/96
Time Spill Entered In Computer Data File: Not reported
Spill Record Last Update: 08/06/96
Is Updated: False
PBS Number: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate Failed Tank: Not reported
Gross Leak Rate: Not reported
Material Class Type: Petroleum
Quantity Spilled: 0
Unkonwn Quantity Spilled: True
Units: Gallons
Quantity Recovered: 0
Unkonwn Quantity Recovered: False
Material: GASOLINE

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s) EDR ID Number
EPA ID Number

30TH PRECINCT NYPD (Continued)

S102233312

Class Type: GASOLINE
Times Material Entry In File: 21329
CAS Number: Not reported
Last Date: 19940929
DEC Remarks: Not reported
Spill Cause: caller is removing tanks from site and found contaminated soil

AD128 544 WEST 156TH H.D.F.C.
NW 544 WEST 156TH STREET
1/8-1/4 NEW YORK, NY 10032
1115 ft.

AST U003396087
HIST AST N/A

Site 3 of 4 in cluster AD

Relative:
Higher

AST:

Actual:
134 ft.

AST:

Region: STATE
Facility Id: 2-601233
UTM X: 589087.16484
UTM Y: 4520736.16653
Expiration Date: 11/24/07
Renewal Date: 07/08/02
Total Capacity: 3000
Facility Type: Not reported
Site Type Name: Apartment Building/Office Building
Site Type Status: Active
Mailing Company: 544 WEST 156 STREET TENANT ASSOC. H.D.F.C.
Mailing Title: Not reported
Mailing Contact: LARRY KLEIN
Mailing Address: 544 WEST 156 STREET #4W
Mailing Address 2: Not reported
Mailing City: NEW YORK
Mailing State: NY
Mailing Zip Code: 10032
Mailing Phone No: (212) 862-5083
Mailing Email: Not reported
Owner Title: Not reported
Owner Name: Not reported
Owner Address: 544 WEST 156TH H.D.F.C.
Owner Address 2: Not reported
Owner State: NY
Owner Zip Code: 10032
Owner Phone: (212) 862-5083
Owner Company: 544 WEST 156TH STREET H.D.F.C.
Emergency Contact: LARRY KLEIN
Emergency Phone: (212) 862-5083
Operator: LARRY KLEIN
Operator Phone: (212) 862-5083
Owner City: NEW YORK
Owner Sub Type: Corporate or Commercial
Program Type: PBS

Tank Number: 001
Tank Location Name: Aboveground on crib, rack, or cradle
Tank Status: In Service
Tank Model: Not reported
Pipe Model: Not reported
Active Status: Active

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s)
EDR ID Number
EPA ID Number

544 WEST 156TH H.D.F.C. (Continued)

U003396087

Install Date: / /
Capacity Gallons: 3000
Material Name: #2 Fuel Oil
Percentage: 100.00
Tank Type Name: Steel/Carbon Steel/Iron
Tank Internal Protection: None
Tank Internal Protection 1: None
Tank Internal Protection 2: Not reported
Pipe Location Name: Aboveground
Pipe Type Name: Steel/Carbon Steel/Iron
Pipe External Protection 1: None
Pipe External Protection 2: Not reported
Tank Secondary Containment 1: Vault (w/o access)
Tank Secondary Containment 2: Not reported
Pipe Secondary Containment: Not reported
Tank Leak Detection 1: None
Tank Leak Detection 2: Not reported
Pipe Leak Detection 1: Exempt Suction Piping
Pipe Leak Detection 2: Not reported
Type Of Overfill Prevention 1: Vent Whistle
Type Of Overfill Prevention 2: Not reported
Dispenser Method: Suction
Spill Prevention: Not reported
Tightness Test Method: Unknown
Date Tested: / /
Next Test Date: / /
Date Tank Closed: / /

HIST AST:

PBS Number: 2-601233
SWIS Code: 6201
Operator: LARRY KLEIN
Facility Phone: (212) 862-5083
Facility Addr2: 544 WEST 156TH STREET
Facility Type: APARTMENT BUILDING
Emergency: LARRY KLEIN
Emergency Tel: (212) 862-5083
Old PBSNO: Not reported
Date Inspected: Not reported
Inspector: Not reported
Result of Inspection: Not reported
Owner Name: 544 WEST 156TH STREET H.D.F.C.
Owner Address: 544 WEST 156TH H.D.F.C.
Owner City,St,Zip: NEW YORK, NY 10032
Federal ID: Not reported
Owner Tel: (212) 862-5083
Owner Type: Corporate/Commercial
Owner Subtype: Not reported
Mailing Contact: LARRY KLEIN
Mailing Name: 544 WEST 156 STREET TENANT ASSOC. H.D.F.C.
Mailing Address: 544 WEST 156 STREET #4W
Mailing Address 2: Not reported
Mailing City,St,Zip: NEW YORK, NY 10032
Mailing Telephone: (212) 862-5083
Owner Mark: First Owner
Facility Status: 1 - Active PBS facility, i.e. total capacity of the PBS tanks is greater than 1,100 gallons, regardless if Subpart 360-14 tanks exist

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

544 WEST 156TH H.D.F.C. (Continued)

EDR ID Number
EPA ID Number

Database(s)

U003396087

or not at the facility.
Certification Flag: False
Certification Date: 11/18/1997
Expiration: 11/24/2002
Renew Flag: False
Renew Date: Not reported
Total Capacity: 3000
FAMT: True
Facility Screen: No Missing Data
Owner Screen: No Missing Data
Tank Screen: No Missing Data
Dead Letter: False
CBS Number: Not reported
Town or City: NEW YORK CITY
County Code: 62
Town or City Code: 01
Region: 2

Tank ID: 001
Tank Location: ABOVEGROUND ON SADDLES LEGS, STILTS, RACK, OR CRADLE
Tank Status: In Service
Install Date: Not reported
Capacity (Gal): 3000
Product Stored: NOS 1,2, OR 4 FUEL OIL
Tank Type: Steel/carbon steel
Tank Internal: 0
Tank External: 00
Pipe Location: Aboveground
Pipe Type: STEEL/IRON
Pipe Internal: None
Pipe External: 00
Tank Containment: Diking
Leak Detection: 00
Overfill Protection: 06
Dispenser Method: Suction
Date Tested: Not reported
Next Test Date: Not reported
Missing Data for Tank: No Missing Data
Date Closed: Not reported
Test Method: Unknown
Deleted: False
Updated: True
SPDES Number: Not reported
Lat/Long: Not reported

AE129 WEST BRIDGE ASSOCIATES LP
WSW 510 WEST 152ND STREET
1/8-1/4 NEW YORK, NY 10031
1120 ft.

AST A100173486
N/A

Relative:
Higher

Site 3 of 3 in cluster AE

AST:

Actual:
136 ft.

AST:

Region: STATE
Facility Id: 2-601059
UTM X: 589008.69002
UTM Y: 4520404.03808

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s)
EDR ID Number
EPA ID Number

WEST BRIDGE ASSOCIATES LP (Continued)

A100173486

Expiration Date: 10/25/10
Renewal Date: / /
Total Capacity: 3000
Facility Type: Not reported
Site Type Name: Apartment Building/Office Building
Site Type Status: Active
Mailing Company: WEST BRIDGE REALTY
Mailing Title: Not reported
Mailing Contact: CHRIS CALHOUN
Mailing Address: 875 ST. NICHOLAS AVE
Mailing Address 2: Not reported
Mailing City: NEW YORK
Mailing State: NY
Mailing Zip Code: 10032
Mailing Phone No: (212) 694-3303
Mailing Email: Not reported
Owner Title: V.P.
Owner Name: CHRIS CALHOUN
Owner Address: 611 WEST 148TH STREET
Owner Address 2: Not reported
Owner State: NY
Owner Zip Code: 10031
Owner Phone: (212) 694-3303
Owner Company: WEST BRIDGE ASSOCIATES, LP
Emergency Contact: CHRIS CALHOUN
Emergency Phone: (718) 562-4363
Operator: ORLANDO TAVERAS
Operator Phone: (917) 578-2156
Owner City: NEW YORK
Owner Sub Type: Corporate or Commercial
Program Type: PBS

Tank Number: 001
Tank Location Name: Aboveground on crib, rack, or cradle
Tank Status: In Service
Tank Model: Not reported
Pipe Model: Not reported
Active Status: Active
Install Date: / /
Capacity Gallons: 3000
Material Name: #2 Fuel Oil
Percentage: 100.00
Tank Type Name: Steel/Carbon Steel/Iron
Tank Internal Protection: Epoxy Liner
Tank Internal Protection 1: None
Tank Internal Protection 2: Not reported
Pipe Location Name: Aboveground
Pipe Type Name: Galvanized Steel
Pipe External Protection 1: None
Pipe External Protection 2: Not reported
Tank Secondary Containment 1: Vault (w/o access)
Tank Secondary Containment 2: Not reported
Pipe Secondary Containment: Not reported
Tank Leak Detection 1: None
Tank Leak Detection 2: Not reported
Pipe Leak Detection 1: Not reported
Pipe Leak Detection 2: Not reported

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

WEST BRIDGE ASSOCIATES LP (Continued)

EDR ID Number
EPA ID Number

Database(s)

A100173486

Type Of Overfill Prevention 1: None
Type Of Overfill Prevention 2: Not reported
Dispenser Method: Not reported
Spill Prevention: Not reported
Tightness Test Method: Testing Not Required
Date Tested: / /
Next Test Date: / /
Date Tank Closed: / /

AH130 2918 8TH AVENUE ASSOCIATES
SE 2918 8TH AVE
1/8-1/4 NEW YORK, NY 10039
1123 ft.

AST U003388119
HIST AST N/A

Site 1 of 5 in cluster AH

Relative:
Lower

AST:

Actual:
17 ft.

AST:

Region: STATE
Facility Id: 2-256595
UTM X: 589620.92241
UTM Y: 4520295.64328
Expiration Date: 07/10/92
Renewal Date: / /
Total Capacity: 1500
Facility Type: Not reported
Site Type Name: Unknown
Site Type Status: Active
Mailing Company: 2918 8TH AVENUE ASSOCIATES
Mailing Title: Not reported
Mailing Contact: Not reported
Mailing Address: 253-24 NORTHERN BLVD-SUITE 201
Mailing Address 2: Not reported
Mailing City: LITTLE NECK
Mailing State: NY
Mailing Zip Code: 11363
Mailing Phone No: (718) 896-5633
Mailing Email: Not reported
Owner Title: Not reported
Owner Name: Not reported
Owner Address: P.O.BOX 7495
Owner Address 2: Not reported
Owner State: NY
Owner Zip Code: 11374
Owner Phone: (718) 896-5633
Owner Company: 2918 8TH AVENUE ASSOCIATES
Emergency Contact: LOUISE WOULIBY
Emergency Phone: (718) 896-5633
Operator: LOUISE WOULIBY
Operator Phone: (718) 896-5633
Owner City: REGO PARK
Owner Sub Type: Not reported
Program Type: PBS

Tank Number: 001
Tank Location Name: Aboveground on crib, rack, or cradle
Tank Status: In Service
Tank Model: Not reported

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s)
EDR ID Number
EPA ID Number

2918 8TH AVENUE ASSOCIATES (Continued)

U003388119

Pipe Model: Not reported
Active Status: Active
Install Date: / /
Capacity Gallons: 1500
Material Name: #2 Fuel Oil
Percentage: 100.00
Tank Type Name: Steel/Carbon Steel/Iron
Tank Internal Protection: None
Tank Internal Protection 1: None
Tank Internal Protection 2: Not reported
Pipe Location Name: No Piping
Pipe Type Name: No Piping
Pipe External Protection 1: None
Pipe External Protection 2: Not reported
Tank Secondary Containment 1: None
Tank Secondary Containment 2: Not reported
Pipe Secondary Containment: Not reported
Tank Leak Detection 1: None
Tank Leak Detection 2: Not reported
Pipe Leak Detection 1: Exempt Suction Piping
Pipe Leak Detection 2: Not reported
Type Of Overfill Prevention 1: Product Level Gauge (A/G)
Type Of Overfill Prevention 2: Not reported
Dispenser Method: Suction
Spill Prevention: Not reported
Tightness Test Method: Testing Not Required
Date Tested: / /
Next Test Date: / /
Date Tank Closed: / /

HIST AST:

PBS Number: 2-256595
SWIS Code: 6201
Operator: LOUISE WOULIBY
Facility Phone: (718) 896-5633
Facility Addr2: 2918 8TH AVE
Facility Type: Not reported
Emergency: LOUISE WOULIBY
Emergency Tel: (212) 293-0552
Old PBSNO: Not reported
Date Inspected: Not reported
Inspector: Not reported
Result of Inspection: Not reported
Owner Name: 2918 8TH AVENUE ASSOCIATES
Owner Address: P.O.BOX 7495
Owner City,St,Zip: REGO PARK, NY 11374
Federal ID: Not reported
Owner Tel: (718) 896-5633
Owner Type: Not reported
Owner Subtype: Not reported
Mailing Contact: Not reported
Mailing Name: 2918 8TH AVENUE ASSOCIATES
Mailing Address: 253-24 NORTHERN BLVD-SUITE 201
Mailing Address 2: Not reported
Mailing City,St,Zip: LITTLE NECK, NY 11363
Mailing Telephone: (718) 896-5633
Owner Mark: First Owner

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

2918 8TH AVENUE ASSOCIATES (Continued)

EDR ID Number
EPA ID Number

Database(s)

U003388119

Facility Status: 1 - Active PBS facility, i.e. total capacity of the PBS tanks is greater than 1,100 gallons, regardless if Subpart 360-14 tanks exist or not at the facility.

Certification Flag: False
Certification Date: 07/10/1987
Expiration: 07/10/1992
Renew Flag: False
Renew Date: Not reported
Total Capacity: 1500
FAMT: True
Facility Screen: Minor Data Missing
Owner Screen: Minor Data Missing
Tank Screen: Minor Data Missing
Dead Letter: True
CBS Number: Not reported
Town or City: NEW YORK CITY
County Code: 62
Town or City Code: 01
Region: 2

Tank ID: 001
Tank Location: ABOVEGROUND ON SADDLES LEGS, STILTS, RACK, OR CRADLE
Tank Status: In Service
Install Date: Not reported
Capacity (Gal): 1500
Product Stored: NOS 1,2, OR 4 FUEL OIL
Tank Type: Steel/carbon steel
Tank Internal: Not reported
Tank External: Not reported
Pipe Location: Not reported
Pipe Type: Not reported
Pipe Internal: Not reported
Pipe External: Not reported
Tank Containment: None
Leak Detection: 0
Overfill Protection: 4
Dispenser Method: Suction
Date Tested: Not reported
Next Test Date: Not reported
Missing Data for Tank: Minor Data Missing
Date Closed: Not reported
Test Method: Not reported
Deleted: False
Updated: False
SPDES Number: Not reported
Lat/Long: Not reported

AH131
SE
1/8-1/4
1130 ft.

MADAM C J WALKER HOUSES
2919 8 AVE
NEW YORK, NY 10039

AST U004047476
N/A

Relative:
Lower

Site 2 of 5 in cluster AH

AST:

Actual:
17 ft.

AST:

Region: STATE
Facility Id: 2-083801

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s) EDR ID Number
EPA ID Number

MADAM C J WALKER HOUSES (Continued)

U004047476

UTM X:	589616.57385
UTM Y:	4520313.46530
Expiration Date:	04/14/09
Renewal Date:	/ /
Total Capacity:	0
Facility Type:	NONE
Site Type Name:	Other
Site Type Status:	Unregulated
Mailing Company:	ECDO MANAGEMENT
Mailing Title:	Not reported
Mailing Contact:	LYDIA B. BLAKELY
Mailing Address:	443 WEST 125 STREET
Mailing Address 2:	Not reported
Mailing City:	NEW YORK
Mailing State:	NY
Mailing Zip Code:	10027
Mailing Phone No:	(212) 678-0037
Mailing Email:	Not reported
Owner Title:	VICE PRESIDENT
Owner Name:	LYDIA B. BLAKELY
Owner Address:	443 WEST 125 STREET
Owner Address 2:	Not reported
Owner State:	NY
Owner Zip Code:	10027
Owner Phone:	(212) 678-0037
Owner Company:	MADAM C J WALKER LLC
Emergency Contact:	EDMUND WISNANT
Emergency Phone:	(646) 235-7048
Operator:	ECDO MANAGEMENT
Operator Phone:	(212) 531-3211
Owner City:	NEW YORK
Owner Sub Type:	Corporate or Commercial
Program Type:	PBS
Tank Number:	001
Tank Location Name:	Aboveground - in contact with soil
Tank Status:	Closed - Removed
Tank Model:	Not reported
Pipe Model:	Not reported
Active Status:	Inactive
Install Date:	/ /
Capacity Gallons:	4000
Material Name:	#2 Fuel Oil
Percentage:	100.00
Tank Type Name:	Steel/Carbon Steel/Iron
Tank Internal Protection:	None
Tank Internal Protection 1:	None
Tank Internal Protection 2:	Not reported
Pipe Location Name:	No Piping
Pipe Type Name:	Steel/Carbon Steel/Iron
Pipe External Protection 1:	None
Pipe External Protection 2:	Not reported
Tank Secondary Containment 1:	Vault (w/o access)
Tank Secondary Containment 2:	Not reported
Pipe Secondary Containment:	Not reported
Tank Leak Detection 1:	None
Tank Leak Detection 2:	Not reported

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

MADAM C J WALKER HOUSES (Continued)

EDR ID Number
EPA ID Number

Database(s)

U004047476

Pipe Leak Detection 1: Not reported
Pipe Leak Detection 2: Not reported
Type Of Overfill Prevention 1: Product Level Gauge (A/G)
Type Of Overfill Prevention 2: Not reported
Dispenser Method: Suction
Spill Prevention: Not reported
Tightness Test Method: Testing Not Required
Date Tested: / /
Next Test Date: / /
Date Tank Closed: 04/30/03

AD132
NW
1/8-1/4
1132 ft.

546 WEST 156TH STREET HDFC
546 WEST 156TH STREET
NEW YORK, NY 10032

AST **U003395092**
HIST AST **N/A**

Site 4 of 4 in cluster AD

Relative:
Higher

AST:

Actual:
133 ft.

AST:

Region: STATE
Facility Id: 2-471542
UTM X: 589082.49656
UTM Y: 4520738.66376
Expiration Date: 04/27/08
Renewal Date: 01/08/03
Total Capacity: 4000
Facility Type: Not reported
Site Type Name: Apartment Building/Office Building
Site Type Status: Active
Mailing Company: 546 WEST 156TH STREET H.D.F.CORP
Mailing Title: Not reported
Mailing Contact: MA J. REYES MONTBLANC, HER L&D
Mailing Address: 601 WEST 136TH STREET,
Mailing Address 2: SUITE 1
Mailing City: NEW YORK
Mailing State: NY
Mailing Zip Code: 10031-8101
Mailing Phone No: (212) 862-5051
Mailing Email: Not reported
Owner Title: MANAGING DIRECTOR
Owner Name: REYES MONTBLANC
Owner Address: 601 WEST 136TH STREET, SUITE 1
Owner Address 2: Not reported
Owner State: NY
Owner Zip Code: 10031-8101
Owner Phone: (212) 862-5051
Owner Company: 546 WEST 156TH STREET H.D.F.CORP
Emergency Contact: J. REYES MONTBLANC
Emergency Phone: (212) 862-2648
Operator: 546 WEST 156TH STREET HDFC
Operator Phone: (212) 862-5051
Owner City: NEW YORK
Owner Sub Type: Corporate or Commercial
Program Type: PBS

Tank Number: 001
Tank Location Name: Aboveground on crib, rack, or cradle

Map ID
 Direction
 Distance
 Distance (ft.)
 Elevation Site

MAP FINDINGS

Database(s)
 EDR ID Number
 EPA ID Number

546 WEST 156TH STREET HDFC (Continued)

U003395092

Tank Status: In Service
 Tank Model: Not reported
 Pipe Model: Not reported
 Active Status: Active
 Install Date: / /
 Capacity Gallons: 4000
 Material Name: #2 Fuel Oil
 Percentage: 100.00
 Tank Type Name: Steel/Carbon Steel/Iron
 Tank Internal Protection: None
 Tank Internal Protection 1: None
 Tank Internal Protection 2: Not reported
 Pipe Location Name: Aboveground
 Pipe Type Name: Galvanized Steel
 Pipe External Protection 1: None
 Pipe External Protection 2: Not reported
 Tank Secondary Containment 1: Vault (w/o access)
 Tank Secondary Containment 2: Not reported
 Pipe Secondary Containment: Not reported
 Tank Leak Detection 1: None
 Tank Leak Detection 2: Not reported
 Pipe Leak Detection 1: None
 Pipe Leak Detection 2: Not reported
 Type Of Overfill Prevention 1: None
 Type Of Overfill Prevention 2: Not reported
 Dispenser Method: Suction
 Spill Prevention: None
 Tightness Test Method: Testing Not Required
 Date Tested: / /
 Next Test Date: / /
 Date Tank Closed: / /

HIST AST:

PBS Number: 2-471542
 SWIS Code: 6201
 Operator: GETRUDIS SEBASTIAN
 Facility Phone: (212) 234-1363
 Facility Addr2: 546 WEST 156TH STREET
 Facility Type: Not reported
 Emergency: GETRUDIS SEBASTIAN
 Emergency Tel: (212) 234-1363
 Old PBSNO: Not reported
 Date Inspected: Not reported
 Inspector: Not reported
 Result of Inspection: Not reported
 Owner Name: 546 WEST 156TH STREET H.D.F.C.
 Owner Address: 55 W. 125TH ST.#300/DEVE.OUTREACH, INC.
 Owner City,St,Zip: NEW YORK, NY 10027
 Federal ID: Not reported
 Owner Tel: (212) 234-1363
 Owner Type: Corporate/Commercial
 Owner Subtype: Not reported
 Mailing Contact: Not reported
 Mailing Name: DEVELOPMENT OUTREACH INC.
 Mailing Address: 546 WEST 154TH STREET H.D.F.C.
 Mailing Address 2: 55 WEST 125TH STREET SUITE 300
 Mailing City,St,Zip: NEW YORK, NY 10027

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

546 WEST 156TH STREET HDFC (Continued)

EDR ID Number
EPA ID Number

Database(s)

U003395092

Mailing Telephone: (212) 427-0320
Owner Mark: Second Owner
Facility Status: 1 - Active PBS facility, i.e. total capacity of the PBS tanks is greater than 1,100 gallons, regardless if Subpart 360-14 tanks exist or not at the facility.

Certification Flag: False
Certification Date: 05/07/1998
Expiration: 04/27/2003
Renew Flag: False
Renew Date: Not reported
Total Capacity: 3000
FAMT: True
Facility Screen: Minor Data Missing
Owner Screen: No Missing Data
Tank Screen: Minor Data Missing
Dead Letter: False
CBS Number: Not reported
Town or City: NEW YORK CITY
County Code: 62
Town or City Code: 01
Region: 2

Tank ID: 001
Tank Location: ABOVEGROUND
Tank Status: In Service
Install Date: Not reported
Capacity (Gal): 3000
Product Stored: NOS 1,2, OR 4 FUEL OIL
Tank Type: Steel/carbon steel
Tank Internal: Not reported
Tank External: Not reported
Pipe Location: Not reported
Pipe Type: GALVANIZED STEEL
Pipe Internal: Not reported
Pipe External: Not reported
Tank Containment: Diking
Leak Detection: 0
Overfill Protection: 4
Dispenser Method: Gravity
Date Tested: Not reported
Next Test Date: Not reported
Missing Data for Tank: Minor Data Missing
Date Closed: Not reported
Test Method: Not reported
Deleted: False
Updated: False
SPDES Number: Not reported
Lat/Long: Not reported

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

AH133
SE
1/8-1/4
1132 ft.

Site 3 of 5 in cluster AH

AST
HIST AST **U003389394**
 N/A

Relative:
Lower

AST:

Actual:
17 ft.

AST:

Region: STATE
Facility Id: 2-286605
UTM X: 589608.24834
UTM Y: 4520297.59897
Expiration Date: 08/24/07
Renewal Date: 04/04/02
Total Capacity: 3000
Facility Type: Not reported
Site Type Name: Apartment Building/Office Building
Site Type Status: Active
Mailing Company: HILDA BRATHWAITE ESSANDOH ETAL
Mailing Title: Not reported
Mailing Contact: HILDA ESSANDOH
Mailing Address: 548 WEST 165TH STREET
Mailing Address 2: Not reported
Mailing City: NEW YORK
Mailing State: NY
Mailing Zip Code: 10032
Mailing Phone No: Not reported
Mailing Email: Not reported
Owner Title: Not reported
Owner Name: Not reported
Owner Address: 548 W. 165 ST
Owner Address 2: Not reported
Owner State: NY
Owner Zip Code: 10032
Owner Phone: Not reported
Owner Company: HILDA BRATHWAITE ESSANDOH ETAL
Emergency Contact: HILDA B. ESSANDOH
Emergency Phone: Not reported
Operator: CHRISTOPHER BRATHWAITE
Operator Phone: Not reported
Owner City: NY
Owner Sub Type: Private Resident
Program Type: PBS

Tank Number: 001
Tank Location Name: Aboveground on crib, rack, or cradle
Tank Status: In Service
Tank Model: Not reported
Pipe Model: Not reported
Active Status: Active
Install Date: / /
Capacity Gallons: 3000
Material Name: #2 Fuel Oil
Percentage: 100.00
Tank Type Name: Steel/Carbon Steel/Iron
Tank Internal Protection: None
Tank Internal Protection 1: None
Tank Internal Protection 2: Not reported
Pipe Location Name: No Piping

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s)
EDR ID Number
EPA ID Number

2915 8TH AVE -OR- (Continued)

U003389394

Pipe Type Name: Steel/Carbon Steel/Iron
Pipe External Protection 1: None
Pipe External Protection 2: Not reported
Tank Secondary Containment 1: None
Tank Secondary Containment 2: Not reported
Pipe Secondary Containment: Not reported
Tank Leak Detection 1: None
Tank Leak Detection 2: Not reported
Pipe Leak Detection 1: Exempt Suction Piping
Pipe Leak Detection 2: Not reported
Type Of Overfill Prevention 1: Product Level Gauge (A/G)
Type Of Overfill Prevention 2: Not reported
Dispenser Method: Suction
Spill Prevention: Not reported
Tightness Test Method: Testing Not Required
Date Tested: / /
Next Test Date: / /
Date Tank Closed: / /

HIST AST:

PBS Number: 2-286605
SWIS Code: 6201
Operator: CHRISTOPHER BRATHWAITE
Facility Phone: (718) 297-0763
Facility Addr2: 2915 FREDERICK DOUGLASS BLVD
Facility Type: APARTMENT BUILDING
Emergency: HILDA B. ESSANDOH
Emergency Tel: (212) 795-1525
Old PBSNO: Not reported
Date Inspected: Not reported
Inspector: Not reported
Result of Inspection: Not reported
Owner Name: HILDA BRATHWAITE ESSANDOH ETAL
Owner Address: 545 W 187 ST
Owner City,St,Zip: NY, NY 10033
Federal ID: Not reported
Owner Tel: (212) 795-1525
Owner Type: Private Resident
Owner Subtype: Not reported
Mailing Contact: HILDA ESSANDOH
Mailing Name: HILDA BRATHWAITE ESSANDOH ETAL
Mailing Address: 548 WEST 165TH STREET
Mailing Address 2: Not reported
Mailing City,St,Zip: NEW YORK, NY 10032
Mailing Telephone: (212) 795-1525
Owner Mark: First Owner
Facility Status: 1 - Active PBS facility, i.e. total capacity of the PBS tanks is greater than 1,100 gallons, regardless if Subpart 360-14 tanks exist or not at the facility.
Certification Flag: False
Certification Date: 04/10/2001
Expiration: 08/24/2002
Renew Flag: False
Renew Date: Not reported
Total Capacity: 3000
FAMT: True
Facility Screen: No Missing Data

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

2915 8TH AVE -OR- (Continued)

EDR ID Number
EPA ID Number

Database(s)

U003389394

Owner Screen: No Missing Data
Tank Screen: Minor Data Missing
Dead Letter: False
CBS Number: Not reported
Town or City: NEW YORK CITY
County Code: 62
Town or City Code: 01
Region: 2

Tank ID: 001
Tank Location: ABOVEGROUND ON SADDLES LEGS, STILTS, RACK, OR CRADLE
Tank Status: In Service
Install Date: Not reported
Capacity (Gal): 3000
Product Stored: NOS 1,2, OR 4 FUEL OIL
Tank Type: Steel/carbon steel
Tank Internal: Not reported
Tank External: Not reported
Pipe Location: Not reported
Pipe Type: STEEL/IRON
Pipe Internal: Not reported
Pipe External: Not reported
Tank Containment: None
Leak Detection: 0
Overfill Protection: 4
Dispenser Method: Suction
Date Tested: Not reported
Next Test Date: Not reported
Missing Data for Tank: Minor Data Missing
Date Closed: Not reported
Test Method: Not reported
Deleted: False
Updated: True
SPDES Number: Not reported
Lat/Long: Not reported

AI134 WBD REALTY. LLC
North 463 WEST 159TH ST
1/8-1/4 NEW YORK, NY 10032
1134 ft.

AST U003395719
HIST AST N/A

Site 1 of 5 in cluster AI

Relative:
Higher

AST:

Actual:
155 ft.

AST:

Region: STATE
Facility Id: 2-600707
UTM X: 589393.81876
UTM Y: 4520852.33841
Expiration Date: 03/24/11
Renewal Date: 01/08/03
Total Capacity: 2000
Facility Type: Not reported
Site Type Name: Apartment Building/Office Building
Site Type Status: Active
Mailing Company: MIDD 159TH LLC
Mailing Title: Not reported
Mailing Contact: MICHAEL HERSHKOWITZ

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

WBD REALTY. LLC (Continued)

EDR ID Number
EPA ID Number

Database(s)

U003395719

Mailing Address: 160 EAST 56TH STREET, 5TH FL
Mailing Address 2: Not reported
Mailing City: NEW YORK'
Mailing State: NY
Mailing Zip Code: 10022
Mailing Phone No: (212) 879-6696
Mailing Email: Not reported
Owner Title: MANAGING PARTNER
Owner Name: MIDD 159TH LLC
Owner Address: 160 EAST 56TH STREET, 5TH FL
Owner Address 2: Not reported
Owner State: NY
Owner Zip Code: 10022
Owner Phone: (212) 879-6696
Owner Company: MIDD 159TH LLC
Emergency Contact: FRANKLIN SANCHEZ
Emergency Phone: (646) 523-8968
Operator: N/A
Operator Phone: N/A
Owner City: NEW YORK'
Owner Sub Type: Corporate or Commercial
Program Type: PBS

Tank Number: 1
Tank Location Name: Aboveground - in contact with soil
Tank Status: In Service
Tank Model: Not reported
Pipe Model: Not reported
Active Status: Active
Install Date: 01/01/09
Capacity Gallons: 2000
Material Name: #2 Fuel Oil
Percentage: 100.00
Tank Type Name: Steel/Carbon Steel/Iron
Tank Internal Protection: None
Tank Internal Protection 1: None
Tank Internal Protection 2: Not reported
Pipe Location Name: Aboveground
Pipe Type Name: Steel/Carbon Steel/Iron
Pipe External Protection 1: None
Pipe External Protection 2: Not reported
Tank Secondary Containment 1: None
Tank Secondary Containment 2: Not reported
Pipe Secondary Containment: Not reported
Tank Leak Detection 1: None
Tank Leak Detection 2: Not reported
Pipe Leak Detection 1: Exempt Suction Piping
Pipe Leak Detection 2: Not reported
Type Of Overfill Prevention 1: Automatic Shut-Off
Type Of Overfill Prevention 2: Not reported
Dispenser Method: Suction
Spill Prevention: Not reported
Tightness Test Method: Testing Not Required
Date Tested: / /
Next Test Date: / /
Date Tank Closed: / /

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

WBD REALTY. LLC (Continued)

EDR ID Number
EPA ID Number

Database(s)

U003395719

HIST AST:

PBS Number: 2-600707
SWIS Code: 6201
Operator: JOSE ANDRICKSON
Facility Phone: (917) 904-5736
Facility Addr2: 463 WEST 159TH ST
Facility Type: APARTMENT BUILDING
Emergency: JOSE ANDRICKSON
Emergency Tel: (212) 740-3994
Old PBSNO: Not reported
Date Inspected: Not reported
Inspector: Not reported
Result of Inspection: Not reported
Owner Name: WBD REALTY, LLC
Owner Address: 185 BRIDGE PLAZA NOARTH SUITE 301
Owner City,St,Zip: FORT LEE, NJ 07024
Federal ID: Not reported
Owner Tel: (201) 944-6300
Owner Type: Corporate/Commercial
Owner Subtype: Not reported
Mailing Contact: ELIOT C. NISENBAUM
Mailing Name: KINGSLEY REALTY HOLDINGS, LTD
Mailing Address: 185 BRIDGE PLAZA NORTH
Mailing Address 2: SUITE 301
Mailing City,St,Zip: FORT LEE, NJ 07024
Mailing Telephone: (201) 944-6300
Owner Mark: Second Owner
Facility Status: 1 - Active PBS facility, i.e. total capacity of the PBS tanks is greater than 1,100 gallons, regardless if Subpart 360-14 tanks exist or not at the facility.

Certification Flag: False
Certification Date: 05/21/1998
Expiration: 04/09/2003
Renew Flag: False
Renew Date: Not reported
Total Capacity: 2000
FAMT: True
Facility Screen: No Missing Data
Owner Screen: No Missing Data
Tank Screen: No Missing Data
Dead Letter: False
CBS Number: Not reported
Town or City: NEW YORK CITY
County Code: 62
Town or City Code: 01
Region: 2

Tank ID: 1
Tank Location: ABOVEGROUND
Tank Status: In Service
Install Date: Not reported
Capacity (Gal): 2000
Product Stored: NOS 1,2, OR 4 FUEL OIL
Tank Type: Steel/carbon steel
Tank Internal: 0
Tank External: 00
Pipe Location: Aboveground

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

WBD REALTY. LLC (Continued)

EDR ID Number
EPA ID Number

Database(s)

U003395719

Pipe Type: STEEL/IRON
Pipe Internal: None
Pipe External: 00
Tank Containment: None
Leak Detection: 00
Overfill Protection: 3
Dispenser Method: Suction
Date Tested: Not reported
Next Test Date: Not reported
Missing Data for Tank: No Missing Data
Date Closed: Not reported
Test Method: Not reported
Deleted: False
Updated: True
SPDES Number: Not reported
Lat/Long: Not reported

AH135
SE
1/8-1/4
1133 ft.

303 WEST 154TH ST
303 W 154TH ST
NEW YORK, NY 10039

UST U004076962
N/A

Site 4 of 5 in cluster AH

Relative:
Lower

UST:

Actual:
16 ft.

UST:

Facility Id: 2-196428
Expiration Date: 07/20/07
Renewal Date: 03/08/02
Total Capacity: 4000
Facility Type: Not reported
Mailing Company: LAWJOY REALTY CORP
Mailing Title: Not reported
Mailing Contact: MIKE KEY
Mailing Address: 5014 16TH AVE
Mailing Address 2: SUITE 191
Mailing City: BROOKLYN
Mailing State: NY
Mailing Zip Code: 11204
Mailing Phone No: (718) 677-1667
Mailing Email: Not reported
Owner Title: Not reported
Owner Name: Not reported
Owner Address: 2302 NOSTRAND AVENUE #4547
Owner Address 2: Not reported
Owner State: NY
Owner Zip Code: 11210
Owner Phone: (718) 677-1667
Owner Company: LAWJOY REALTY CORP
Emergency Contact: MIKE KEY
Emergency Phone: (718) 677-1667
Operator: ROBERT CRASON
Operator Phone: (212) 862-4511
Owner City: BROOKLYN
Owner Sub Type: Corporate or Commercial
UTM X: 589589.51198
UTM Y: 4520284.82606
Site Type Name: Apartment Building/Office Building

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

303 WEST 154TH ST (Continued)

EDR ID Number
EPA ID Number

Database(s)

U004076962

Site Type Status: Active
Comments: Not reported

Program Type: PBS

Tank Number: 001
Tank Location Name: Underground, vaulted, with access
Tank Status: In Service
Tank Model: Not reported
Pipe Model: Not reported
Active Status: Active
Install Date: / /
Capacity Gallons: 4000
Material Name: #6 Fuel Oil
Percentage: 100.00
Tank Type Name: Steel/Carbon Steel/Iron
Tank Internal Protection: None
Tank Internal Protection 1: None
Tank Internal Protection 2: Not reported
Pipe Location Name: No Piping
Pipe Type Name: Steel/Carbon Steel/Iron
Pipe External Protection 1: None
Pipe External Protection 2: Not reported
Tank Secondary Containment 1: None
Tank Secondary Containment 2: Not reported
Pipe Secondary Containment: Not reported
Tank Leak Detection 1: None
Tank Leak Detection 2: Not reported
Pipe Leak Detection 1: Exempt Suction Piping
Pipe Leak Detection 2: Not reported
Type Of Overfill Prevention 1: Product Level Gauge (A/G)
Type Of Overfill Prevention 2: Not reported
Dispenser Method: Suction
Spill Prevention: Not reported
Tightness Test Method: Testing Not Required
Date Tested: / /
Next Test Date: / /
Date Tank Closed: / /

AH136 303 WEST 154TH ST
SE 303 W 154TH ST
1/8-1/4 NEW YORK, NY 10039
1133 ft.

HIST UST U000402004
N/A

Site 5 of 5 in cluster AH

Relative:
Lower

HIST UST:
PBS Number: 2-196428
SPDES Number: Not reported
Emergency Contact: ALAN R BUSH
Emergency Telephone: (212) 795-1555
Operator: ROBERT CRASON
Operator Telephone: (212) 862-4511
Owner Name: LAWJOY REALTY CORP
Owner Address: 2460 LEMOINE AVENUE 3RD FLOOR
Owner City,St,Zip: FORT LEE, NJ 07024
Owner Telephone: (212) 795-1555
Owner Type: Corporate/Commercial
Owner Subtype: Not reported

Actual:
16 ft.

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

303 WEST 154TH ST (Continued)

U000402004

Mailing Name: ALAN BUSH INC.
Mailing Address: 2460 LEMOINE AVE 3RD FL.
Mailing Address 2: Not reported
Mailing City,St,Zip: FORT LEE, NJ 07024
Mailing Contact: Not reported
Mailing Telephone: (212) 795-1555
Owner Mark: First Owner
Facility Status: 1 - Active PBS facility, i.e. total capacity of the PBS tanks is greater than 1,100 gallons, regardless if Subpart 360-14 tanks exist or not at the facility.

Facility Addr2: 303 W 154TH ST
SWIS ID: 6201
Old PBS Number: Not reported
Facility Type: APARTMENT BUILDING
Inspected Date: Not reported
Inspector: Not reported
Inspection Result: Not reported
Federal ID: Not reported
Certification Flag: False
Certification Date: 07/10/1997
Expiration Date: 07/20/2002
Renew Flag: False
Renewal Date: Not reported
Total Capacity: 4000
FAMT: True
Facility Screen: No Missing Data
Owner Screen: No Missing Data
Tank Screen: Minor Data Missing
Dead Letter: False
CBS Number: Not reported
Town or City: NEW YORK CITY
County Code: 62
Town or City: 01
Region: 2

Tank Id: 001
Tank Location: UNDERGROUND, VAULTED, WITH ACCESS
Tank Status: In Service
Install Date: Not reported
Capacity (gals): 4000
Product Stored: NOS 5 OR 6 FUEL OIL
Tank Type: Steel/carbon steel
Tank Internal: Not reported
Tank External: Not reported
Pipe Location: Not reported
Pipe Type: STEEL/IRON
Pipe Internal: Not reported
Pipe External: Not reported
Second Containment: None
Leak Detection: None
Overfill Prot: Product Level Gauge
Dispenser: Suction
Date Tested: Not reported
Next Test Date: Not reported
Missing Data for Tank: Minor Data Missing
Date Closed: Not reported
Test Method: Not reported

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

303 WEST 154TH ST (Continued)

U000402004

Deleted: False
Updated: False
Lat/long: Not reported

AF137 BUILDING 512 W 158 ST
NNW 512 W 158 ST
1/8-1/4 NEW YORK, NY 10032
1134 ft.

AST U003390201
HIST AST N/A

Relative:
Higher

Site 3 of 5 in cluster AF

AST:

Actual:
146 ft.

AST:

Region: STATE
Facility Id: 2-208957
UTM X: 589235.32605
UTM Y: 4520834.54543
Expiration Date: 01/06/08
Renewal Date: / /
Total Capacity: 3000
Facility Type: Not reported
Site Type Name: Apartment Building/Office Building
Site Type Status: Active
Mailing Company: WEST 158TH MNGMNT LLC
Mailing Title: Not reported
Mailing Contact: PHIL JACOBS
Mailing Address: 31 GRIFFEN AVENUE
Mailing Address 2: #101
Mailing City: SCARSDALE
Mailing State: NY
Mailing Zip Code: 10583
Mailing Phone No: (914) 725-1711
Mailing Email: Not reported
Owner Title: Not reported
Owner Name: Not reported
Owner Address: 31 GRIFFEN AVE #101
Owner Address 2: Not reported
Owner State: NY
Owner Zip Code: 10583
Owner Phone: (914) 725-1711
Owner Company: WEST 158TH MNGMNT LLC
Emergency Contact: PHIL JACOBS
Emergency Phone: (914) 725-1711
Operator: HECTOR GONZALEZ
Operator Phone: (914) 898-2893
Owner City: SCARSDALE
Owner Sub Type: Corporate or Commercial
Program Type: PBS

Tank Number: 001
Tank Location Name: Aboveground - in contact with soil
Tank Status: In Service
Tank Model: Not reported
Pipe Model: Not reported
Active Status: Active
Install Date: 12/01/53
Capacity Gallons: 3000
Material Name: #2 Fuel Oil

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s)
EDR ID Number
EPA ID Number

BUILDING 512 W 158 ST (Continued)

U003390201

Percentage: 100.00
Tank Type Name: Steel/Carbon Steel/Iron
Tank Internal Protection: None
Tank Internal Protection 1: Painted/Asphalt Coating
Tank Internal Protection 2: Not reported
Pipe Location Name: Aboveground
Pipe Type Name: Steel/Carbon Steel/Iron
Pipe External Protection 1: Painted/Asphalt Coating
Pipe External Protection 2: Not reported
Tank Secondary Containment 1: None
Tank Secondary Containment 2: Not reported
Pipe Secondary Containment: Not reported
Tank Leak Detection 1: None
Tank Leak Detection 2: Not reported
Pipe Leak Detection 1: Exempt Suction Piping
Pipe Leak Detection 2: Not reported
Type Of Overfill Prevention 1: Product Level Gauge (A/G)
Type Of Overfill Prevention 2: Not reported
Dispenser Method: Suction
Spill Prevention: Not reported
Tightness Test Method: Testing Not Required
Date Tested: / /
Next Test Date: / /
Date Tank Closed: / /

HIST AST:

PBS Number: 2-208957
SWIS Code: 6201
Operator: GUILLERMO CASTILLO
Facility Phone: (212) 927-1409
Facility Addr2: 512 W 158 ST
Facility Type: Not reported
Emergency: GUILLERMO CASTILLO
Emergency Tel: (212) 927-1409
Old PBSNO: Not reported
Date Inspected: Not reported
Inspector: Not reported
Result of Inspection: Not reported
Owner Name: JAFRUD REALTY CORP
Owner Address: 408 W 130 ST PO BOX 101
Owner City,St,Zip: NEW YORK, NY 10027
Federal ID: Not reported
Owner Tel: (212) 222-1141
Owner Type: Not reported
Owner Subtype: Not reported
Mailing Contact: Not reported
Mailing Name: MARTHIE L. THOMPSON
Mailing Address: 335 BROADWAY
Mailing Address 2: Not reported
Mailing City,St,Zip: NEW YORK, NY 10013
Mailing Telephone: (212) 222-1141
Owner Mark: First Owner
Facility Status: 1 - Active PBS facility, i.e. total capacity of the PBS tanks is greater than 1,100 gallons, regardless if Subpart 360-14 tanks exist or not at the facility.
Certification Flag: False
Certification Date: 08/24/1987

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

BUILDING 512 W 158 ST (Continued)

EDR ID Number
EPA ID Number

Database(s)

U003390201

Expiration: 08/24/1992
Renew Flag: False
Renew Date: Not reported
Total Capacity: 3000
FAMT: True
Facility Screen: Minor Data Missing
Owner Screen: Minor Data Missing
Tank Screen: Minor Data Missing
Dead Letter: True
CBS Number: Not reported
Town or City: NEW YORK CITY
County Code: 62
Town or City Code: 01
Region: 2

Tank ID: 001
Tank Location: ABOVEGROUND
Tank Status: In Service
Install Date: 19531201
Capacity (Gal): 3000
Product Stored: NOS 1,2, OR 4 FUEL OIL
Tank Type: Steel/carbon steel
Tank Internal: Not reported
Tank External: Not reported
Pipe Location: Not reported
Pipe Type: GALVANIZED STEEL
Pipe Internal: Not reported
Pipe External: Not reported
Tank Containment: None
Leak Detection: 0
Overfill Protection: 4
Dispenser Method: Suction
Date Tested: Not reported
Next Test Date: Not reported
Missing Data for Tank: Minor Data Missing
Date Closed: Not reported
Test Method: Not reported
Deleted: False
Updated: False
SPDES Number: Not reported
Lat/Long: Not reported

138
SSW
1/8-1/4
1137 ft.

M-D
813 ST NICHOLAS AVE
NEW YORK CITY, NY 10031

AST **U003388118**
HIST AST **N/A**

Relative:
Lower

AST:

AST:

Actual:
102 ft.

Region: STATE
Facility Id: 2-256579
UTM X: 589185.91839
UTM Y: 4520176.91273
Expiration Date: 01/14/10
Renewal Date: 04/04/02
Total Capacity: 1500
Facility Type: Not reported

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s) EDR ID Number
EPA ID Number

M-D (Continued)

U003388118

Site Type Name: Apartment Building/Office Building
Site Type Status: Active
Mailing Company: WESLEY BROWN & RAQUEL C. BROWN
Mailing Title: MANAGER
Mailing Contact: RAQUEL C. BROWN
Mailing Address: 365 WEST 125TH ST. #2942
Mailing Address 2: Not reported
Mailing City: NEW YORK
Mailing State: NY
Mailing Zip Code: 10027
Mailing Phone No: Not reported
Mailing Email: Not reported
Owner Title: MANAGER
Owner Name: RAQUEL C. BROWN
Owner Address: 365 WEST 125TH ST. #2942
Owner Address 2: Not reported
Owner State: NY
Owner Zip Code: 10027
Owner Phone: Not reported
Owner Company: WESLEY BROWN & RAQUEL C. BROWN
Emergency Contact: WESLEY D. BROWN & RAQUEL C. BROWN
Emergency Phone: Not reported
Operator: WESLEY D. BROWN
Operator Phone: Not reported
Owner City: NEW YORK
Owner Sub Type: Private Resident
Program Type: PBS

Tank Number: 001
Tank Location Name: Aboveground - in contact with soil
Tank Status: In Service
Tank Model: Not reported
Pipe Model: Not reported
Active Status: Active
Install Date: / /
Capacity Gallons: 1500
Material Name: #2 Fuel Oil
Percentage: 100.00
Tank Type Name: Steel/Carbon Steel/Iron
Tank Internal Protection: None
Tank Internal Protection 1: None
Tank Internal Protection 2: Not reported
Pipe Location Name: No Piping
Pipe Type Name: Galvanized Steel
Pipe External Protection 1: None
Pipe External Protection 2: Not reported
Tank Secondary Containment 1: Vault (w/o access)
Tank Secondary Containment 2: Not reported
Pipe Secondary Containment: Not reported
Tank Leak Detection 1: None
Tank Leak Detection 2: Not reported
Pipe Leak Detection 1: Not reported
Pipe Leak Detection 2: Not reported
Type Of Overfill Prevention 1: Product Level Gauge (A/G)
Type Of Overfill Prevention 2: Not reported
Dispenser Method: Suction
Spill Prevention: Not reported

Map ID
Direction
Distance
Distance (ft.)
Elevation

Site

MAP FINDINGS

Database(s)

EDR ID Number
EPA ID Number

M-D (Continued)

U003388118

Tightness Test Method: Testing Not Required
Date Tested: / /
Next Test Date: / /
Date Tank Closed: / /

HIST AST:

PBS Number: 2-256579
SWIS Code: 6201
Operator: WILLIAM RANDOLPH
Facility Phone: (212) 283-9655
Facility Addr2: 813 ST NICHOLAS AVE
Facility Type: APARTMENT BUILDING
Emergency: WILLIAM RANDOLPH
Emergency Tel: (212) 283-9655
Old PBSNO: Not reported
Date Inspected: Not reported
Inspector: Not reported
Result of Inspection: Not reported
Owner Name: WILLIAM RANDOLPH
Owner Address: 1620 SEDGWICK AVE
Owner City,St,Zip: BRONX, NY 10453
Federal ID: Not reported
Owner Tel: (212) 583-9056
Owner Type: Corporate/Commercial
Owner Subtype: Not reported
Mailing Contact: Not reported
Mailing Name: WILLIAM RANDOLPH
Mailing Address: 1620 SEDGWICK AVE
Mailing Address 2: Not reported
Mailing City,St,Zip: BRONX, NY 10453
Mailing Telephone: (212) 583-9056
Owner Mark: First Owner
Facility Status: 1 - Active PBS facility, i.e. total capacity of the PBS tanks is greater than 1,100 gallons, regardless if Subpart 360-14 tanks exist or not at the facility.

Certification Flag: False
Certification Date: 08/01/1997
Expiration: 08/24/2002
Renew Flag: False
Renew Date: Not reported
Total Capacity: 1500
FAMT: True
Facility Screen: No Missing Data
Owner Screen: Minor Data Missing
Tank Screen: Minor Data Missing
Dead Letter: False
CBS Number: Not reported
Town or City: NEW YORK CITY
County Code: 62
Town or City Code: 01
Region: 2

Tank ID: 001
Tank Location: ABOVEGROUND
Tank Status: In Service
Install Date: Not reported
Capacity (Gal): 1500

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

M-D (Continued)

EDR ID Number
EPA ID Number

U003388118

Product Stored: LEADED GASOLINE
Tank Type: Steel/carbon steel
Tank Internal: Not reported
Tank External: Not reported
Pipe Location: Not reported
Pipe Type: GALVANIZED STEEL
Pipe Internal: Not reported
Pipe External: Not reported
Tank Containment: Diking
Leak Detection: 0
Overfill Protection: 4
Dispenser Method: Suction
Date Tested: Not reported
Next Test Date: Not reported
Missing Data for Tank: Minor Data Missing
Date Closed: Not reported
Test Method: Not reported
Deleted: False
Updated: False
SPDES Number: Not reported
Lat/Long: Not reported

AI139 537 REALTY ASSOCIATES, LLC
North 470 WEST 159TH STREET
1/8-1/4 NEW YORK, NY 10031
1138 ft.

AST A100183589
N/A

Site 2 of 5 in cluster AI

Relative:
Higher

AST:

Actual:
156 ft.

AST:

Region: STATE
Facility Id: 2-607032
UTM X: 589363.64872
UTM Y: 4520828.50465
Expiration Date: 11/26/08
Renewal Date: / /
Total Capacity: 1500
Facility Type: Not reported
Site Type Name: Apartment Building/Office Building
Site Type Status: Active
Mailing Company: J&M REALTY CORP.
Mailing Title: Not reported
Mailing Contact: PAUL JACCOM
Mailing Address: 21 WEST 86TH STREET
Mailing Address 2: Not reported
Mailing City: NEW YORK
Mailing State: NY
Mailing Zip Code: 10024
Mailing Phone No: (212) 721-0424
Mailing Email: Not reported
Owner Title: Not reported
Owner Name: Not reported
Owner Address: 21 WEST 86TH ST
Owner Address 2: Not reported
Owner State: NY
Owner Zip Code: 10024
Owner Phone: (212) 721-0424

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s) EDR ID Number
EPA ID Number

537 REALTY ASSOCIATES, LLC (Continued)

A100183589

Owner Company: 537 REALTY ASSOCIATES, LLC
Emergency Contact: STEVEN JACKSON
Emergency Phone: (917) 731-6534
Operator: RAFAEL BLANCO
Operator Phone: (347) 386-6798
Owner City: NEW YORK
Owner Sub Type: Corporate or Commercial
Program Type: PBS

Tank Number: 001
Tank Location Name: Aboveground - in contact with soil
Tank Status: In Service
Tank Model: Not reported
Pipe Model: Not reported
Active Status: Active
Install Date: / /
Capacity Gallons: 1500
Material Name: #2 Fuel Oil
Percentage: 100.00
Tank Type Name: Steel/Carbon Steel/Iron
Tank Internal Protection: None
Tank Internal Protection 1: None
Tank Internal Protection 2: Not reported
Pipe Location Name: Aboveground
Pipe Type Name: Galvanized Steel
Pipe External Protection 1: None
Pipe External Protection 2: Not reported
Tank Secondary Containment 1: None
Tank Secondary Containment 2: Not reported
Pipe Secondary Containment: Not reported
Tank Leak Detection 1: None
Tank Leak Detection 2: Not reported
Pipe Leak Detection 1: Not reported
Pipe Leak Detection 2: Not reported
Type Of Overfill Prevention 1: None
Type Of Overfill Prevention 2: Not reported
Dispenser Method: None
Spill Prevention: Not reported
Tightness Test Method: Testing Not Required
Date Tested: / /
Next Test Date: / /
Date Tank Closed: / /

AI140 WBD REALTY, LLC
North 465 WEST 159TH ST
1/8-1/4 NEW YORK, NY 10032
1141 ft.

AST U003395720
HIST AST N/A

Relative: Site 3 of 5 in cluster AI

Higher AST:

Actual: AST:
156 ft. Region: STATE
Facility Id: 2-600708
UTM X: 589391.35611
UTM Y: 4520853.75191
Expiration Date: 03/24/11
Renewal Date: 01/08/03

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s)
EDR ID Number
EPA ID Number

WBD REALTY, LLC (Continued)

U003395720

Total Capacity: 2000
Facility Type: Not reported
Site Type Name: Apartment Building/Office Building
Site Type Status: Active
Mailing Company: MIDD 159TH LLC
Mailing Title: MANAGING PARTNER
Mailing Contact: MICHAEL HERSHKOWITZ
Mailing Address: 160 EAST 56TH STREET, 5TH FL
Mailing Address 2: Not reported
Mailing City: NEW YORK
Mailing State: NY
Mailing Zip Code: 10022
Mailing Phone No: (212) 879-6696
Mailing Email: Not reported
Owner Title: MANAGING PARTNER
Owner Name: MICHAEL HERSHKOWITZ
Owner Address: 160 EAST 56TH STREET, 5TH FL
Owner Address 2: Not reported
Owner State: NY
Owner Zip Code: 10022
Owner Phone: (212) 879-6696
Owner Company: MIDD 159TH LLC
Emergency Contact: FRANKLIN SANCHEZ
Emergency Phone: (646) 523-8968
Operator: N/A
Operator Phone: N/A
Owner City: NEW YORK
Owner Sub Type: Corporate or Commercial
Program Type: PBS

Tank Number: 1
Tank Location Name: Aboveground - in contact with soil
Tank Status: In Service
Tank Model: Not reported
Pipe Model: Not reported
Active Status: Active
Install Date: 01/01/09
Capacity Gallons: 2000
Material Name: #2 Fuel Oil
Percentage: 100.00
Tank Type Name: Steel/Carbon Steel/Iron
Tank Internal Protection: None
Tank Internal Protection 1: None
Tank Internal Protection 2: Not reported
Pipe Location Name: Aboveground
Pipe Type Name: Steel/Carbon Steel/Iron
Pipe External Protection 1: None
Pipe External Protection 2: Not reported
Tank Secondary Containment 1: None
Tank Secondary Containment 2: Not reported
Pipe Secondary Containment: Not reported
Tank Leak Detection 1: None
Tank Leak Detection 2: Not reported
Pipe Leak Detection 1: Exempt Suction Piping
Pipe Leak Detection 2: Not reported
Type Of Overfill Prevention 1: Automatic Shut-Off
Type Of Overfill Prevention 2: Not reported

Map ID
Direction
Distance
Distance (ft.)
Elevation

Site

MAP FINDINGS

Database(s)

EDR ID Number
EPA ID Number

WBD REALTY, LLC (Continued)

U003395720

Dispenser Method: Suction
Spill Prevention: Not reported
Tightness Test Method: Testing Not Required
Date Tested: / /
Next Test Date: / /
Date Tank Closed: / /

HIST AST:

PBS Number: 2-600708
SWIS Code: 6201
Operator: JOSE ANDRICKSON
Facility Phone: (917) 904-5736
Facility Addr2: 465 WEST 159TH ST
Facility Type: Not reported
Emergency: JOSE ANDRICKSON
Emergency Tel: (212) 740-3994
Old PBSNO: Not reported
Date Inspected: Not reported
Inspector: Not reported
Result of Inspection: Not reported
Owner Name: WBD REALTY LLC
Owner Address: 185 BRIDGE PLAZA NORTH, SUITE 301
Owner City,St,Zip: FORT LEE, NJ 07024
Federal ID: Not reported
Owner Tel: (201) 944-6300
Owner Type: Corporate/Commercial
Owner Subtype: Not reported
Mailing Contact: ELIOT C. NOSENBAUM
Mailing Name: KINGSLEY REALTY HOLDINGS, LTD.
Mailing Address: 185 BRIDGE PLAZA NORTH
Mailing Address 2: SUITE 301
Mailing City,St,Zip: FORT LEE, NJ 07024
Mailing Telephone: (201) 944-6300
Owner Mark: Second Owner
Facility Status: 1 - Active PBS facility, i.e. total capacity of the PBS tanks is greater than 1,100 gallons, regardless if Subpart 360-14 tanks exist or not at the facility.

Certification Flag: False
Certification Date: 05/21/1998
Expiration: 04/09/2003
Renew Flag: False
Renew Date: Not reported
Total Capacity: 2000
FAMT: True
Facility Screen: Minor Data Missing
Owner Screen: No Missing Data
Tank Screen: No Missing Data
Dead Letter: False
CBS Number: Not reported
Town or City: NEW YORK CITY
County Code: 62
Town or City Code: 01
Region: 2

Tank ID: 1
Tank Location: ABOVEGROUND
Tank Status: In Service

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

WBD REALTY, LLC (Continued)

EDR ID Number
EPA ID Number

Database(s)

U003395720

Install Date: Not reported
Capacity (Gal): 2000
Product Stored: NOS 1,2, OR 4 FUEL OIL
Tank Type: Steel/carbon steel
Tank Internal: 0
Tank External: 00
Pipe Location: Aboveground
Pipe Type: STEEL/IRON
Pipe Internal: None
Pipe External: 00
Tank Containment: None
Leak Detection: 00
Overfill Protection: 3
Dispenser Method: Suction
Date Tested: Not reported
Next Test Date: Not reported
Missing Data for Tank: No Missing Data
Date Closed: Not reported
Test Method: Not reported
Deleted: False
Updated: True
SPDES Number: Not reported
Lat/Long: Not reported

AI141
North
1/8-1/4
1144 ft.

WED REALTY, LLC
467 WEST 159TH ST
NEW YORK, NY 10032

AST
HIST AST
U003395718
N/A

Site 4 of 5 in cluster AI

Relative:
Higher

AST:

Actual:
156 ft.

AST:

Region: STATE
Facility Id: 2-600706
UTM X: 589388.89481
UTM Y: 4520855.05440
Expiration Date: 03/24/11
Renewal Date: 01/08/03
Total Capacity: 2000
Facility Type: Not reported
Site Type Name: Apartment Building/Office Building
Site Type Status: Active
Mailing Company: MIDD 159TH LLC
Mailing Title: MANAGING PARTNER
Mailing Contact: MICHAEL HERSHKOWITZ
Mailing Address: 160 EAST 56TH STREET, 5TH FL
Mailing Address 2: Not reported
Mailing City: NEW YORK
Mailing State: NY
Mailing Zip Code: 10022
Mailing Phone No: (212) 879-6696
Mailing Email: Not reported
Owner Title: MANAGING PARTNER
Owner Name: MICHAEL HERSHKOWITZ
Owner Address: 160 EAST 56TH STREET, 5TH FL
Owner Address 2: Not reported
Owner State: NY

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

WED REALTY, LLC (Continued)

U003395718

Owner Zip Code: 10022
Owner Phone: (212) 879-6696
Owner Company: MIDD 159TH LLC
Emergency Contact: FRAKLIN SANCHEZ
Emergency Phone: (646) 523-8968
Operator: N/A
Operator Phone: N/A
Owner City: NEW YORK
Owner Sub Type: Corporate or Commercial
Program Type: PBS

Tank Number: 1
Tank Location Name: Aboveground - in contact with soil
Tank Status: In Service
Tank Model: Not reported
Pipe Model: Not reported
Active Status: Active
Install Date: 01/01/20
Capacity Gallons: 2000
Material Name: #2 Fuel Oil
Percentage: 100.00
Tank Type Name: Steel/Carbon Steel/Iron
Tank Internal Protection: None
Tank Internal Protection 1: None
Tank Internal Protection 2: Not reported
Pipe Location Name: Aboveground
Pipe Type Name: Steel/Carbon Steel/Iron
Pipe External Protection 1: None
Pipe External Protection 2: Not reported
Tank Secondary Containment 1: None
Tank Secondary Containment 2: Not reported
Pipe Secondary Containment: Not reported
Tank Leak Detection 1: None
Tank Leak Detection 2: Not reported
Pipe Leak Detection 1: Exempt Suction Piping
Pipe Leak Detection 2: Not reported
Type Of Overfill Prevention 1: Automatic Shut-Off
Type Of Overfill Prevention 2: Not reported
Dispenser Method: Suction
Spill Prevention: Not reported
Tightness Test Method: Testing Not Required
Date Tested: / /
Next Test Date: / /
Date Tank Closed: / /

HIST AST:

PBS Number: 2-600706
SWIS Code: 6201
Operator: JOSE ANDRICKSON
Facility Phone: (917) 904-5736
Facility Addr2: 467 WEST 159TH ST
Facility Type: APARTMENT BUILDING
Emergency: JOSE ANDRICKSON
Emergency Tel: (212) 740-3994
Old PBSNO: Not reported
Date Inspected: Not reported
Inspector: Not reported

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

WED REALTY, LLC (Continued)

EDR ID Number
EPA ID Number

Database(s)

U003395718

Result of Inspection: Not reported
Owner Name: WBD REALTY, LLC
Owner Address: 185 BRIDGE PLAZA NORTH SUITE 301
Owner City,St,Zip: FORT LEE, NJ 07024
Federal ID: Not reported
Owner Tel: (201) 944-6300
Owner Type: Corporate/Commercial
Owner Subtype: Not reported
Mailing Contact: ELIOT C.NISENBAUM
Mailing Name: KINGSLEY REALTY HOLDINGS, LTD.
Mailing Address: 185 BRIDGE PLAZA NORTH SUITE 301
Mailing Address 2: Not reported
Mailing City,St,Zip: FORT LEE, NJ 07024
Mailing Telephone: (201) 944-6300
Owner Mark: Second Owner
Facility Status: 1 - Active PBS facility, i.e. total capacity of the PBS tanks is greater than 1,100 gallons, regardless if Subpart 360-14 tanks exist or not at the facility.

Certification Flag: False
Certification Date: 05/21/1998
Expiration: 04/09/2003
Renew Flag: False
Renew Date: Not reported
Total Capacity: 2000
FAMT: True
Facility Screen: No Missing Data
Owner Screen: No Missing Data
Tank Screen: No Missing Data
Dead Letter: False
CBS Number: Not reported
Town or City: NEW YORK CITY
County Code: 62
Town or City Code: 01
Region: 2

Tank ID: 1
Tank Location: ABOVEGROUND
Tank Status: In Service
Install Date: Not reported
Capacity (Gal): 2000
Product Stored: NOS 1,2, OR 4 FUEL OIL
Tank Type: Steel/carbon steel
Tank Internal: 0
Tank External: 00
Pipe Location: Aboveground
Pipe Type: STEEL/IRON
Pipe Internal: None
Pipe External: 00
Tank Containment: None
Leak Detection: 00
Overfill Protection: 3
Dispenser Method: Suction
Date Tested: Not reported
Next Test Date: Not reported
Missing Data for Tank: No Missing Data
Date Closed: Not reported
Test Method: Not reported

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

WED REALTY, LLC (Continued)

EDR ID Number
EPA ID Number

U003395718

Deleted: False
Updated: True
SPDES Number: Not reported
Lat/Long: Not reported

AJ142
NNW
1/8-1/4
1144 ft.

APARTMENT BUILDING
523 WEST 157TH ST
MANHATTAN, NY

LTANKS S107523390
N/A

Site 1 of 3 in cluster AJ

Relative:
Higher

Actual:
135 ft.

LTANKS:

Site ID: 358144
Spill Date: 01/16/06
Facility Addr2: Not reported
Facility ID: 0511904
Program Number: 0511904
SWIS: 3101
Region of Spill: 2
Investigator: mxferoze
Referred To: Not reported
Reported to Dept: 01/16/06
CID: 15
Spill Cause: Tank Test Failure
Water Affected: Not reported
Spill Source: Private Dwelling
Spill Notifier: Tank Tester
Cleanup Ceased: / /
Cleanup Meets Standard: False
Last Inspection: / /
Recommended Penalty: Penalty Not Recommended
UST Involvement: False
Spill Class: Known release with minimal potential for fire or hazard. DEC Response.
Willing Responsible Party. Corrective action taken.
Spill Closed Dt: 03/03/06
Remediation Phase: 0
Date Entered In Computer: 01/16/06
Spill Record Last Update: 03/03/06
Spiller Namer: CHRIS GORGA
Spiller Company: APARTMENT BUILDING
Spiller Phone: (646) 772-1404
Spiller Extention: Not reported
Spiller Address: 523 WEST 157TH ST
Spiller City,St,Zip: MANHATTAN, NY
Spiller County: 001
Spiller Contact: CHRIS GORGA
Spiller Phone: (646) 772-1404
Spiller Extention: Not reported
DEC Region: 2
Program Number: 0511904
DER Facility ID: 308161
Site ID: 358144
Operable Unit ID: 1115397
Operable Unit: 01
Material ID: 2105459
Material Code: 0001
Material Name: #2 Fuel Oil
Case No.: Not reported

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

APARTMENT BUILDING (Continued)

S107523390

Material FA: Petroleum
Quantity: 0.00
Units: Gallons
Recovered: 0.00
Resource Affected: Soil
Oxygenate: False
Site ID: 358144
Spill Tank Test: 1549646
Tank Number: 1
Tank Size: 1080
Test Method: 00
Leak Rate: 0.00
Gross Fail: Not reported
Modified By: Watchdog
Last Modified: 01/16/06
Test Method: Unknown
Site ID: 358144
Spill Tank Test: 1549647
Tank Number: Not reported
Tank Size: 0
Test Method: 03
Leak Rate: 0.00
Gross Fail: Not reported
Modified By: Watchdog
Last Modified: 01/16/06
Test Method: Horner EZ Check I or II
DEC Memo: Start DECRemark - 0511904 01/17/06 Feroze. TTF is sent to; Building owner/
Building Super 523 west 157 Th Street, New York. Ny 10032 03/02/06 Feroze
talked with Mr.Jacy Green 212-831-4400. He informed that there was a problem in
the testingapparatus. They fixed it and tested the tank again. The test was
passed. He will fax me the tank test result on 03/03/06. 03/03/06 Feroze. I
received tank test result from Mr.Jacy Green. The test result is passed.
Accprding to PTC there was no soil contamination. The spill is closed. END
DECRemark - 0511904
Remarks: Start CallerRemark - 0511904 NO REMARKS. END CallerRemark - 0511904

AI143 469-71 WEST 159TH STREET
North 469-71 WEST 159TH STREET
1/8-1/4 NEW YORK, NY 10032
1148 ft.

AST A100292410
N/A

Relative:
Higher

Site 5 of 5 in cluster AI

AST:

Actual:
156 ft.

AST:

Region: STATE
Facility Id: 2-607859
UTM X: 589356.43709
UTM Y: 4520846.07043
Expiration Date: 06/20/07
Renewal Date: / /
Total Capacity: 2000
Facility Type: Not reported
Site Type Name: Apartment Building/Office Building
Site Type Status: Active
Mailing Company: Not reported
Mailing Title: Not reported
Mailing Contact: MILTON MANNING 7A ADMIN

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s)
EDR ID Number
EPA ID Number

469-71 WEST 159TH STREET (Continued)

A100292410

Mailing Address: 880 ST. NICHOLAS AVE
Mailing Address 2: #21
Mailing City: NEW YORK
Mailing State: NY
Mailing Zip Code: 10032
Mailing Phone No: (212) 283-7914
Mailing Email: Not reported
Owner Title: Not reported
Owner Name: Not reported
Owner Address: 880 ST. NICHOLAS AVE #21
Owner Address 2: Not reported
Owner State: NY
Owner Zip Code: 10032
Owner Phone: (212) 283-7914
Owner Company: MILTON MANNING 7A ADMIN
Emergency Contact: MILTON MANNING 7A
Emergency Phone: (212) 283-7914
Operator: MILTON MANNING 7A
Operator Phone: (212) 283-7914
Owner City: NEW YORK
Owner Sub Type: Corporate or Commercial
Program Type: PBS

Tank Number: 001
Tank Location Name: Aboveground on crib, rack, or cradle
Tank Status: In Service
Tank Model: Not reported
Pipe Model: Not reported
Active Status: Active
Install Date: / /
Capacity Gallons: 2000
Material Name: #2 Fuel Oil
Percentage: 100.00
Tank Type Name: Steel/Carbon Steel/Iron
Tank Internal Protection: None
Tank Internal Protection 1: Painted/Asphalt Coating
Tank Internal Protection 2: Not reported
Pipe Location Name: Aboveground
Pipe Type Name: Steel/Carbon Steel/Iron
Pipe External Protection 1: None
Pipe External Protection 2: Not reported
Tank Secondary Containment 1: Other
Tank Secondary Containment 2: Not reported
Pipe Secondary Containment: Not reported
Tank Leak Detection 1: Interstitial - Electronic Monitoring
Tank Leak Detection 2: Not reported
Pipe Leak Detection 1: Not reported
Pipe Leak Detection 2: Not reported
Type Of Overfill Prevention 1: Vent Whistle
Type Of Overfill Prevention 2: Not reported
Dispenser Method: Not reported
Spill Prevention: Not reported
Tightness Test Method: Testing Not Required
Date Tested: / /
Next Test Date: / /
Date Tank Closed: / /

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

AF144
North
1/8-1/4
1152 ft.

ANDRES CLEANERS
1988 AMSTERDAM AVE.
NEW YORK, NY 10032

DRYCLEANERS

S106436121
N/A

Site 4 of 5 in cluster AF

Relative:
Higher

DRYCLEANERS:
Facility ID: 2-6201-00314
Region: NY

Actual:
151 ft.

AF145
North
1/8-1/4
1152 ft.

A & R CLEANERS
1988 AMSTERDAM AVE
NEW YORK, NY 10032

RCRA-SQG
FINDS
NY MANIFEST

1000705526
NYD986970044

Site 5 of 5 in cluster AF

Relative:
Higher

RCRAInfo:
Owner: ANDRES NUNEZ
(212) 923-1489
EPA ID: NYD986970044
Contact: ANDRES NUNEZ
(212) 923-1489
Classification: Small Quantity Generator
TSDF Activities: Not reported
Violation Status: No violations found

Actual:
151 ft.

FINDS:

Other Pertinent Environmental Activity Identified at Site

AFS (Aerometric Information Retrieval System (AIRS) Facility Subsystem) replaces the former Compliance Data System (CDS), the National Emission Data System (NEDS), and the Storage and Retrieval of Aerometric Data (SAROAD). AFS is the national repository for information concerning airborne pollution in the United States. AFS is used to track emissions and compliance data from industrial plants. AFS data are utilized by states to prepare State Implementation Plans to comply with regulatory programs and by EPA as an input for the estimation of total national emissions. AFS is undergoing a major redesign to support facility operating permits required under Title V of the Clean Air Act.

NJ-NJEMS (New Jersey - New Jersey Environmental Management System). The Department of Environmental Protection (NJDEP) manages large databases of environmental information in this integrated system.

FIS (New York - Facility Information System) is New York's Department of Environmental Conservation (DEC) information system for tracking environmental facility information found across the State.

RCRAInfo is a national information system that supports the Resource Conservation and Recovery Act (RCRA) program through the tracking of events and activities related to facilities that generate, transport, and treat, store, or dispose of hazardous waste. RCRAInfo allows RCRA program staff to track the notification, permit, compliance, and corrective action activities required under RCRA.

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

A & R CLEANERS (Continued)

EDR ID Number
EPA ID Number

Database(s)

1000705526

NY MANIFEST:

Document ID: NYC6392946
Manifest Status: Not reported
Trans1 State ID: SCR000075150
Trans2 State ID: NJD071629976
Generator Ship Date: 07/31/2001
Trans1 Recv Date: 07/31/2001
Trans2 Recv Date: 08/06/2001
TSD Site Recv Date: 08/07/2001
Part A Recv Date: Not reported
Part B Recv Date: Not reported
Generator EPA ID: NYD986970044
Trans1 EPA ID: OHD980587364
Trans2 EPA ID: Not reported
TSDF ID: NJDEPE086
Waste Code: F002 - HALO SOLV + STILL BOTTOMS FM REC OF SOLV
Quantity: 00160
Units: P - Pounds
Number of Containers: 001
Container Type: DF - Fiberboard or plastic drums (glass)
Handling Method: B Incineration, heat recovery, burning.
Specific Gravity: 01.00
Waste Code: F002 - HALO SOLV + STILL BOTTOMS FM REC OF SOLV
Quantity: 00100
Units: P - Pounds
Number of Containers: 001
Container Type: DF - Fiberboard or plastic drums (glass)
Handling Method: B Incineration, heat recovery, burning.
Specific Gravity: 01.00
Year: 01
Manifest Tracking Num: Not reported
Import Ind: Not reported
Export Ind: Not reported
Discr Quantity Ind: Not reported
Discr Type Ind: Not reported
Discr Residue Ind: Not reported
Discr Partial Reject Ind: Not reported
Discr Full Reject Ind: Not reported
Manifest Ref Num: Not reported
Alt Fac RCRA Id: Not reported
Alt Fac Sign Date: Not reported
Mgmt Method Type Code: Not reported
EPA ID: NYD986970044
Facility Name: A & R CLEANERS
Facility Address: 1988 AMSTERDAM AVENUE
Facility City: NEW YORK
Facility Address 2: Not reported
Country: USA
County: NE
Mailing Name: A & R CLEANERS
Mailing Contact: A & R CLEANERS
Mailing Address: 1988 AMSTERDAM AVENUE
Mailing Address 2: Not reported
Mailing City: NEW YORK
Mailing State: NY
Mailing Zip: Not reported
Mailing Zip4: Not reported

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

A & R CLEANERS (Continued)

EDR ID Number
EPA ID Number

Database(s)

1000705526

Mailing Country: USA
Mailing Phone: 212-923-1489

Document ID: NJA1416332
Manifest Status: Completed copy
Trans1 State ID: NJDEPS869
Trans2 State ID: Not reported
Generator Ship Date: 920403
Trans1 Recv Date: 920403
Trans2 Recv Date: Not reported
TSD Site Recv Date: 920403
Part A Recv Date: 920417
Part B Recv Date: 920416
Generator EPA ID: NYD986970044
Trans1 EPA ID: ILD051060408
Trans2 EPA ID: Not reported
TSDF ID: NJD000768093
Waste Code: F002 - HALO SOLV + STILL BOTTOMS FM REC OF SOLV
Quantity: 00060
Units: P - Pounds
Number of Containers: 001
Container Type: DM - Metal drums, barrels
Handling Method: B Incineration, heat recovery, burning.
Specific Gravity: 100
Year: 92
Manifest Tracking Num: Not reported
Import Ind: Not reported
Export Ind: Not reported
Discr Quantity Ind: Not reported
Discr Type Ind: Not reported
Discr Residue Ind: Not reported
Discr Partial Reject Ind: Not reported
Discr Full Reject Ind: Not reported
Manifest Ref Num: Not reported
Alt Fac RCRA Id: Not reported
Alt Fac Sign Date: Not reported
Mgmt Method Type Code: Not reported
EPA ID: NYD986970044
Facility Name: A & R CLEANERS
Facility Address: 1988 AMSTERDAM AVENUE
Facility City: NEW YORK
Facility Address 2: Not reported
Country: USA
County: NE
Mailing Name: A & R CLEANERS
Mailing Contact: A & R CLEANERS
Mailing Address: 1988 AMSTERDAM AVENUE
Mailing Address 2: Not reported
Mailing City: NEW YORK
Mailing State: NY
Mailing Zip: Not reported
Mailing Zip4: Not reported
Mailing Country: USA
Mailing Phone: 212-923-1489

Document ID: NJA1444367
Manifest Status: Completed after the designated time period for a TSDF to get a copy to the DEC

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

A & R CLEANERS (Continued)

EDR ID Number
EPA ID Number

Database(s)

1000705526

Trans1 State ID: NJDEPS869
Trans2 State ID: Not reported
Generator Ship Date: 920430
Trans1 Recv Date: 920430
Trans2 Recv Date: Not reported
TSD Site Recv Date: 920430
Part A Recv Date: Not reported
Part B Recv Date: 920602
Generator EPA ID: NYD986970044
Trans1 EPA ID: ILD051060408
Trans2 EPA ID: Not reported
TSDF ID: NJD000768093
Waste Code: F002 - HALO SOLV + STILL BOTTOMS FM REC OF SOLV
Quantity: 00195
Units: P - Pounds
Number of Containers: 001
Container Type: DF - Fiberboard or plastic drums (glass)
Handling Method: B Incineration, heat recovery, burning.
Specific Gravity: 100
Year: 92
Manifest Tracking Num: Not reported
Import Ind: Not reported
Export Ind: Not reported
Discr Quantity Ind: Not reported
Discr Type Ind: Not reported
Discr Residue Ind: Not reported
Discr Partial Reject Ind: Not reported
Discr Full Reject Ind: Not reported
Manifest Ref Num: Not reported
Alt Fac RCRA Id: Not reported
Alt Fac Sign Date: Not reported
Mgmt Method Type Code: Not reported
EPA ID: NYD986970044
Facility Name: A & R CLEANERS
Facility Address: 1988 AMSTERDAM AVENUE
Facility City: NEW YORK
Facility Address 2: Not reported
Country: USA
County: NE
Mailing Name: A & R CLEANERS
Mailing Contact: A & R CLEANERS
Mailing Address: 1988 AMSTERDAM AVENUE
Mailing Address 2: Not reported
Mailing City: NEW YORK
Mailing State: NY
Mailing Zip: Not reported
Mailing Zip4: Not reported
Mailing Country: USA
Mailing Phone: 212-923-1489

Document ID: NJA1632173
Manifest Status: Completed copy
Trans1 State ID: NJDEPS869
Trans2 State ID: Not reported
Generator Ship Date: 921211
Trans1 Recv Date: 921211
Trans2 Recv Date: Not reported

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

A & R CLEANERS (Continued)

EDR ID Number
EPA ID Number

Database(s)

1000705526

TSD Site Recv Date: 921211
Part A Recv Date: 921223
Part B Recv Date: 921229
Generator EPA ID: NYD986970044
Trans1 EPA ID: ILD051060408
Trans2 EPA ID: Not reported
TSD ID: NJD000768093
Waste Code: F002 - HALO SOLV + STILL BOTTOMS FM REC OF SOLV
Quantity: 00120
Units: P - Pounds
Number of Containers: 002
Container Type: DM - Metal drums, barrels
Handling Method: B Incineration, heat recovery, burning.
Specific Gravity: 100
Year: 92
Manifest Tracking Num: Not reported
Import Ind: Not reported
Export Ind: Not reported
Discr Quantity Ind: Not reported
Discr Type Ind: Not reported
Discr Residue Ind: Not reported
Discr Partial Reject Ind: Not reported
Discr Full Reject Ind: Not reported
Manifest Ref Num: Not reported
Alt Fac RCRA Id: Not reported
Alt Fac Sign Date: Not reported
Mgmt Method Type Code: Not reported
EPA ID: NYD986970044
Facility Name: A & R CLEANERS
Facility Address: 1988 AMSTERDAM AVENUE
Facility City: NEW YORK
Facility Address 2: Not reported
Country: USA
County: NE
Mailing Name: A & R CLEANERS
Mailing Contact: A & R CLEANERS
Mailing Address: 1988 AMSTERDAM AVENUE
Mailing Address 2: Not reported
Mailing City: NEW YORK
Mailing State: NY
Mailing Zip: Not reported
Mailing Zip4: Not reported
Mailing Country: USA
Mailing Phone: 212-923-1489

Document ID: NJA1463287
Manifest Status: Completed copy
Trans1 State ID: NJDEPS869
Trans2 State ID: Not reported
Generator Ship Date: 920630
Trans1 Recv Date: 920630
Trans2 Recv Date: Not reported
TSD Site Recv Date: 920630
Part A Recv Date: Not reported
Part B Recv Date: 920710
Generator EPA ID: NYD986970044
Trans1 EPA ID: ILD051060408

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

A & R CLEANERS (Continued)

EDR ID Number
EPA ID Number

Database(s)

1000705526

Trans2 EPA ID: Not reported
TSDF ID: NJD000768093
Waste Code: F002 - HALO SOLV + STILL BOTTOMS FM REC OF SOLV
Quantity: 00195
Units: P - Pounds
Number of Containers: 001
Container Type: DF - Fiberboard or plastic drums (glass)
Handling Method: B Incineration, heat recovery, burning.
Specific Gravity: 100
Year: 92
Manifest Tracking Num: Not reported
Import Ind: Not reported
Export Ind: Not reported
Discr Quantity Ind: Not reported
Discr Type Ind: Not reported
Discr Residue Ind: Not reported
Discr Partial Reject Ind: Not reported
Discr Full Reject Ind: Not reported
Manifest Ref Num: Not reported
Alt Fac RCRA Id: Not reported
Alt Fac Sign Date: Not reported
Mgmt Method Type Code: Not reported
EPA ID: NYD986970044
Facility Name: A & R CLEANERS
Facility Address: 1988 AMSTERDAM AVENUE
Facility City: NEW YORK
Facility Address 2: Not reported
Country: USA
County: NE
Mailing Name: A & R CLEANERS
Mailing Contact: A & R CLEANERS
Mailing Address: 1988 AMSTERDAM AVENUE
Mailing Address 2: Not reported
Mailing City: NEW YORK
Mailing State: NY
Mailing Zip: Not reported
Mailing Zip4: Not reported
Mailing Country: USA
Mailing Phone: 212-923-1489

Document ID: NJA1343565
Manifest Status: Completed copy
Trans1 State ID: NJDEPS869
Trans2 State ID: Not reported
Generator Ship Date: 920309
Trans1 Recv Date: 920309
Trans2 Recv Date: Not reported
TSD Site Recv Date: 920309
Part A Recv Date: 920319
Part B Recv Date: 920323
Generator EPA ID: NYD986970044
Trans1 EPA ID: ILD051060408
Trans2 EPA ID: Not reported
TSDF ID: NJD000768093
Waste Code: F002 - HALO SOLV + STILL BOTTOMS FM REC OF SOLV
Quantity: 00060
Units: P - Pounds

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s)
EDR ID Number
EPA ID Number

A & R CLEANERS (Continued)

1000705526

Number of Containers: 001
Container Type: DM - Metal drums, barrels
Handling Method: B Incineration, heat recovery, burning.
Specific Gravity: 100
Year: 92
Manifest Tracking Num: Not reported
Import Ind: Not reported
Export Ind: Not reported
Discr Quantity Ind: Not reported
Discr Type Ind: Not reported
Discr Residue Ind: Not reported
Discr Partial Reject Ind: Not reported
Discr Full Reject Ind: Not reported
Manifest Ref Num: Not reported
Alt Fac RCRA Id: Not reported
Alt Fac Sign Date: Not reported
Mgmt Method Type Code: Not reported
EPA ID: NYD986970044
Facility Name: A & R CLEANERS
Facility Address: 1988 AMSTERDAM AVENUE
Facility City: NEW YORK
Facility Address 2: Not reported
Country: USA
County: NE
Mailing Name: A & R CLEANERS
Mailing Contact: A & R CLEANERS
Mailing Address: 1988 AMSTERDAM AVENUE
Mailing Address 2: Not reported
Mailing City: NEW YORK
Mailing State: NY
Mailing Zip: Not reported
Mailing Zip4: Not reported
Mailing Country: USA
Mailing Phone: 212-923-1489

Document ID: NJA1372525
Manifest Status: Completed copy
Trans1 State ID: NJDEPS869
Trans2 State ID: Not reported
Generator Ship Date: 921111
Trans1 Recv Date: 921111
Trans2 Recv Date: Not reported
TSD Site Recv Date: 921111
Part A Recv Date: 921125
Part B Recv Date: 921127
Generator EPA ID: NYD986970044
Trans1 EPA ID: ILD051060408
Trans2 EPA ID: Not reported
TSD ID: NJD000768093
Waste Code: F002 - HALO SOLV + STILL BOTTOMS FM REC OF SOLV
Quantity: 00195
Units: P - Pounds
Number of Containers: 001
Container Type: DF - Fiberboard or plastic drums (glass)
Handling Method: B Incineration, heat recovery, burning.
Specific Gravity: 100
Year: 92

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

A & R CLEANERS (Continued)

EDR ID Number
EPA ID Number

Database(s)

1000705526

Manifest Tracking Num: Not reported
Import Ind: Not reported
Export Ind: Not reported
Discr Quantity Ind: Not reported
Discr Type Ind: Not reported
Discr Residue Ind: Not reported
Discr Partial Reject Ind: Not reported
Discr Full Reject Ind: Not reported
Manifest Ref Num: Not reported
Alt Fac RCRA Id: Not reported
Alt Fac Sign Date: Not reported
Mgmt Method Type Code: Not reported
EPA ID: NYD986970044
Facility Name: A & R CLEANERS
Facility Address: 1988 AMSTERDAM AVENUE
Facility City: NEW YORK
Facility Address 2: Not reported
Country: USA
County: NE
Mailing Name: A & R CLEANERS
Mailing Contact: A & R CLEANERS
Mailing Address: 1988 AMSTERDAM AVENUE
Mailing Address 2: Not reported
Mailing City: NEW YORK
Mailing State: NY
Mailing Zip: Not reported
Mailing Zip4: Not reported
Mailing Country: USA
Mailing Phone: 212-923-1489

Document ID: NJA1659990
Manifest Status: Completed copy
Trans1 State ID: NJDEPS869
Trans2 State ID: Not reported
Generator Ship Date: 930118
Trans1 Recv Date: 930118
Trans2 Recv Date: Not reported
TSD Site Recv Date: 930118
Part A Recv Date: 930128
Part B Recv Date: 930129
Generator EPA ID: NYD986970044
Trans1 EPA ID: ILD051060408
Trans2 EPA ID: Not reported
TSD ID: NJD000768093
Waste Code: F002 - HALO SOLV + STILL BOTTOMS FM REC OF SOLV
Quantity: 00195
Units: P - Pounds
Number of Containers: 001
Container Type: DF - Fiberboard or plastic drums (glass)
Handling Method: B Incineration, heat recovery, burning.
Specific Gravity: 100
Year: 93
Manifest Tracking Num: Not reported
Import Ind: Not reported
Export Ind: Not reported
Discr Quantity Ind: Not reported
Discr Type Ind: Not reported

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

A & R CLEANERS (Continued)

EDR ID Number
EPA ID Number

Database(s)

1000705526

Discr Residue Ind:	Not reported
Discr Partial Reject Ind:	Not reported
Discr Full Reject Ind:	Not reported
Manifest Ref Num:	Not reported
Alt Fac RCRA Id:	Not reported
Alt Fac Sign Date:	Not reported
Mgmt Method Type Code:	Not reported
EPA ID:	NYD986970044
Facility Name:	A & R CLEANERS
Facility Address:	1988 AMSTERDAM AVENUE
Facility City:	NEW YORK
Facility Address 2:	Not reported
Country:	USA
County:	NE
Mailing Name:	A & R CLEANERS
Mailing Contact:	A & R CLEANERS
Mailing Address:	1988 AMSTERDAM AVENUE
Mailing Address 2:	Not reported
Mailing City:	NEW YORK
Mailing State:	NY
Mailing Zip:	Not reported
Mailing Zip4:	Not reported
Mailing Country:	USA
Mailing Phone:	212-923-1489
Document ID:	NJA1419955
Manifest Status:	Completed copy
Trans1 State ID:	NJDEPS869
Trans2 State ID:	Not reported
Generator Ship Date:	920824
Trans1 Recv Date:	920824
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	920824
Part A Recv Date:	Not reported
Part B Recv Date:	920903
Generator EPA ID:	NYD986970044
Trans1 EPA ID:	ILD051060408
Trans2 EPA ID:	Not reported
TSDF ID:	NJD000768093
Waste Code:	F002 - HALO SOLV + STILL BOTTOMS FM REC OF SOLV
Quantity:	00195
Units:	P - Pounds
Number of Containers:	001
Container Type:	DF - Fiberboard or plastic drums (glass)
Handling Method:	B Incineration, heat recovery, burning.
Specific Gravity:	100
Year:	92
Manifest Tracking Num:	Not reported
Import Ind:	Not reported
Export Ind:	Not reported
Discr Quantity Ind:	Not reported
Discr Type Ind:	Not reported
Discr Residue Ind:	Not reported
Discr Partial Reject Ind:	Not reported
Discr Full Reject Ind:	Not reported
Manifest Ref Num:	Not reported
Alt Fac RCRA Id:	Not reported

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s) EDR ID Number
EPA ID Number

A & R CLEANERS (Continued)

1000705526

Alt Fac Sign Date:	Not reported
Mgmt Method Type Code:	Not reported
EPA ID:	NYD986970044
Facility Name:	A & R CLEANERS
Facility Address:	1988 AMSTERDAM AVENUE
Facility City:	NEW YORK
Facility Address 2:	Not reported
Country:	USA
County:	NE
Mailing Name:	A & R CLEANERS
Mailing Contact:	A & R CLEANERS
Mailing Address:	1988 AMSTERDAM AVENUE
Mailing Address 2:	Not reported
Mailing City:	NEW YORK
Mailing State:	NY
Mailing Zip:	Not reported
Mailing Zip4:	Not reported
Mailing Country:	USA
Mailing Phone:	212-923-1489
Document ID:	NYC6596910
Manifest Status:	Not reported
Trans1 State ID:	SCR000075150
Trans2 State ID:	NJD071629976
Generator Ship Date:	12/20/2001
Trans1 Recv Date:	12/20/2001
Trans2 Recv Date:	01/02/2002
TSD Site Recv Date:	01/08/2002
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYD986970044
Trans1 EPA ID:	OHD980587364
Trans2 EPA ID:	Not reported
TSD ID:	NJDEP0869
Waste Code:	F002 - HALO SOLV + STILL BOTTOMS FM REC OF SOLV
Quantity:	00375
Units:	P - Pounds
Number of Containers:	003
Container Type:	DF - Fiberboard or plastic drums (glass)
Handling Method:	B Incineration, heat recovery, burning.
Specific Gravity:	01.00
Year:	01
Manifest Tracking Num:	Not reported
Import Ind:	Not reported
Export Ind:	Not reported
Discr Quantity Ind:	Not reported
Discr Type Ind:	Not reported
Discr Residue Ind:	Not reported
Discr Partial Reject Ind:	Not reported
Discr Full Reject Ind:	Not reported
Manifest Ref Num:	Not reported
Alt Fac RCRA Id:	Not reported
Alt Fac Sign Date:	Not reported
Mgmt Method Type Code:	Not reported
EPA ID:	NYD986970044
Facility Name:	A & R CLEANERS
Facility Address:	1988 AMSTERDAM AVENUE

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s)
EDR ID Number
EPA ID Number

A & R CLEANERS (Continued)

1000705526

Facility City: NEW YORK
Facility Address 2: Not reported
Country: USA
County: NE
Mailing Name: A & R CLEANERS
Mailing Contact: A & R CLEANERS
Mailing Address: 1988 AMSTERDAM AVENUE
Mailing Address 2: Not reported
Mailing City: NEW YORK
Mailing State: NY
Mailing Zip: Not reported
Mailing Zip4: Not reported
Mailing Country: USA
Mailing Phone: 212-923-1489

Document ID: NJA1544392
Manifest Status: Completed copy
Trans1 State ID: NJDEPS869
Trans2 State ID: Not reported
Generator Ship Date: 930419
Trans1 Recv Date: 930419
Trans2 Recv Date: Not reported
TSD Site Recv Date: 930419
Part A Recv Date: 930430
Part B Recv Date: 930503
Generator EPA ID: NYD986970044
Trans1 EPA ID: ILD051060408
Trans2 EPA ID: Not reported
TSDF ID: NJD000768093
Waste Code: F002 - HALO SOLV + STILL BOTTOMS FM REC OF SOLV
Quantity: 00195
Units: P - Pounds
Number of Containers: 001
Container Type: DF - Fiberboard or plastic drums (glass)
Handling Method: B Incineration, heat recovery, burning.
Specific Gravity: 100
Year: 93
Manifest Tracking Num: Not reported
Import Ind: Not reported
Export Ind: Not reported
Discr Quantity Ind: Not reported
Discr Type Ind: Not reported
Discr Residue Ind: Not reported
Discr Partial Reject Ind: Not reported
Discr Full Reject Ind: Not reported
Manifest Ref Num: Not reported
Alt Fac RCRA Id: Not reported
Alt Fac Sign Date: Not reported
Mgmt Method Type Code: Not reported
EPA ID: NYD986970044
Facility Name: A & R CLEANERS
Facility Address: 1988 AMSTERDAM AVENUE
Facility City: NEW YORK
Facility Address 2: Not reported
Country: USA
County: NE
Mailing Name: A & R CLEANERS

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

A & R CLEANERS (Continued)

EDR ID Number
EPA ID Number

Database(s)

1000705526

Mailing Contact: A & R CLEANERS
Mailing Address: 1988 AMSTERDAM AVENUE
Mailing Address 2: Not reported
Mailing City: NEW YORK
Mailing State: NY
Mailing Zip: Not reported
Mailing Zip4: Not reported
Mailing Country: USA
Mailing Phone: 212-923-1489

Document ID: NJA1625909
Manifest Status: Completed copy
Trans1 State ID: NJDEPS869
Trans2 State ID: Not reported
Generator Ship Date: 930319
Trans1 Recv Date: 930319
Trans2 Recv Date: Not reported
TSD Site Recv Date: 930319
Part A Recv Date: 930330
Part B Recv Date: 930401
Generator EPA ID: NYD986970044
Trans1 EPA ID: ILD051060408
Trans2 EPA ID: Not reported
TSDF ID: NJD000768093
Waste Code: F002 - HALO SOLV + STILL BOTTOMS FM REC OF SOLV
Quantity: 00060
Units: P - Pounds
Number of Containers: 001
Container Type: DM - Metal drums, barrels
Handling Method: B Incineration, heat recovery, burning.
Specific Gravity: 100
Year: 93
Manifest Tracking Num: Not reported
Import Ind: Not reported
Export Ind: Not reported
Discr Quantity Ind: Not reported
Discr Type Ind: Not reported
Discr Residue Ind: Not reported
Discr Partial Reject Ind: Not reported
Discr Full Reject Ind: Not reported
Manifest Ref Num: Not reported
Alt Fac RCRA Id: Not reported
Alt Fac Sign Date: Not reported
Mgmt Method Type Code: Not reported
EPA ID: NYD986970044
Facility Name: A & R CLEANERS
Facility Address: 1988 AMSTERDAM AVENUE
Facility City: NEW YORK
Facility Address 2: Not reported
Country: USA
County: NE
Mailing Name: A & R CLEANERS
Mailing Contact: A & R CLEANERS
Mailing Address: 1988 AMSTERDAM AVENUE
Mailing Address 2: Not reported
Mailing City: NEW YORK
Mailing State: NY

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

A & R CLEANERS (Continued)

EDR ID Number
EPA ID Number

Database(s)

1000705526

Mailing Zip: Not reported
Mailing Zip4: Not reported
Mailing Country: USA
Mailing Phone: 212-923-1489

Document ID: NJA1749827
Manifest Status: Completed after the designated time period for a TSDF to get a copy to the DEC
Trans1 State ID: NJDEPS869
Trans2 State ID: Not reported
Generator Ship Date: 930818
Trans1 Recv Date: 930818
Trans2 Recv Date: Not reported
TSD Site Recv Date: 930818
Part A Recv Date: 930830
Part B Recv Date: 930923
Generator EPA ID: NYD986970044
Trans1 EPA ID: ILD984908202
Trans2 EPA ID: Not reported
TSDF ID: NJD000768093
Waste Code: F002 - HALO SOLV + STILL BOTTOMS FM REC OF SOLV
Quantity: 00060
Units: P - Pounds
Number of Containers: 001
Container Type: DM - Metal drums, barrels
Handling Method: B Incineration, heat recovery, burning.
Specific Gravity: 100
Year: 93
Manifest Tracking Num: Not reported
Import Ind: Not reported
Export Ind: Not reported
Discr Quantity Ind: Not reported
Discr Type Ind: Not reported
Discr Residue Ind: Not reported
Discr Partial Reject Ind: Not reported
Discr Full Reject Ind: Not reported
Manifest Ref Num: Not reported
Alt Fac RCRA Id: Not reported
Alt Fac Sign Date: Not reported
Mgmt Method Type Code: Not reported
EPA ID: NYD986970044
Facility Name: A & R CLEANERS
Facility Address: 1988 AMSTERDAM AVENUE
Facility City: NEW YORK
Facility Address 2: Not reported
Country: USA
County: NE
Mailing Name: A & R CLEANERS
Mailing Contact: A & R CLEANERS
Mailing Address: 1988 AMSTERDAM AVENUE
Mailing Address 2: Not reported
Mailing City: NEW YORK
Mailing State: NY
Mailing Zip: Not reported
Mailing Zip4: Not reported
Mailing Country: USA
Mailing Phone: 212-923-1489

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

A & R CLEANERS (Continued)

EDR ID Number
EPA ID Number

Database(s)

1000705526

Document ID: NJA1743143
Manifest Status: Completed copy
Trans1 State ID: NJDEPS869
Trans2 State ID: Not reported
Generator Ship Date: 930722
Trans1 Recv Date: 930722
Trans2 Recv Date: Not reported
TSD Site Recv Date: 930722
Part A Recv Date: 930809
Part B Recv Date: 930802
Generator EPA ID: NYD986970044
Trans1 EPA ID: ILD984908202
Trans2 EPA ID: Not reported
TSD ID: NJD000768093
Waste Code: F002 - HALO SOLV + STILL BOTTOMS FM REC OF SOLV
Quantity: 00195
Units: P - Pounds
Number of Containers: 001
Container Type: DF - Fiberboard or plastic drums (glass)
Handling Method: B Incineration, heat recovery, burning.
Specific Gravity: 100
Year: 93
Manifest Tracking Num: Not reported
Import Ind: Not reported
Export Ind: Not reported
Discr Quantity Ind: Not reported
Discr Type Ind: Not reported
Discr Residue Ind: Not reported
Discr Partial Reject Ind: Not reported
Discr Full Reject Ind: Not reported
Manifest Ref Num: Not reported
Alt Fac RCRA Id: Not reported
Alt Fac Sign Date: Not reported
Mgmt Method Type Code: Not reported
EPA ID: NYD986970044
Facility Name: A & R CLEANERS
Facility Address: 1988 AMSTERDAM AVENUE
Facility City: NEW YORK
Facility Address 2: Not reported
Country: USA
County: NE
Mailing Name: A & R CLEANERS
Mailing Contact: A & R CLEANERS
Mailing Address: 1988 AMSTERDAM AVENUE
Mailing Address 2: Not reported
Mailing City: NEW YORK
Mailing State: NY
Mailing Zip: Not reported
Mailing Zip4: Not reported
Mailing Country: USA
Mailing Phone: 212-923-1489

Document ID: NJA1659813
Manifest Status: Completed copy
Trans1 State ID: NJDEPS869
Trans2 State ID: Not reported
Generator Ship Date: 930505

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

A & R CLEANERS (Continued)

EDR ID Number
EPA ID Number

Database(s)

1000705526

Trans1 Recv Date: 930505
Trans2 Recv Date: Not reported
TSD Site Recv Date: 930505
Part A Recv Date: 930517
Part B Recv Date: 930514
Generator EPA ID: NYD986970044
Trans1 EPA ID: ILD051060408
Trans2 EPA ID: Not reported
TSDF ID: NJD000768093
Waste Code: F002 - HALO SOLV + STILL BOTTOMS FM REC OF SOLV
Quantity: 00060
Units: P - Pounds
Number of Containers: 001
Container Type: DM - Metal drums, barrels
Handling Method: B Incineration, heat recovery, burning.
Specific Gravity: 100
Year: 93
Manifest Tracking Num: Not reported
Import Ind: Not reported
Export Ind: Not reported
Discr Quantity Ind: Not reported
Discr Type Ind: Not reported
Discr Residue Ind: Not reported
Discr Partial Reject Ind: Not reported
Discr Full Reject Ind: Not reported
Manifest Ref Num: Not reported
Alt Fac RCRA Id: Not reported
Alt Fac Sign Date: Not reported
Mgmt Method Type Code: Not reported
EPA ID: NYD986970044
Facility Name: A & R CLEANERS
Facility Address: 1988 AMSTERDAM AVENUE
Facility City: NEW YORK
Facility Address 2: Not reported
Country: USA
County: NE
Mailing Name: A & R CLEANERS
Mailing Contact: A & R CLEANERS
Mailing Address: 1988 AMSTERDAM AVENUE
Mailing Address 2: Not reported
Mailing City: NEW YORK
Mailing State: NY
Mailing Zip: Not reported
Mailing Zip4: Not reported
Mailing Country: USA
Mailing Phone: 212-923-1489

Document ID: NJA1629369
Manifest Status: Completed copy
Trans1 State ID: NJDEPS869
Trans2 State ID: Not reported
Generator Ship Date: 930525
Trans1 Recv Date: 930525
Trans2 Recv Date: Not reported
TSD Site Recv Date: 930525
Part A Recv Date: 930608
Part B Recv Date: 930618

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

A & R CLEANERS (Continued)

EDR ID Number
EPA ID Number

Database(s)

1000705526

Generator EPA ID:	NYD986970044
Trans1 EPA ID:	ILD051060408
Trans2 EPA ID:	Not reported
TSD ID:	NJD000768093
Waste Code:	F002 - HALO SOLV + STILL BOTTOMS FM REC OF SOLV
Quantity:	00195
Units:	P - Pounds
Number of Containers:	001
Container Type:	DF - Fiberboard or plastic drums (glass)
Handling Method:	B Incineration, heat recovery, burning.
Specific Gravity:	100
Year:	93
Manifest Tracking Num:	Not reported
Import Ind:	Not reported
Export Ind:	Not reported
Discr Quantity Ind:	Not reported
Discr Type Ind:	Not reported
Discr Residue Ind:	Not reported
Discr Partial Reject Ind:	Not reported
Discr Full Reject Ind:	Not reported
Manifest Ref Num:	Not reported
Alt Fac RCRA Id:	Not reported
Alt Fac Sign Date:	Not reported
Mgmt Method Type Code:	Not reported
EPA ID:	NYD986970044
Facility Name:	A & R CLEANERS
Facility Address:	1988 AMSTERDAM AVENUE
Facility City:	NEW YORK
Facility Address 2:	Not reported
Country:	USA
County:	NE
Mailing Name:	A & R CLEANERS
Mailing Contact:	A & R CLEANERS
Mailing Address:	1988 AMSTERDAM AVENUE
Mailing Address 2:	Not reported
Mailing City:	NEW YORK
Mailing State:	NY
Mailing Zip:	Not reported
Mailing Zip4:	Not reported
Mailing Country:	USA
Mailing Phone:	212-923-1489
Document ID:	NJA1842578
Manifest Status:	Completed after the designated time period for a TSD to get a copy to the DEC
Trans1 State ID:	51736
Trans2 State ID:	Not reported
Generator Ship Date:	931119
Trans1 Recv Date:	931119
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	931119
Part A Recv Date:	931207
Part B Recv Date:	931221
Generator EPA ID:	NYD986970044
Trans1 EPA ID:	ILD984908202
Trans2 EPA ID:	Not reported
TSD ID:	NJD000768093
Waste Code:	F002 - HALO SOLV + STILL BOTTOMS FM REC OF SOLV

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s)
EDR ID Number
EPA ID Number

A & R CLEANERS (Continued)

1000705526

Quantity: 00060
Units: P - Pounds
Number of Containers: 001
Container Type: DM - Metal drums, barrels
Handling Method: B Incineration, heat recovery, burning.
Specific Gravity: 100
Year: 93
Manifest Tracking Num: Not reported
Import Ind: Not reported
Export Ind: Not reported
Discr Quantity Ind: Not reported
Discr Type Ind: Not reported
Discr Residue Ind: Not reported
Discr Partial Reject Ind: Not reported
Discr Full Reject Ind: Not reported
Manifest Ref Num: Not reported
Alt Fac RCRA Id: Not reported
Alt Fac Sign Date: Not reported
Mgmt Method Type Code: Not reported
EPA ID: NYD986970044
Facility Name: A & R CLEANERS
Facility Address: 1988 AMSTERDAM AVENUE
Facility City: NEW YORK
Facility Address 2: Not reported
Country: USA
County: NE
Mailing Name: A & R CLEANERS
Mailing Contact: A & R CLEANERS
Mailing Address: 1988 AMSTERDAM AVENUE
Mailing Address 2: Not reported
Mailing City: NEW YORK
Mailing State: NY
Mailing Zip: Not reported
Mailing Zip4: Not reported
Mailing Country: USA
Mailing Phone: 212-923-1489

Document ID: NJA1731419
Manifest Status: Completed copy
Trans1 State ID: NJDEPS869
Trans2 State ID: Not reported
Generator Ship Date: 930922
Trans1 Recv Date: 930922
Trans2 Recv Date: Not reported
TSD Site Recv Date: 930922
Part A Recv Date: Not reported
Part B Recv Date: 931005
Generator EPA ID: NYD986970044
Trans1 EPA ID: ILD984908202
Trans2 EPA ID: Not reported
TSDF ID: NJD000768093
Waste Code: F002 - HALO SOLV + STILL BOTTOMS FM REC OF SOLV
Quantity: 00195
Units: P - Pounds
Number of Containers: 001
Container Type: DF - Fiberboard or plastic drums (glass)
Handling Method: B Incineration, heat recovery, burning.

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

A & R CLEANERS (Continued)

EDR ID Number
EPA ID Number

Database(s)

1000705526

Specific Gravity: 100
Year: 93
Manifest Tracking Num: Not reported
Import Ind: Not reported
Export Ind: Not reported
Discr Quantity Ind: Not reported
Discr Type Ind: Not reported
Discr Residue Ind: Not reported
Discr Partial Reject Ind: Not reported
Discr Full Reject Ind: Not reported
Manifest Ref Num: Not reported
Alt Fac RCRA Id: Not reported
Alt Fac Sign Date: Not reported
Mgmt Method Type Code: Not reported
EPA ID: NYD986970044
Facility Name: A & R CLEANERS
Facility Address: 1988 AMSTERDAM AVENUE
Facility City: NEW YORK
Facility Address 2: Not reported
Country: USA
County: NE
Mailing Name: A & R CLEANERS
Mailing Contact: A & R CLEANERS
Mailing Address: 1988 AMSTERDAM AVENUE
Mailing Address 2: Not reported
Mailing City: NEW YORK
Mailing State: NY
Mailing Zip: Not reported
Mailing Zip4: Not reported
Mailing Country: USA
Mailing Phone: 212-923-1489

Document ID: NJA1848520
Manifest Status: Completed copy
Trans1 State ID: NJDEPS869
Trans2 State ID: Not reported
Generator Ship Date: 931228
Trans1 Recv Date: 931228
Trans2 Recv Date: Not reported
TSD Site Recv Date: 931228
Part A Recv Date: 940110
Part B Recv Date: 940120
Generator EPA ID: NYD986970044
Trans1 EPA ID: ILD984908202
Trans2 EPA ID: Not reported
TSDF ID: NJD000768093
Waste Code: F002 - HALO SOLV + STILL BOTTOMS FM REC OF SOLV
Quantity: 00195
Units: P - Pounds
Number of Containers: 001
Container Type: DF - Fiberboard or plastic drums (glass)
Handling Method: B Incineration, heat recovery, burning.
Specific Gravity: 100
Year: 93
Manifest Tracking Num: Not reported
Import Ind: Not reported
Export Ind: Not reported

Map ID
 Direction
 Distance
 Distance (ft.)
 Elevation Site

MAP FINDINGS

Database(s) EDR ID Number
 EPA ID Number

A & R CLEANERS (Continued)

1000705526

Discr Quantity Ind:	Not reported
Discr Type Ind:	Not reported
Discr Residue Ind:	Not reported
Discr Partial Reject Ind:	Not reported
Discr Full Reject Ind:	Not reported
Manifest Ref Num:	Not reported
Alt Fac RCRA Id:	Not reported
Alt Fac Sign Date:	Not reported
Mgmt Method Type Code:	Not reported
EPA ID:	NYD986970044
Facility Name:	A & R CLEANERS
Facility Address:	1988 AMSTERDAM AVENUE
Facility City:	NEW YORK
Facility Address 2:	Not reported
Country:	USA
County:	NE
Mailing Name:	A & R CLEANERS
Mailing Contact:	A & R CLEANERS
Mailing Address:	1988 AMSTERDAM AVENUE
Mailing Address 2:	Not reported
Mailing City:	NEW YORK
Mailing State:	NY
Mailing Zip:	Not reported
Mailing Zip4:	Not reported
Mailing Country:	USA
Mailing Phone:	212-923-1489
Document ID:	NJA1808872
Manifest Status:	Completed copy
Trans1 State ID:	NJDEPS869
Trans2 State ID:	Not reported
Generator Ship Date:	940117
Trans1 Recv Date:	940117
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	940117
Part A Recv Date:	940126
Part B Recv Date:	940131
Generator EPA ID:	NYD986970044
Trans1 EPA ID:	ILD984908202
Trans2 EPA ID:	Not reported
TSD ID:	NJD000768093
Waste Code:	F002 - HALO SOLV + STILL BOTTOMS FM REC OF SOLV
Quantity:	00060
Units:	P - Pounds
Number of Containers:	001
Container Type:	DM - Metal drums, barrels
Handling Method:	B Incineration, heat recovery, burning.
Specific Gravity:	100
Year:	94
Manifest Tracking Num:	Not reported
Import Ind:	Not reported
Export Ind:	Not reported
Discr Quantity Ind:	Not reported
Discr Type Ind:	Not reported
Discr Residue Ind:	Not reported
Discr Partial Reject Ind:	Not reported
Discr Full Reject Ind:	Not reported

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

A & R CLEANERS (Continued)

EDR ID Number
EPA ID Number

Database(s)

1000705526

Manifest Ref Num: Not reported
Alt Fac RCRA Id: Not reported
Alt Fac Sign Date: Not reported
Mgmt Method Type Code: Not reported
EPA ID: NYD986970044
Facility Name: A & R CLEANERS
Facility Address: 1988 AMSTERDAM AVENUE
Facility City: NEW YORK
Facility Address 2: Not reported
Country: USA
County: NE
Mailing Name: A & R CLEANERS
Mailing Contact: A & R CLEANERS
Mailing Address: 1988 AMSTERDAM AVENUE
Mailing Address 2: Not reported
Mailing City: NEW YORK
Mailing State: NY
Mailing Zip: Not reported
Mailing Zip4: Not reported
Mailing Country: USA
Mailing Phone: 212-923-1489

[Click this hyperlink](#) while viewing on your computer to access
23 additional NY_MANIFEST: record(s) in the EDR Site Report.

AK146 518-20 WEST 152ND STREET
WSW 518 WEST 152ND STREET
1/8-1/4 NEW YORK, NY 10031
1171 ft.

AST A100173481
N/A

Relative:
Higher

Site 1 of 9 in cluster AK

AST:

Actual:
136 ft.

AST:

Region: STATE
Facility Id: 2-600014
UTM X: 588952.66134
UTM Y: 4520406.71031
Expiration Date: 03/18/11
Renewal Date: / /
Total Capacity: 4000
Facility Type: Not reported
Site Type Name: Apartment Building/Office Building
Site Type Status: Active
Mailing Company: % JOHN J. GROGAN & ASSOCIATES, INC.
Mailing Title: Not reported
Mailing Contact: STEPHEN D. KESSLER
Mailing Address: 360 LEXINGTON AVENUE
Mailing Address 2: 5TH FLOOR
Mailing City: NEW YORK
Mailing State: NY
Mailing Zip Code: 10017
Mailing Phone No: (212) 376-1480
Mailing Email: SKESSLER@GROGANASSOC.COM
Owner Title: PRESIDENT
Owner Name: STEPHEN D. KESSLER
Owner Address: 360 LEXINGTON AVENUE - 5TH FLOOR
Owner Address 2: Not reported

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

518-20 WEST 152ND STREET (Continued)

EDR ID Number
EPA ID Number

Database(s)

A100173481

Owner State: NY
Owner Zip Code: 10017
Owner Phone: (212) 370-1480
Owner Company: ROSK REALTY CORP.
Emergency Contact: STEPHEN D. KESSLER
Emergency Phone: (212) 370-1480
Operator: PHILIP MAISELLO
Operator Phone: (212) 690-5088
Owner City: NEW YORK
Owner Sub Type: Corporate or Commercial
Program Type: PBS

Tank Number: 001
Tank Location Name: Aboveground - in contact with soil
Tank Status: In Service
Tank Model: Not reported
Pipe Model: Not reported
Active Status: Active
Install Date: / /
Capacity Gallons: 4000
Material Name: #2 Fuel Oil
Percentage: 100.00
Tank Type Name: Steel/Carbon Steel/Iron
Tank Internal Protection: None
Tank Internal Protection 1: Not reported
Tank Internal Protection 2: Not reported
Pipe Location Name: Aboveground
Pipe Type Name: Steel/Carbon Steel/Iron
Pipe External Protection 1: Wrapped
Pipe External Protection 2: Not reported
Tank Secondary Containment 1: Vault (w/o access)
Tank Secondary Containment 2: Not reported
Pipe Secondary Containment: Not reported
Tank Leak Detection 1: Vapor Well
Tank Leak Detection 2: Not reported
Pipe Leak Detection 1: Exempt Suction Piping
Pipe Leak Detection 2: Not reported
Type Of Overfill Prevention 1: High Level Alarm
Type Of Overfill Prevention 2: Not reported
Dispenser Method: Suction
Spill Prevention: Not reported
Tightness Test Method: Testing Not Required
Date Tested: / /
Next Test Date: / /
Date Tank Closed: / /

AK147 WEST BRIDGE ASSOCIATES, L.P.
WSW 519 WEST 152ND STREET
1/8-1/4 NEW YORK, NY 10031
1171 ft.

AST A100168961
N/A

Relative: Site 2 of 9 in cluster AK
Higher

Actual: 136 ft.
AST:
Region: STATE
Facility Id: 2-470260
UTM X: 588994.85619

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s)
EDR ID Number
EPA ID Number

WEST BRIDGE ASSOCIATES, L.P. (Continued)

A100168961

UTM Y: 4520425.29888
Expiration Date: 09/14/10
Renewal Date: / /
Total Capacity: 4000
Facility Type: Not reported
Site Type Name: Apartment Building/Office Building
Site Type Status: Active
Mailing Company: WEST REALTY GROUP
Mailing Title: Not reported
Mailing Contact: CHRIS CALHOUN
Mailing Address: 611 W. 148TH STREET
Mailing Address 2: Not reported
Mailing City: NEW YORK
Mailing State: NY
Mailing Zip Code: 10032
Mailing Phone No: (212) 694-3303
Mailing Email: Not reported
Owner Title: V.P.
Owner Name: CHRIS CALHOUN
Owner Address: 875 ST. NICHOLAS AVE
Owner Address 2: Not reported
Owner State: NY
Owner Zip Code: 10032
Owner Phone: (212) 624-3304
Owner Company: WEST BRIDGE REALTY CORP.
Emergency Contact: CHRIS CALHOUN
Emergency Phone: (718) 562-4363
Operator: ORLANDO TAVARES
Operator Phone: (917) 578-2156
Owner City: NEW YORK
Owner Sub Type: Corporate or Commercial
Program Type: PBS

Tank Number: 001
Tank Location Name: Aboveground on crib, rack, or cradle
Tank Status: In Service
Tank Model: Not reported
Pipe Model: Not reported
Active Status: Active
Install Date: / /
Capacity Gallons: 4000
Material Name: #2 Fuel Oil
Percentage: 100.00
Tank Type Name: Steel/Carbon Steel/Iron
Tank Internal Protection: None
Tank Internal Protection 1: None
Tank Internal Protection 2: Not reported
Pipe Location Name: Aboveground
Pipe Type Name: Galvanized Steel
Pipe External Protection 1: None
Pipe External Protection 2: Not reported
Tank Secondary Containment 1: Diking (Aboveground)
Tank Secondary Containment 2: Not reported
Pipe Secondary Containment: Not reported
Tank Leak Detection 1: None
Tank Leak Detection 2: Not reported
Pipe Leak Detection 1: Exempt Suction Piping

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

WEST BRIDGE ASSOCIATES, L.P. (Continued)

EDR ID Number
EPA ID Number

Database(s)

A100168961

Pipe Leak Detection 2: Not reported
Type Of Overfill Prevention 1: Vent Whistle
Type Of Overfill Prevention 2: Not reported
Dispenser Method: Suction
Spill Prevention: Not reported
Tightness Test Method: Testing Not Required
Date Tested: / /
Next Test Date: / /
Date Tank Closed: / /

AL148 520 WEST 158 STREET HDFC
NNW 520 WEST 158 STREET
1/8-1/4 NEW YORK, NY 10032
1185 ft.

AST A100292497
N/A

Site 1 of 4 in cluster AL

Relative:
Higher

AST:

Actual:
140 ft.

AST:

Region: STATE
Facility Id: 2-608421
UTM X: 589186.23021
UTM Y: 4520835.02050
Expiration Date: 02/27/08
Renewal Date: / /
Total Capacity: 5000
Facility Type: Not reported
Site Type Name: Apartment Building/Office Building
Site Type Status: Active
Mailing Company: C/O ADELINA RODRIGUEZ
Mailing Title: Not reported
Mailing Contact: 520 W 158 ST HDFC
Mailing Address: 520 WEST 158 STREET
Mailing Address 2: APT 1-D
Mailing City: NEW YORK
Mailing State: NY
Mailing Zip Code: 10032
Mailing Phone No: (212) 795-5316
Mailing Email: Not reported
Owner Title: Not reported
Owner Name: Not reported
Owner Address: 520 WEST 158 STREET, APT 1-D
Owner Address 2: Not reported
Owner State: NY
Owner Zip Code: 10032
Owner Phone: (212) 795-5316
Owner Company: ADELINA GODGEGUEZ PRESIDENT
Emergency Contact: ADELINA RODRIGUEZ
Emergency Phone: (212) 795-5316
Operator: ADELINA RODRIGUEZ
Operator Phone: (212) 795-5316
Owner City: NEW YORK
Owner Sub Type: Corporate or Commercial
Program Type: PBS

Tank Number: 001
Tank Location Name: Aboveground - in contact with soil
Tank Status: In Service

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

520 WEST 158 STREET HDFC (Continued)

EDR ID Number
EPA ID Number

Database(s)

A100292497

Tank Model: Not reported
Pipe Model: Not reported
Active Status: Active
Install Date: / /
Capacity Gallons: 5000
Material Name: #2 Fuel Oil
Percentage: 100.00
Tank Type Name: Steel/Carbon Steel/Iron
Tank Internal Protection: None
Tank Internal Protection 1: None
Tank Internal Protection 2: Not reported
Pipe Location Name: Aboveground
Pipe Type Name: Steel/Carbon Steel/Iron
Pipe External Protection 1: None
Pipe External Protection 2: Not reported
Tank Secondary Containment 1: None
Tank Secondary Containment 2: Not reported
Pipe Secondary Containment: Not reported
Tank Leak Detection 1: None
Tank Leak Detection 2: Not reported
Pipe Leak Detection 1: Exempt Suction Piping
Pipe Leak Detection 2: Not reported
Type Of Overfill Prevention 1: Vent Whistle
Type Of Overfill Prevention 2: Not reported
Dispenser Method: Suction
Spill Prevention: Not reported
Tightness Test Method: Testing Not Required
Date Tested: / /
Next Test Date: / /
Date Tank Closed: / /

149 470 CONVENT AVENUE
SW 470 CONVENT AVENUE
1/8-1/4 NEW YORK, NY 10031
1186 ft.

AST U004045578
N/A

Relative:
Higher

AST:
AST:

Actual:
112 ft.

Region: STATE
Facility Id: 2-601017
UTM X: 589130.31757
UTM Y: 4520234.75092
Expiration Date: 10/21/07
Renewal Date: 05/31/02
Total Capacity: 0
Facility Type: Not reported
Site Type Name: Apartment Building/Office Building
Site Type Status: Unregulated
Mailing Company: DAN SIEGLE
Mailing Title: Not reported
Mailing Contact: Not reported
Mailing Address: PROMANAGEMENT ASSOCIATES INC.
Mailing Address 2: 972 BROAD STREET
Mailing City: NEWARK
Mailing State: NJ
Mailing Zip Code: 07102
Mailing Phone No: (973) 642-7888

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s)
EDR ID Number
EPA ID Number

470 CONVENT AVENUE (Continued)

U004045578

Mailing Email: Not reported
Owner Title: Not reported
Owner Name: Not reported
Owner Address: 100 GOLD ST., #7Z5
Owner Address 2: Not reported
Owner State: NY
Owner Zip Code: 10038
Owner Phone: (212) 863-7301
Owner Company: NYC/HPD/DAMP
Emergency Contact: DAN SIEGEL
Emergency Phone: (973) 642-7888
Operator: ASST. COMMISSIONER/DAMP
Operator Phone: (212) 863-7301
Owner City: NEW YORK
Owner Sub Type: Local Government
Program Type: PBS

Tank Number: 002
Tank Location Name: Aboveground - in contact with soil
Tank Status: Closed - Removed
Tank Model: Not reported
Pipe Model: Not reported
Active Status: Inactive
Install Date: / /
Capacity Gallons: 3200
Material Name: #2 Fuel Oil
Percentage: 100.00
Tank Type Name: Steel/Carbon Steel/Iron
Tank Internal Protection: None
Tank Internal Protection 1: None
Tank Internal Protection 2: Not reported
Pipe Location Name: Aboveground
Pipe Type Name: Steel/Carbon Steel/Iron
Pipe External Protection 1: None
Pipe External Protection 2: Not reported
Tank Secondary Containment 1: Double-Walled (Underground)
Tank Secondary Containment 2: Not reported
Pipe Secondary Containment: Not reported
Tank Leak Detection 1: None
Tank Leak Detection 2: Not reported
Pipe Leak Detection 1: Not reported
Pipe Leak Detection 2: Not reported
Type Of Overfill Prevention 1: Vent Whistle
Type Of Overfill Prevention 2: Not reported
Dispenser Method: Not reported
Spill Prevention: Not reported
Tightness Test Method: Testing Not Required
Date Tested: / /
Next Test Date: / /
Date Tank Closed: 12/01/03

Tank Number: 1
Tank Location Name: Aboveground - in contact with soil
Tank Status: Closed - Removed
Tank Model: Not reported
Pipe Model: Not reported

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

470 CONVENT AVENUE (Continued)

EDR ID Number
EPA ID Number

Database(s)

U004045578

Active Status: Inactive
Install Date: / /
Capacity Gallons: 4000
Material Name: #2 Fuel Oil
Percentage: 100.00
Tank Type Name: Steel/Carbon Steel/Iron
Tank Internal Protection: None
Tank Internal Protection 1: Painted/Asphalt Coating
Tank Internal Protection 2: Not reported
Pipe Location Name: Aboveground/Underground Combination
Pipe Type Name: Steel/Carbon Steel/Iron
Pipe External Protection 1: Painted/Asphalt Coating
Pipe External Protection 2: Not reported
Tank Secondary Containment 1: Vault (w/o access)
Tank Secondary Containment 2: Not reported
Pipe Secondary Containment: Not reported
Tank Leak Detection 1: None
Tank Leak Detection 2: Not reported
Pipe Leak Detection 1: Not reported
Pipe Leak Detection 2: Not reported
Type Of Overfill Prevention 1: Vent Whistle
Type Of Overfill Prevention 2: Not reported
Dispenser Method: Suction
Spill Prevention: Not reported
Tightness Test Method: Testing Not Required
Date Tested: / /
Next Test Date: / /
Date Tank Closed: / /

150
NE
1/8-1/4
1190 ft.

RANGEL
159-38 HARLEM RIVER DR
MANHATTAN, NY

LTANKS S102662631
HIST LTANKS N/A

Relative:
Lower

LTANKS:

Actual:
19 ft.

Site ID: 279914
Spill Date: 04/08/96
Facility Addr2: Not reported
Facility ID: 9601212
Program Number: 9601212
SWIS: 3101
Region of Spill: 2
Investigator: HEALY
Referred To: Not reported
Reported to Dept: 04/24/96
CID: 15
Spill Cause: Tank Overfill
Water Affected: Not reported
Spill Source: Private Dwelling
Spill Notifier: Affected Persons
Cleanup Ceased: / /
Cleanup Meets Standard: False
Last Inspection: / /
Recommended Penalty: Penalty Not Recommended
UST Involvement: False
Spill Class: Known release with minimal potential for fire or hazard. DEC Response.
Willing Responsible Party. Corrective action taken.
Spill Closed Dt: 07/23/97

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

RANGEL (Continued)

EDR ID Number
EPA ID Number

Database(s)

S102662631

Remediation Phase: 0
Date Entered In Computer: 04/24/96
Spill Record Last Update: 12/20/05
Spille Namer: Not reported
Spiller Company: NYC HOUSING AUTHORITY
Spiller Phone: Not reported
Spiller Extention: Not reported
Spiller Address: Not reported
Spiller City,St,Zip: ZZ
Spiller County: 001
Spiller Contact: MIKE SOTO
Spiller Phone: (212) 283-4510
Spiller Extention: Not reported
DEC Region: 2
Program Number: 9601212
DER Facility ID: 75927
Site ID: 279914
Operable Unit ID: 1032777
Operable Unit: 01
Material ID: 351028
Material Code: 0002
Material Name: #4 Fuel Oil
Case No.: Not reported
Material FA: Petroleum
Quantity: 50.00
Units: Gallons
Recovered: 0.00
Resource Affected: Soil
Oxygenate: False
Site ID: Not reported
Spill Tank Test: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate: Not reported
Gross Fail: Not reported
Modified By: Not reported
Last Modified: Not reported
Test Method: Not reported
DEC Memo: Not reported
Remarks: Start CallerRemark - 9601212 tank is contained in a vault defective gasket
caused tank overfill winston contracting notified for clean up END
CallerRemark - 9601212

HIST LTANKS:

Region of Spill: 2
Spill Number: 9601212
Investigator: HEALY
Caller Name: Not reported
Caller Agency: Not reported
Caller Phone: Not reported
Caller Extension: Not reported
Notifier Name: Not reported
Notifier Agency: Not reported
Notifier Phone: Not reported
Notifier Extension: Not reported
Spill Date: 04/08/1996

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s)
EDR ID Number
EPA ID Number

RANGEL (Continued)

S102662631

Spill Time: 12:00
Reported to Department Date: 04/24/96
Reported to Department Time: 11:46
SWIS: 62
Spiller Contact: MIKE SOTO
Spiller Phone: (212) 283-4510
Spiller Extension: Not reported
Spiller Name: NYC HOUSING AUTHORITY
Spiller Address: Not reported
Spiller City,St,Zip: Not reported
Facility Contact: Not reported
Facility Phone: Not reported
Facility Extension: Not reported
Spill Cause: Tank Overfill
Resource Affected: On Land
Water Affected: Not reported
Spill Source: Private Dwelling
Spill Notifier: Affected Persons
PBS Number: Not reported
Cleanup Ceased: / /
Cleanup Meets Standard: False
Last Inspection: / /
Recommended Penalty: Penalty Not Recommended
Spiller Cleanup Date: / /
Enforcement Date: / /
Investigation Complete: / /
UST Involvement: False
Spill Class: Known release with minimal potential for fire or hazard. DEC Response.
Willing Responsible Party. Corrective action taken.
Spill Closed Dt: 07/23/97
Date Region Sent Summary to Central Office: / /
Corrective Action Plan Submitted: / /
Date Spill Entered In Computer Data File: 04/24/96
Time Spill Entered In Computer Data File: Not reported
Spill Record Last Update: 07/23/97
Is Updated: False
PBS Number: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate Failed Tank: Not reported
Gross Leak Rate: Not reported
Material Class Type: Petroleum
Quantity Spilled: 50
Unkonwn Quantity Spilled: False
Units: Gallons
Quantity Recovered: 0
Unkonwn Quantity Recovered: False
Material: #4 FUEL OIL
Class Type: #4 FUEL OIL
Times Material Entry In File: 1751
CAS Number: Not reported
Last Date: 19941205
DEC Remarks: 4/24/96 - Spill report from Cedric Hercules. Was making repairs to boilers and found overfill in tank vault of 50+ gallons. I checked the log book in the boiler room with Frank Ocello - found that the spill occurred on 4/22 but was never reported. Winston called to site to do clean up. Case no. R2-0020-96-05

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

RANGEL (Continued)

EDR ID Number
EPA ID Number

Database(s)

S102662631

Spill Cause: opened for failure to notify DEC of a spill.
tank is contained in a vault defective gasket caused tank overfill winston
contracting notified for clean up

151
South
1/8-1/4
1190 ft.

357 EDGECOMBE AVE
357 EDGECOMBE AVENUE
NEW YORK, NY 10031

AST
HIST AST
U003387915
N/A

Relative:
Lower

AST:

AST:

Actual:
75 ft.

Region: STATE
Facility Id: 2-314560
UTM X: 589409.88479
UTM Y: 4520305.07645
Expiration Date: 11/21/08
Renewal Date: 05/06/02
Total Capacity: 6000
Facility Type: Not reported
Site Type Name: Apartment Building/Office Building
Site Type Status: Active
Mailing Company: J&M REALTY CORP.
Mailing Title: Not reported
Mailing Contact: PAUL JACCOM
Mailing Address: 21 WEST 86TH STREET
Mailing Address 2: Not reported
Mailing City: NEW YORK
Mailing State: NY
Mailing Zip Code: 10024
Mailing Phone No: (212) 721-0424
Mailing Email: Not reported
Owner Title: Not reported
Owner Name: Not reported
Owner Address: 21 WEST 86 ST
Owner Address 2: Not reported
Owner State: NY
Owner Zip Code: 10024
Owner Phone: (212) 721-0424
Owner Company: 357 EDGECOMBE PARTNERS LLC % J&M REALTY
Emergency Contact: PAUL JACCOM
Emergency Phone: (212) 721-0424
Operator: THEO PUGH
Operator Phone: (917) 731-1106
Owner City: NEW YORK
Owner Sub Type: Corporate or Commercial
Program Type: PBS

Tank Number: 001
Tank Location Name: Aboveground - in contact with soil
Tank Status: In Service
Tank Model: Not reported
Pipe Model: Not reported
Active Status: Active
Install Date: / /
Capacity Gallons: 6000
Material Name: #6 Fuel Oil
Percentage: 100.00

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s)
EDR ID Number
EPA ID Number

357 EDGECOMBE AVE (Continued)

U003387915

Tank Type Name: Steel/Carbon Steel/Iron
Tank Internal Protection: None
Tank Internal Protection 1: None
Tank Internal Protection 2: Not reported
Pipe Location Name: No Piping
Pipe Type Name: Steel/Carbon Steel/Iron
Pipe External Protection 1: None
Pipe External Protection 2: Not reported
Tank Secondary Containment 1: Vault (w/o access)
Tank Secondary Containment 2: Not reported
Pipe Secondary Containment: Not reported
Tank Leak Detection 1: None
Tank Leak Detection 2: Not reported
Pipe Leak Detection 1: Exempt Suction Piping
Pipe Leak Detection 2: Not reported
Type Of Overfill Prevention 1: Product Level Gauge (A/G)
Type Of Overfill Prevention 2: Not reported
Dispenser Method: Suction
Spill Prevention: Not reported
Tightness Test Method: Testing Not Required
Date Tested: / /
Next Test Date: / /
Date Tank Closed: / /

HIST AST:

PBS Number: 2-314560
SWIS Code: 6201
Operator: QUILLIE HUNTLEY
Facility Phone: (212) 281-4210
Facility Addr2: 357 EDGECOMBE AVE
Facility Type: APARTMENT BUILDING
Emergency: IVAN LEIST
Emergency Tel: (718) 258-0373
Old PBSNO: Not reported
Date Inspected: Not reported
Inspector: Not reported
Result of Inspection: Not reported
Owner Name: IVAN LEIST
Owner Address: 3857 KINGS HIGHWAY
Owner City,St,Zip: BROOKLYN, NY 11234
Federal ID: Not reported
Owner Tel: (718) 258-0373
Owner Type: Private Resident
Owner Subtype: Not reported
Mailing Contact: IVAN LEIST
Mailing Name: IVAN LEIST
Mailing Address: 3857 KINGS HIGHWAY
Mailing Address 2: Not reported
Mailing City,St,Zip: BROOKLYN, NY 11234
Mailing Telephone: (718) 258-0373
Owner Mark: First Owner
Facility Status: 1 - Active PBS facility, i.e. total capacity of the PBS tanks is greater than 1,100 gallons, regardless if Subpart 360-14 tanks exist or not at the facility.

Certification Flag: False
Certification Date: 08/26/1997
Expiration: 09/19/2002

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

357 EDGECOMBE AVE (Continued)

EDR ID Number
EPA ID Number

Database(s)

U003387915

Renew Flag: False
Renew Date: Not reported
Total Capacity: 6000
FAMT: True
Facility Screen: No Missing Data
Owner Screen: Minor Data Missing
Tank Screen: Minor Data Missing
Dead Letter: False
CBS Number: Not reported
Town or City: NEW YORK CITY
County Code: 62
Town or City Code: 01
Region: 2

Tank ID: 001
Tank Location: ABOVEGROUND
Tank Status: In Service
Install Date: Not reported
Capacity (Gal): 6000
Product Stored: NOS 5 OR 6 FUEL OIL
Tank Type: Steel/carbon steel
Tank Internal: Not reported
Tank External: Not reported
Pipe Location: Not reported
Pipe Type: STEEL/IRON
Pipe Internal: Not reported
Pipe External: Not reported
Tank Containment: Diking
Leak Detection: 0
Overfill Protection: 4
Dispenser Method: Suction
Date Tested: Not reported
Next Test Date: Not reported
Missing Data for Tank: Minor Data Missing
Date Closed: Not reported
Test Method: Not reported
Deleted: False
Updated: False
SPDES Number: Not reported
Lat/Long: Not reported

AJ152
NW
1/8-1/4
1196 ft.

527 REALTY NY LLC
527 WEST 157TH STREET
NEW YORK, NY 10032

AST A100173452
N/A

Site 2 of 3 in cluster AJ

Relative:
Higher

AST:

Actual:
132 ft.

AST:

Region: STATE
Facility Id: 2-403008
UTM X: 589172.19438
UTM Y: 4520797.03421
Expiration Date: 09/29/10
Renewal Date: / /
Total Capacity: 3000
Facility Type: Not reported

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s) EDR ID Number
EPA ID Number

527 REALTY NY LLC (Continued)

A100173452

Site Type Name:	Apartment Building/Office Building
Site Type Status:	Active
Mailing Company:	PINNACLE GROUP
Mailing Title:	Not reported
Mailing Contact:	MICHELLE MORALES
Mailing Address:	P.O. BOX 1920
Mailing Address 2:	Not reported
Mailing City:	NEW YORK
Mailing State:	NY
Mailing Zip Code:	10116
Mailing Phone No:	(212) 564-2111
Mailing Email:	Not reported
Owner Title:	AGENT
Owner Name:	MICHELLE MORALES
Owner Address:	P.O. BOX 1920
Owner Address 2:	Not reported
Owner State:	NY
Owner Zip Code:	10116
Owner Phone:	(212) 564-2111
Owner Company:	527 REALTY NY LLC
Emergency Contact:	MICHELLE MORALES
Emergency Phone:	(212) 564-2111
Operator:	PEDRO
Operator Phone:	(646) 773-9521
Owner City:	NEW YORK
Owner Sub Type:	Corporate or Commercial
Program Type:	PBS
Tank Number:	001
Tank Location Name:	Aboveground - in contact with soil
Tank Status:	In Service
Tank Model:	Not reported
Pipe Model:	Not reported
Active Status:	Active
Install Date:	/ /
Capacity Gallons:	3000
Material Name:	#2 Fuel Oil
Percentage:	100.00
Tank Type Name:	Steel/Carbon Steel/Iron
Tank Internal Protection:	None
Tank Internal Protection 1:	None
Tank Internal Protection 2:	Not reported
Pipe Location Name:	No Piping
Pipe Type Name:	Steel/Carbon Steel/Iron
Pipe External Protection 1:	None
Pipe External Protection 2:	Not reported
Tank Secondary Containment 1:	Vault (w/o access)
Tank Secondary Containment 2:	Not reported
Pipe Secondary Containment:	Not reported
Tank Leak Detection 1:	None
Tank Leak Detection 2:	Not reported
Pipe Leak Detection 1:	Exempt Suction Piping
Pipe Leak Detection 2:	Not reported
Type Of Overfill Prevention 1:	Product Level Gauge (A/G)
Type Of Overfill Prevention 2:	Not reported
Dispenser Method:	Suction
Spill Prevention:	Not reported

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

527 REALTY NY LLC (Continued)

EDR ID Number
EPA ID Number

Database(s)

A100173452

Tightness Test Method: Testing Not Required
Date Tested: / /
Next Test Date: / /
Date Tank Closed: / /

AL153
NNW
1/8-1/4
1197 ft.

522 WEST 158 STREET
522 WEST 158TH STREET
NEW YORK, NY 10032

AST A100183365
N/A

Site 2 of 4 in cluster AL

Relative:
Higher

AST:

Actual:
139 ft.

AST:

Region: STATE
Facility Id: 2-606786
UTM X: 589181.73339
UTM Y: 4520837.29775
Expiration Date: 08/22/11
Renewal Date: / /
Total Capacity: 3000
Facility Type: Not reported
Site Type Name: Apartment Building/Office Building
Site Type Status: Active
Mailing Company: NYC/HPD/DAMP
Mailing Title: Not reported
Mailing Contact: ASST. COMMISSIONER/DAMP
Mailing Address: Not reported
Mailing Address 2: 100 GOLD ST # 7Z5
Mailing City: NEW YORK
Mailing State: NY
Mailing Zip Code: 10038
Mailing Phone No: (212) 863-7301
Mailing Email: Not reported
Owner Title: 100 GOLD ST # 7Z5
Owner Name: WILLA H. PADGETT
Owner Address: 100 GOLD ST # 7Z5
Owner Address 2: Not reported
Owner State: NY
Owner Zip Code: 10038
Owner Phone: (212) 863-7301
Owner Company: NYC/HPD/DAMP
Emergency Contact: ASST. COMMISSIONER/DAMP
Emergency Phone: (212) 863-7301
Operator: ASST. COMMISSIONER/DAMP
Operator Phone: (212) 863-7301
Owner City: NEW YORK
Owner Sub Type: Local Government
Program Type: PBS

Tank Number: 1
Tank Location Name: Aboveground - in contact with soil
Tank Status: In Service
Tank Model: Not reported
Pipe Model: Not reported
Active Status: Active
Install Date: / /
Capacity Gallons: 3000

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

522 WEST 158 STREET (Continued)

EDR ID Number
EPA ID Number

Database(s)

A100183365

Material Name: #2 Fuel Oil
Percentage: 100.00
Tank Type Name: Steel/Carbon Steel/Iron
Tank Internal Protection: None
Tank Internal Protection 1: Painted/Asphalt Coating
Tank Internal Protection 2: Not reported
Pipe Location Name: Aboveground/Underground Combination
Pipe Type Name: Steel/Carbon Steel/Iron
Pipe External Protection 1: None
Pipe External Protection 2: Not reported
Tank Secondary Containment 1: None
Tank Secondary Containment 2: Not reported
Pipe Secondary Containment: Not reported
Tank Leak Detection 1: None
Tank Leak Detection 2: Not reported
Pipe Leak Detection 1: Exempt Suction Piping
Pipe Leak Detection 2: Not reported
Type Of Overfill Prevention 1: Vent Whistle
Type Of Overfill Prevention 2: Not reported
Dispenser Method: Suction
Spill Prevention: Not reported
Tightness Test Method: Testing Not Required
Date Tested: / /
Next Test Date: / /
Date Tank Closed: / /

AM154 555 W 156 ST
NW 555 W 156 ST
1/8-1/4 NEW YORK, NY 10032
1200 ft.

AST U003391496
HIST AST N/A

Site 1 of 4 in cluster AM

Relative:
Higher

AST:

Actual:
131 ft.

AST:

Region: STATE
Facility Id: 2-399221
UTM X: 589068.49446
UTM Y: 4520759.92239
Expiration Date: 10/07/11
Renewal Date: / /
Total Capacity: 5000
Facility Type: Not reported
Site Type Name: Apartment Building/Office Building
Site Type Status: Active
Mailing Company: BEACH LANE MANAGEMENT, INC.
Mailing Title: Not reported
Mailing Contact: 555 PARTNERS, L.P.
Mailing Address: 280 NORTH CENTRAL PARK AVENUE,
SUITE # 210
Mailing City: HARTSDALE,
Mailing State: NY
Mailing Zip Code: 10530
Mailing Phone No: (914) 997-2435
Mailing Email: Not reported
Owner Title: PRES
Owner Name: MARK SCHARFMAN
Owner Address: 280 NORTH CENTRAL PARK AVENUE, SUITE 210

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

555 W 156 ST (Continued)

EDR ID Number
EPA ID Number

Database(s)

U003391496

Owner Address 2: Not reported
Owner State: NY
Owner Zip Code: 10530
Owner Phone: (914) 997-2435
Owner Company: 555 PARTNERS, L.P.
Emergency Contact: ROBERT BRYANT
Emergency Phone: (914) 438-6949
Operator: RAFEAL SOSA
Operator Phone: (914) 572-8818
Owner City: HARTSDALE
Owner Sub Type: Corporate or Commercial
Program Type: PBS

Tank Number: 001
Tank Location Name: Aboveground - in contact with soil
Tank Status: In Service
Tank Model: Not reported
Pipe Model: Not reported
Active Status: Active
Install Date: / /
Capacity Gallons: 5000
Material Name: #6 Fuel Oil
Percentage: 100.00
Tank Type Name: Steel/Carbon Steel/Iron
Tank Internal Protection: None
Tank Internal Protection 1: None
Tank Internal Protection 2: Not reported
Pipe Location Name: No Piping
Pipe Type Name: Steel/Carbon Steel/Iron
Pipe External Protection 1: None
Pipe External Protection 2: Not reported
Tank Secondary Containment 1: None
Tank Secondary Containment 2: Not reported
Pipe Secondary Containment: Not reported
Tank Leak Detection 1: None
Tank Leak Detection 2: Not reported
Pipe Leak Detection 1: Exempt Suction Piping
Pipe Leak Detection 2: Not reported
Type Of Overfill Prevention 1: Product Level Gauge (A/G)
Type Of Overfill Prevention 2: Not reported
Dispenser Method: Suction
Spill Prevention: Not reported
Tightness Test Method: Testing Not Required
Date Tested: / /
Next Test Date: / /
Date Tank Closed: / /

HIST AST:

PBS Number: 2-399221
SWIS Code: 6201
Operator: ANTONIO LANTIGUA
Facility Phone: (917) 507-2109
Facility Addr2: 555 W 156 ST
Facility Type: APARTMENT BUILDING
Emergency: ROBERT BRYANT
Emergency Tel: (917) 273-8635
Old PBSNO: Not reported

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

555 W 156 ST (Continued)

EDR ID Number
EPA ID Number

Database(s)

U003391496

Date Inspected: Not reported
Inspector: Not reported
Result of Inspection: Not reported
Owner Name: 555 PARTNERS, L.P.
Owner Address: 280 NORTH CENTRAL PARK AVENUE, SUITE 210
Owner City,St,Zip: HARTSDALE, NY 10530
Federal ID: Not reported
Owner Tel: (914) 997-2435
Owner Type: Corporate/Commercial
Owner Subtype: Not reported
Mailing Contact: 555 PARTNERS, L.P.
Mailing Name: BEACH LANE MANAGEMENT, INC.
Mailing Address: 280 NORTH CENTRAL PARK AVENUE,
Mailing Address 2: SUITE # 210
Mailing City,St,Zip: HARTSDALE,, NY 10530
Mailing Telephone: (914) 997-2435
Owner Mark: Second Owner
Facility Status: 1 - Active PBS facility, i.e. total capacity of the PBS tanks is
greater than 1,100 gallons, regardless if Subpart 360-14 tanks exist
or not at the facility.
Certification Flag: False
Certification Date: 09/28/2001
Expiration: 10/07/2006
Renew Flag: False
Renew Date: Not reported
Total Capacity: 5000
FAMT: True
Facility Screen: No Missing Data
Owner Screen: No Missing Data
Tank Screen: Minor Data Missing
Dead Letter: False
CBS Number: Not reported
Town or City: NEW YORK CITY
County Code: 62
Town or City Code: 01
Region: 2
Tank ID: 001
Tank Location: ABOVEGROUND
Tank Status: In Service
Install Date: Not reported
Capacity (Gal): 5000
Product Stored: NOS 5 OR 6 FUEL OIL
Tank Type: Steel/carbon steel
Tank Internal: Not reported
Tank External: Not reported
Pipe Location: Not reported
Pipe Type: STEEL/IRON
Pipe Internal: Not reported
Pipe External: Not reported
Tank Containment: None
Leak Detection: 0
Overfill Protection: 4
Dispenser Method: Suction
Date Tested: Not reported
Next Test Date: Not reported
Missing Data for Tank: Minor Data Missing

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

555 W 156 ST (Continued)

EDR ID Number
EPA ID Number

U003391496

Date Closed: Not reported
Test Method: Not reported
Deleted: False
Updated: True
SPDES Number: Not reported
Lat/Long: Not reported

AK155 524 W. 152 ST. HDFC
WSW 524 WEST 152ND STREET
1/8-1/4 NEW YORK, NY 10031
1200 ft.

AST A100183531
N/A

Site 3 of 9 in cluster AK

Relative:
Higher

AST:

Actual:
136 ft.

AST:

Region: STATE
Facility Id: 2-606967
UTM X: 588955.62707
UTM Y: 4520405.23748
Expiration Date: 09/20/11
Renewal Date: / /
Total Capacity: 2000
Facility Type: Not reported
Site Type Name: Apartment Building/Office Building
Site Type Status: Active
Mailing Company: 524 W. 152 ST HDFC
Mailing Title: Not reported
Mailing Contact: Not reported
Mailing Address: 524 WEST 152ND STREET
Mailing Address 2: #10
Mailing City: NEW YORK
Mailing State: NY
Mailing Zip Code: 10031
Mailing Phone No: (212) 283-4493
Mailing Email: Not reported
Owner Title: Not reported
Owner Name: JEAN GEE
Owner Address: 524 W. 152 ST. #10
Owner Address 2: Not reported
Owner State: NY
Owner Zip Code: 10031
Owner Phone: (212) 283-4493
Owner Company: 524 W. 152 ST HDFC
Emergency Contact: JEAN GEE
Emergency Phone: (212) 283-4493
Operator: JEAN GEE
Operator Phone: (212) 283-4493
Owner City: NEW YORK
Owner Sub Type: Corporate or Commercial
Program Type: PBS

Tank Number: 001
Tank Location Name: Aboveground - in contact with soil
Tank Status: In Service
Tank Model: Not reported
Pipe Model: Not reported
Active Status: Active

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

524 W. 152 ST. HDFC (Continued)

EDR ID Number
EPA ID Number

Database(s)

A100183531

Install Date: / /
Capacity Gallons: 2000
Material Name: #2 Fuel Oil
Percentage: 100.00
Tank Type Name: Steel/Carbon Steel/Iron
Tank Internal Protection: None
Tank Internal Protection 1: None
Tank Internal Protection 2: Not reported
Pipe Location Name: Aboveground
Pipe Type Name: Steel/Carbon Steel/Iron
Pipe External Protection 1: None
Pipe External Protection 2: Not reported
Tank Secondary Containment 1: Diking (Aboveground)
Tank Secondary Containment 2: Not reported
Pipe Secondary Containment: Not reported
Tank Leak Detection 1: None
Tank Leak Detection 2: Not reported
Pipe Leak Detection 1: Exempt Suction Piping
Pipe Leak Detection 2: Not reported
Type Of Overfill Prevention 1: Vent Whistle
Type Of Overfill Prevention 2: Not reported
Dispenser Method: Suction
Spill Prevention: Not reported
Tightness Test Method: Testing Not Required
Date Tested: / /
Next Test Date: / /
Date Tank Closed: / /

AK156 CITY OF NY DEPARTMENT OF H.P.D
WSW 522 W 152 ST
1/8-1/4 MANHATTAN, NY 10031
1200 ft.

AST U003395974
HIST AST N/A

Relative:
Higher

Site 4 of 9 in cluster AK

Actual:
136 ft.

AST:
AST:
Region: STATE
Facility Id: 2-601099
UTM X: 588981.01662
UTM Y: 4520419.02587
Expiration Date: 10/21/97
Renewal Date: / /
Total Capacity: 1500
Facility Type: Not reported
Site Type Name: Apartment Building/Office Building
Site Type Status: Active
Mailing Company: CITY OF NY DEPARTMENT OF H.P.D
Mailing Title: Not reported
Mailing Contact: IVAN SCHWARTZ
Mailing Address: 75 MAIDEN LANE
Mailing Address 2: 4TH FL- RM 427
Mailing City: NEW YORK
Mailing State: NY
Mailing Zip Code: 10038
Mailing Phone No: (212) 806-8037
Mailing Email: Not reported
Owner Title: Not reported

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s) EDR ID Number
EPA ID Number

CITY OF NY DEPARTMENT OF H.P.D (Continued)

U003395974

Owner Name: Not reported
Owner Address: 75 MAIDEN LANE
Owner Address 2: Not reported
Owner State: NY
Owner Zip Code: 10038
Owner Phone: (212) 806-8306
Owner Company: CITY OF NY DEPARTMENT OF H.P.D
Emergency Contact: LOUISE BECTON
Emergency Phone: (212) 234-3656
Operator: JOH PRESAK
Operator Phone: (212) 234-1175
Owner City: NEW YORK
Owner Sub Type: Local Government
Program Type: PBS

Tank Number: 1
Tank Location Name: Aboveground - in contact with soil
Tank Status: In Service
Tank Model: Not reported
Pipe Model: Not reported
Active Status: Active
Install Date: / /
Capacity Gallons: 1500
Material Name: #2 Fuel Oil
Percentage: 100.00
Tank Type Name: Steel/Carbon Steel/Iron
Tank Internal Protection: None
Tank Internal Protection 1: Painted/Asphalt Coating
Tank Internal Protection 2: Not reported
Pipe Location Name: Aboveground/Underground Combination
Pipe Type Name: Steel/Carbon Steel/Iron
Pipe External Protection 1: Painted/Asphalt Coating
Pipe External Protection 2: Not reported
Tank Secondary Containment 1: Vault (w/o access)
Tank Secondary Containment 2: Not reported
Pipe Secondary Containment: Not reported
Tank Leak Detection 1: None
Tank Leak Detection 2: Not reported
Pipe Leak Detection 1: Exempt Suction Piping
Pipe Leak Detection 2: Not reported
Type Of Overfill Prevention 1: Vent Whistle
Type Of Overfill Prevention 2: Not reported
Dispenser Method: Suction
Spill Prevention: Not reported
Tightness Test Method: Testing Not Required
Date Tested: / /
Next Test Date: / /
Date Tank Closed: / /

HIST AST:

PBS Number: 2-601099
SWIS Code: 6201
Operator: JOH PRESAK
Facility Phone: (212) 234-1175
Facility Addr2: 522 W 152 ST
Facility Type: APARTMENT BUILDING
Emergency: LOUISE BECTON

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

CITY OF NY DEPARTMENT OF H.P.D (Continued)

EDR ID Number
EPA ID Number

Database(s)

U003395974

Emergency Tel: (212) 234-3656
Old PBSNO: Not reported
Date Inspected: Not reported
Inspector: Not reported
Result of Inspection: Not reported
Owner Name: CITY OF NY DEPARTMENT OF H.P.D
Owner Address: 75 MAIDEN LANE
Owner City,St,Zip: NY, NY 10038
Federal ID: Not reported
Owner Tel: (212) 806-8306
Owner Type: Local Government
Owner Subtype: Not reported
Mailing Contact: IVAN SCHWARTZ
Mailing Name: CITY OF NY DEPARTMENT OF H.P.D
Mailing Address: 75 MAIDEN LANE
Mailing Address 2: 4TH FL- RM 427
Mailing City,St,Zip: NY, NY 10038
Mailing Telephone: (212) 806-8037
Owner Mark: First Owner
Facility Status: 1 - Active PBS facility, i.e. total capacity of the PBS tanks is greater than 1,100 gallons, regardless if Subpart 360-14 tanks exist or not at the facility.

Certification Flag: False
Certification Date: 10/23/1992
Expiration: 10/21/1997
Renew Flag: False
Renew Date: Not reported
Total Capacity: 1500
FAMT: True
Facility Screen: No Missing Data
Owner Screen: Minor Data Missing
Tank Screen: No Missing Data
Dead Letter: False
CBS Number: Not reported
Town or City: NEW YORK CITY
County Code: 62
Town or City Code: 01
Region: 2

Tank ID: 1
Tank Location: ABOVEGROUND
Tank Status: In Service
Install Date: Not reported
Capacity (Gal): 1500
Product Stored: NOS 1,2, OR 4 FUEL OIL
Tank Type: Steel/carbon steel
Tank Internal: 0
Tank External: 01
Pipe Location: Aboveground/Underground Combination
Pipe Type: STEEL/IRON
Pipe Internal: None
Pipe External: 01
Tank Containment: Diking
Leak Detection: 00
Overfill Protection: 06
Dispenser Method: Suction
Date Tested: Not reported

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

CITY OF NY DEPARTMENT OF H.P.D (Continued)

EDR ID Number
EPA ID Number

Database(s)

U003395974

Next Test Date: Not reported
Missing Data for Tank: No Missing Data
Date Closed: Not reported
Test Method: Not reported
Deleted: False
Updated: True
SPDES Number: Not reported
Lat/Long: Not reported

AK157 523-525 WEST 152ND STREET H.D.F.C.
WSW 523-525 WEST 152ND STREET
1/8-1/4 NEW YORK, NY 10031
1200 ft.

AST U003394916
HIST AST N/A

Site 5 of 9 in cluster AK

Relative:
Higher

AST:

Actual:
136 ft.

AST:

Region: STATE
Facility Id: 2-469955
UTM X: 588943.40476
UTM Y: 4520411.81237
Expiration Date: 03/28/09
Renewal Date: / /
Total Capacity: 4000
Facility Type: Not reported
Site Type Name: Private Residence
Site Type Status: Active
Mailing Company: 523-525 WEST 152ND STREET HDFC
Mailing Title: Not reported
Mailing Contact: SUPER FACILITY MANAGER
Mailing Address: 523-525 WEST 152ND STREET
Mailing Address 2: Not reported
Mailing City: NEW YORK
Mailing State: NY
Mailing Zip Code: 10031
Mailing Phone No: Not reported
Mailing Email: Not reported
Owner Title: Not reported
Owner Name: Not reported
Owner Address: 523-525 W. 152ND STREET
Owner Address 2: Not reported
Owner State: NY
Owner Zip Code: 10031
Owner Phone: Not reported
Owner Company: 523-525 W. 152ND ST. HDFC
Emergency Contact: KELVYN BELL
Emergency Phone: Not reported
Operator: 523-525 W. 152ND ST. HDFC
Operator Phone: Not reported
Owner City: NEW YORK
Owner Sub Type: Corporate or Commercial
Program Type: PBS

Tank Number: 001
Tank Location Name: Aboveground - in contact with soil
Tank Status: In Service
Tank Model: Not reported

Map ID
 Direction
 Distance
 Distance (ft.)
 Elevation Site

MAP FINDINGS

Database(s)
 EDR ID Number
 EPA ID Number

523-525 WEST 152ND STREET H.D.F.C. (Continued)

U003394916

Pipe Model: Not reported
 Active Status: Active
 Install Date: / /
 Capacity Gallons: 4000
 Material Name: #2 Fuel Oil
 Percentage: 100.00
 Tank Type Name: Steel/Carbon Steel/Iron
 Tank Internal Protection: None
 Tank Internal Protection 1: None
 Tank Internal Protection 2: Not reported
 Pipe Location Name: Aboveground
 Pipe Type Name: Steel/Carbon Steel/Iron
 Pipe External Protection 1: None
 Pipe External Protection 2: Not reported
 Tank Secondary Containment 1: Vault (w/o access)
 Tank Secondary Containment 2: Not reported
 Pipe Secondary Containment: Not reported
 Tank Leak Detection 1: None
 Tank Leak Detection 2: Not reported
 Pipe Leak Detection 1: Exempt Suction Piping
 Pipe Leak Detection 2: Not reported
 Type Of Overfill Prevention 1: Product Level Gauge (A/G)
 Type Of Overfill Prevention 2: Not reported
 Dispenser Method: Suction
 Spill Prevention: Not reported
 Tightness Test Method: Testing Not Required
 Date Tested: / /
 Next Test Date: / /
 Date Tank Closed: / /

HIST AST:
 PBS Number: 2-469955
 SWIS Code: 6201
 Operator: NYC HOUSING PRESERV & DEVEL
 Facility Phone: (212) 806-8565
 Facility Addr2: 523 WEST 152ND STREET
 Facility Type: Not reported
 Emergency: JUANITA ARSENEC
 Emergency Tel: (212) 360-7900
 Old PBSNO: Not reported
 Date Inspected: Not reported
 Inspector: Not reported
 Result of Inspection: Not reported
 Owner Name: NYC HOUSING PRESERV & DEVEL
 Owner Address: 75 MAIDEN LANE
 Owner City,St,Zip: NEW YORK, NY 10038
 Federal ID: Not reported
 Owner Tel: (212) 806-8565
 Owner Type: Corporate/Commercial
 Owner Subtype: Not reported
 Mailing Contact: SUPER FACILITY MANAGER
 Mailing Name: 523-525 WEST 152ND STREET H.D.F.C.
 Mailing Address: 523-525 WEST 152ND STREET
 Mailing Address 2: Not reported
 Mailing City,St,Zip: NEW YORK, NY 10031
 Mailing Telephone: (212) 234-3877
 Owner Mark: First Owner

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

523-525 WEST 152ND STREET H.D.F.C. (Continued)

EDR ID Number
EPA ID Number

Database(s)

U003394916

Facility Status: 1 - Active PBS facility, i.e. total capacity of the PBS tanks is greater than 1,100 gallons, regardless if Subpart 360-14 tanks exist or not at the facility.

Certification Flag: False
Certification Date: 01/20/1999
Expiration: 03/28/2004
Renew Flag: False
Renew Date: Not reported
Total Capacity: 4000
FAMT: True
Facility Screen: Minor Data Missing
Owner Screen: No Missing Data
Tank Screen: Minor Data Missing
Dead Letter: False
CBS Number: Not reported
Town or City: NEW YORK CITY
County Code: 62
Town or City Code: 01
Region: 2

Tank ID: 001
Tank Location: ABOVEGROUND
Tank Status: In Service
Install Date: Not reported
Capacity (Gal): 4000
Product Stored: UNLEADED GASOLINE
Tank Type: Steel/carbon steel
Tank Internal: Not reported
Tank External: Not reported
Pipe Location: Not reported
Pipe Type: STEEL/IRON
Pipe Internal: Not reported
Pipe External: Not reported
Tank Containment: Diking
Leak Detection: 0
Overfill Protection: 4
Dispenser Method: Suction
Date Tested: Not reported
Next Test Date: Not reported
Missing Data for Tank: Minor Data Missing
Date Closed: Not reported
Test Method: Not reported
Deleted: False
Updated: True
SPDES Number: Not reported
Lat/Long: Not reported

AL158
NNW
1/8-1/4
1210 ft.

525 WEST 158TH REALTY LLC
525 WEST 158TH STREET
NEW YORK, NY 10032

AST A100292500
N/A

Relative:
Higher

Site 3 of 4 in cluster AL

AST:

Actual:
138 ft.

AST:

Region: STATE
Facility Id: 2-607302

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s) EDR ID Number
EPA ID Number

525 WEST 158TH REALTY LLC (Continued)

A100292500

UTM X: 589181.82015
UTM Y: 4520851.06592
Expiration Date: 05/09/10
Renewal Date: / /
Total Capacity: 3000
Facility Type: Not reported
Site Type Name: Apartment Building/Office Building
Site Type Status: Active
Mailing Company: 525 WEST 158 STREET, LLC
Mailing Title: Not reported
Mailing Contact: Not reported
Mailing Address: 29 WEST 46TH STREET 6TH FL.
Mailing Address 2: Not reported
Mailing City: NEW YORK
Mailing State: NY
Mailing Zip Code: 10036
Mailing Phone No: Not reported
Mailing Email: Not reported
Owner Title: MANAGING MEMBER
Owner Name: GODI ZAMIR
Owner Address: 29 WEST 46TH STREET 6TH FL.
Owner Address 2: Not reported
Owner State: NY
Owner Zip Code: 10036
Owner Phone: Not reported
Owner Company: 525 WEST 158 STREET, LLC
Emergency Contact: LOUIS GIANO
Emergency Phone: Not reported
Operator: LOUIS GIANO
Operator Phone: Not reported
Owner City: NEW YORK
Owner Sub Type: Private Resident
Program Type: PBS

Tank Number: 001
Tank Location Name: Aboveground on crib, rack, or cradle
Tank Status: In Service
Tank Model: Not reported
Pipe Model: Not reported
Active Status: Active
Install Date: / /
Capacity Gallons: 3000
Material Name: #2 Fuel Oil
Percentage: 100.00
Tank Type Name: Steel/Carbon Steel/Iron
Tank Internal Protection: None
Tank Internal Protection 1: None
Tank Internal Protection 2: Not reported
Pipe Location Name: Aboveground
Pipe Type Name: Steel/Carbon Steel/Iron
Pipe External Protection 1: None
Pipe External Protection 2: Not reported
Tank Secondary Containment 1: Vault (w/o access)
Tank Secondary Containment 2: Not reported
Pipe Secondary Containment: Not reported
Tank Leak Detection 1: None
Tank Leak Detection 2: Not reported

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

525 WEST 158TH REALTY LLC (Continued)

EDR ID Number
EPA ID Number

Database(s)

A100292500

Pipe Leak Detection 1: Exempt Suction Piping
Pipe Leak Detection 2: Not reported
Type Of Overfill Prevention 1: Vent Whistle
Type Of Overfill Prevention 2: Not reported
Dispenser Method: Suction
Spill Prevention: Not reported
Tightness Test Method: Testing Not Required
Date Tested: / /
Next Test Date: / /
Date Tank Closed: / /

AM159
NW
1/8-1/4
1217 ft.

556 W 156 ST
556 W 156 ST
NY, NY 10032

AST U003389296
HIST AST N/A

Site 2 of 4 in cluster AM

Relative:
Higher

AST:

Actual:
131 ft.

AST:

Region: STATE
Facility Id: 2-305359
UTM X: 589059.23953
UTM Y: 4520751.15097
Expiration Date: 08/22/07
Renewal Date: 03/06/02
Total Capacity: 3000
Facility Type: Not reported
Site Type Name: Apartment Building/Office Building
Site Type Status: Active
Mailing Company: DIANA ASSOCIATES TWENTY LP
Mailing Title: Not reported
Mailing Contact: WILLIAM STANLEY
Mailing Address: C/O JMG MANAGEMENT PLUS INC
Mailing Address 2: P.O. BOX 949
Mailing City: YONKERS
Mailing State: NY
Mailing Zip Code: 10704
Mailing Phone No: (914) 667-4500
Mailing Email: Not reported
Owner Title: Not reported
Owner Name: Not reported
Owner Address: P.O. BOX 949
Owner Address 2: Not reported
Owner State: NY
Owner Zip Code: 10704
Owner Phone: (914) 667-4500
Owner Company: PRONA ASSOCIATES TWENTY, LP C/O JMG MGMT PLUS INC
Emergency Contact: MARIZED SIERRA
Emergency Phone: (914) 667-4500
Operator: CESAR GUARACA
Operator Phone: (212) 368-0861
Owner City: YONKERS
Owner Sub Type: Not reported
Program Type: PBS

Tank Number: 001
Tank Location Name: Aboveground - in contact with soil

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s)
EDR ID Number
EPA ID Number

556 W 156 ST (Continued)

U003389296

Tank Status: In Service
Tank Model: Not reported
Pipe Model: Not reported
Active Status: Active
Install Date: / /
Capacity Gallons: 3000
Material Name: #2 Fuel Oil
Percentage: 100.00
Tank Type Name: Steel/Carbon Steel/Iron
Tank Internal Protection: None
Tank Internal Protection 1: None
Tank Internal Protection 2: Not reported
Pipe Location Name: Aboveground
Pipe Type Name: Galvanized Steel
Pipe External Protection 1: None
Pipe External Protection 2: Not reported
Tank Secondary Containment 1: None
Tank Secondary Containment 2: Not reported
Pipe Secondary Containment: Not reported
Tank Leak Detection 1: None
Tank Leak Detection 2: Not reported
Pipe Leak Detection 1: Not reported
Pipe Leak Detection 2: Not reported
Type Of Overfill Prevention 1: None
Type Of Overfill Prevention 2: Not reported
Dispenser Method: None
Spill Prevention: Not reported
Tightness Test Method: Testing Not Required
Date Tested: / /
Next Test Date: / /
Date Tank Closed: / /

HIST AST:

PBS Number: 2-305359
SWIS Code: 6201
Operator: RAEFLO REALTY INC
Facility Phone: (212) 662-0600
Facility Addr2: 556 W 156 ST
Facility Type: APARTMENT BUILDING
Emergency: STEPHEN WEINTRAUB
Emergency Tel: (212) 662-0600
Old PBSNO: Not reported
Date Inspected: Not reported
Inspector: Not reported
Result of Inspection: Not reported
Owner Name: RAEFLO REALTY INC
Owner Address: 229 WEST 105TH ST. SUITE 1
Owner City,St,Zip: NY, NY 10025
Federal ID: Not reported
Owner Tel: (212) 662-0600
Owner Type: Corporate/Commercial
Owner Subtype: Not reported
Mailing Contact: LESLIE KAUFMAN
Mailing Name: RAEFLO REALTY INC
Mailing Address: 229 WEST 105TH ST. SUITE 1
Mailing Address 2: Not reported
Mailing City,St,Zip: NY, NY 10025

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

556 W 156 ST (Continued)

EDR ID Number
EPA ID Number

Database(s)

U003389296

Mailing Telephone: (212) 662-0600
Owner Mark: First Owner
Facility Status: 1 - Active PBS facility, i.e. total capacity of the PBS tanks is greater than 1,100 gallons, regardless if Subpart 360-14 tanks exist or not at the facility.
Certification Flag: False
Certification Date: 07/10/1997
Expiration: 07/14/2002
Renew Flag: False
Renew Date: Not reported
Total Capacity: 3000
FAMT: True
Facility Screen: No Missing Data
Owner Screen: No Missing Data
Tank Screen: No Missing Data
Dead Letter: False
CBS Number: Not reported
Town or City: NEW YORK CITY
County Code: 62
Town or City Code: 01
Region: 2
Tank ID: 001
Tank Location: ABOVEGROUND
Tank Status: In Service
Install Date: Not reported
Capacity (Gal): 3000
Product Stored: NOS 1,2, OR 4 FUEL OIL
Tank Type: Steel/carbon steel
Tank Internal: 0
Tank External: 0
Pipe Location: Aboveground
Pipe Type: GALVANIZED STEEL
Pipe Internal: None
Pipe External: 0
Tank Containment: Diking
Leak Detection: 0
Overfill Protection: 4
Dispenser Method: Suction
Date Tested: Not reported
Next Test Date: Not reported
Missing Data for Tank: No Missing Data
Date Closed: Not reported
Test Method: Not reported
Deleted: False
Updated: True
SPDES Number: Not reported
Lat/Long: Not reported

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

	Site	Database(s)	EDR ID Number EPA ID Number
AM160 NW 1/8-1/4 1217 ft.	556 WEST 156TH ST-APT A 556 WEST 156TH ST-APT A NEW YORK, NY Site 3 of 4 in cluster AM	LTANKS HIST LTANKS	S102662838 N/A
Relative: Higher	LTANKS:		
Actual: 131 ft.	Site ID: 78355 Spill Date: 02/03/97 Facility Addr2: Not reported Facility ID: 9613009 Program Number: 9613009 SWIS: 3101 Region of Spill: 2 Investigator: TOMASELLO Referred To: Not reported Reported to Dept: 02/03/97 CID: 199 Spill Cause: Tank Overfill Water Affected: Not reported Spill Source: Commercial/Industrial Spill Notifier: Affected Persons Cleanup Ceased: / / Cleanup Meets Standard: False Last Inspection: / / Recommended Penalty: Penalty Not Recommended UST Involvement: False Spill Class: Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken. Spill Closed Dt: 02/24/03 Remediation Phase: 0 Date Entered In Computer: 02/03/97 Spill Record Last Update: 02/24/03 Spille Namer: Not reported Spiller Company: Not reported Spiller Phone: Not reported Spiller Extention: Not reported Spiller Address: Not reported Spiller City,St,Zip: ***Update***, ZZ Spiller County: 001 Spiller Contact: MARY MIDDLETON Spiller Phone: (212) 281-9480 Spiller Extention: Not reported DEC Region: 2 Program Number: 9613009 DER Facility ID: 72921 Site ID: 78355 Operable Unit ID: 1044554 Operable Unit: 01 Material ID: 341659 Material Code: 0001 Material Name: #2 Fuel Oil Case No.: Not reported Material FA: Petroleum Quantity: 0.00 Units: Gallons Recovered: 0.00 Resource Affected: Soil Oxygenate: False		

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

556 WEST 156TH ST-APT A (Continued)

EDR ID Number
EPA ID Number

Database(s)

S102662838

Site ID: Not reported
Spill Tank Test: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate: Not reported
Gross Fail: Not reported
Modified By: Not reported
Last Modified: Not reported
Test Method: Not reported
DEC Memo: Not reported
Remarks: Start CallerRemark - 9613009 BUILDING IS OWNED RAFELLO REALITY COMPANY - TENNANT HAS HAD NO LUCK WITH LANDLORD - CALLER STATES THAT EACH TIME THE TANK IS FILLED THERE IS SOME SPILLAGE - IT HAS GOTTEN TO THE POINT THAT THE APTS ARE STARTING TO SMELL LIKE FUEL OIL - RAFELLO REALITY IS AT 229 WEST 105TH STREET 10025 END CallerRemark - 9613009

HIST LTANKS:

Region of Spill: 2
Spill Number: 9613009
Investigator: TOMASELLO
Caller Name: Not reported
Caller Agency: Not reported
Caller Phone: Not reported
Caller Extension: Not reported
Notifier Name: Not reported
Notifier Agency: Not reported
Notifier Phone: Not reported
Notifier Extension: Not reported
Spill Date: 02/03/1997
Spill Time: 14:39
Reported to Department Date: 02/03/97
Reported to Department Time: 14:39
SWIS: 62
Spiller Contact: MARY MIDDLETON
Spiller Phone: (212) 281-9480
Spiller Extension: Not reported
Spiller Name: Not reported
Spiller Address: Not reported
Spiller City,St,Zip: Not reported
Facility Contact: Not reported
Facility Phone: Not reported
Facility Extension: Not reported
Spill Cause: Tank Overfill
Resource Affectd: On Land
Water Affected: Not reported
Spill Source: Other Commercial/Industrial
Spill Notifier: Affected Persons
PBS Number: Not reported
Cleanup Ceased: / /
Cleanup Meets Standard: False
Last Inspection: / /
Recommended Penalty: Penalty Not Recommended
Spiller Cleanup Date: / /
Enforcement Date: / /
Investigation Complete: / /
UST Involvement: False

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s)
EDR ID Number
EPA ID Number

556 WEST 156TH ST-APT A (Continued)

S102662838

Spill Class: Known release with minimal potential for fire or hazard. DEC Response.
Willing Responsible Party. Corrective action taken.
Spill Closed Dt: / /
Date Region Sent Summary to Central Office: / /
Corrective Action Plan Submitted: / /
Date Spill Entered In Computer Data File: 02/03/97
Time Spill Entered In Computer Data File: Not reported
Spill Record Last Update: 02/04/97
Is Updated: False
PBS Number: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate Failed Tank: Not reported
Gross Leak Rate: Not reported
Material Class Type: Petroleum
Quantity Spilled: 0
Unkonwn Quantity Spilled: True
Units: Gallons
Quantity Recovered: 0
Unkonwn Quantity Recovered: True
Material: #2 FUEL OIL
Class Type: #2 FUEL OIL
Times Material Entry In File: 24464
CAS Number: Not reported
Last Date: 19941207
DEC Remarks: Not reported
Spill Cause: BUILDING IS OWNED RAFELLO REALITY COMPANY - TENNANT HAS HAD NO LUCK WITH
LANDLORD - CALLER STATES THAT EACH TIME THE TANK IS FILLED THERE IS SOME
SPILLAGE - IT HAS GOTTEN TO THE POINT THAT THE APTS ARE STARTING TO SMELL LIKE
FUEL OIL - RAFELLO REALITY IS AT 229 WEST 105TH STREET 10025

AN161 555 EDGELANDS AVE
NNE 555 EDGEcombe AVE
1/8-1/4 NEW YORK, NY 10032
1220 ft.

AST U000401541
HIST UST N/A

Site 1 of 2 in cluster AN

Relative:
Higher

AST:

Actual:
136 ft.

AST:

Region: STATE
Facility Id: 2-294799
UTM X: 589506.18117
UTM Y: 4520828.49693
Expiration Date: 07/14/12
Renewal Date: 03/06/02
Total Capacity: 10000
Facility Type: Not reported
Site Type Name: Apartment Building/Office Building
Site Type Status: Active
Mailing Company: GOLSON REALTY CORP
Mailing Title: Not reported
Mailing Contact: Not reported
Mailing Address: 1841 BROADWAY
Mailing Address 2: SUITE 1206
Mailing City: NEW YORK
Mailing State: NY

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s)
EDR ID Number
EPA ID Number

555 EDGELANDS AVE (Continued)

U000401541

Mailing Zip Code: 10023
Mailing Phone No: (212) 246-6525
Mailing Email: Not reported
Owner Title: VP
Owner Name: GOLSON REALTY
Owner Address: 1841 BROADWAY
Owner Address 2: Not reported
Owner State: NY
Owner Zip Code: 10023
Owner Phone: (212) 246-6525
Owner Company: GOLSON REALTY CORP
Emergency Contact: COASTAL PETROLEUM TANK CORP
Emergency Phone: (212) 475-4263
Operator: GOLSONREALTY CORP
Operator Phone: (212) 781-4138
Owner City: NEW YORK
Owner Sub Type: Corporate or Commercial
Program Type: PBS

Tank Number: 001
Tank Location Name: Aboveground on crib, rack, or cradle
Tank Status: In Service
Tank Model: Not reported
Pipe Model: Not reported
Active Status: Active
Install Date: 06/01/58
Capacity Gallons: 10000
Material Name: #6 Fuel Oil
Percentage: 100.00
Tank Type Name: Steel/Carbon Steel/Iron
Tank Internal Protection: None
Tank Internal Protection 1: None
Tank Internal Protection 2: Not reported
Pipe Location Name: No Piping
Pipe Type Name: Steel/Carbon Steel/Iron
Pipe External Protection 1: None
Pipe External Protection 2: Not reported
Tank Secondary Containment 1: Vault (w/o access)
Tank Secondary Containment 2: Not reported
Pipe Secondary Containment: Not reported
Tank Leak Detection 1: None
Tank Leak Detection 2: Not reported
Pipe Leak Detection 1: None
Pipe Leak Detection 2: Not reported
Type Of Overfill Prevention 1: Product Level Gauge (A/G)
Type Of Overfill Prevention 2: Not reported
Dispenser Method: Suction
Spill Prevention: Not reported
Tightness Test Method: Testing Not Required
Date Tested: / /
Next Test Date: / /
Date Tank Closed: / /

HIST UST:

PBS Number: 2-294799
SPDES Number: Not reported
Emergency Contact: COASTAL PETROLEUM TANK CORP

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s)
EDR ID Number
EPA ID Number

555 EDGELANDS AVE (Continued)

U000401541

Emergency Telephone: (212) 475-4263
Operator: GOLDSWAN REALTY CORP
Operator Telephone: (212) 781-4138
Owner Name: GOLDSWAN REALTY CORP
Owner Address: 1841 BROADWAY
Owner City,St,Zip: NEW YORK, NY 10023
Owner Telephone: (212) 246-6525
Owner Type: Corporate/Commercial
Owner Subtype: Not reported
Mailing Name: GOLDSWAN REALTY CORP
Mailing Address: 1841 BROADWAY
Mailing Address 2: SUITE 1206
Mailing City,St,Zip: NEW YORK, NY 10023
Mailing Contact: Not reported
Mailing Telephone: (212) 246-6525
Owner Mark: First Owner
Facility Status: 1 - Active PBS facility, i.e. total capacity of the PBS tanks is greater than 1,100 gallons, regardless if Subpart 360-14 tanks exist or not at the facility.

Facility Addr2: 555 EDGEcombe AVE
SWIS ID: 6201
Old PBS Number: Not reported
Facility Type: APARTMENT BUILDING
Inspected Date: Not reported
Inspector: Not reported
Inspection Result: Not reported
Federal ID: Not reported
Certification Flag: False
Certification Date: 07/18/1997
Expiration Date: 07/14/2002
Renew Flag: False
Renewal Date: Not reported
Total Capacity: 10000
FAMT: True
Facility Screen: No Missing Data
Owner Screen: No Missing Data
Tank Screen: Minor Data Missing
Dead Letter: False
CBS Number: Not reported
Town or City: NEW YORK CITY
County Code: 62
Town or City: 01
Region: 2

Tank Id: 001
Tank Location: UNDERGROUND, VAULTED, WITH ACCESS
Tank Status: In Service
Install Date: Not reported
Capacity (gals): 10000
Product Stored: NOS 5 OR 6 FUEL OIL
Tank Type: Steel/carbon steel
Tank Internal: Not reported
Tank External: Not reported
Pipe Location: Not reported
Pipe Type: STEEL/IRON
Pipe Internal: Not reported
Pipe External: Not reported

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

555 EDGELANDS AVE (Continued)

EDR ID Number
EPA ID Number

U000401541

Second Containment: Diking
Leak Detection: None
Overfill Prot: Product Level Gauge
Dispenser: Suction
Date Tested: Not reported
Next Test Date: Not reported
Missing Data for Tank: Minor Data Missing
Date Closed: Not reported
Test Method: Not reported
Deleted: False
Updated: False
Lat/long: Not reported

AN162
NNE
1/8-1/4
1220 ft.

555 EDGEcombe AVE
555 EDGEcombe AVE
NYC, NY

LTANKS
HIST LTANKS

S100493543
N/A

Relative:
Higher

Site 2 of 2 in cluster AN

Actual:
136 ft.

LTANKS:
Site ID: 99809
Spill Date: 05/16/92
Facility Addr2: Not reported
Facility ID: 9201956
Program Number: 9201956
SWIS: 3101
Region of Spill: 2
Investigator: O'DOWD
Referred To: Not reported
Reported to Dept: 05/18/92
CID: 15
Spill Cause: Tank Failure
Water Affected: Not reported
Spill Source: Commercial/Industrial
Spill Notifier: Responsible Party
Cleanup Ceased: 05/29/92
Cleanup Meets Standard: True
Last Inspection: / /
Recommended Penalty: Penalty Not Recommended
UST Involvement: False
Spill Class: Known release with minimal potential for fire or hazard. DEC Response.
Willing Responsible Party. Corrective action taken.
Spill Closed Dt: 05/29/92
Remediation Phase: 0
Date Entered In Computer: 05/20/92
Spill Record Last Update: 04/23/93
Spille Namer: Not reported
Spiller Company: GOLSWAN REALTY
Spiller Phone: Not reported
Spiller Extention: Not reported
Spiller Address: Not reported
Spiller City,St,Zip: ZZ
Spiller County: 001
Spiller Contact: Not reported
Spiller Phone: Not reported
Spiller Extention: Not reported
DEC Region: 2
Program Number: 9201956

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

555 EDGECOMBE AVE (Continued)

EDR ID Number
EPA ID Number

Database(s)

S100493543

DER Facility ID: 88666
Site ID: 99809
Operable Unit ID: 966049
Operable Unit: 01
Material ID: 413240
Material Code: 0003
Material Name: #6 Fuel Oil
Case No.: Not reported
Material FA: Petroleum
Quantity: 6000.00
Units: Gallons
Recovered: 0.00
Resource Affected: Soil
Oxygenate: False
Site ID: Not reported
Spill Tank Test: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate: Not reported
Gross Fail: Not reported
Modified By: Not reported
Last Modified: Not reported
Test Method: Not reported
DEC Memo: Not reported
Remarks: Start CallerRemark - 9201956 FUEL ON FLOOR; A L EASTMON CLEANING & REPAIRING.
END CallerRemark - 9201956

HIST LTANKS:

Region of Spill: 2
Spill Number: 9201956
Investigator: O'DOWD
Caller Name: Not reported
Caller Agency: Not reported
Caller Phone: Not reported
Caller Extension: Not reported
Notifier Name: Not reported
Notifier Agency: Not reported
Notifier Phone: Not reported
Notifier Extension: Not reported
Spill Date: 05/16/1992
Spill Time: 24:00
Reported to Department Date: 05/18/92
Reported to Department Time: 11:22
SWIS: 62
Spiller Contact: Not reported
Spiller Phone: Not reported
Spiller Extension: Not reported
Spiller Name: GOLSWAN REALTY
Spiller Address: Not reported
Spiller City,St,Zip: Not reported
Facility Contact: Not reported
Facility Phone: Not reported
Facility Extension: Not reported
Spill Cause: Tank Failure
Resource Affectd: On Land
Water Affected: Not reported

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

555 EDGECOMBE AVE (Continued)

EDR ID Number
EPA ID Number

Database(s)

S100493543

Spill Source: Other Commercial/Industrial
Spill Notifier: Responsible Party
PBS Number: Not reported
Cleanup Ceased: 05/29/92
Cleanup Meets Standard: True
Last Inspection: / /
Recommended Penalty: Penalty Not Recommended
Spiller Cleanup Date: / /
Enforcement Date: / /
Investigation Complete: / /
UST Involvement: False
Spill Class: Known release with minimal potential for fire or hazard. DEC Response.
Willing Responsible Party. Corrective action taken.
Spill Closed Dt: 05/29/92
Date Region Sent Summary to Central Office: / /
Corrective Action Plan Submitted: / /
Date Spill Entered In Computer Data File: 05/20/92
Time Spill Entered In Computer Data File: Not reported
Spill Record Last Update: 04/23/93
Is Updated: False
PBS Number: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate Failed Tank: Not reported
Gross Leak Rate: Not reported
Material Class Type: Petroleum
Quantity Spilled: 6000
Unkonwn Quantity Spilled: False
Units: Gallons
Quantity Recovered: 0
Unkonwn Quantity Recovered: False
Material: #6 FUEL OIL
Class Type: #6 FUEL OIL
Times Material Entry In File: 2190
CAS Number: Not reported
Last Date: 19940728
DEC Remarks: Not reported
Spill Cause: FUEL ON FLOOR; A L EASTMON CLEANING REPAIRING.

AJ163
NW
1/8-1/4
1223 ft.

530 WEST 157TH STREET
530 WEST 157TH STREET
NEW YORK, NY 10032

AST
HIST AST
U003392367
N/A

Site 3 of 3 in cluster AJ

Relative:
Higher

AST:

Actual:
132 ft.

AST:

Region: STATE
Facility Id: 2-365130
UTM X: 589158.44266
UTM Y: 4520790.53986
Expiration Date: 06/30/08
Renewal Date: / /
Total Capacity: 4000
Facility Type: Not reported
Site Type Name: Apartment Building/Office Building

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s)
EDR ID Number
EPA ID Number

530 WEST 157TH STREET (Continued)

U003392367

Site Type Status: Active
Mailing Company: VENTURA LAND CORP.
Mailing Title: Not reported
Mailing Contact: STEVEN LAVELLE
Mailing Address: 149-45 NORTHERN BOULEVARD
Mailing Address 2: SUITE 6V
Mailing City: FLUSHING
Mailing State: NY
Mailing Zip Code: 11354
Mailing Phone No: Not reported
Mailing Email: Not reported
Owner Title: Not reported
Owner Name: Not reported
Owner Address: 149-45 NORTHERN BOULEVARD
Owner Address 2: Not reported
Owner State: NY
Owner Zip Code: 11354
Owner Phone: Not reported
Owner Company: WESTSIDE VENTURA LLC
Emergency Contact: JOSEPH SBIROLI
Emergency Phone: Not reported
Operator: JOSE CABRERA
Operator Phone: Not reported
Owner City: FLUSHING
Owner Sub Type: Private Resident
Program Type: PBS

Tank Number: 1
Tank Location Name: Aboveground - in contact with soil
Tank Status: In Service
Tank Model: Not reported
Pipe Model: Not reported
Active Status: Active
Install Date: / /
Capacity Gallons: 4000
Material Name: #2 Fuel Oil
Percentage: 100.00
Tank Type Name: Steel/Carbon Steel/Iron
Tank Internal Protection: None
Tank Internal Protection 1: None
Tank Internal Protection 2: Not reported
Pipe Location Name: No Piping
Pipe Type Name: Galvanized Steel
Pipe External Protection 1: None
Pipe External Protection 2: Not reported
Tank Secondary Containment 1: Double-Walled (Underground)
Tank Secondary Containment 2: Not reported
Pipe Secondary Containment: Not reported
Tank Leak Detection 1: None
Tank Leak Detection 2: Not reported
Pipe Leak Detection 1: Exempt Suction Piping
Pipe Leak Detection 2: Not reported
Type Of Overfill Prevention 1: Product Level Gauge (A/G)
Type Of Overfill Prevention 2: Not reported
Dispenser Method: Suction
Spill Prevention: Not reported
Tightness Test Method: Testing Not Required

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s)

EDR ID Number
EPA ID Number

530 WEST 157TH STREET (Continued)

U003392367

Date Tested: / /
Next Test Date: / /
Date Tank Closed: / /

HIST AST:

PBS Number: 2-365130
SWIS Code: 6201
Operator: JOSE
Facility Phone: (212) 281-4245
Facility Addr2: 530 WEST 157TH STREET
Facility Type: APARTMENT BUILDING
Emergency: EDUARDO DELACRUZ
Emergency Tel: (718) 796-9595
Old PBSNO: Not reported
Date Inspected: Not reported
Inspector: Not reported
Result of Inspection: Not reported
Owner Name: PRANA ASSOCIATES NINETEEN, LP
Owner Address: 3154 ALBANY CRESCENT, 2ND FLOOR
Owner City,St,Zip: BRONX, NY 10763
Federal ID: Not reported
Owner Tel: (718) 796-9595
Owner Type: Corporate/Commercial
Owner Subtype: Not reported
Mailing Contact: JONAHTAN HOCHHAUSER
Mailing Name: PRANA ASSOCIATES NINETEEN, LP
Mailing Address: 3154 ALBANY CRESCENT
Mailing Address 2: 2ND FLOOR
Mailing City,St,Zip: BRONX, NY 10763
Mailing Telephone: (718) 796-9595
Owner Mark: Second Owner
Facility Status: 1 - Active PBS facility, i.e. total capacity of the PBS tanks is
 greater than 1,100 gallons, regardless if Subpart 360-14 tanks exist
 or not at the facility.
Certification Flag: False
Certification Date: 02/23/2001
Expiration: 02/22/2006
Renew Flag: False
Renew Date: Not reported
Total Capacity: 4000
FAMT: True
Facility Screen: No Missing Data
Owner Screen: No Missing Data
Tank Screen: Minor Data Missing
Dead Letter: False
CBS Number: Not reported
Town or City: NEW YORK CITY
County Code: 62
Town or City Code: 01
Region: 2

Tank ID: 1
Tank Location: ABOVEGROUND ON SADDLES LEGS, STILTS, RACK, OR CRADLE
Tank Status: In Service
Install Date: Not reported
Capacity (Gal): 4000
Product Stored: NOS 1,2, OR 4 FUEL OIL

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

530 WEST 157TH STREET (Continued)

EDR ID Number
EPA ID Number

Database(s)

U003392367

Tank Type: Steel/carbon steel
Tank Internal: Not reported
Tank External: Not reported
Pipe Location: Not reported
Pipe Type: GALVANIZED STEEL
Pipe Internal: Not reported
Pipe External: Not reported
Tank Containment: Vault (w/access)
Leak Detection: 0
Overfill Protection: 4
Dispenser Method: Suction
Date Tested: Not reported
Next Test Date: Not reported
Missing Data for Tank: Minor Data Missing
Date Closed: Not reported
Test Method: Not reported
Deleted: False
Updated: True
SPDES Number: Not reported
Lat/Long: Not reported

AK164 529 WEST 152ND STREET HDFO (T.A)
West 529 WEST 152ND STREET
1/8-1/4 NEW YORK, NY 10031
1226 ft.

AST U003395083
HIST AST N/A

Site 6 of 9 in cluster AK

Relative:
Higher

AST:

Actual:
136 ft.

AST:

Region: STATE
Facility Id: 2-471488
UTM X: 588971.84998
UTM Y: 4520437.90042
Expiration Date: 03/28/94
Renewal Date: / /
Total Capacity: 2500
Facility Type: Not reported
Site Type Name: Unknown
Site Type Status: Active
Mailing Company: 529 WEST 152ND STREET HDFO (T.A.)
Mailing Title: Not reported
Mailing Contact: SUPER/FACILITY MANAGER
Mailing Address: 529 WEST 152ND STREET
Mailing Address 2: Not reported
Mailing City: NEW YORK
Mailing State: NY
Mailing Zip Code: 10031
Mailing Phone No: (212) 283-6451
Mailing Email: Not reported
Owner Title: Not reported
Owner Name: Not reported
Owner Address: 2089-2091 ARTHUR AVENUE
Owner Address 2: Not reported
Owner State: NY
Owner Zip Code: 10457
Owner Phone: (718) 295-2178
Owner Company: NYC HOUSING PRESERV & DEVEL

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s)
EDR ID Number
EPA ID Number

529 WEST 152ND STREET HDFO (T.A) (Continued)

U003395083

Emergency Contact: NYC
Emergency Phone: Not reported
Operator: NYC HOUSING PRESERV & DEVEL
Operator Phone: (212) 283-6451
Owner City: BRONX
Owner Sub Type: Corporate or Commercial
Program Type: PBS

Tank Number: 001
Tank Location Name: Aboveground - in contact with soil
Tank Status: In Service
Tank Model: Not reported
Pipe Model: Not reported
Active Status: Active
Install Date: / /
Capacity Gallons: 2500
Material Name: #2 Fuel Oil
Percentage: 100.00
Tank Type Name: Steel/Carbon Steel/Iron
Tank Internal Protection: None
Tank Internal Protection 1: None
Tank Internal Protection 2: Not reported
Pipe Location Name: No Piping
Pipe Type Name: Steel/Carbon Steel/Iron
Pipe External Protection 1: None
Pipe External Protection 2: Not reported
Tank Secondary Containment 1: Double-Walled (Underground)
Tank Secondary Containment 2: Not reported
Pipe Secondary Containment: Not reported
Tank Leak Detection 1: None
Tank Leak Detection 2: Not reported
Pipe Leak Detection 1: Exempt Suction Piping
Pipe Leak Detection 2: Not reported
Type Of Overfill Prevention 1: Product Level Gauge (A/G)
Type Of Overfill Prevention 2: Not reported
Dispenser Method: Suction
Spill Prevention: Not reported
Tightness Test Method: Testing Not Required
Date Tested: / /
Next Test Date: / /
Date Tank Closed: / /

HIST AST:

PBS Number: 2-471488
SWIS Code: 6201
Operator: NYC HOUSING PRESERV & DEVEL
Facility Phone: (212) 283-6451
Facility Addr2: 529 WEST 152ND STREET
Facility Type: Not reported
Emergency: NYC
Emergency Tel: (000) 000-0000
Old PBSNO: Not reported
Date Inspected: Not reported
Inspector: Not reported
Result of Inspection: Not reported
Owner Name: NYC HOUSING PRESERV & DEVEL
Owner Address: 75 MAIDEN LANE

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s)
EDR ID Number
EPA ID Number

529 WEST 152ND STREET HDFO (T.A) (Continued)

U003395083

Owner City,St,Zip: NEW YORK, NY 10038
Federal ID: Not reported
Owner Tel: (212) 283-6451
Owner Type: Corporate/Commercial
Owner Subtype: Not reported
Mailing Contact: SUPER/FACILITY MANAGER
Mailing Name: 529 WEST 152ND STREET HDFO (T.A.)
Mailing Address: 529 WEST 152ND STREET
Mailing Address 2: Not reported
Mailing City,St,Zip: NEW YORK, NY 10031
Mailing Telephone: (212) 283-6451
Owner Mark: First Owner
Facility Status: 1 - Active PBS facility, i.e. total capacity of the PBS tanks is greater than 1,100 gallons, regardless if Subpart 360-14 tanks exist or not at the facility.

Certification Flag: False
Certification Date: Not reported
Expiration: 03/28/1994
Renew Flag: False
Renew Date: Not reported
Total Capacity: 2500
FAMT: True
Facility Screen: Minor Data Missing
Owner Screen: Minor Data Missing
Tank Screen: Minor Data Missing
Dead Letter: False
CBS Number: Not reported
Town or City: NEW YORK CITY
County Code: 62
Town or City Code: 01
Region: 2

Tank ID: 001
Tank Location: ABOVEGROUND
Tank Status: In Service
Install Date: Not reported
Capacity (Gal): 2500
Product Stored: NOS 1,2, OR 4 FUEL OIL
Tank Type: Steel/carbon steel
Tank Internal: Not reported
Tank External: Not reported
Pipe Location: Not reported
Pipe Type: STEEL/IRON
Pipe Internal: Not reported
Pipe External: Not reported
Tank Containment: Vault (w/access)
Leak Detection: 0
Overfill Protection: 4
Dispenser Method: Suction
Date Tested: Not reported
Next Test Date: Not reported
Missing Data for Tank: Minor Data Missing
Date Closed: Not reported
Test Method: Not reported
Deleted: False
Updated: False
SPDES Number: Not reported

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

529 WEST 152ND STREET HDFC (T.A) (Continued)

EDR ID Number
EPA ID Number

Database(s)

Lat/Long: Not reported

U003395083

AK165
West
1/8-1/4
1226 ft.

528 WEST 152ND STREET
528 WEST 152ND STREET
NEW YORK, NY 10031

UST U004076991
N/A

Site 7 of 9 in cluster AK

Relative:
Higher

UST:

Actual:
136 ft.

UST:

Facility Id: 2-207926
Expiration Date: 06/30/92
Renewal Date: / /
Total Capacity: 2500
Facility Type: Not reported
Mailing Company: KI, PROPERTIES INC
Mailing Title: Not reported
Mailing Contact: Not reported
Mailing Address: 528 WEST 152ND STREET
Mailing Address 2: Not reported
Mailing City: NEW YORK
Mailing State: NY
Mailing Zip Code: 10031
Mailing Phone No: (212) 234-6006
Mailing Email: Not reported
Owner Title: Not reported
Owner Name: Not reported
Owner Address: 528 WEST 152ND STREET
Owner Address 2: Not reported
Owner State: NY
Owner Zip Code: 10031
Owner Phone: (212) 234-6006
Owner Company: KI, PROPERTIES INC
Emergency Contact: COASTAL PETROLEUM TANK CORP
Emergency Phone: (212) 475-4263
Operator: MR HEZEKIAH CARR
Operator Phone: (212) 234-6006
Owner City: NEW YORK
Owner Sub Type: Not reported
UTM X: 588967.17862
UTM Y: 4520426.63082
Site Type Name: Unknown
Site Type Status: Active
Comments: Not reported

Program Type: PBS

Tank Number: 001
Tank Location Name: Underground, vaulted, with access
Tank Status: In Service
Tank Model: Not reported
Pipe Model: Not reported
Active Status: Active
Install Date: / /
Capacity Gallons: 2500
Material Name: #2 Fuel Oil
Percentage: 100.00

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s)
EDR ID Number
EPA ID Number

528 WEST 152ND STREET (Continued)

U004076991

Tank Type Name: Steel/Carbon Steel/Iron
Tank Internal Protection: None
Tank Internal Protection 1: None
Tank Internal Protection 2: Not reported
Pipe Location Name: No Piping
Pipe Type Name: Steel/Carbon Steel/Iron
Pipe External Protection 1: None
Pipe External Protection 2: Not reported
Tank Secondary Containment 1: Vault (w/o access)
Tank Secondary Containment 2: Not reported
Pipe Secondary Containment: Not reported
Tank Leak Detection 1: None
Tank Leak Detection 2: Not reported
Pipe Leak Detection 1: Exempt Suction Piping
Pipe Leak Detection 2: Not reported
Type Of Overfill Prevention 1: Product Level Gauge (A/G)
Type Of Overfill Prevention 2: Not reported
Dispenser Method: Suction
Spill Prevention: Not reported
Tightness Test Method: Testing Not Required
Date Tested: / /
Next Test Date: / /
Date Tank Closed: / /

AK166
West
1/8-1/4
1226 ft.

528 WEST 152ND STREET
528 WEST 152ND STREET
NEW YORK, NY 10031

HIST UST U000397673
N/A

Site 8 of 9 in cluster AK

Relative:
Higher

HIST UST:

Actual:
136 ft.

PBS Number: 2-207926
SPDES Number: Not reported
Emergency Contact: COASTAL PETROLEUM TANK CORP
Emergency Telephone: (212) 475-4263
Operator: MR HEZEKIAH CARR
Operator Telephone: (212) 234-6006
Owner Name: KI, PROPERTIES INC
Owner Address: 528 WEST 152ND STREET
Owner City,St,Zip: NEW YORK, NY 10031
Owner Telephone: (212) 234-6006
Owner Type: Not reported
Owner Subtype: Not reported
Mailing Name: KI, PROPERTIES INC
Mailing Address: 528 WEST 152ND STREET
Mailing Address 2: Not reported
Mailing City,St,Zip: NEW YORK, NY 10031
Mailing Contact: Not reported
Mailing Telephone: (212) 234-6006
Owner Mark: First Owner
Facility Status: 1 - Active PBS facility, i.e. total capacity of the PBS tanks is greater than 1,100 gallons, regardless if Subpart 360-14 tanks exist or not at the facility.
Facility Addr2: 528 WEST 152ND STREET
SWIS ID: 6201
Old PBS Number: Not reported
Facility Type: Not reported
Inspected Date: Not reported

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

528 WEST 152ND STREET (Continued)

EDR ID Number
EPA ID Number

Database(s)

U000397673

Inspector: Not reported
Inspection Result: Not reported
Federal ID: Not reported
Certification Flag: False
Certification Date: 06/30/1987
Expiration Date: 06/30/1992
Renew Flag: False
Renewal Date: Not reported
Total Capacity: 2500
FAMT: True
Facility Screen: Minor Data Missing
Owner Screen: Minor Data Missing
Tank Screen: Minor Data Missing
Dead Letter: False
CBS Number: Not reported
Town or City: NEW YORK CITY
County Code: 62
Town or City: 01
Region: 2

Tank Id: 001
Tank Location: UNDERGROUND, VAULTED, WITH ACCESS
Tank Status: In Service
Install Date: Not reported
Capacity (gals): 2500
Product Stored: NOS 1,2, OR 4 FUEL OIL
Tank Type: Steel/carbon steel
Tank Internal: Not reported
Tank External: Not reported
Pipe Location: Not reported
Pipe Type: STEEL/IRON
Pipe Internal: Not reported
Pipe External: Not reported
Second Containment: Diking
Leak Detection: None
Overfill Prot: Product Level Gauge
Dispenser: Suction
Date Tested: Not reported
Next Test Date: Not reported
Missing Data for Tank: Minor Data Missing
Date Closed: Not reported
Test Method: Not reported
Deleted: False
Updated: False
Lat/long: Not reported

AM167 559 WEST 156TH ST NEW YORK NY
NW 559 WEST 156TH ST
1/8-1/4 NEW YORK, NY 10032
1235 ft.

AST U003386366
HIST AST N/A

Relative:
Higher

Site 4 of 4 in cluster AM

Actual:
130 ft.

AST:
Region: STATE
Facility Id: 2-213683
UTM X: 589059.24093

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s)
EDR ID Number
EPA ID Number

559 WEST 156TH ST NEW YORK NY (Continued)

U003386366

UTM Y: 4520765.02890
Expiration Date: 06/30/07
Renewal Date: 02/05/02
Total Capacity: 5000
Facility Type: Not reported
Site Type Name: Apartment Building/Office Building
Site Type Status: Active
Mailing Company: 559 WEST 156TH STREET
Mailing Title: Not reported
Mailing Contact: SUPER FACILITY MANAGER
Mailing Address: 559 WEST 156TH STREET
Mailing Address 2: Not reported
Mailing City: NEW YORK
Mailing State: NY
Mailing Zip Code: 10032
Mailing Phone No: (212) 234-8242
Mailing Email: Not reported
Owner Title: Not reported
Owner Name: Not reported
Owner Address: 452 75TH STREET
Owner Address 2: Not reported
Owner State: NY
Owner Zip Code: 11209
Owner Phone: (718) 745-2870
Owner Company: PETER KOKOLIS AND TERRY TSAFATINOS
Emergency Contact: P KOKOLIS
Emergency Phone: (718) 745-2870
Operator: CECILIA BARREIROS
Operator Phone: (212) 234-8242
Owner City: BROOKLYN
Owner Sub Type: Corporate or Commercial
Program Type: PBS

Tank Number: 001
Tank Location Name: Aboveground - in contact with soil
Tank Status: In Service
Tank Model: Not reported
Pipe Model: Not reported
Active Status: Active
Install Date: / /
Capacity Gallons: 5000
Material Name: #2 Fuel Oil
Percentage: 100.00
Tank Type Name: Steel/Carbon Steel/Iron
Tank Internal Protection: None
Tank Internal Protection 1: None
Tank Internal Protection 2: Not reported
Pipe Location Name: No Piping
Pipe Type Name: Steel/Carbon Steel/Iron
Pipe External Protection 1: None
Pipe External Protection 2: Not reported
Tank Secondary Containment 1: None
Tank Secondary Containment 2: Not reported
Pipe Secondary Containment: Not reported
Tank Leak Detection 1: None
Tank Leak Detection 2: Not reported
Pipe Leak Detection 1: Not reported

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s)
EDR ID Number
EPA ID Number

559 WEST 156TH ST NEW YORK NY (Continued)

U003386366

Pipe Leak Detection 2: Not reported
Type Of Overfill Prevention 1: Product Level Gauge (A/G)
Type Of Overfill Prevention 2: Not reported
Dispenser Method: Not reported
Spill Prevention: Not reported
Tightness Test Method: Testing Not Required
Date Tested: / /
Next Test Date: / /
Date Tank Closed: / /

HIST AST:

PBS Number: 2-213683
SWIS Code: 6201
Operator: CECILIA BARREIROS
Facility Phone: (212) 234-8242
Facility Addr2: 559 WEST 156TH ST
Facility Type: APARTMENT BUILDING
Emergency: P KOKOLIS
Emergency Tel: (718) 745-2870
Old PBSNO: Not reported
Date Inspected: Not reported
Inspector: Not reported
Result of Inspection: Not reported
Owner Name: PETER KOKOLIS AND TERRY TSAFATINOS
Owner Address: 452 75TH STREET
Owner City,St,Zip: BROOKLYN, NY 11209
Federal ID: Not reported
Owner Tel: (718) 745-2870
Owner Type: Corporate/Commercial
Owner Subtype: Not reported
Mailing Contact: SUPER FACILITY MANAGER
Mailing Name: 559 WEST 156TH STREET
Mailing Address: 559 WEST 156TH STREET
Mailing Address 2: Not reported
Mailing City,St,Zip: NEW YORK, NY 10032
Mailing Telephone: (212) 234-8242
Owner Mark: First Owner
Facility Status: 1 - Active PBS facility, i.e. total capacity of the PBS tanks is greater than 1,100 gallons, regardless if Subpart 360-14 tanks exist or not at the facility.

Certification Flag: False
Certification Date: 05/07/1998
Expiration: 06/30/2002
Renew Flag: False
Renew Date: Not reported
Total Capacity: 5000
FAMT: True
Facility Screen: No Missing Data
Owner Screen: No Missing Data
Tank Screen: Minor Data Missing
Dead Letter: False
CBS Number: Not reported
Town or City: NEW YORK CITY
County Code: 62
Town or City Code: 01
Region: 2

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

559 WEST 156TH ST NEW YORK NY (Continued)

EDR ID Number
EPA ID Number

Database(s)

U003386366

Tank ID: 001
Tank Location: ABOVEGROUND
Tank Status: In Service
Install Date: Not reported
Capacity (Gal): 5000
Product Stored: NOS 1,2, OR 4 FUEL OIL
Tank Type: Steel/carbon steel
Tank Internal: Not reported
Tank External: Not reported
Pipe Location: Not reported
Pipe Type: STEEL/IRON
Pipe Internal: Not reported
Pipe External: Not reported
Tank Containment: None
Leak Detection: 0
Overfill Protection: 4
Dispenser Method: Gravity
Date Tested: Not reported
Next Test Date: Not reported
Missing Data for Tank: Minor Data Missing
Date Closed: Not reported
Test Method: Not reported
Deleted: False
Updated: False
SPDES Number: Not reported
Lat/Long: Not reported

168
SE
1/8-1/4
1236 ft.

307 W. 153RD ST
301 153RD ST
MANHATTAN, NY

LTANKS S102672694
HIST LTANKS N/A

Relative:
Lower

LTANKS:

Actual:
16 ft.

Site ID: 135661
Spill Date: 11/25/94
Facility Addr2: Not reported
Facility ID: 9411344
Program Number: 9411344
SWIS: 3101
Region of Spill: 2
Investigator: SMMARTIN
Referred To: Not reported
Reported to Dept: 11/25/94
CID: 15
Spill Cause: Tank Overfill
Water Affected: Not reported
Spill Source: Tank Truck
Spill Notifier: Responsible Party
Cleanup Ceased: 11/25/94
Cleanup Meets Standard: True
Last Inspection: / /
Recommended Penalty: Penalty Not Recommended
UST Involvement: False
Spill Class: Known release with minimal potential for fire or hazard. DEC Response.
Willing Responsible Party. Corrective action taken.
Spill Closed Dt: 11/25/94
Remediation Phase: 0
Date Entered In Computer: 01/05/95

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

307 W. 153RD ST (Continued)

S102672694

Spill Record Last Update: 06/19/06
Spille Namer: Not reported
Spiller Company: 307 W. 153RD ST CORP
Spiller Phone: Not reported
Spiller Extention: Not reported
Spiller Address: Not reported
Spiller City,St,Zip: ZZ
Spiller County: 001
Spiller Contact: Not reported
Spiller Phone: Not reported
Spiller Extention: Not reported
DEC Region: 2
Program Number: 9411344
DER Facility ID: 116487
Site ID: 135661
Operable Unit ID: 1009224
Operable Unit: 01
Material ID: 377202
Material Code: 0001
Material Name: #2 Fuel Oil
Case No.: Not reported
Material FA: Petroleum
Quantity: 1.00
Units: Gallons
Recovered: 0.00
Resource Affected: Soil
Oxygenate: False
Site ID: Not reported
Spill Tank Test: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate: Not reported
Gross Fail: Not reported
Modified By: Not reported
Last Modified: Not reported
Test Method: Not reported
DEC Memo: Start DECRemark - 9411344 Prior to Sept, 2004 data translation this spill Lead
DEC Field was "MARTINKAT" END DECRemark - 9411344
Remarks: Start CallerRemark - 9411344 DEFFECTIVE PETROMETER TANK OVERFILL- SIDEWALK
CLEANUP. END CallerRemark - 9411344

HIST LTANKS:

Region of Spill: 2
Spill Number: 9411344
Investigator: MARTINKAT
Caller Name: Not reported
Caller Agency: Not reported
Caller Phone: Not reported
Caller Extension: Not reported
Notifier Name: Not reported
Notifier Agency: Not reported
Notifier Phone: Not reported
Notifier Extension: Not reported
Spill Date: 11/25/1994
Spill Time: 11:00
Reported to Department Date: 11/25/94

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s)
EDR ID Number
EPA ID Number

307 W. 153RD ST (Continued)

S102672694

Reported to Department Time: 11:44
SWIS: 62
Spiller Contact: Not reported
Spiller Phone: Not reported
Spiller Extention: Not reported
Spiller Name: 307 W. 153RD ST CORP
Spiller Address: Not reported
Spiller City,St,Zip: Not reported
Facility Contact: Not reported
Facility Phone: Not reported
Facility Extention: Not reported
Spill Cause: Tank Overfill
Resource Affectd: On Land
Water Affected: Not reported
Spill Source: Tank Truck
Spill Notifier: Responsible Party
PBS Number: Not reported
Cleanup Ceased: 11/25/94
Cleanup Meets Standard: True
Last Inspection: / /
Recommended Penalty: Penalty Not Recommended
Spiller Cleanup Date: / /
Enforcement Date: / /
Investigation Complete: / /
UST Involvement: False
Spill Class: Known release with minimal potential for fire or hazard. DEC Response.
Willing Responsible Party. Corrective action taken.
Spill Closed Dt: 11/25/94
Date Region Sent Summary to Central Office: / /
Corrective Action Plan Submitted: / /
Date Spill Entered In Computer Data File: 01/05/95
Time Spill Entered In Computer Data File: Not reported
Spill Record Last Update: / /
Is Updated: False
PBS Number: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate Failed Tank: Not reported
Gross Leak Rate: Not reported
Material Class Type: Petroleum
Quantity Spilled: 1
Unkonwn Quantity Spilled: False
Units: Gallons
Quantity Recovered: 0
Unkonwn Quantity Recovered: False
Material: #2 FUEL OIL
Class Type: #2 FUEL OIL
Times Material Entry In File: 24464
CAS Number: Not reported
Last Date: 19941207
DEC Remarks: Not reported
Spill Cause: DEFFECTIVE PETROMETER TANK OVERFILL- SIDEWALK CLEANUP.

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

AL169
NNW
1/8-1/4
1237 ft.

529 WEST 158TH ST. INC.
529 WEST 158TH STREET
NEW YORK, NY 10032

AST **A100153918**
N/A

Site 4 of 4 in cluster AL

Relative:
Higher

AST:

Actual:
137 ft.

AST:

Region: STATE
Facility Id: 2-290920
UTM X: 589203.57682
UTM Y: 4520865.91458
Expiration Date: 08/20/04
Renewal Date: / /
Total Capacity: 3000
Facility Type: Not reported
Site Type Name: Apartment Building/Office Building
Site Type Status: Active
Mailing Company: 529 WEST 158TH STREET, INC.
Mailing Title: Not reported
Mailing Contact: Not reported
Mailing Address: 1801 WEEKS AVENUE
Mailing Address 2: Not reported
Mailing City: BRONX
Mailing State: NY
Mailing Zip Code: 10457
Mailing Phone No: (718) 583-2300
Mailing Email: Not reported
Owner Title: Not reported
Owner Name: Not reported
Owner Address: 1801 WEEKS AVE.
Owner Address 2: Not reported
Owner State: NY
Owner Zip Code: 10457
Owner Phone: (718) 583-2300
Owner Company: 529 WEST 158TH STREET INC.
Emergency Contact: LEZE GAZIVODA
Emergency Phone: (718) 583-2300
Operator: LEZE GAZIVODA
Operator Phone: (718) 583-2300
Owner City: BRONX
Owner Sub Type: Corporate or Commercial
Program Type: PBS

Tank Number: 001
Tank Location Name: Aboveground - in contact with soil
Tank Status: In Service
Tank Model: Not reported
Pipe Model: Not reported
Active Status: Active
Install Date: / /
Capacity Gallons: 3000
Material Name: #6 Fuel Oil
Percentage: 100.00
Tank Type Name: Steel/Carbon Steel/Iron
Tank Internal Protection: None
Tank Internal Protection 1: None
Tank Internal Protection 2: Not reported
Pipe Location Name: No Piping

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

529 WEST 158TH ST. INC. (Continued)

EDR ID Number
EPA ID Number

Database(s)

A100153918

Pipe Type Name: Steel/Carbon Steel/Iron
Pipe External Protection 1: None
Pipe External Protection 2: Not reported
Tank Secondary Containment 1: Vault (w/o access)
Tank Secondary Containment 2: Not reported
Pipe Secondary Containment: Not reported
Tank Leak Detection 1: None
Tank Leak Detection 2: Not reported
Pipe Leak Detection 1: Exempt Suction Piping
Pipe Leak Detection 2: Not reported
Type Of Overfill Prevention 1: Product Level Gauge (A/G)
Type Of Overfill Prevention 2: Not reported
Dispenser Method: Suction
Spill Prevention: Not reported
Tightness Test Method: Testing Not Required
Date Tested: / /
Next Test Date: / /
Date Tank Closed: / /

170
West
1/8-1/4
1243 ft.

550 WEST 153RD STREET
550 WEST 153RD STREET
NEW YORK, NY 10031

AST
HIST AST

U003395086
N/A

Relative:
Higher

AST:

AST:

Actual:
147 ft.

Region: STATE
Facility Id: 2-471518
UTM X: 588954.79598
UTM Y: 4520523.51597
Expiration Date: 03/28/94
Renewal Date: / /
Total Capacity: 2500
Facility Type: Not reported
Site Type Name: Unknown
Site Type Status: Active
Mailing Company: NYC HOUSING PRESERV & DEVEL
Mailing Title: Not reported
Mailing Contact: Not reported
Mailing Address: 2089-2091 ARTHUR AVENUE
Mailing Address 2: Not reported
Mailing City: BRONX
Mailing State: NY
Mailing Zip Code: 10457
Mailing Phone No: (718) 295-2178
Mailing Email: Not reported
Owner Title: Not reported
Owner Name: Not reported
Owner Address: 2089-2091 ARTHUR AVENUE
Owner Address 2: Not reported
Owner State: NY
Owner Zip Code: 10457
Owner Phone: (718) 295-2178
Owner Company: NYC HOUSING PRESERV & DEVEL
Emergency Contact: JUANITA ARSENEC
Emergency Phone: (212) 360-7900
Operator: NYC HOUSING PRSERV & DEVEL

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s)
EDR ID Number
EPA ID Number

550 WEST 153RD STREET (Continued)

U003395086

Operator Phone: (212) 806-8565
Owner City: BRONX
Owner Sub Type: Not reported
Program Type: PBS

Tank Number: 001
Tank Location Name: Aboveground - in contact with soil
Tank Status: In Service
Tank Model: Not reported
Pipe Model: Not reported
Active Status: Active
Install Date: / /
Capacity Gallons: 2500
Material Name: #2 Fuel Oil
Percentage: 100.00
Tank Type Name: Steel/Carbon Steel/Iron
Tank Internal Protection: None
Tank Internal Protection 1: None
Tank Internal Protection 2: Not reported
Pipe Location Name: No Piping
Pipe Type Name: Steel/Carbon Steel/Iron
Pipe External Protection 1: None
Pipe External Protection 2: Not reported
Tank Secondary Containment 1: Double-Walled (Underground)
Tank Secondary Containment 2: Not reported
Pipe Secondary Containment: Not reported
Tank Leak Detection 1: None
Tank Leak Detection 2: Not reported
Pipe Leak Detection 1: Exempt Suction Piping
Pipe Leak Detection 2: Not reported
Type Of Overfill Prevention 1: Product Level Gauge (A/G)
Type Of Overfill Prevention 2: Not reported
Dispenser Method: Suction
Spill Prevention: Not reported
Tightness Test Method: Testing Not Required
Date Tested: / /
Next Test Date: / /
Date Tank Closed: / /

HIST AST:

PBS Number: 2-471518
SWIS Code: 6201
Operator: NYC HOUSING PRSERV & DEVEL
Facility Phone: (212) 806-8565
Facility Addr2: 550 WEST 153RD STREET
Facility Type: Not reported
Emergency: JUANITA ARSENEC
Emergency Tel: (212) 360-7900
Old PBSNO: Not reported
Date Inspected: Not reported
Inspector: Not reported
Result of Inspection: Not reported
Owner Name: NYC HOUSING PRESERV & DEVEL
Owner Address: 75 MAIDEN LANE
Owner City,St,Zip: NEW YORK, NY 10038
Federal ID: Not reported
Owner Tel: (212) 806-8565

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

550 WEST 153RD STREET (Continued)

EDR ID Number
EPA ID Number

Database(s)

U003395086

Owner Type: Not reported
Owner Subtype: Not reported
Mailing Contact: Not reported
Mailing Name: NYC HOUSING PRESERV & DEVEL
Mailing Address: 75 MAIDEN LANE
Mailing Address 2: Not reported
Mailing City,St,Zip: NEW YORK, NY 10038
Mailing Telephone: (212) 806-8565
Owner Mark: First Owner
Facility Status: 1 - Active PBS facility, i.e. total capacity of the PBS tanks is greater than 1,100 gallons, regardless if Subpart 360-14 tanks exist or not at the facility.

Certification Flag: False
Certification Date: 03/28/1989
Expiration: 03/28/1994
Renew Flag: False
Renew Date: Not reported
Total Capacity: 2500
FAMT: True
Facility Screen: Minor Data Missing
Owner Screen: Minor Data Missing
Tank Screen: Minor Data Missing
Dead Letter: False
CBS Number: Not reported
Town or City: NEW YORK CITY
County Code: 62
Town or City Code: 01
Region: 2

Tank ID: 001
Tank Location: ABOVEGROUND
Tank Status: In Service
Install Date: Not reported
Capacity (Gal): 2500
Product Stored: NOS 1,2, OR 4 FUEL OIL
Tank Type: Steel/carbon steel
Tank Internal: Not reported
Tank External: Not reported
Pipe Location: Not reported
Pipe Type: STEEL/IRON
Pipe Internal: Not reported
Pipe External: Not reported
Tank Containment: Vault (w/access)
Leak Detection: 0
Overfill Protection: 4
Dispenser Method: Suction
Date Tested: Not reported
Next Test Date: Not reported
Missing Data for Tank: Minor Data Missing
Date Closed: Not reported
Test Method: Not reported
Deleted: False
Updated: False
SPDES Number: Not reported
Lat/Long: Not reported

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

AK171
West
1/8-1/4
1255 ft.

532 WEST 152 ST
532 WEST 152ND STREET
NEW YORK, NY 10031

AST **A100183248**
N/A

Site 9 of 9 in cluster AK

Relative:
Higher

AST:

Actual:
136 ft.

AST:

Region: STATE
Facility Id: 2-606652
UTM X: 588928.71873
UTM Y: 4520419.79090
Expiration Date: 08/07/11
Renewal Date: / /
Total Capacity: 1500
Facility Type: Not reported
Site Type Name: Apartment Building/Office Building
Site Type Status: Active
Mailing Company: 532 CORP.
Mailing Title: Not reported
Mailing Contact: PRITPAL KOCHHAR
Mailing Address: P.O. BOX 1075
Mailing Address 2: COOPER STATION
Mailing City: NEW YORK
Mailing State: NY
Mailing Zip Code: 10276-1075
Mailing Phone No: (212) 979-2246
Mailing Email: PSKOCHHAR@MSN.COM
Owner Title: PRESIDENT
Owner Name: PRITPAL S. KOCHHAR
Owner Address: P.O. BOX 1075, COOPER STN.
Owner Address 2: Not reported
Owner State: NY
Owner Zip Code: 10276
Owner Phone: (212) 979-2246
Owner Company: 532 CORP.
Emergency Contact: PRITPAL KOCHHAR
Emergency Phone: (917) 998-2244
Operator: PRITPAL KOCHHAR
Operator Phone: (212) 979-2246
Owner City: NEW YORK
Owner Sub Type: Corporate or Commercial
Program Type: PBS

Tank Number: 001
Tank Location Name: Aboveground - in contact with soil
Tank Status: In Service
Tank Model: Not reported
Pipe Model: Not reported
Active Status: Active
Install Date: / /
Capacity Gallons: 1500
Material Name: #2 Fuel Oil
Percentage: 100.00
Tank Type Name: Steel/Carbon Steel/Iron
Tank Internal Protection: None
Tank Internal Protection 1: None
Tank Internal Protection 2: Not reported
Pipe Location Name: No Piping

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

532 WEST 152 ST (Continued)

EDR ID Number
EPA ID Number

Database(s)

A100183248

Pipe Type Name: No Piping
Pipe External Protection 1: None
Pipe External Protection 2: Not reported
Tank Secondary Containment 1: None
Tank Secondary Containment 2: Not reported
Pipe Secondary Containment: Not reported
Tank Leak Detection 1: None
Tank Leak Detection 2: Not reported
Pipe Leak Detection 1: Not reported
Pipe Leak Detection 2: Not reported
Type Of Overfill Prevention 1: None
Type Of Overfill Prevention 2: Not reported
Dispenser Method: None
Spill Prevention: Not reported
Tightness Test Method: Testing Not Required
Date Tested: / /
Next Test Date: / /
Date Tank Closed: / /

AO172
WSW
1/8-1/4
1256 ft.

FOUR SEASONS CLEANERS
1838 AMSTERDAM AVE
NEW YORK, NY 10032

RCRA-SQG
FINDS
NY MANIFEST

1000351723
NYD981176878

Relative:
Higher

Site 1 of 6 in cluster AO

Actual:
130 ft.

RCRAInfo:
Owner: SUNG-CHUL OH
(212) 555-1212
EPA ID: NYD981176878
Contact: Not reported
Classification: Small Quantity Generator
TSDF Activities: Not reported
Violation Status: No violations found

FINDS:

Other Pertinent Environmental Activity Identified at Site

AFS (Aerometric Information Retrieval System (AIRS) Facility Subsystem) replaces the former Compliance Data System (CDS), the National Emission Data System (NEDS), and the Storage and Retrieval of Aerometric Data (SAROAD). AFS is the national repository for information concerning airborne pollution in the United States. AFS is used to track emissions and compliance data from industrial plants. AFS data are utilized by states to prepare State Implementation Plans to comply with regulatory programs and by EPA as an input for the estimation of total national emissions. AFS is undergoing a major redesign to support facility operating permits required under Title V of the Clean Air Act.

NJ-NJEMS (New Jersey - New Jersey Environmental Management System). The Department of Environmental Protection (NJDEP) manages large databases of environmental information in this integrated system.

FIS (New York - Facility Information System) is New York's Department of Environmental Conservation (DEC) information system for tracking environmental facility information found across the State.

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s)

EDR ID Number
EPA ID Number

FOUR SEASONS CLEANERS (Continued)

1000351723

RCRAInfo is a national information system that supports the Resource Conservation and Recovery Act (RCRA) program through the tracking of events and activities related to facilities that generate, transport, and treat, store, or dispose of hazardous waste. RCRAInfo allows RCRA program staff to track the notification, permit, compliance, and corrective action activities required under RCRA.

NY MANIFEST:

Document ID: NJA1421075
Manifest Status: Completed copy
Trans1 State ID: NJDEPS869
Trans2 State ID: Not reported
Generator Ship Date: 920602
Trans1 Recv Date: 920602
Trans2 Recv Date: Not reported
TSD Site Recv Date: 920602
Part A Recv Date: Not reported
Part B Recv Date: 920616
Generator EPA ID: NYD981176878
Trans1 EPA ID: ILD051060408
Trans2 EPA ID: Not reported
TSDF ID: NJD000768093
Waste Code: F002 - HALO SOLV + STILL BOTTOMS FM REC OF SOLV
Quantity: 00060
Units: P - Pounds
Number of Containers: 001
Container Type: DM - Metal drums, barrels
Handling Method: B Incineration, heat recovery, burning.
Specific Gravity: 100
Year: 92
Manifest Tracking Num: Not reported
Import Ind: Not reported
Export Ind: Not reported
Discr Quantity Ind: Not reported
Discr Type Ind: Not reported
Discr Residue Ind: Not reported
Discr Partial Reject Ind: Not reported
Discr Full Reject Ind: Not reported
Manifest Ref Num: Not reported
Alt Fac RCRA Id: Not reported
Alt Fac Sign Date: Not reported
Mgmt Method Type Code: Not reported
EPA ID: NYD981176878
Facility Name: FOUR SEASONS CLEANERS
Facility Address: 1838 AMSTERDAM AVENUE
Facility City: NEW YORK
Facility Address 2: Not reported
Country: USA
County: NE
Mailing Name: FOUR SEASONS CLEANERS
Mailing Contact: FOUR SEASONS CLEANERS
Mailing Address: 1838 AMSTERDAM AVENUE
Mailing Address 2: Not reported
Mailing City: NEW YORK
Mailing State: NY
Mailing Zip: Not reported

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s) EDR ID Number
EPA ID Number

FOUR SEASONS CLEANERS (Continued)

1000351723

Mailing Zip4:	Not reported
Mailing Country:	USA
Mailing Phone:	212-281-7622
Document ID:	NJA1444358
Manifest Status:	Completed after the designated time period for a TSDF to get a copy to the DEC
Trans1 State ID:	NJDEPS869
Trans2 State ID:	Not reported
Generator Ship Date:	920504
Trans1 Recv Date:	920504
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	920504
Part A Recv Date:	Not reported
Part B Recv Date:	920602
Generator EPA ID:	NYD981176878
Trans1 EPA ID:	ILD051060408
Trans2 EPA ID:	Not reported
TSDF ID:	NJD000768093
Waste Code:	F002 - HALO SOLV + STILL BOTTOMS FM REC OF SOLV
Quantity:	00060
Units:	P - Pounds
Number of Containers:	001
Container Type:	DM - Metal drums, barrels
Handling Method:	B Incineration, heat recovery, burning.
Specific Gravity:	100
Year:	92
Manifest Tracking Num:	Not reported
Import Ind:	Not reported
Export Ind:	Not reported
Discr Quantity Ind:	Not reported
Discr Type Ind:	Not reported
Discr Residue Ind:	Not reported
Discr Partial Reject Ind:	Not reported
Discr Full Reject Ind:	Not reported
Manifest Ref Num:	Not reported
Alt Fac RCRA Id:	Not reported
Alt Fac Sign Date:	Not reported
Mgmt Method Type Code:	Not reported
EPA ID:	NYD981176878
Facility Name:	FOUR SEASONS CLEANERS
Facility Address:	1838 AMSTERDAM AVENUE
Facility City:	NEW YORK
Facility Address 2:	Not reported
Country:	USA
County:	NE
Mailing Name:	FOUR SEASONS CLEANERS
Mailing Contact:	FOUR SEASONS CLEANERS
Mailing Address:	1838 AMSTERDAM AVENUE
Mailing Address 2:	Not reported
Mailing City:	NEW YORK
Mailing State:	NY
Mailing Zip:	Not reported
Mailing Zip4:	Not reported
Mailing Country:	USA
Mailing Phone:	212-281-7622
Document ID:	NJA1463278

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

FOUR SEASONS CLEANERS (Continued)

EDR ID Number
EPA ID Number

Database(s)

1000351723

Manifest Status: Completed copy
Trans1 State ID: NJDEPS869
Trans2 State ID: Not reported
Generator Ship Date: 920630
Trans1 Recv Date: 920630
Trans2 Recv Date: Not reported
TSD Site Recv Date: 920630
Part A Recv Date: 920715
Part B Recv Date: 920710
Generator EPA ID: NYD981176878
Trans1 EPA ID: ILD051060408
Trans2 EPA ID: Not reported
TSD ID: NJD000768093
Waste Code: F002 - HALO SOLV + STILL BOTTOMS FM REC OF SOLV
Quantity: 00060
Units: P - Pounds
Number of Containers: 001
Container Type: DM - Metal drums, barrels
Handling Method: B Incineration, heat recovery, burning.
Specific Gravity: 100
Year: 92
Manifest Tracking Num: Not reported
Import Ind: Not reported
Export Ind: Not reported
Discr Quantity Ind: Not reported
Discr Type Ind: Not reported
Discr Residue Ind: Not reported
Discr Partial Reject Ind: Not reported
Discr Full Reject Ind: Not reported
Manifest Ref Num: Not reported
Alt Fac RCRA Id: Not reported
Alt Fac Sign Date: Not reported
Mgmt Method Type Code: Not reported
EPA ID: NYD981176878
Facility Name: FOUR SEASONS CLEANERS
Facility Address: 1838 AMSTERDAM AVENUE
Facility City: NEW YORK
Facility Address 2: Not reported
Country: USA
County: NE
Mailing Name: FOUR SEASONS CLEANERS
Mailing Contact: FOUR SEASONS CLEANERS
Mailing Address: 1838 AMSTERDAM AVENUE
Mailing Address 2: Not reported
Mailing City: NEW YORK
Mailing State: NY
Mailing Zip: Not reported
Mailing Zip4: Not reported
Mailing Country: USA
Mailing Phone: 212-281-7622

Document ID: NJA1416323
Manifest Status: Completed copy
Trans1 State ID: NJDEPS869
Trans2 State ID: Not reported
Generator Ship Date: 920409
Trans1 Recv Date: 920409

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s)
EDR ID Number
EPA ID Number

FOUR SEASONS CLEANERS (Continued)

1000351723

Trans2 Recv Date:	Not reported
TSD Site Recv Date:	920409
Part A Recv Date:	920423
Part B Recv Date:	920422
Generator EPA ID:	NYD981176878
Trans1 EPA ID:	ILD051060408
Trans2 EPA ID:	Not reported
TSD ID:	NJD000768093
Waste Code:	F002 - HALO SOLV + STILL BOTTOMS FM REC OF SOLV
Quantity:	00060
Units:	P - Pounds
Number of Containers:	001
Container Type:	DM - Metal drums, barrels
Handling Method:	B Incineration, heat recovery, burning.
Specific Gravity:	100
Year:	92
Manifest Tracking Num:	Not reported
Import Ind:	Not reported
Export Ind:	Not reported
Discr Quantity Ind:	Not reported
Discr Type Ind:	Not reported
Discr Residue Ind:	Not reported
Discr Partial Reject Ind:	Not reported
Discr Full Reject Ind:	Not reported
Manifest Ref Num:	Not reported
Alt Fac RCRA Id:	Not reported
Alt Fac Sign Date:	Not reported
Mgmt Method Type Code:	Not reported
EPA ID:	NYD981176878
Facility Name:	FOUR SEASONS CLEANERS
Facility Address:	1838 AMSTERDAM AVENUE
Facility City:	NEW YORK
Facility Address 2:	Not reported
Country:	USA
County:	NE
Mailing Name:	FOUR SEASONS CLEANERS
Mailing Contact:	FOUR SEASONS CLEANERS
Mailing Address:	1838 AMSTERDAM AVENUE
Mailing Address 2:	Not reported
Mailing City:	NEW YORK
Mailing State:	NY
Mailing Zip:	Not reported
Mailing Zip4:	Not reported
Mailing Country:	USA
Mailing Phone:	212-281-7622
Document ID:	NJA0254892
Manifest Status:	Completed after the designated time period for a TSD to get a copy to the DEC
Trans1 State ID:	NJDEPS869
Trans2 State ID:	Not reported
Generator Ship Date:	870105
Trans1 Recv Date:	870105
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	870105
Part A Recv Date:	870123
Part B Recv Date:	870202
Generator EPA ID:	NYD981176878

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

FOUR SEASONS CLEANERS (Continued)

EDR ID Number
EPA ID Number

Database(s)

1000351723

Trans1 EPA ID: ILD000805911
Trans2 EPA ID: Not reported
TSDF ID: NJD000768093
Waste Code: F002 - HALO SOLV + STILL BOTTOMS FM REC OF SOLV
Quantity: 00060
Units: P - Pounds
Number of Containers: 001
Container Type: DM - Metal drums, barrels
Handling Method: R Material recovery of more than 75 percent of the total material.
Specific Gravity: 100
Year: 87
Manifest Tracking Num: Not reported
Import Ind: Not reported
Export Ind: Not reported
Discr Quantity Ind: Not reported
Discr Type Ind: Not reported
Discr Residue Ind: Not reported
Discr Partial Reject Ind: Not reported
Discr Full Reject Ind: Not reported
Manifest Ref Num: Not reported
Alt Fac RCRA Id: Not reported
Alt Fac Sign Date: Not reported
Mgmt Method Type Code: Not reported
EPA ID: NYD981176878
Facility Name: FOUR SEASONS CLEANERS
Facility Address: 1838 AMSTERDAM AVENUE
Facility City: NEW YORK
Facility Address 2: Not reported
Country: USA
County: NE
Mailing Name: FOUR SEASONS CLEANERS
Mailing Contact: FOUR SEASONS CLEANERS
Mailing Address: 1838 AMSTERDAM AVENUE
Mailing Address 2: Not reported
Mailing City: NEW YORK
Mailing State: NY
Mailing Zip: Not reported
Mailing Zip4: Not reported
Mailing Country: USA
Mailing Phone: 212-281-7622

Document ID: NJA0364146
Manifest Status: Completed copy
Trans1 State ID: NJDEPS869
Trans2 State ID: Not reported
Generator Ship Date: 871113
Trans1 Recv Date: 871113
Trans2 Recv Date: Not reported
TSD Site Recv Date: 871113
Part A Recv Date: 871120
Part B Recv Date: 871124
Generator EPA ID: NYD981176878
Trans1 EPA ID: NJD000768093
Trans2 EPA ID: Not reported
TSDF ID: NJD000768093
Waste Code: F002 - HALO SOLV + STILL BOTTOMS FM REC OF SOLV
Quantity: 00195

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

FOUR SEASONS CLEANERS (Continued)

1000351723

Units:	P - Pounds
Number of Containers:	001
Container Type:	DM - Metal drums, barrels
Handling Method:	R Material recovery of more than 75 percent of the total material.
Specific Gravity:	100
Waste Code:	Not reported
Quantity:	00080
Units:	P - Pounds
Number of Containers:	001
Container Type:	CF - Fiber or plastic boxes, cartons
Handling Method:	R Material recovery of more than 75 percent of the total material.
Specific Gravity:	100
Year:	87
Manifest Tracking Num:	Not reported
Import Ind:	Not reported
Export Ind:	Not reported
Discr Quantity Ind:	Not reported
Discr Type Ind:	Not reported
Discr Residue Ind:	Not reported
Discr Partial Reject Ind:	Not reported
Discr Full Reject Ind:	Not reported
Manifest Ref Num:	Not reported
Alt Fac RCRA Id:	Not reported
Alt Fac Sign Date:	Not reported
Mgmt Method Type Code:	Not reported
EPA ID:	NYD981176878
Facility Name:	FOUR SEASONS CLEANERS
Facility Address:	1838 AMSTERDAM AVENUE
Facility City:	NEW YORK
Facility Address 2:	Not reported
Country:	USA
County:	NE
Mailing Name:	FOUR SEASONS CLEANERS
Mailing Contact:	FOUR SEASONS CLEANERS
Mailing Address:	1838 AMSTERDAM AVENUE
Mailing Address 2:	Not reported
Mailing City:	NEW YORK
Mailing State:	NY
Mailing Zip:	Not reported
Mailing Zip4:	Not reported
Mailing Country:	USA
Mailing Phone:	212-281-7622
Document ID:	NJA1349816
Manifest Status:	Completed copy
Trans1 State ID:	NJDEPS869
Trans2 State ID:	Not reported
Generator Ship Date:	921201
Trans1 Recv Date:	921201
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	921201
Part A Recv Date:	921214
Part B Recv Date:	921215
Generator EPA ID:	NYD981176878
Trans1 EPA ID:	ILD051060408
Trans2 EPA ID:	Not reported
TSDF ID:	NJD000768093

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s)
EDR ID Number
EPA ID Number

FOUR SEASONS CLEANERS (Continued)

1000351723

Waste Code: F002 - HALO SOLV + STILL BOTTOMS FM REC OF SOLV
Quantity: 00060
Units: P - Pounds
Number of Containers: 001
Container Type: DM - Metal drums, barrels
Handling Method: B Incineration, heat recovery, burning.
Specific Gravity: 100
Year: 92
Manifest Tracking Num: Not reported
Import Ind: Not reported
Export Ind: Not reported
Discr Quantity Ind: Not reported
Discr Type Ind: Not reported
Discr Residue Ind: Not reported
Discr Partial Reject Ind: Not reported
Discr Full Reject Ind: Not reported
Manifest Ref Num: Not reported
Alt Fac RCRA Id: Not reported
Alt Fac Sign Date: Not reported
Mgmt Method Type Code: Not reported
EPA ID: NYD981176878
Facility Name: FOUR SEASONS CLEANERS
Facility Address: 1838 AMSTERDAM AVENUE
Facility City: NEW YORK
Facility Address 2: Not reported
Country: USA
County: NE
Mailing Name: FOUR SEASONS CLEANERS
Mailing Contact: FOUR SEASONS CLEANERS
Mailing Address: 1838 AMSTERDAM AVENUE
Mailing Address 2: Not reported
Mailing City: NEW YORK
Mailing State: NY
Mailing Zip: Not reported
Mailing Zip4: Not reported
Mailing Country: USA
Mailing Phone: 212-281-7622

Document ID: NYG0075348
Manifest Status: Completed after the designated time period for a TSDF to get a copy to the DEC
Trans1 State ID: XZ90GR501
Trans2 State ID: Not reported
Generator Ship Date: 970915
Trans1 Recv Date: 970915
Trans2 Recv Date: Not reported
TSD Site Recv Date: 970926
Part A Recv Date: 971020
Part B Recv Date: 971014
Generator EPA ID: NYD981176878
Trans1 EPA ID: NJD000564906
Trans2 EPA ID: Not reported
TSDF ID: NYD082785429
Waste Code: F002 - HALO SOLV + STILL BOTTOMS FM REC OF SOLV
Quantity: 00100
Units: P - Pounds
Number of Containers: 001
Container Type: DM - Metal drums, barrels

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s)
EDR ID Number
EPA ID Number

FOUR SEASONS CLEANERS (Continued)

1000351723

Handling Method: B Incineration, heat recovery, burning.
Specific Gravity: 100
Year: 97
Manifest Tracking Num: Not reported
Import Ind: Not reported
Export Ind: Not reported
Discr Quantity Ind: Not reported
Discr Type Ind: Not reported
Discr Residue Ind: Not reported
Discr Partial Reject Ind: Not reported
Discr Full Reject Ind: Not reported
Manifest Ref Num: Not reported
Alt Fac RCRA Id: Not reported
Alt Fac Sign Date: Not reported
Mgmt Method Type Code: Not reported
EPA ID: NYD981176878
Facility Name: FOUR SEASONS CLEANERS
Facility Address: 1838 AMSTERDAM AVENUE
Facility City: NEW YORK
Facility Address 2: Not reported
Country: USA
County: NE
Mailing Name: FOUR SEASONS CLEANERS
Mailing Contact: FOUR SEASONS CLEANERS
Mailing Address: 1838 AMSTERDAM AVENUE
Mailing Address 2: Not reported
Mailing City: NEW YORK
Mailing State: NY
Mailing Zip: Not reported
Mailing Zip4: Not reported
Mailing Country: USA
Mailing Phone: 212-281-7622

Document ID: NYB8528337
Manifest Status: Completed copy
Trans1 State ID: XZ90GR501
Trans2 State ID: Not reported
Generator Ship Date: 970409
Trans1 Recv Date: 970409
Trans2 Recv Date: Not reported
TSD Site Recv Date: 970414
Part A Recv Date: 970424
Part B Recv Date: 970428
Generator EPA ID: NYD981176878
Trans1 EPA ID: NJD000564906
Trans2 EPA ID: Not reported
TSDF ID: NYD082785429
Waste Code: F002 - HALO SOLV + STILL BOTTOMS FM REC OF SOLV
Quantity: 00060
Units: P - Pounds
Number of Containers: 001
Container Type: DM - Metal drums, barrels
Handling Method: B Incineration, heat recovery, burning.
Specific Gravity: 100
Year: 97
Manifest Tracking Num: Not reported
Import Ind: Not reported

Map ID
 Direction
 Distance
 Distance (ft.)
 Elevation Site

MAP FINDINGS

Database(s)
 EDR ID Number
 EPA ID Number

FOUR SEASONS CLEANERS (Continued)

1000351723

Export Ind:	Not reported
Discr Quantity Ind:	Not reported
Discr Type Ind:	Not reported
Discr Residue Ind:	Not reported
Discr Partial Reject Ind:	Not reported
Discr Full Reject Ind:	Not reported
Manifest Ref Num:	Not reported
Alt Fac RCRA Id:	Not reported
Alt Fac Sign Date:	Not reported
Mgmt Method Type Code:	Not reported
EPA ID:	NYD981176878
Facility Name:	FOUR SEASONS CLEANERS
Facility Address:	1838 AMSTERDAM AVENUE
Facility City:	NEW YORK
Facility Address 2:	Not reported
Country:	USA
County:	NE
Mailing Name:	FOUR SEASONS CLEANERS
Mailing Contact:	FOUR SEASONS CLEANERS
Mailing Address:	1838 AMSTERDAM AVENUE
Mailing Address 2:	Not reported
Mailing City:	NEW YORK
Mailing State:	NY
Mailing Zip:	Not reported
Mailing Zip4:	Not reported
Mailing Country:	USA
Mailing Phone:	212-281-7622
Document ID:	NYG0159921
Manifest Status:	Completed copy
Trans1 State ID:	XZ90GR501
Trans2 State ID:	Not reported
Generator Ship Date:	970619
Trans1 Recv Date:	970619
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	970620
Part A Recv Date:	970716
Part B Recv Date:	970714
Generator EPA ID:	NYD981176878
Trans1 EPA ID:	NJD000564906
Trans2 EPA ID:	Not reported
TSDF ID:	NYD082785429
Waste Code:	F002 - HALO SOLV + STILL BOTTOMS FM REC OF SOLV
Quantity:	00060
Units:	P - Pounds
Number of Containers:	001
Container Type:	DM - Metal drums, barrels
Handling Method:	B Incineration, heat recovery, burning.
Specific Gravity:	100
Year:	97
Manifest Tracking Num:	Not reported
Import Ind:	Not reported
Export Ind:	Not reported
Discr Quantity Ind:	Not reported
Discr Type Ind:	Not reported
Discr Residue Ind:	Not reported
Discr Partial Reject Ind:	Not reported

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

FOUR SEASONS CLEANERS (Continued)

EDR ID Number
EPA ID Number

Database(s)

1000351723

Discr Full Reject Ind:	Not reported
Manifest Ref Num:	Not reported
Alt Fac RCRA Id:	Not reported
Alt Fac Sign Date:	Not reported
Mgmt Method Type Code:	Not reported
EPA ID:	NYD981176878
Facility Name:	FOUR SEASONS CLEANERS
Facility Address:	1838 AMSTERDAM AVENUE
Facility City:	NEW YORK
Facility Address 2:	Not reported
Country:	USA
County:	NE
Mailing Name:	FOUR SEASONS CLEANERS
Mailing Contact:	FOUR SEASONS CLEANERS
Mailing Address:	1838 AMSTERDAM AVENUE
Mailing Address 2:	Not reported
Mailing City:	NEW YORK
Mailing State:	NY
Mailing Zip:	Not reported
Mailing Zip4:	Not reported
Mailing Country:	USA
Mailing Phone:	212-281-7622
Document ID:	NJA0433934
Manifest Status:	Completed copy
Trans1 State ID:	NJDEPS869
Trans2 State ID:	Not reported
Generator Ship Date:	880527
Trans1 Recv Date:	880527
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	880527
Part A Recv Date:	880606
Part B Recv Date:	880608
Generator EPA ID:	NYD981176878
Trans1 EPA ID:	ILD051060408
Trans2 EPA ID:	Not reported
TSDF ID:	NJD000768093
Waste Code:	F002 - HALO SOLV + STILL BOTTOMS FM REC OF SOLV
Quantity:	00195
Units:	P - Pounds
Number of Containers:	001
Container Type:	DF - Fiberboard or plastic drums (glass)
Handling Method:	R Material recovery of more than 75 percent of the total material.
Specific Gravity:	100
Year:	88
Manifest Tracking Num:	Not reported
Import Ind:	Not reported
Export Ind:	Not reported
Discr Quantity Ind:	Not reported
Discr Type Ind:	Not reported
Discr Residue Ind:	Not reported
Discr Partial Reject Ind:	Not reported
Discr Full Reject Ind:	Not reported
Manifest Ref Num:	Not reported
Alt Fac RCRA Id:	Not reported
Alt Fac Sign Date:	Not reported
Mgmt Method Type Code:	Not reported

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s) EDR ID Number
EPA ID Number

FOUR SEASONS CLEANERS (Continued)

1000351723

EPA ID: NYD981176878
Facility Name: FOUR SEASONS CLEANERS
Facility Address: 1838 AMSTERDAM AVENUE
Facility City: NEW YORK
Facility Address 2: Not reported
Country: USA
County: NE
Mailing Name: FOUR SEASONS CLEANERS
Mailing Contact: FOUR SEASONS CLEANERS
Mailing Address: 1838 AMSTERDAM AVENUE
Mailing Address 2: Not reported
Mailing City: NEW YORK
Mailing State: NY
Mailing Zip: Not reported
Mailing Zip4: Not reported
Mailing Country: USA
Mailing Phone: 212-281-7622

Document ID: NJA1415969
Manifest Status: Completed copy
Trans1 State ID: NJDEPS869
Trans2 State ID: Not reported
Generator Ship Date: 921006
Trans1 Recv Date: 921006
Trans2 Recv Date: Not reported
TSD Site Recv Date: 921006
Part A Recv Date: Not reported
Part B Recv Date: 921023
Generator EPA ID: NYD981176878
Trans1 EPA ID: ILD051060408
Trans2 EPA ID: Not reported
TSDF ID: NJD000768093
Waste Code: F002 - HALO SOLV + STILL BOTTOMS FM REC OF SOLV
Quantity: 00060
Units: P - Pounds
Number of Containers: 001
Container Type: DM - Metal drums, barrels
Handling Method: B Incineration, heat recovery, burning.
Specific Gravity: 100
Year: 92
Manifest Tracking Num: Not reported
Import Ind: Not reported
Export Ind: Not reported
Discr Quantity Ind: Not reported
Discr Type Ind: Not reported
Discr Residue Ind: Not reported
Discr Partial Reject Ind: Not reported
Discr Full Reject Ind: Not reported
Manifest Ref Num: Not reported
Alt Fac RCRA Id: Not reported
Alt Fac Sign Date: Not reported
Mgmt Method Type Code: Not reported
EPA ID: NYD981176878
Facility Name: FOUR SEASONS CLEANERS
Facility Address: 1838 AMSTERDAM AVENUE
Facility City: NEW YORK
Facility Address 2: Not reported

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s)
EDR ID Number
EPA ID Number

FOUR SEASONS CLEANERS (Continued)

1000351723

Country: USA
County: NE
Mailing Name: FOUR SEASONS CLEANERS
Mailing Contact: FOUR SEASONS CLEANERS
Mailing Address: 1838 AMSTERDAM AVENUE
Mailing Address 2: Not reported
Mailing City: NEW YORK
Mailing State: NY
Mailing Zip: Not reported
Mailing Zip4: Not reported
Mailing Country: USA
Mailing Phone: 212-281-7622

Document ID: NJA1647290
Manifest Status: Completed copy
Trans1 State ID: NJDEPS869
Trans2 State ID: Not reported
Generator Ship Date: 930106
Trans1 Recv Date: 930106
Trans2 Recv Date: Not reported
TSD Site Recv Date: 930106
Part A Recv Date: 930115
Part B Recv Date: 930120
Generator EPA ID: NYD981176878
Trans1 EPA ID: ILD051060408
Trans2 EPA ID: Not reported
TSDF ID: NJD000768093
Waste Code: F002 - HALO SOLV + STILL BOTTOMS FM REC OF SOLV
Quantity: 00060
Units: P - Pounds
Number of Containers: 001
Container Type: DM - Metal drums, barrels
Handling Method: B Incineration, heat recovery, burning.
Specific Gravity: 100
Year: 93
Manifest Tracking Num: Not reported
Import Ind: Not reported
Export Ind: Not reported
Discr Quantity Ind: Not reported
Discr Type Ind: Not reported
Discr Residue Ind: Not reported
Discr Partial Reject Ind: Not reported
Discr Full Reject Ind: Not reported
Manifest Ref Num: Not reported
Alt Fac RCRA Id: Not reported
Alt Fac Sign Date: Not reported
Mgmt Method Type Code: Not reported
EPA ID: NYD981176878
Facility Name: FOUR SEASONS CLEANERS
Facility Address: 1838 AMSTERDAM AVENUE
Facility City: NEW YORK
Facility Address 2: Not reported
Country: USA
County: NE
Mailing Name: FOUR SEASONS CLEANERS
Mailing Contact: FOUR SEASONS CLEANERS
Mailing Address: 1838 AMSTERDAM AVENUE

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s)
EDR ID Number
EPA ID Number

FOUR SEASONS CLEANERS (Continued)

1000351723

Mailing Address 2:	Not reported
Mailing City:	NEW YORK
Mailing State:	NY
Mailing Zip:	Not reported
Mailing Zip4:	Not reported
Mailing Country:	USA
Mailing Phone:	212-281-7622
Document ID:	NJA1413800
Manifest Status:	Completed after the designated time period for a TSDF to get a copy to the DEC
Trans1 State ID:	NJDEPS869
Trans2 State ID:	Not reported
Generator Ship Date:	920730
Trans1 Recv Date:	920730
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	920730
Part A Recv Date:	Not reported
Part B Recv Date:	920929
Generator EPA ID:	NYD981176878
Trans1 EPA ID:	ILD051060408
Trans2 EPA ID:	Not reported
TSDF ID:	NJD000768093
Waste Code:	F002 - HALO SOLV + STILL BOTTOMS FM REC OF SOLV
Quantity:	00195
Units:	P - Pounds
Number of Containers:	001
Container Type:	DF - Fiberboard or plastic drums (glass)
Handling Method:	B Incineration, heat recovery, burning.
Specific Gravity:	100
Year:	92
Manifest Tracking Num:	Not reported
Import Ind:	Not reported
Export Ind:	Not reported
Discr Quantity Ind:	Not reported
Discr Type Ind:	Not reported
Discr Residue Ind:	Not reported
Discr Partial Reject Ind:	Not reported
Discr Full Reject Ind:	Not reported
Manifest Ref Num:	Not reported
Alt Fac RCRA Id:	Not reported
Alt Fac Sign Date:	Not reported
Mgmt Method Type Code:	Not reported
EPA ID:	NYD981176878
Facility Name:	FOUR SEASONS CLEANERS
Facility Address:	1838 AMSTERDAM AVENUE
Facility City:	NEW YORK
Facility Address 2:	Not reported
Country:	USA
County:	NE
Mailing Name:	FOUR SEASONS CLEANERS
Mailing Contact:	FOUR SEASONS CLEANERS
Mailing Address:	1838 AMSTERDAM AVENUE
Mailing Address 2:	Not reported
Mailing City:	NEW YORK
Mailing State:	NY
Mailing Zip:	Not reported
Mailing Zip4:	Not reported

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s)
EDR ID Number
EPA ID Number

FOUR SEASONS CLEANERS (Continued)

1000351723

Mailing Country: USA
Mailing Phone: 212-281-7622

Document ID: NJA1420119
Manifest Status: Completed copy
Trans1 State ID: NJDEPS869
Trans2 State ID: Not reported
Generator Ship Date: 920824
Trans1 Recv Date: 920824
Trans2 Recv Date: Not reported
TSD Site Recv Date: 920824
Part A Recv Date: 920908
Part B Recv Date: 920903
Generator EPA ID: NYD981176878
Trans1 EPA ID: ILD051060408
Trans2 EPA ID: Not reported
TSDF ID: NJD000768093
Waste Code: F002 - HALO SOLV + STILL BOTTOMS FM REC OF SOLV
Quantity: 00060
Units: P - Pounds
Number of Containers: 001
Container Type: DM - Metal drums, barrels
Handling Method: B Incineration, heat recovery, burning.
Specific Gravity: 100
Year: 92
Manifest Tracking Num: Not reported
Import Ind: Not reported
Export Ind: Not reported
Discr Quantity Ind: Not reported
Discr Type Ind: Not reported
Discr Residue Ind: Not reported
Discr Partial Reject Ind: Not reported
Discr Full Reject Ind: Not reported
Manifest Ref Num: Not reported
Alt Fac RCRA Id: Not reported
Alt Fac Sign Date: Not reported
Mgmt Method Type Code: Not reported
EPA ID: NYD981176878
Facility Name: FOUR SEASONS CLEANERS
Facility Address: 1838 AMSTERDAM AVENUE
Facility City: NEW YORK
Facility Address 2: Not reported
Country: USA
County: NE
Mailing Name: FOUR SEASONS CLEANERS
Mailing Contact: FOUR SEASONS CLEANERS
Mailing Address: 1838 AMSTERDAM AVENUE
Mailing Address 2: Not reported
Mailing City: NEW YORK
Mailing State: NY
Mailing Zip: Not reported
Mailing Zip4: Not reported
Mailing Country: USA
Mailing Phone: 212-281-7622

Document ID: NJA0503561
Manifest Status: Completed copy

Map ID
 Direction
 Distance
 Distance (ft.)
 Elevation Site

MAP FINDINGS

Database(s)
 EDR ID Number
 EPA ID Number

FOUR SEASONS CLEANERS (Continued)

1000351723

Trans1 State ID: NJDEPS869
 Trans2 State ID: Not reported
 Generator Ship Date: 880802
 Trans1 Recv Date: 880802
 Trans2 Recv Date: Not reported
 TSD Site Recv Date: 880802
 Part A Recv Date: 880804
 Part B Recv Date: 880819
 Generator EPA ID: NYD981176878
 Trans1 EPA ID: ILD051060408
 Trans2 EPA ID: Not reported
 TSDF ID: NJD000768093
 Waste Code: F002 - HALO SOLV + STILL BOTTOMS FM REC OF SOLV
 Quantity: 00080
 Units: P - Pounds
 Number of Containers: 001
 Container Type: CF - Fiber or plastic boxes, cartons
 Handling Method: R Material recovery of more than 75 percent of the total material.
 Specific Gravity: 100
 Year: 88
 Manifest Tracking Num: Not reported
 Import Ind: Not reported
 Export Ind: Not reported
 Discr Quantity Ind: Not reported
 Discr Type Ind: Not reported
 Discr Residue Ind: Not reported
 Discr Partial Reject Ind: Not reported
 Discr Full Reject Ind: Not reported
 Manifest Ref Num: Not reported
 Alt Fac RCRA Id: Not reported
 Alt Fac Sign Date: Not reported
 Mgmt Method Type Code: Not reported
 EPA ID: NYD981176878
 Facility Name: FOUR SEASONS CLEANERS
 Facility Address: 1838 AMSTERDAM AVENUE
 Facility City: NEW YORK
 Facility Address 2: Not reported
 Country: USA
 County: NE
 Mailing Name: FOUR SEASONS CLEANERS
 Mailing Contact: FOUR SEASONS CLEANERS
 Mailing Address: 1838 AMSTERDAM AVENUE
 Mailing Address 2: Not reported
 Mailing City: NEW YORK
 Mailing State: NY
 Mailing Zip: Not reported
 Mailing Zip4: Not reported
 Mailing Country: USA
 Mailing Phone: 212-281-7622

 Document ID: NJA0441212
 Manifest Status: Completed copy
 Trans1 State ID: NJDEPS869
 Trans2 State ID: Not reported
 Generator Ship Date: 880414
 Trans1 Recv Date: 880414
 Trans2 Recv Date: Not reported

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

FOUR SEASONS CLEANERS (Continued)

EDR ID Number
EPA ID Number

Database(s)

1000351723

TSD Site Recv Date: 880414
Part A Recv Date: 880419
Part B Recv Date: 880426
Generator EPA ID: NYD981176878
Trans1 EPA ID: ILD051060408
Trans2 EPA ID: Not reported
TSD ID: NJD000768093
Waste Code: F002 - HALO SOLV + STILL BOTTOMS FM REC OF SOLV
Quantity: 00080
Units: P - Pounds
Number of Containers: 001
Container Type: CF - Fiber or plastic boxes, cartons
Handling Method: R Material recovery of more than 75 percent of the total material.
Specific Gravity: 100
Year: 88
Manifest Tracking Num: Not reported
Import Ind: Not reported
Export Ind: Not reported
Discr Quantity Ind: Not reported
Discr Type Ind: Not reported
Discr Residue Ind: Not reported
Discr Partial Reject Ind: Not reported
Discr Full Reject Ind: Not reported
Manifest Ref Num: Not reported
Alt Fac RCRA Id: Not reported
Alt Fac Sign Date: Not reported
Mgmt Method Type Code: Not reported
EPA ID: NYD981176878
Facility Name: FOUR SEASONS CLEANERS
Facility Address: 1838 AMSTERDAM AVENUE
Facility City: NEW YORK
Facility Address 2: Not reported
Country: USA
County: NE
Mailing Name: FOUR SEASONS CLEANERS
Mailing Contact: FOUR SEASONS CLEANERS
Mailing Address: 1838 AMSTERDAM AVENUE
Mailing Address 2: Not reported
Mailing City: NEW YORK
Mailing State: NY
Mailing Zip: Not reported
Mailing Zip4: Not reported
Mailing Country: USA
Mailing Phone: 212-281-7622

Document ID: NYA8634262
Manifest Status: Completed copy
Trans1 State ID: NJDEPS869
Trans2 State ID: Not reported
Generator Ship Date: 880201
Trans1 Recv Date: 880201
Trans2 Recv Date: Not reported
TSD Site Recv Date: 880201
Part A Recv Date: 880208
Part B Recv Date: 880208
Generator EPA ID: NYD981176878
Trans1 EPA ID: ILD051060408

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s)
EDR ID Number
EPA ID Number

FOUR SEASONS CLEANERS (Continued)

1000351723

Trans2 EPA ID: Not reported
TSDF ID: NJD000768093
Waste Code: F002 - HALO SOLV + STILL BOTTOMS FM REC OF SOLV
Quantity: 00080
Units: P - Pounds
Number of Containers: 001
Container Type: CF - Fiber or plastic boxes, cartons
Handling Method: R Material recovery of more than 75 percent of the total material.
Specific Gravity: 100
Year: 88
Manifest Tracking Num: Not reported
Import Ind: Not reported
Export Ind: Not reported
Discr Quantity Ind: Not reported
Discr Type Ind: Not reported
Discr Residue Ind: Not reported
Discr Partial Reject Ind: Not reported
Discr Full Reject Ind: Not reported
Manifest Ref Num: Not reported
Alt Fac RCRA Id: Not reported
Alt Fac Sign Date: Not reported
Mgmt Method Type Code: Not reported
EPA ID: NYD981176878
Facility Name: FOUR SEASONS CLEANERS
Facility Address: 1838 AMSTERDAM AVENUE
Facility City: NEW YORK
Facility Address 2: Not reported
Country: USA
County: NE
Mailing Name: FOUR SEASONS CLEANERS
Mailing Contact: FOUR SEASONS CLEANERS
Mailing Address: 1838 AMSTERDAM AVENUE
Mailing Address 2: Not reported
Mailing City: NEW YORK
Mailing State: NY
Mailing Zip: Not reported
Mailing Zip4: Not reported
Mailing Country: USA
Mailing Phone: 212-281-7622

Document ID: NJA0506227
Manifest Status: Completed copy
Trans1 State ID: NJDEPS869
Trans2 State ID: Not reported
Generator Ship Date: 881003
Trans1 Recv Date: 881003
Trans2 Recv Date: Not reported
TSD Site Recv Date: 881003
Part A Recv Date: 881006
Part B Recv Date: 881007
Generator EPA ID: NYD981176878
Trans1 EPA ID: ILD051060408
Trans2 EPA ID: Not reported
TSDF ID: NJD000768093
Waste Code: F002 - HALO SOLV + STILL BOTTOMS FM REC OF SOLV
Quantity: 00080
Units: P - Pounds

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s)

EDR ID Number
EPA ID Number

FOUR SEASONS CLEANERS (Continued)

1000351723

Number of Containers: 001
Container Type: CF - Fiber or plastic boxes, cartons
Handling Method: R Material recovery of more than 75 percent of the total material.
Specific Gravity: 100
Year: 88
Manifest Tracking Num: Not reported
Import Ind: Not reported
Export Ind: Not reported
Discr Quantity Ind: Not reported
Discr Type Ind: Not reported
Discr Residue Ind: Not reported
Discr Partial Reject Ind: Not reported
Discr Full Reject Ind: Not reported
Manifest Ref Num: Not reported
Alt Fac RCRA Id: Not reported
Alt Fac Sign Date: Not reported
Mgmt Method Type Code: Not reported
EPA ID: NYD981176878
Facility Name: FOUR SEASONS CLEANERS
Facility Address: 1838 AMSTERDAM AVENUE
Facility City: NEW YORK
Facility Address 2: Not reported
Country: USA
County: NE
Mailing Name: FOUR SEASONS CLEANERS
Mailing Contact: FOUR SEASONS CLEANERS
Mailing Address: 1838 AMSTERDAM AVENUE
Mailing Address 2: Not reported
Mailing City: NEW YORK
Mailing State: NY
Mailing Zip: Not reported
Mailing Zip4: Not reported
Mailing Country: USA
Mailing Phone: 212-281-7622

Document ID: NJA1545798
Manifest Status: Completed copy
Trans1 State ID: NJDEPS869
Trans2 State ID: Not reported
Generator Ship Date: 930419
Trans1 Recv Date: 930419
Trans2 Recv Date: Not reported
TSD Site Recv Date: 930419
Part A Recv Date: 930504
Part B Recv Date: 930503
Generator EPA ID: NYD981176878
Trans1 EPA ID: ILD051060408
Trans2 EPA ID: Not reported
TSD ID: NJD000768093
Waste Code: F002 - HALO SOLV + STILL BOTTOMS FM REC OF SOLV
Quantity: 00060
Units: P - Pounds
Number of Containers: 001
Container Type: DM - Metal drums, barrels
Handling Method: B Incineration, heat recovery, burning.
Specific Gravity: 100
Year: 93

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

FOUR SEASONS CLEANERS (Continued)

EDR ID Number
EPA ID Number

Database(s)

1000351723

Manifest Tracking Num: Not reported
Import Ind: Not reported
Export Ind: Not reported
Discr Quantity Ind: Not reported
Discr Type Ind: Not reported
Discr Residue Ind: Not reported
Discr Partial Reject Ind: Not reported
Discr Full Reject Ind: Not reported
Manifest Ref Num: Not reported
Alt Fac RCRA Id: Not reported
Alt Fac Sign Date: Not reported
Mgmt Method Type Code: Not reported
EPA ID: NYD981176878
Facility Name: FOUR SEASONS CLEANERS
Facility Address: 1838 AMSTERDAM AVENUE
Facility City: NEW YORK
Facility Address 2: Not reported
Country: USA
County: NE
Mailing Name: FOUR SEASONS CLEANERS
Mailing Contact: FOUR SEASONS CLEANERS
Mailing Address: 1838 AMSTERDAM AVENUE
Mailing Address 2: Not reported
Mailing City: NEW YORK
Mailing State: NY
Mailing Zip: Not reported
Mailing Zip4: Not reported
Mailing Country: USA
Mailing Phone: 212-281-7622

[Click this hyperlink](#) while viewing on your computer to access
73 additional NY_MANIFEST: record(s) in the EDR Site Report.

AO173 FOUR SEASONS/PINETREE FRNCH CLNRS
WSW 1838 AMSTERDAM AVENUE
1/8-1/4 NEW YORK, NY
1256 ft.

DRYCLEANERS S106436112
N/A

Relative: Site 2 of 6 in cluster AO
Higher DRYCLEANERS:
Facility ID: 2-6201-00070
Actual: Region: NY
130 ft.

AO174 PINE TREE FRENCH CLEANERS
WSW 1838 AMSTERDAM AVE
1/8-1/4 NEW YORK, NY 10031
1262 ft.

RCRA-SQG 1000994334
NYD981875214

Relative: Site 3 of 6 in cluster AO
Higher

Actual:
130 ft.

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

PINE TREE FRENCH CLEANERS (Continued)

EDR ID Number
EPA ID Number

Database(s)

1000994334

RCRAInfo:

Owner: PINE TREE FRENCH CLEANERS
(212) 555-1212
EPA ID: NYD981875214
Contact: EI BOO LEE
(212) 555-1212

Classification: Small Quantity Generator
TSDF Activities: Not reported

Violation Status: No violations found

AP175
North
1/8-1/4
1267 ft.

498 W 159TH ST
498 W 159TH ST
NEW YORK CITY, NY

LTANKS **S102662860**
HIST LTANKS **N/A**

Site 1 of 5 in cluster AP

Relative:
Higher

LTANKS:

Actual:
153 ft.

Site ID: 164403
Spill Date: 02/18/97
Facility Addr2: Not reported
Facility ID: 9613555
Program Number: 9613555
SWIS: 3101
Region of Spill: 2
Investigator: GUTIERREZ
Referred To: Not reported
Reported to Dept: 02/18/97
CID: 15
Spill Cause: Tank Overfill
Water Affected: Not reported
Spill Source: Private Dwelling
Spill Notifier: Local Agency
Cleanup Ceased: / /
Cleanup Meets Standard: False
Last Inspection: / /
Recommended Penalty: Penalty Not Recommended
UST Involvement: False
Spill Class: Known release with minimal potential for fire or hazard. DEC Response.
Willing Responsible Party. Corrective action taken.
Spill Closed Dt: 03/10/03
Remediation Phase: 0
Date Entered In Computer: 02/18/97
Spill Record Last Update: 03/10/03
Spille Namer: Not reported
Spiller Company: JTF MANAGEMENT
Spiller Phone: (914) 686-1424
Spiller Extention: Not reported
Spiller Address: Not reported
Spiller City,St,Zip: ZZ
Spiller County: 001
Spiller Contact: JIM CAREY
Spiller Phone: (718) 579-3414
Spiller Extention: Not reported
DEC Region: 2
Program Number: 9613555
DER Facility ID: 138627

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

498 W 159TH ST (Continued)

EDR ID Number
EPA ID Number

Database(s)

S102662860

Site ID: 164403
Operable Unit ID: 1041124
Operable Unit: 01
Material ID: 338662
Material Code: 0002
Material Name: #4 Fuel Oil
Case No.: Not reported
Material FA: Petroleum
Quantity: 20.00
Units: Gallons
Recovered: 0.00
Resource Affected: Soil
Oxygenate: False
Site ID: Not reported
Spill Tank Test: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate: Not reported
Gross Fail: Not reported
Modified By: Not reported
Last Modified: Not reported
Test Method: Not reported
DEC Memo: Not reported
Remarks: Not reported

HIST LTANKS:

Region of Spill: 2
Spill Number: 9613555
Investigator: GUTIERREZ
Caller Name: Not reported
Caller Agency: Not reported
Caller Phone: Not reported
Caller Extension: Not reported
Notifier Name: Not reported
Notifier Agency: Not reported
Notifier Phone: Not reported
Notifier Extension: Not reported
Spill Date: 02/18/1997
Spill Time: 20:00
Reported to Department Date: 02/18/97
Reported to Department Time: 20:27
SWIS: 62
Spiller Contact: JIM CAREY
Spiller Phone: (718) 579-3414
Spiller Extension: Not reported
Spiller Name: JTF MANAGEMENT
Spiller Address: Not reported
Spiller City,St,Zip: Not reported
Facility Contact: Not reported
Facility Phone: (914) 686-1424
Facility Extension: Not reported
Spill Cause: Tank Overfill
Resource Affectd: On Land
Water Affected: Not reported
Spill Source: Private Dwelling
Spill Notifier: Local Agency

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

498 W 159TH ST (Continued)

EDR ID Number
EPA ID Number

Database(s)

S102662860

PBS Number: Not reported
Cleanup Ceased: / /
Cleanup Meets Standard: False
Last Inspection: / /
Recommended Penalty: Penalty Not Recommended
Spiller Cleanup Date: / /
Enforcement Date: / /
Investigation Complete: / /
UST Involvement: False
Spill Class: Known release with minimal potential for fire or hazard. DEC Response.
Willing Responsible Party. Corrective action taken.
Spill Closed Dt: / /
Date Region Sent Summary to Central Office: / /
Corrective Action Plan Submitted: / /
Date Spill Entered In Computer Data File: 02/18/97
Time Spill Entered In Computer Data File: Not reported
Spill Record Last Update: 02/21/97
Is Updated: False
PBS Number: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate Failed Tank: Not reported
Gross Leak Rate: Not reported
Material Class Type: Petroleum
Quantity Spilled: 20
Unkonwn Quantity Spilled: False
Units: Gallons
Quantity Recovered: 0
Unkonwn Quantity Recovered: False
Material: #4 FUEL OIL
Class Type: #4 FUEL OIL
Times Material Entry In File: 1751
CAS Number: Not reported
Last Date: 19941205
DEC Remarks: Not reported
Spill Cause: Not reported

AP176 MARIPOSA PROPERTIES
North 498 WEST 159TH STREET
1/8-1/4 NEW YORK, NY 10032
1267 ft.

AST U003395791
HIST AST N/A

Relative:
Higher

Site 2 of 5 in cluster AP

Actual:
153 ft.

AST:
AST:
Region: STATE
Facility Id: 2-600907
UTM X: 589314.01519
UTM Y: 4520882.57051
Expiration Date: 10/07/07
Renewal Date: 06/04/02
Total Capacity: 1500
Facility Type: Not reported
Site Type Name: Apartment Building/Office Building
Site Type Status: Active
Mailing Company: JTF MANAGEMENT ASSOCIATES,LTD.

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s)
EDR ID Number
EPA ID Number

MARIPOSA PROPERTIES (Continued)

U003395791

Mailing Title:	Not reported
Mailing Contact:	PHYLLIS WELSH
Mailing Address:	P.O. BOX 722
Mailing Address 2:	Not reported
Mailing City:	HARTSDALE
Mailing State:	NY
Mailing Zip Code:	10530-0722
Mailing Phone No:	(718) 365-1739
Mailing Email:	Not reported
Owner Title:	Not reported
Owner Name:	Not reported
Owner Address:	P.O. BOX 722
Owner Address 2:	Not reported
Owner State:	NY
Owner Zip Code:	10530
Owner Phone:	(718) 365-1439
Owner Company:	MARIPOSA PROPERTIES INC
Emergency Contact:	PHYLLIS WALSH
Emergency Phone:	(718) 365-1439
Operator:	MCX GOMEZ
Operator Phone:	(718) 367-1761
Owner City:	HARTSDALE
Owner Sub Type:	Corporate or Commercial
Program Type:	PBS
Tank Number:	001
Tank Location Name:	Aboveground - in contact with soil
Tank Status:	In Service
Tank Model:	Not reported
Pipe Model:	Not reported
Active Status:	Active
Install Date:	/ /
Capacity Gallons:	1500
Material Name:	#6 Fuel Oil
Percentage:	100.00
Tank Type Name:	Steel/Carbon Steel/Iron
Tank Internal Protection:	None
Tank Internal Protection 1:	None
Tank Internal Protection 2:	Not reported
Pipe Location Name:	Aboveground/Underground Combination
Pipe Type Name:	Steel/Carbon Steel/Iron
Pipe External Protection 1:	Original Impressed Current
Pipe External Protection 2:	Not reported
Tank Secondary Containment 1:	None
Tank Secondary Containment 2:	Not reported
Pipe Secondary Containment:	Not reported
Tank Leak Detection 1:	None
Tank Leak Detection 2:	Not reported
Pipe Leak Detection 1:	Exempt Suction Piping
Pipe Leak Detection 2:	Not reported
Type Of Overfill Prevention 1:	Float Vent Valve
Type Of Overfill Prevention 2:	Automatic Shut-Off
Dispenser Method:	Suction
Spill Prevention:	Not reported
Tightness Test Method:	Testing Not Required
Date Tested:	/ /
Next Test Date:	/ /

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s)
EDR ID Number
EPA ID Number

MARIPOSA PROPERTIES (Continued)

U003395791

Date Tank Closed: / /

HIST AST:

PBS Number: 2-600907
SWIS Code: 6201
Operator: MEX GOMEZ
Facility Phone: (718) 367-1761
Facility Addr2: 498 WEST 159TH STREET
Facility Type: APARTMENT BUILDING
Emergency: PHYLLIS WALSH
Emergency Tel: (718) 365-1439
Old PBSNO: Not reported
Date Inspected: Not reported
Inspector: Not reported
Result of Inspection: Not reported
Owner Name: MARIPOSA PROPERTIES
Owner Address: P.O. BOX 722
Owner City,St,Zip: HARTSDALE, NY 10530
Federal ID: Not reported
Owner Tel: (718) 365-1439
Owner Type: Corporate/Commercial
Owner Subtype: Not reported
Mailing Contact: PHYLLIS WALCH
Mailing Name: JTF MANAGEMENT ASSOCIATES,LTD.
Mailing Address: P.O. BOX 722
Mailing Address 2: Not reported
Mailing City,St,Zip: HARTSDALE, NY 10530-0722
Mailing Telephone: (718) 365-1739
Owner Mark: First Owner
Facility Status: 1 - Active PBS facility, i.e. total capacity of the PBS tanks is
greater than 1,100 gallons, regardless if Subpart 360-14 tanks exist
or not at the facility.

Certification Flag: False
Certification Date: 10/07/1997
Expiration: 10/07/2002
Renew Flag: False
Renew Date: Not reported
Total Capacity: 1500
FAMT: True
Facility Screen: No Missing Data
Owner Screen: Minor Data Missing
Tank Screen: Minor Data Missing
Dead Letter: False
CBS Number: Not reported
Town or City: NEW YORK CITY
County Code: 62
Town or City Code: 01
Region: 2

Tank ID: 001
Tank Location: ABOVEGROUND
Tank Status: In Service
Install Date: Not reported
Capacity (Gal): 1500
Product Stored: NOS 5 OR 6 FUEL OIL
Tank Type: Steel/carbon steel
Tank Internal: Not reported

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

MARIPOSA PROPERTIES (Continued)

EDR ID Number
EPA ID Number

Database(s)

U003395791

Tank External: Not reported
Pipe Location: Aboveground/Underground Combination
Pipe Type: STEEL/IRON
Pipe Internal: Fiberglass Liner (FRP)
Pipe External: 3
Tank Containment: Not reported
Leak Detection: Not reported
Overfill Protection: 13
Dispenser Method: Suction
Date Tested: Not reported
Next Test Date: Not reported
Missing Data for Tank: Minor Data Missing
Date Closed: Not reported
Test Method: Not reported
Deleted: False
Updated: True
SPDES Number: Not reported
Lat/Long: Not reported

177
West
1/8-1/4
1268 ft.

534-536 WEST 152ND STREET
534-536 WEST 152ND STREET
NEW YORK, NY 10031

AST
HIST AST

U003395085
N/A

Relative:
Higher

AST:

AST:

Actual:
136 ft.

Region: STATE
Facility Id: 2-471496
UTM X: 588915.63501
UTM Y: 4520427.11854
Expiration Date: 04/20/08
Renewal Date: 01/08/03
Total Capacity: 3000
Facility Type: Not reported
Site Type Name: Unknown
Site Type Status: Active
Mailing Company: 534-536 WEST 152ND STREET
Mailing Title: Not reported
Mailing Contact: SUPER FACILITY MANAGER
Mailing Address: 534-536 WEST 152ND STREET #23
Mailing Address 2: Not reported
Mailing City: NEW YORK
Mailing State: NY
Mailing Zip Code: 10031
Mailing Phone No: (212) 491-6501
Mailing Email: Not reported
Owner Title: Not reported
Owner Name: Not reported
Owner Address: 534 WEST 152ND STREET #23
Owner Address 2: Not reported
Owner State: NY
Owner Zip Code: 10031
Owner Phone: (212) 491-6501
Owner Company: 534 WEST 152ND STREET H D F C
Emergency Contact: KIM COLEMAN
Emergency Phone: (212) 491-6501
Operator: 534 W.152ND ST. HDFC

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s)
EDR ID Number
EPA ID Number

534-536 WEST 152ND STREET (Continued)

U003395085

Operator Phone: (212) 491-6501
Owner City: NEW YORK
Owner Sub Type: Corporate or Commercial
Program Type: PBS

Tank Number: 001
Tank Location Name: Aboveground - in contact with soil
Tank Status: In Service
Tank Model: Not reported
Pipe Model: Not reported
Active Status: Active
Install Date: / /
Capacity Gallons: 3000
Material Name: #2 Fuel Oil
Percentage: 100.00
Tank Type Name: Steel/Carbon Steel/Iron
Tank Internal Protection: None
Tank Internal Protection 1: None
Tank Internal Protection 2: Not reported
Pipe Location Name: No Piping
Pipe Type Name: Steel/Carbon Steel/Iron
Pipe External Protection 1: None
Pipe External Protection 2: Not reported
Tank Secondary Containment 1: Vault (w/o access)
Tank Secondary Containment 2: Not reported
Pipe Secondary Containment: Not reported
Tank Leak Detection 1: None
Tank Leak Detection 2: Not reported
Pipe Leak Detection 1: Exempt Suction Piping
Pipe Leak Detection 2: Not reported
Type Of Overfill Prevention 1: Product Level Gauge (A/G)
Type Of Overfill Prevention 2: Not reported
Dispenser Method: Suction
Spill Prevention: Not reported
Tightness Test Method: Testing Not Required
Date Tested: / /
Next Test Date: / /
Date Tank Closed: / /

HIST AST:

PBS Number: 2-471496
SWIS Code: 6201
Operator: 534 W.152ND ST. HDFC
Facility Phone: (212) 491-6501
Facility Addr2: 534 WEST 152ND STREET
Facility Type: Not reported
Emergency: KIM COLEMAN
Emergency Tel: (212) 491-6501
Old PBSNO: Not reported
Date Inspected: Not reported
Inspector: Not reported
Result of Inspection: Not reported
Owner Name: 534 WEST 152ND STREET H D F C
Owner Address: 534 WEST 152ND STREET #23
Owner City,St,Zip: NEW YORK, NY 10031
Federal ID: Not reported
Owner Tel: (212) 491-6501

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

534-536 WEST 152ND STREET (Continued)

EDR ID Number
EPA ID Number

Database(s)

U003395085

Owner Type: Corporate/Commercial
Owner Subtype: Not reported
Mailing Contact: SUPER FACILITY MANAGER
Mailing Name: 534-536 WEST 152ND STREET
Mailing Address: 534-536 WEST 152ND STREET #23
Mailing Address 2: Not reported
Mailing City,St,Zip: NEW YORK, NY 10031
Mailing Telephone: (212) 491-6501
Owner Mark: Second Owner
Facility Status: 1 - Active PBS facility, i.e. total capacity of the PBS tanks is greater than 1,100 gallons, regardless if Subpart 360-14 tanks exist or not at the facility.

Certification Flag: False
Certification Date: 04/21/1998
Expiration: 04/20/2003
Renew Flag: False
Renew Date: Not reported
Total Capacity: 3000
FAMT: True
Facility Screen: Minor Data Missing
Owner Screen: No Missing Data
Tank Screen: Minor Data Missing
Dead Letter: False
CBS Number: Not reported
Town or City: NEW YORK CITY
County Code: 62
Town or City Code: 01
Region: 2

Tank ID: 001
Tank Location: ABOVEGROUND
Tank Status: In Service
Install Date: Not reported
Capacity (Gal): 3000
Product Stored: NOS 1,2, OR 4 FUEL OIL
Tank Type: Steel/carbon steel
Tank Internal: Not reported
Tank External: Not reported
Pipe Location: Not reported
Pipe Type: STEEL/IRON
Pipe Internal: Not reported
Pipe External: Not reported
Tank Containment: Diking
Leak Detection: 0
Overfill Protection: 4
Dispenser Method: Suction
Date Tested: Not reported
Next Test Date: Not reported
Missing Data for Tank: Minor Data Missing
Date Closed: Not reported
Test Method: Not reported
Deleted: False
Updated: False
SPDES Number: Not reported
Lat/Long: Not reported

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

178
South
1/8-1/4
1277 ft.

192/196/200 BRADHURST AVE
196 BRADHURST AVE
NEW YORK, NY 10039

AST
HIST AST

U003391251
N/A

Relative:
Lower

AST:

AST:

Actual:
20 ft.

Region: STATE
Facility Id: 2-336130
UTM X: 589418.06895
UTM Y: 4520123.54132
Expiration Date: 10/02/07
Renewal Date: 06/04/02
Total Capacity: 7500
Facility Type: Not reported
Site Type Name: Apartment Building/Office Building
Site Type Status: Active
Mailing Company: TRYAX REALTY MANAGEMENT, INC
Mailing Title: Not reported
Mailing Contact: JAMES H. WICKLINE
Mailing Address: PO BOX 222118
Mailing Address 2: Not reported
Mailing City: GREAT NECK
Mailing State: NY
Mailing Zip Code: 11022-2118
Mailing Phone No: (516) 829-5400
Mailing Email: Not reported
Owner Title: Not reported
Owner Name: Not reported
Owner Address: P.O. BOX 222118
Owner Address 2: Not reported
Owner State: NY
Owner Zip Code: 11022-2118
Owner Phone: (516) 829-5400
Owner Company: BRADHURST ASSOCIATES, L.L.C.
Emergency Contact: TRYAX MGMT. INC.
Emergency Phone: (718) 590-4311
Operator: ALLEN RHODES
Operator Phone: (212) 926-3271
Owner City: GREAT NECK
Owner Sub Type: Corporate or Commercial
Program Type: PBS

Tank Number: 001
Tank Location Name: Aboveground - in contact with soil
Tank Status: In Service
Tank Model: Not reported
Pipe Model: Not reported
Active Status: Active
Install Date: / /
Capacity Gallons: 7500
Material Name: #6 Fuel Oil
Percentage: 100.00
Tank Type Name: Steel/Carbon Steel/Iron
Tank Internal Protection: None
Tank Internal Protection 1: Painted/Asphalt Coating
Tank Internal Protection 2: Not reported
Pipe Location Name: Aboveground
Pipe Type Name: Steel/Carbon Steel/Iron

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s)
EDR ID Number
EPA ID Number

192/196/200 BRADHURST AVE (Continued)

U003391251

Pipe External Protection 1: Wrapped
Pipe External Protection 2: Not reported
Tank Secondary Containment 1: Other
Tank Secondary Containment 2: Not reported
Pipe Secondary Containment: Not reported
Tank Leak Detection 1: None
Tank Leak Detection 2: Not reported
Pipe Leak Detection 1: Exempt Suction Piping
Pipe Leak Detection 2: Not reported
Type Of Overfill Prevention 1: Product Level Gauge (A/G)
Type Of Overfill Prevention 2: Not reported
Dispenser Method: Suction
Spill Prevention: Not reported
Tightness Test Method: Testing Not Required
Date Tested: / /
Next Test Date: / /
Date Tank Closed: / /

HIST AST:

PBS Number: 2-336130
SWIS Code: 6201
Operator: LEGENT MCFARLAND
Facility Phone: (212) 281-1496
Facility Addr2: Not reported
Facility Type: APARTMENT BUILDING
Emergency: TRYAX MGMT. INC.
Emergency Tel: (718) 590-4311
Old PBSNO: Not reported
Date Inspected: Not reported
Inspector: Not reported
Result of Inspection: Not reported
Owner Name: BRADHURST ASSOCIATES, L.L.C.
Owner Address: P.O. BOX 222118
Owner City,St,Zip: GREAY NECK, NY 11022-2118
Federal ID: Not reported
Owner Tel: (516) 819-5400
Owner Type: Corporate/Commercial
Owner Subtype: Not reported
Mailing Contact: MARVIN GOLDBERG
Mailing Name: TRYAX REALTY MANAGEMENT, INC
Mailing Address: PO BOX 222118
Mailing Address 2: Not reported
Mailing City,St,Zip: GREAT NECK, NY 11022-2118
Mailing Telephone: (516) 829-5400
Owner Mark: First Owner
Facility Status: 1 - Active PBS facility, i.e. total capacity of the PBS tanks is
 greater than 1,100 gallons, regardless if Subpart 360-14 tanks exist
 or not at the facility.

Certification Flag: False
Certification Date: 11/18/1997
Expiration: 10/02/2002
Renew Flag: False
Renew Date: Not reported
Total Capacity: 7500
FAMT: True
Facility Screen: No Missing Data
Owner Screen: No Missing Data

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

192/196/200 BRADHURST AVE (Continued)

EDR ID Number
EPA ID Number

Database(s)

U003391251

Tank Screen: No Missing Data
Dead Letter: False
CBS Number: Not reported
Town or City: NEW YORK CITY
County Code: 62
Town or City Code: 01
Region: 2

Tank ID: 001
Tank Location: ABOVEGROUND
Tank Status: In Service
Install Date: Not reported
Capacity (Gal): 7500
Product Stored: NOS 5 OR 6 FUEL OIL
Tank Type: Steel/carbon steel
Tank Internal: 0
Tank External: 01
Pipe Location: Aboveground
Pipe Type: STEEL/IRON
Pipe Internal: None
Pipe External: 6
Tank Containment: Double-Walled
Leak Detection: 0
Overfill Protection: 4
Dispenser Method: Suction
Date Tested: Not reported
Next Test Date: Not reported
Missing Data for Tank: No Missing Data
Date Closed: Not reported
Test Method: Not reported
Deleted: False
Updated: True
SPDES Number: Not reported
Lat/Long: Not reported

AQ179
NNW
1/8-1/4
1291 ft.

537 WEST 158TH ST.
537 WEST 158TH ST.
NEW YORK, NY 10033

AST A100300198
N/A

Relative:
Higher

Site 1 of 2 in cluster AQ

AST:

Actual:
136 ft.

AST:

Region: STATE
Facility Id: 2-610366
UTM X: 589155.00931
UTM Y: 4520864.62045
Expiration Date: 08/29/10
Renewal Date: / /
Total Capacity: 3000
Facility Type: Not reported
Site Type Name: Apartment Building/Office Building
Site Type Status: Active
Mailing Company: VIGOR REALTY, LLC
Mailing Title: Not reported
Mailing Contact: JOE HAIM
Mailing Address: 2002 SECOND AVE.

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s) EDR ID Number
EPA ID Number

537 WEST 158TH ST. (Continued)

A100300198

Mailing Address 2:	Not reported
Mailing City:	NEW YORK
Mailing State:	NY
Mailing Zip Code:	10029
Mailing Phone No:	(212) 996-8975
Mailing Email:	Not reported
Owner Title:	MANAGER
Owner Name:	JOE HAIM
Owner Address:	2002 SECOND AVE
Owner Address 2:	Not reported
Owner State:	NY
Owner Zip Code:	10029
Owner Phone:	(212) 996-8975
Owner Company:	VIGOR REALTY, LLC
Emergency Contact:	JUAN QUEZADA
Emergency Phone:	(917) 578--7436
Operator:	JUAN QUEZADA
Operator Phone:	(917) 578-7436
Owner City:	NEW YORK
Owner Sub Type:	Corporate or Commercial
Program Type:	PBS
Tank Number:	001
Tank Location Name:	Aboveground - in contact with soil
Tank Status:	In Service
Tank Model:	Not reported
Pipe Model:	Not reported
Active Status:	Active
Install Date:	09/01/70
Capacity Gallons:	3000
Material Name:	#2 Fuel Oil
Percentage:	100.00
Tank Type Name:	Steel/Carbon Steel/Iron
Tank Internal Protection:	None
Tank Internal Protection 1:	Painted/Asphalt Coating
Tank Internal Protection 2:	Jacketed
Pipe Location Name:	Aboveground
Pipe Type Name:	Steel/Carbon Steel/Iron
Pipe External Protection 1:	None
Pipe External Protection 2:	Not reported
Tank Secondary Containment 1:	Double-Walled (Underground)
Tank Secondary Containment 2:	Not reported
Pipe Secondary Containment:	Not reported
Tank Leak Detection 1:	None
Tank Leak Detection 2:	Not reported
Pipe Leak Detection 1:	Exempt Suction Piping
Pipe Leak Detection 2:	Not reported
Type Of Overfill Prevention 1:	Product Level Gauge (A/G)
Type Of Overfill Prevention 2:	Vent Whistle
Dispenser Method:	Suction
Spill Prevention:	Not reported
Tightness Test Method:	Testing Not Required
Date Tested:	/ /
Next Test Date:	/ /
Date Tank Closed:	/ /

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

AP180
North
1/8-1/4
1297 ft.

507 W 159TH ST
507 W 159TH ST
NEW YORK, NY 10032

AST
HIST AST **U003390074**
 N/A

Relative:
Higher

Site 3 of 5 in cluster AP

AST:

Actual:
151 ft.

AST:

Region: STATE
Facility Id: 2-267473
UTM X: 589291.43904
UTM Y: 4520908.49906
Expiration Date: 12/30/08
Renewal Date: 04/04/02
Total Capacity: 2500
Facility Type: Not reported
Site Type Name: Apartment Building/Office Building
Site Type Status: Active
Mailing Company: AMSTERDAM 159 LLC
Mailing Title: Not reported
Mailing Contact: M. SAJAD (MANAGER)
Mailing Address: 511 WEST 159TH STREET
Mailing Address 2: BSMT
Mailing City: NEW YORK
Mailing State: NY
Mailing Zip Code: 10032
Mailing Phone No: (212) 543-4766
Mailing Email: Not reported
Owner Title: Not reported
Owner Name: Not reported
Owner Address: 511 WEST 159 ST
Owner Address 2: Not reported
Owner State: NY
Owner Zip Code: 10032
Owner Phone: (212) 543-4766
Owner Company: AMSTERDAM 159 LLC
Emergency Contact: FELTHON ROSARIO
Emergency Phone: (212) 795-1850
Operator: FELTHON ROSARIO
Operator Phone: (212) 795-1850
Owner City: NEW YORK
Owner Sub Type: Corporate or Commercial
Program Type: PBS

Tank Number: 001
Tank Location Name: Aboveground - in contact with soil
Tank Status: In Service
Tank Model: Not reported
Pipe Model: Not reported
Active Status: Active
Install Date: / /
Capacity Gallons: 2500
Material Name: #2 Fuel Oil
Percentage: 100.00
Tank Type Name: Steel/Carbon Steel/Iron
Tank Internal Protection: None
Tank Internal Protection 1: None
Tank Internal Protection 2: Not reported
Pipe Location Name: Aboveground

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s) EDR ID Number
EPA ID Number

507 W 159TH ST (Continued)

U003390074

Pipe Type Name: Steel/Carbon Steel/Iron
Pipe External Protection 1: None
Pipe External Protection 2: Not reported
Tank Secondary Containment 1: Vault (w/o access)
Tank Secondary Containment 2: Not reported
Pipe Secondary Containment: Not reported
Tank Leak Detection 1: Impervious Barrier/Concrete Pad (A/G)
Tank Leak Detection 2: Not reported
Pipe Leak Detection 1: Exempt Suction Piping
Pipe Leak Detection 2: Not reported
Type Of Overfill Prevention 1: Product Level Gauge (A/G)
Type Of Overfill Prevention 2: Vent Whistle
Dispenser Method: Suction
Spill Prevention: Not reported
Tightness Test Method: Testing Not Required
Date Tested: / /
Next Test Date: / /
Date Tank Closed: / /

HIST AST:

PBS Number: 2-267473
SWIS Code: 6201
Operator: STEVE SFIKAS
Facility Phone: (212) 740-2476
Facility Addr2: 507 W 159TH ST
Facility Type: APARTMENT BUILDING
Emergency: STEVE SFIKAS
Emergency Tel: (212) 740-2476
Old PBSNO: Not reported
Date Inspected: Not reported
Inspector: Not reported
Result of Inspection: Not reported
Owner Name: S.S 507 W 159TH STREET REALTY ASSOCIATES
Owner Address: 511 WEST 159TH STREET # 17
Owner City,St,Zip: MANHATTAN, NY 10032
Federal ID: Not reported
Owner Tel: (212) 740-2476
Owner Type: Corporate/Commercial
Owner Subtype: Not reported
Mailing Contact: SUPER FACILITY MANGER
Mailing Name: 507 WEST 159TH STREET
Mailing Address: 507 WEST 159TH STREET
Mailing Address 2: Not reported
Mailing City,St,Zip: NEW YORK, NY 10032
Mailing Telephone: (212) 740-2476
Owner Mark: First Owner
Facility Status: 1 - Active PBS facility, i.e. total capacity of the PBS tanks is greater than 1,100 gallons, regardless if Subpart 360-14 tanks exist or not at the facility.

Certification Flag: False
Certification Date: 04/21/1998
Expiration: 08/17/2002
Renew Flag: False
Renew Date: Not reported
Total Capacity: 4000
FAMT: True
Facility Screen: No Missing Data

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

507 W 159TH ST (Continued)

EDR ID Number
EPA ID Number

Database(s)

U003390074

Owner Screen: No Missing Data
Tank Screen: Minor Data Missing
Dead Letter: False
CBS Number: Not reported
Town or City: NEW YORK CITY
County Code: 62
Town or City Code: 01
Region: 2

Tank ID: 001
Tank Location: ABOVEGROUND
Tank Status: In Service
Install Date: Not reported
Capacity (Gal): 4000
Product Stored: UNLEADED GASOLINE
Tank Type: Steel/carbon steel
Tank Internal: Not reported
Tank External: Not reported
Pipe Location: Not reported
Pipe Type: Not reported
Pipe Internal: Not reported
Pipe External: Not reported
Tank Containment: None
Leak Detection: 0
Overfill Protection: 4
Dispenser Method: Suction
Date Tested: Not reported
Next Test Date: Not reported
Missing Data for Tank: Minor Data Missing
Date Closed: Not reported
Test Method: Not reported
Deleted: False
Updated: False
SPDES Number: Not reported
Lat/Long: Not reported

AR181 GLASGALL ROOFING SHEET METAL
SSW 415 WEST 150TH ST
1/8-1/4 NEW YORK, NY 10031
1300 ft.

UST U004076148
N/A

Site 1 of 5 in cluster AR

Relative:
Lower

UST:

Actual:
103 ft.

UST:

Facility Id: 2-055204
Expiration Date: 12/02/06
Renewal Date: / /
Total Capacity: 1500
Facility Type: Not reported
Mailing Company: 415 WEST 150 STREET INC
Mailing Title: Not reported
Mailing Contact: MARTIN WEISE
Mailing Address: 415 WEST 150TH STREET
Mailing Address 2: Not reported
Mailing City: NEW YORK
Mailing State: NY
Mailing Zip Code: 10031

Map ID
 Direction
 Distance
 Distance (ft.)
 Elevation Site

MAP FINDINGS

Database(s)
 EDR ID Number
 EPA ID Number

GLASGALL ROOFING SHEET METAL (Continued)

U004076148

Mailing Phone No: (917) 566-1255
 Mailing Email: Not reported
 Owner Title: Not reported
 Owner Name: Not reported
 Owner Address: 415 WEST 150TH ST
 Owner Address 2: Not reported
 Owner State: NY
 Owner Zip Code: 10031
 Owner Phone: (212) 862-5400
 Owner Company: 415 WEST 150 STREET INC
 Emergency Contact: NEIL GLASGALL
 Emergency Phone: (914) 937-5692
 Operator: GLASGALL ROOFING SHEET METAL
 Operator Phone: (212) 862-5400
 Owner City: NEW YORK
 Owner Sub Type: Corporate or Commercial
 UTM X: 589239.32907
 UTM Y: 4520111.94300
 Site Type Name: Other
 Site Type Status: Active
 Comments: Not reported

Program Type: PBS

Tank Number: 001
 Tank Location Name: Underground, vaulted, with access
 Tank Status: In Service
 Tank Model: Not reported
 Pipe Model: Not reported
 Active Status: Active
 Install Date: 12/01/56
 Capacity Gallons: 1500
 Material Name: #2 Fuel Oil
 Percentage: 100.00
 Tank Type Name: Steel/Carbon Steel/Iron
 Tank Internal Protection: None
 Tank Internal Protection 1: None
 Tank Internal Protection 2: Not reported
 Pipe Location Name: No Piping
 Pipe Type Name: Steel/Carbon Steel/Iron
 Pipe External Protection 1: None
 Pipe External Protection 2: Not reported
 Tank Secondary Containment 1: Vault (w/o access)
 Tank Secondary Containment 2: Not reported
 Pipe Secondary Containment: Not reported
 Tank Leak Detection 1: Other
 Tank Leak Detection 2: Not reported
 Pipe Leak Detection 1: Not reported
 Pipe Leak Detection 2: Not reported
 Type Of Overfill Prevention 1: Product Level Gauge (A/G)
 Type Of Overfill Prevention 2: Not reported
 Dispenser Method: Not reported
 Spill Prevention: Not reported
 Tightness Test Method: Testing Not Required
 Date Tested: / /
 Next Test Date: / /
 Date Tank Closed: / /

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

AR182
SSW
1/8-1/4
1300 ft.

GLASGALL ROOFING SHEET METAL
415 WEST 150TH ST
NEW YORK, NY 10031

HIST UST

U000393915
N/A

Relative:
Lower

Site 2 of 5 in cluster AR

Actual:
103 ft.

HIST UST:

PBS Number: 2-055204
SPDES Number: Not reported
Emergency Contact: NEIL GLASGALL
Emergency Telephone: (914) 937-5692
Operator: GLASGALL ROOFING SHEET METAL
Operator Telephone: (212) 862-5400
Owner Name: 415 WEST 150 STREET INC
Owner Address: 415 WEST 150TH ST
Owner City,St,Zip: NEW YORK, NY 10031
Owner Telephone: (212) 862-5400
Owner Type: Corporate/Commercial
Owner Subtype: Not reported
Mailing Name: 415 WEST 150 STREET INC
Mailing Address: 415 WEST 150TH STREET
Mailing Address 2: Not reported
Mailing City,St,Zip: NEW YORK, NY 10031
Mailing Contact: Not reported
Mailing Telephone: (212) 862-5400
Owner Mark: First Owner
Facility Status: 1 - Active PBS facility, i.e. total capacity of the PBS tanks is greater than 1,100 gallons, regardless if Subpart 360-14 tanks exist or not at the facility.
Facility Addr2: 415 WEST 150TH ST
SWIS ID: 6201
Old PBS Number: Not reported
Facility Type: OTHER
Inspected Date: Not reported
Inspector: Not reported
Inspection Result: Not reported
Federal ID: Not reported
Certification Flag: False
Certification Date: 10/18/2001
Expiration Date: 12/02/2006
Renew Flag: False
Renewal Date: Not reported
Total Capacity: 1500
FAMT: True
Facility Screen: No Missing Data
Owner Screen: No Missing Data
Tank Screen: Minor Data Missing
Dead Letter: False
CBS Number: Not reported
Town or City: NEW YORK CITY
County Code: 62
Town or City: 01
Region: 2

Tank Id: 001
Tank Location: UNDERGROUND, VAULTED, WITH ACCESS
Tank Status: In Service
Install Date: 19561201
Capacity (gals): 1500

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

GLASGALL ROOFING SHEET METAL (Continued)

EDR ID Number
EPA ID Number

Database(s)

U000393915

Product Stored: NOS 1,2, OR 4 FUEL OIL
Tank Type: Steel/carbon steel
Tank Internal: Not reported
Tank External: Not reported
Pipe Location: Not reported
Pipe Type: STEEL/IRON
Pipe Internal: Not reported
Pipe External: Not reported
Second Containment: Diking
Leak Detection: Other
Overfill Prot: Product Level Gauge
Dispenser: Gravity
Date Tested: Not reported
Next Test Date: Not reported
Missing Data for Tank: Minor Data Missing
Date Closed: Not reported
Test Method: Not reported
Deleted: False
Updated: False
Lat/long: Not reported

AO183
WSW
1/8-1/4
1303 ft.

WEST BRIDGE ASSOCIATES, L.P.
508 WEST 151ST STREET
NEW YORK, NY 10031

AST A100169071
N/A

Site 4 of 6 in cluster AO

Relative:
Higher

AST:

Actual:
131 ft.

AST:

Region: STATE
Facility Id: 2-604691
UTM X: 588977.60741
UTM Y: 4520330.94341
Expiration Date: 09/14/10
Renewal Date: / /
Total Capacity: 4000
Facility Type: Not reported
Site Type Name: Apartment Building/Office Building
Site Type Status: Active
Mailing Company: WEST REALTY GROUP
Mailing Title: Not reported
Mailing Contact: CHRIS CALHOUN
Mailing Address: 875 ST. NICHOLAS AVE
Mailing Address 2: Not reported
Mailing City: NEW YORK
Mailing State: NY
Mailing Zip Code: 10032
Mailing Phone No: (212) 694-3303
Mailing Email: Not reported
Owner Title: V.P.
Owner Name: CHRIS CALHOUN
Owner Address: 875 ST. NICHOLAS AVE
Owner Address 2: Not reported
Owner State: NY
Owner Zip Code: 10032
Owner Phone: (212) 694-3303
Owner Company: WEST BRIDGE REALTY CORP.

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

WEST BRIDGE ASSOCIATES, L.P. (Continued)

EDR ID Number
EPA ID Number

Database(s)

A100169071

Emergency Contact: CHRIS CALHOUN
Emergency Phone: (718) 562-4363
Operator: ORLANDO TAVARES
Operator Phone: (917) 578-2156
Owner City: NEW YORK
Owner Sub Type: Corporate or Commercial
Program Type: PBS

Tank Number: 001
Tank Location Name: Aboveground - in contact with soil
Tank Status: In Service
Tank Model: Not reported
Pipe Model: Not reported
Active Status: Active
Install Date: / /
Capacity Gallons: 4000
Material Name: #2 Fuel Oil
Percentage: 100.00
Tank Type Name: Steel/Carbon Steel/Iron
Tank Internal Protection: None
Tank Internal Protection 1: Painted/Asphalt Coating
Tank Internal Protection 2: Not reported
Pipe Location Name: Aboveground
Pipe Type Name: Steel/Carbon Steel/Iron
Pipe External Protection 1: None
Pipe External Protection 2: Not reported
Tank Secondary Containment 1: Vault (w/o access)
Tank Secondary Containment 2: Not reported
Pipe Secondary Containment: Not reported
Tank Leak Detection 1: None
Tank Leak Detection 2: Not reported
Pipe Leak Detection 1: Not reported
Pipe Leak Detection 2: Not reported
Type Of Overfill Prevention 1: Vent Whistle
Type Of Overfill Prevention 2: Not reported
Dispenser Method: Not reported
Spill Prevention: Not reported
Tightness Test Method: Testing Not Required
Date Tested: / /
Next Test Date: / /
Date Tank Closed: / /

AP184
North
1/8-1/4
1307 ft.

509 WEST 159TH ST.
509 W 159 ST
NEW YORK, NY 10032

AST A100166508
N/A

Site 4 of 5 in cluster AP

Relative:
Higher

AST:

Actual:
150 ft.

AST:

Region: STATE
Facility Id: 2-272078
UTM X: 589286.77080
UTM Y: 4520910.99616
Expiration Date: 01/30/08
Renewal Date: / /
Total Capacity: 6000

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s)
EDR ID Number
EPA ID Number

509 WEST 159TH ST. (Continued)

A100166508

Facility Type:	Not reported
Site Type Name:	Apartment Building/Office Building
Site Type Status:	Active
Mailing Company:	AMSTERDAM 159 LLC
Mailing Title:	Not reported
Mailing Contact:	M. SAJAD
Mailing Address:	511 WEST 159 STREET 'BSMT'
Mailing Address 2:	Not reported
Mailing City:	NEW YORK
Mailing State:	NY
Mailing Zip Code:	10032
Mailing Phone No:	(212) 543-4766
Mailing Email:	Not reported
Owner Title:	MEMBER
Owner Name:	AMSTERDAM 159 LLC
Owner Address:	511 WEST 159 STREET 'BSMT'
Owner Address 2:	Not reported
Owner State:	NY
Owner Zip Code:	10032
Owner Phone:	(212) 543-4766
Owner Company:	AMSTERDAM 159 LLC
Emergency Contact:	M. SAJAD
Emergency Phone:	(212) 543-4766
Operator:	M. SAJAD
Operator Phone:	(212) 543-4766
Owner City:	NEW YORK
Owner Sub Type:	Corporate or Commercial
Program Type:	PBS
Tank Number:	001
Tank Location Name:	Aboveground - in contact with soil
Tank Status:	In Service
Tank Model:	Not reported
Pipe Model:	Not reported
Active Status:	Active
Install Date:	/ /
Capacity Gallons:	3000
Material Name:	#2 Fuel Oil
Percentage:	100.00
Tank Type Name:	Steel/Carbon Steel/Iron
Tank Internal Protection:	None
Tank Internal Protection 1:	None
Tank Internal Protection 2:	Not reported
Pipe Location Name:	No Piping
Pipe Type Name:	No Piping
Pipe External Protection 1:	None
Pipe External Protection 2:	Not reported
Tank Secondary Containment 1:	None
Tank Secondary Containment 2:	Not reported
Pipe Secondary Containment:	Not reported
Tank Leak Detection 1:	None
Tank Leak Detection 2:	Not reported
Pipe Leak Detection 1:	Exempt Suction Piping
Pipe Leak Detection 2:	Not reported
Type Of Overfill Prevention 1:	Product Level Gauge (A/G)
Type Of Overfill Prevention 2:	Not reported
Dispenser Method:	Suction

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

509 WEST 159TH ST. (Continued)

EDR ID Number
EPA ID Number

Database(s)

A100166508

Spill Prevention: Not reported
Tightness Test Method: Testing Not Required
Date Tested: / /
Next Test Date: / /
Date Tank Closed: / /

Tank Number: 002
Tank Location Name: Aboveground - in contact with soil
Tank Status: In Service
Tank Model: Not reported
Pipe Model: Not reported
Active Status: Active
Install Date: / /
Capacity Gallons: 3000
Material Name: #6 Fuel Oil
Percentage: 100.00
Tank Type Name: Steel/Carbon Steel/Iron
Tank Internal Protection: None
Tank Internal Protection 1: None
Tank Internal Protection 2: Not reported
Pipe Location Name: No Piping
Pipe Type Name: No Piping
Pipe External Protection 1: None
Pipe External Protection 2: Not reported
Tank Secondary Containment 1: None
Tank Secondary Containment 2: Not reported
Pipe Secondary Containment: Not reported
Tank Leak Detection 1: None
Tank Leak Detection 2: Not reported
Pipe Leak Detection 1: Exempt Suction Piping
Pipe Leak Detection 2: Not reported
Type Of Overfill Prevention 1: Product Level Gauge (A/G)
Type Of Overfill Prevention 2: Not reported
Dispenser Method: Suction
Spill Prevention: Not reported
Tightness Test Method: Testing Not Required
Date Tested: / /
Next Test Date: / /
Date Tank Closed: / /

AP185
North
1/8-1/4
1308 ft.

504-517 WEST 159TH ST
504 W 159TH ST
NEW YORK, NY 10032

AST A100153912
N/A

Site 5 of 5 in cluster AP

Relative:
Higher

AST:

Actual:
149 ft.

AST:

Region: STATE
Facility Id: 2-267503
UTM X: 589291.43675
UTM Y: 4520894.73213
Expiration Date: 09/01/09
Renewal Date: / /
Total Capacity: 2000
Facility Type: Not reported

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s)
EDR ID Number
EPA ID Number

504-517 WEST 159TH ST (Continued)

A100153912

Site Type Name: Apartment Building/Office Building
Site Type Status: Active
Mailing Company: 504-517 WEST 159TH STREET CORP.
Mailing Title: Not reported
Mailing Contact: Not reported
Mailing Address: 3200 CRUGEE AVE.
Mailing Address 2: SUITE: 203
Mailing City: BRONX
Mailing State: NY
Mailing Zip Code: 10467
Mailing Phone No: (718) 231-2211
Mailing Email: Not reported
Owner Title: PRES.
Owner Name: LEZE GAZIVODA
Owner Address: 1801 WEEKS AVE
Owner Address 2: Not reported
Owner State: NY
Owner Zip Code: 10457
Owner Phone: (718) 583-2300
Owner Company: 504-517 WEST 159TH STREET CORP.
Emergency Contact: LEZE GAZIVODA
Emergency Phone: (718) 583-2300
Operator: LEZE GAZIVODA
Operator Phone: (718) 583-2300
Owner City: BRONX
Owner Sub Type: Corporate or Commercial
Program Type: PBS

Tank Number: 001
Tank Location Name: Aboveground - in contact with soil
Tank Status: In Service
Tank Model: Not reported
Pipe Model: Not reported
Active Status: Active
Install Date: / /
Capacity Gallons: 2000
Material Name: #2 Fuel Oil
Percentage: 100.00
Tank Type Name: Steel/Carbon Steel/Iron
Tank Internal Protection: None
Tank Internal Protection 1: None
Tank Internal Protection 2: Not reported
Pipe Location Name: No Piping
Pipe Type Name: No Piping
Pipe External Protection 1: None
Pipe External Protection 2: Not reported
Tank Secondary Containment 1: None
Tank Secondary Containment 2: Not reported
Pipe Secondary Containment: Not reported
Tank Leak Detection 1: None
Tank Leak Detection 2: Not reported
Pipe Leak Detection 1: Not reported
Pipe Leak Detection 2: Not reported
Type Of Overfill Prevention 1: Product Level Gauge (A/G)
Type Of Overfill Prevention 2: Not reported
Dispenser Method: Suction
Spill Prevention: Not reported

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

504-517 WEST 159TH ST (Continued)

EDR ID Number
EPA ID Number

Database(s)

A100153912

Tightness Test Method: Testing Not Required
Date Tested: / /
Next Test Date: / /
Date Tank Closed: / /

AR186 ST. NICHOLAS AMANA, INC.
SSW 800 ST NICHOLAS AVE
1/8-1/4 NEW YORK, NY 10031
1312 ft.

UST U000414037
HIST UST N/A

Site 3 of 5 in cluster AR

Relative:
Lower

UST:

Actual:
103 ft.

UST:

Facility Id: 2-600647
Expiration Date: 08/17/09
Renewal Date: / /
Total Capacity: 12000
Facility Type: Not reported
Mailing Company: ST. NICHOLAS AMANA, INC.
Mailing Title: Not reported
Mailing Contact: FADY ISA
Mailing Address: 800 ST. NICHOLAS AVE.
Mailing Address 2: Not reported
Mailing City: NEW YORK
Mailing State: NY
Mailing Zip Code: 10031
Mailing Phone No: (212) 694-2320
Mailing Email: Not reported
Owner Title: PRESIDENT
Owner Name: FADY ISA
Owner Address: 191 BROADWAY, APT. 6C
Owner Address 2: Not reported
Owner State: NY
Owner Zip Code: 10522
Owner Phone: (917) 567-3167
Owner Company: FADY ISA
Emergency Contact: FADY ISA
Emergency Phone: (917) 567-3167
Operator: FADY ISA
Operator Phone: (212) 694-2320
Owner City: DOBBS FERRY
Owner Sub Type: Corporate or Commercial
UTM X: 589182.10821
UTM Y: 4520122.24330
Site Type Name: Retail Gasoline Sales
Site Type Status: Active
Comments: Not reported

Program Type: PBS

Tank Number: 001
Tank Location Name: Underground
Tank Status: In Service
Tank Model: 103
Pipe Model: C
Active Status: Active
Install Date: 02/01/86

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s) EDR ID Number
EPA ID Number

ST. NICHOLAS AMANA, INC. (Continued)

U000414037

Capacity Gallons: 4000
Material Name: Gasoline
Percentage: 100.00
Tank Type Name: Fiberglass Reinforced Plastic (FRP)
Tank Internal Protection: Fiberglass Liner (FRP)
Tank Internal Protection 1: Fiberglass
Tank Internal Protection 2: Not reported
Pipe Location Name: Underground/On-ground
Pipe Type Name: Fiberglass Reinforced Plastic (FRP)
Pipe External Protection 1: Fiberglass
Pipe External Protection 2: Not reported
Tank Secondary Containment 1: None
Tank Secondary Containment 2: Not reported
Pipe Secondary Containment: None
Tank Leak Detection 1: In-Tank System (ATG)
Tank Leak Detection 2: Not reported
Pipe Leak Detection 1: Pressurized Piping Leak Detector
Pipe Leak Detection 2: Not reported
Type Of Overfill Prevention 1: High Level Alarm
Type Of Overfill Prevention 2: Not reported
Dispenser Method: Submersible
Spill Prevention: Catch Basin
Tightness Test Method: VacuTest
Date Tested: 04/27/04
Next Test Date: / /
Date Tank Closed: / /

Tank Number: 002
Tank Location Name: Underground
Tank Status: In Service
Tank Model: 103
Pipe Model: C
Active Status: Active
Install Date: 02/01/86
Capacity Gallons: 4000
Material Name: Gasoline
Percentage: 100.00
Tank Type Name: Fiberglass Reinforced Plastic (FRP)
Tank Internal Protection: Fiberglass Liner (FRP)
Tank Internal Protection 1: Fiberglass
Tank Internal Protection 2: Not reported
Pipe Location Name: Underground/On-ground
Pipe Type Name: Fiberglass Reinforced Plastic (FRP)
Pipe External Protection 1: Fiberglass
Pipe External Protection 2: Not reported
Tank Secondary Containment 1: None
Tank Secondary Containment 2: Not reported
Pipe Secondary Containment: None
Tank Leak Detection 1: In-Tank System (ATG)
Tank Leak Detection 2: Not reported
Pipe Leak Detection 1: Pressurized Piping Leak Detector
Pipe Leak Detection 2: Not reported
Type Of Overfill Prevention 1: High Level Alarm
Type Of Overfill Prevention 2: Not reported
Dispenser Method: Submersible
Spill Prevention: Catch Basin

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s)
EDR ID Number
EPA ID Number

ST. NICHOLAS AMANA, INC. (Continued)

U000414037

Tightness Test Method: VacuTest
Date Tested: 04/27/04
Next Test Date: / /
Date Tank Closed: / /

Tank Number: 003
Tank Location Name: Underground
Tank Status: In Service
Tank Model: 103
Pipe Model: C
Active Status: Active
Install Date: 02/01/86
Capacity Gallons: 4000
Material Name: Gasoline
Percentage: 100.00
Tank Type Name: Fiberglass Reinforced Plastic (FRP)
Tank Internal Protection: Fiberglass Liner (FRP)
Tank Internal Protection 1: Fiberglass
Tank Internal Protection 2: Not reported
Pipe Location Name: Underground/On-ground
Pipe Type Name: Fiberglass Reinforced Plastic (FRP)
Pipe External Protection 1: Fiberglass
Pipe External Protection 2: Not reported
Tank Secondary Containment 1: None
Tank Secondary Containment 2: Not reported
Pipe Secondary Containment: None
Tank Leak Detection 1: In-Tank System (ATG)
Tank Leak Detection 2: Not reported
Pipe Leak Detection 1: Pressurized Piping Leak Detector
Pipe Leak Detection 2: Not reported
Type Of Overfill Prevention 1: High Level Alarm
Type Of Overfill Prevention 2: Not reported
Dispenser Method: Submersible
Spill Prevention: Catch Basin
Tightness Test Method: VacuTest
Date Tested: 04/27/04
Next Test Date: / /
Date Tank Closed: / /

Tank Number: 1
Tank Location Name: Underground
Tank Status: Closed - In Place
Tank Model: Not reported
Pipe Model: Not reported
Active Status: Inactive
Install Date: / /
Capacity Gallons: 550
Material Name: Gasoline
Percentage: 100.00
Tank Type Name: Steel/Carbon Steel/Iron
Tank Internal Protection: None
Tank Internal Protection 1: None
Tank Internal Protection 2: Not reported
Pipe Location Name: Underground/On-ground
Pipe Type Name: Galvanized Steel

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s)
EDR ID Number
EPA ID Number

ST. NICHOLAS AMANA, INC. (Continued)

U000414037

Pipe External Protection 1: None
Pipe External Protection 2: Not reported
Tank Secondary Containment 1: None
Tank Secondary Containment 2: Not reported
Pipe Secondary Containment: Not reported
Tank Leak Detection 1: None
Tank Leak Detection 2: Not reported
Pipe Leak Detection 1: Not reported
Pipe Leak Detection 2: Not reported
Type Of Overfill Prevention 1: None
Type Of Overfill Prevention 2: Not reported
Dispenser Method: None
Spill Prevention: Not reported
Tightness Test Method: Testing Not Required
Date Tested: / /
Next Test Date: / /
Date Tank Closed: 06/01/00

Tank Number: 2
Tank Location Name: Underground
Tank Status: Closed - In Place
Tank Model: Not reported
Pipe Model: Not reported
Active Status: Inactive
Install Date: 06/01/00
Capacity Gallons: 550
Material Name: Gasoline
Percentage: 100.00
Tank Type Name: Steel/Carbon Steel/Iron
Tank Internal Protection: None
Tank Internal Protection 1: None
Tank Internal Protection 2: Not reported
Pipe Location Name: Underground/On-ground
Pipe Type Name: Galvanized Steel
Pipe External Protection 1: None
Pipe External Protection 2: Not reported
Tank Secondary Containment 1: None
Tank Secondary Containment 2: Not reported
Pipe Secondary Containment: Not reported
Tank Leak Detection 1: None
Tank Leak Detection 2: Not reported
Pipe Leak Detection 1: Not reported
Pipe Leak Detection 2: Not reported
Type Of Overfill Prevention 1: None
Type Of Overfill Prevention 2: Not reported
Dispenser Method: None
Spill Prevention: Not reported
Tightness Test Method: Testing Not Required
Date Tested: / /
Next Test Date: / /
Date Tank Closed: 06/01/00

Tank Number: 3
Tank Location Name: Underground
Tank Status: Closed - In Place

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s)
EDR ID Number
EPA ID Number

ST. NICHOLAS AMANA, INC. (Continued)

U000414037

Tank Model: Not reported
Pipe Model: Not reported
Active Status: Inactive
Install Date: 06/01/00
Capacity Gallons: 550
Material Name: Gasoline
Percentage: 100.00
Tank Type Name: Steel/Carbon Steel/Iron
Tank Internal Protection: None
Tank Internal Protection 1: None
Tank Internal Protection 2: Not reported
Pipe Location Name: Underground/On-ground
Pipe Type Name: Galvanized Steel
Pipe External Protection 1: None
Pipe External Protection 2: Not reported
Tank Secondary Containment 1: None
Tank Secondary Containment 2: Not reported
Pipe Secondary Containment: Not reported
Tank Leak Detection 1: None
Tank Leak Detection 2: Not reported
Pipe Leak Detection 1: Not reported
Pipe Leak Detection 2: Not reported
Type Of Overfill Prevention 1: None
Type Of Overfill Prevention 2: Not reported
Dispenser Method: None
Spill Prevention: Not reported
Tightness Test Method: Testing Not Required
Date Tested: / /
Next Test Date: / /
Date Tank Closed: 06/01/00

Tank Number: 4
Tank Location Name: Underground
Tank Status: Closed - In Place
Tank Model: Not reported
Pipe Model: Not reported
Active Status: Inactive
Install Date: 06/01/00
Capacity Gallons: 550
Material Name: Gasoline
Percentage: 100.00
Tank Type Name: Steel/Carbon Steel/Iron
Tank Internal Protection: None
Tank Internal Protection 1: None
Tank Internal Protection 2: Not reported
Pipe Location Name: Underground/On-ground
Pipe Type Name: Galvanized Steel
Pipe External Protection 1: None
Pipe External Protection 2: Not reported
Tank Secondary Containment 1: None
Tank Secondary Containment 2: Not reported
Pipe Secondary Containment: Not reported
Tank Leak Detection 1: None
Tank Leak Detection 2: Not reported
Pipe Leak Detection 1: Not reported
Pipe Leak Detection 2: Not reported

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s)
EDR ID Number
EPA ID Number

ST. NICHOLAS AMANA, INC. (Continued)

U000414037

Type Of Overfill Prevention 1: None
Type Of Overfill Prevention 2: Not reported
Dispenser Method: None
Spill Prevention: Not reported
Tightness Test Method: Testing Not Required
Date Tested: / /
Next Test Date: / /
Date Tank Closed: 06/01/00

Tank Number: 5
Tank Location Name: Underground
Tank Status: Closed - In Place
Tank Model: Not reported
Pipe Model: Not reported
Active Status: Inactive
Install Date: 06/01/00
Capacity Gallons: 550
Material Name: Gasoline
Percentage: 100.00
Tank Type Name: Steel/Carbon Steel/Iron
Tank Internal Protection: None
Tank Internal Protection 1: None
Tank Internal Protection 2: Not reported
Pipe Location Name: Underground/On-ground
Pipe Type Name: Galvanized Steel
Pipe External Protection 1: None
Pipe External Protection 2: Not reported
Tank Secondary Containment 1: None
Tank Secondary Containment 2: Not reported
Pipe Secondary Containment: Not reported
Tank Leak Detection 1: None
Tank Leak Detection 2: Not reported
Pipe Leak Detection 1: Not reported
Pipe Leak Detection 2: Not reported
Type Of Overfill Prevention 1: None
Type Of Overfill Prevention 2: Not reported
Dispenser Method: None
Spill Prevention: Not reported
Tightness Test Method: Testing Not Required
Date Tested: / /
Next Test Date: / /
Date Tank Closed: 06/01/00

Tank Number: 6
Tank Location Name: Underground
Tank Status: Closed - In Place
Tank Model: Not reported
Pipe Model: Not reported
Active Status: Inactive
Install Date: 06/01/00
Capacity Gallons: 550
Material Name: Gasoline
Percentage: 100.00
Tank Type Name: Steel/Carbon Steel/Iron
Tank Internal Protection: None

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

ST. NICHOLAS AMANA, INC. (Continued)

EDR ID Number
EPA ID Number

Database(s)

U000414037

Tank Internal Protection 1: None
Tank Internal Protection 2: Not reported
Pipe Location Name: Underground/On-ground
Pipe Type Name: Galvanized Steel
Pipe External Protection 1: None
Pipe External Protection 2: Not reported
Tank Secondary Containment 1: None
Tank Secondary Containment 2: Not reported
Pipe Secondary Containment: Not reported
Tank Leak Detection 1: None
Tank Leak Detection 2: Not reported
Pipe Leak Detection 1: Not reported
Pipe Leak Detection 2: Not reported
Type Of Overfill Prevention 1: None
Type Of Overfill Prevention 2: Not reported
Dispenser Method: None
Spill Prevention: Not reported
Tightness Test Method: Testing Not Required
Date Tested: / /
Next Test Date: / /
Date Tank Closed: 06/01/00

Tank Number: 7
Tank Location Name: Underground
Tank Status: Closed - In Place
Tank Model: Not reported
Pipe Model: Not reported
Active Status: Inactive
Install Date: 06/01/00
Capacity Gallons: 550
Material Name: Gasoline
Percentage: 100.00
Tank Type Name: Steel/Carbon Steel/Iron
Tank Internal Protection: None
Tank Internal Protection 1: None
Tank Internal Protection 2: Not reported
Pipe Location Name: Underground/On-ground
Pipe Type Name: Galvanized Steel
Pipe External Protection 1: None
Pipe External Protection 2: Not reported
Tank Secondary Containment 1: None
Tank Secondary Containment 2: Not reported
Pipe Secondary Containment: Not reported
Tank Leak Detection 1: None
Tank Leak Detection 2: Not reported
Pipe Leak Detection 1: Not reported
Pipe Leak Detection 2: Not reported
Type Of Overfill Prevention 1: None
Type Of Overfill Prevention 2: Not reported
Dispenser Method: None
Spill Prevention: Not reported
Tightness Test Method: Testing Not Required
Date Tested: / /
Next Test Date: / /
Date Tank Closed: 06/01/00

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

ST. NICHOLAS AMANA, INC. (Continued)

EDR ID Number
EPA ID Number

Database(s)

U000414037

HIST UST:

PBS Number: 2-600647
SPDES Number: Not reported
Emergency Contact: FADY ISA
Emergency Telephone: (917) 567-2080
Operator: FADY ISA
Operator Telephone: (212) 694-2320
Owner Name: STEADY REALTY, LLC.
Owner Address: 459 COLUMBUS AVE #606
Owner City,St,Zip: NEW YORK, NY 10025
Owner Telephone: (212) 749-7151
Owner Type: Corporate/Commercial
Owner Subtype: Not reported
Mailing Name: ST. NICHOLAS AMANA
Mailing Address: 800 ST. NICHOLAS AVE.
Mailing Address 2: Not reported
Mailing City,St,Zip: NEW YORK, NY 10031
Mailing Contact: FADY ISA
Mailing Telephone: (212) 694-2320
Owner Mark: Second Owner
Facility Status: 1 - Active PBS facility, i.e. total capacity of the PBS tanks is greater than 1,100 gallons, regardless if Subpart 360-14 tanks exist or not at the facility.

Facility Addr2: 800 ST NICHOLAS AVE
SWIS ID: 6201
Old PBS Number: Not reported
Facility Type: RETAIL GASOLINE SALES
Inspected Date: Not reported
Inspector: Not reported
Inspection Result: Not reported
Federal ID: Not reported
Certification Flag: False
Certification Date: 10/14/1999
Expiration Date: 10/05/2004
Renew Flag: False
Renewal Date: Not reported
Total Capacity: 12000
FAMT: True
Facility Screen: No Missing Data
Owner Screen: No Missing Data
Tank Screen: Minor Data Missing
Dead Letter: False
CBS Number: Not reported
Town or City: NEW YORK CITY
County Code: 62
Town or City: 01
Region: 2

Tank Id: 001
Tank Location: UNDERGROUND
Tank Status: In Service
Install Date: 19860201
Capacity (gals): 4000
Product Stored: UNLEADED GASOLINE
Tank Type: Fiberglass reinforced plastic [FRP]
Tank Internal: Fiberglass Liner (FRP)
Tank External: Fiberglass

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

ST. NICHOLAS AMANA, INC. (Continued)

EDR ID Number
EPA ID Number

Database(s)

U000414037

Pipe Location: Underground
Pipe Type: STAINLESS STEEL ALLOY
Pipe Internal: Fiberglass Liner (FRP)
Pipe External: Fiberglass
Second Containment: Vault (w/access)
Leak Detection: Electronic
Overfill Prot: Vent Whistle
Dispenser: Not reported
Date Tested: 11/01/1999
Next Test Date: Not reported
Missing Data for Tank: Minor Data Missing
Date Closed: Not reported
Test Method: Tankology [Vacutect]
Deleted: False
Updated: True
Lat/long: 40|82|73 / 73|94|30

Tank Id: 002
Tank Location: UNDERGROUND
Tank Status: In Service
Install Date: 19860201
Capacity (gals): 4000
Product Stored: UNLEADED GASOLINE
Tank Type: Fiberglass reinforced plastic [FRP]
Tank Internal: Fiberglass Liner (FRP)
Tank External: Fiberglass
Pipe Location: Underground
Pipe Type: STAINLESS STEEL ALLOY
Pipe Internal: Fiberglass Liner (FRP)
Pipe External: Fiberglass
Second Containment: Vault (w/access)
Leak Detection: Electronic
Overfill Prot: Vent Whistle
Dispenser: Not reported
Date Tested: 11/01/1999
Next Test Date: Not reported
Missing Data for Tank: Minor Data Missing
Date Closed: Not reported
Test Method: Tankology [Vacutect]
Deleted: False
Updated: True
Lat/long: 40|82|73 / 73|94|30

Tank Id: 003
Tank Location: UNDERGROUND
Tank Status: In Service
Install Date: 19860201
Capacity (gals): 4000
Product Stored: UNLEADED GASOLINE
Tank Type: Fiberglass reinforced plastic [FRP]
Tank Internal: Fiberglass Liner (FRP)
Tank External: Fiberglass
Pipe Location: Underground
Pipe Type: STAINLESS STEEL ALLOY
Pipe Internal: Fiberglass Liner (FRP)

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

ST. NICHOLAS AMANA, INC. (Continued)

EDR ID Number
EPA ID Number

Database(s)

U000414037

Pipe External: Fiberglass
Second Containment: Vault (w/access)
Leak Detection: Electronic
Overfill Prot: Vent Whistle
Dispenser: Not reported
Date Tested: 11/01/1999
Next Test Date: Not reported
Missing Data for Tank: Minor Data Missing
Date Closed: Not reported
Test Method: Tankology [Vacutect]
Deleted: False
Updated: True
Lat/long: 40|82|73 / 73|94|30

Tank Id: 1
Tank Location: UNDERGROUND
Tank Status: Closed-In Place
Install Date: Not reported
Capacity (gals): 550
Product Stored: UNLEADED GASOLINE
Tank Type: Steel/carbon steel
Tank Internal: Not reported
Tank External: Not reported
Pipe Location: Underground
Pipe Type: GALVANIZED STEEL
Pipe Internal: Not reported
Pipe External: Not reported
Second Containment: Not reported
Leak Detection: Not reported
Overfill Prot: Not reported
Dispenser: Not reported
Date Tested: Not reported
Next Test Date: Not reported
Missing Data for Tank: Minor Data Missing
Date Closed: 06/01/2000
Test Method: Not reported
Deleted: False
Updated: True
Lat/long: 40|82|73 / 73|94|30

Tank Id: 2
Tank Location: UNDERGROUND
Tank Status: Closed-In Place
Install Date: 20000601
Capacity (gals): 550
Product Stored: UNLEADED GASOLINE
Tank Type: Steel/carbon steel
Tank Internal: Not reported
Tank External: Not reported
Pipe Location: Underground
Pipe Type: GALVANIZED STEEL
Pipe Internal: Not reported
Pipe External: Not reported
Second Containment: Not reported
Leak Detection: Not reported

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

ST. NICHOLAS AMANA, INC. (Continued)

EDR ID Number
EPA ID Number

Database(s)

U000414037

Overfill Prot: Not reported
Dispenser: Not reported
Date Tested: Not reported
Next Test Date: Not reported
Missing Data for Tank: Minor Data Missing
Date Closed: 06/01/2000
Test Method: Not reported
Deleted: False
Updated: True
Lat/long: 40|82|73 / 73|94|30

Tank Id: 3
Tank Location: UNDERGROUND
Tank Status: Closed-In Place
Install Date: 20000601
Capacity (gals): 550
Product Stored: UNLEADED GASOLINE
Tank Type: Steel/carbon steel
Tank Internal: Not reported
Tank External: Not reported
Pipe Location: Underground
Pipe Type: GALVANIZED STEEL
Pipe Internal: Not reported
Pipe External: Not reported
Second Containment: Not reported
Leak Detection: Not reported
Overfill Prot: Not reported
Dispenser: Not reported
Date Tested: Not reported
Next Test Date: Not reported
Missing Data for Tank: Minor Data Missing
Date Closed: 06/01/2000
Test Method: Not reported
Deleted: False
Updated: True
Lat/long: 40|82|73 / 73|94|30

Tank Id: 4
Tank Location: UNDERGROUND
Tank Status: Closed-In Place
Install Date: 20000601
Capacity (gals): 550
Product Stored: UNLEADED GASOLINE
Tank Type: Steel/carbon steel
Tank Internal: Not reported
Tank External: Not reported
Pipe Location: Underground
Pipe Type: GALVANIZED STEEL
Pipe Internal: Not reported
Pipe External: Not reported
Second Containment: Not reported
Leak Detection: Not reported
Overfill Prot: Not reported
Dispenser: Not reported
Date Tested: Not reported

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

ST. NICHOLAS AMANA, INC. (Continued)

EDR ID Number
EPA ID Number

Database(s)

U000414037

Next Test Date: Not reported
Missing Data for Tank: Minor Data Missing
Date Closed: 06/01/2000
Test Method: Not reported
Deleted: False
Updated: True
Lat/long: 40|82|73 / 73|94|30

Tank Id: 5
Tank Location: UNDERGROUND
Tank Status: Closed-In Place
Install Date: 20000601
Capacity (gals): 550
Product Stored: UNLEADED GASOLINE
Tank Type: Steel/carbon steel
Tank Internal: Not reported
Tank External: Not reported
Pipe Location: Underground
Pipe Type: GALVANIZED STEEL
Pipe Internal: Not reported
Pipe External: Not reported
Second Containment: Not reported
Leak Detection: Not reported
Overfill Prot: Not reported
Dispenser: Not reported
Date Tested: Not reported
Next Test Date: Not reported
Missing Data for Tank: Minor Data Missing
Date Closed: 06/01/2000
Test Method: Not reported
Deleted: False
Updated: True
Lat/long: 40|82|73 / 73|94|30

Tank Id: 6
Tank Location: UNDERGROUND
Tank Status: Closed-In Place
Install Date: 20000601
Capacity (gals): 550
Product Stored: UNLEADED GASOLINE
Tank Type: Steel/carbon steel
Tank Internal: Not reported
Tank External: Not reported
Pipe Location: Underground
Pipe Type: GALVANIZED STEEL
Pipe Internal: Not reported
Pipe External: Not reported
Second Containment: Not reported
Leak Detection: Not reported
Overfill Prot: Not reported
Dispenser: Not reported
Date Tested: Not reported
Next Test Date: Not reported
Missing Data for Tank: Minor Data Missing
Date Closed: 06/01/2000

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

ST. NICHOLAS AMANA, INC. (Continued)

EDR ID Number
EPA ID Number

Database(s)

U000414037

Test Method: Not reported
Deleted: False
Updated: True
Lat/long: 40|82|73 / 73|94|30

Tank Id: 7
Tank Location: UNDERGROUND
Tank Status: Closed-In Place
Install Date: 20000601
Capacity (gals): 550
Product Stored: UNLEADED GASOLINE
Tank Type: Steel/carbon steel
Tank Internal: Not reported
Tank External: Not reported
Pipe Location: Underground
Pipe Type: GALVANIZED STEEL
Pipe Internal: Not reported
Pipe External: Not reported
Second Containment: Not reported
Leak Detection: Not reported
Overfill Prot: Not reported
Dispenser: Not reported
Date Tested: Not reported
Next Test Date: Not reported
Missing Data for Tank: Minor Data Missing
Date Closed: 06/01/2000
Test Method: Not reported
Deleted: False
Updated: True
Lat/long: 40|82|73 / 73|94|30

AR187 AMOCO GASOLINE #60030
SSW 800 ST. NICHOLAS AVE
1/8-1/4 MANHATTAN, NY
1312 ft.

LTANKS S102145072
HIST LTANKS N/A

Relative:
Lower

Site 4 of 5 in cluster AR

Actual:
103 ft.

LTANKS:
Site ID: 137053
Spill Date: 05/21/97
Facility Addr2: Not reported
Facility ID: 9702241
Program Number: 9702241
SWIS: 3101
Region of Spill: 2
Investigator: JBVOUGHT
Referred To: Not reported
Reported to Dept: 05/21/97
CID: 15
Spill Cause: Tank Test Failure
Water Affected: Not reported
Spill Source: Gasoline Station
Spill Notifier: Tank Tester
Cleanup Ceased: / /
Cleanup Meets Standard: False
Last Inspection: 11/04/97
Recommended Penalty: Penalty Not Recommended

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

AMOCO GASOLINE #60030 (Continued)

EDR ID Number
EPA ID Number

Database(s)

S102145072

UST Involvement: True
Spill Class: Known release that creates potential for fire or hazard. DEC Response.
Willing Responsible Party. Corrective action taken.
Spill Closed Dt: 03/03/03
Remediation Phase: 0
Date Entered In Computer: 05/21/97
Spill Record Last Update: 03/17/03
Spille Namer: SAME
Spiller Company: AMOCO GASOLINE
Spiller Phone: Not reported
Spiller Extention: Not reported
Spiller Address: 800 ST NICHOLAS AVE
Spiller City,St,Zip: MANHATTAN, NY 10021-001
Spiller County: 001
Spiller Contact: JIM LIGAS
Spiller Phone: (212) 690-8575
Spiller Extention: Not reported
DEC Region: 2
Program Number: 9702241
DER Facility ID: 117251
Site ID: 137053
Operable Unit ID: 1044974
Operable Unit: 01
Material ID: 335184
Material Code: 0009
Material Name: Gasoline
Case No.: Not reported
Material FA: Petroleum
Quantity: 0.00
Units: Gallons
Recovered: 0.00
Resource Affected: Soil
Oxygenate: False
Site ID: 137053
Spill Tank Test: 1545127
Tank Number: WEST TANK
Tank Size: 4000
Test Method: 00
Leak Rate: 0.00
Gross Fail: Not reported
Modified By: Spills
Last Modified: 10/01/04
Test Method: Unknown
DEC Memo: Start DECRemark - 9702241 Prior to Sept, 2004 data translation this spill Lead
DEC Field was "VOUGHT" SPILL LOCATION IS THE SITE OF AN ACTIVE PIN PROJECT #
SP93510, AND IS ACTIVE UNDER SPILL # 93-07222. AS OF OCT. '97, THERE WAS
INQUERIES BY POTENTIAL OPERATORS OF THE SITE. 11/04/97 mmm:INSPECTED STATION
- OPERATOR WAS NOT AROUND. STATION DIRECTLY OVER SUBWAY TUNNELS, AND TANKS &
PUMPS ARE OUT OF SERVICE. SVE SYSTEM LOCATED ON SOUTHERN END OF PARCEL AND IS
OPERATING. 11/12/97 mmm:RE-ASSIGNED TO TOMASELLO FOR FOLLOW UP.
03/03/2003- AUSTIN As per directive to close out spills with no recent history,
close out. 3/17/03 REASSIGNED FROM TOMASELLO. END DECRemark - 9702241
Remarks: Start CallerRemark - 9702241 CALLER STATES THERE WAS A TANK FAILURE AFTER A
TEST. NO PBS NUMBER AVAILABLE. TEST WAS AN AIR TEST ON PRODUCT. END
CallerRemark - 9702241

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s)
EDR ID Number
EPA ID Number

AMOCO GASOLINE #60030 (Continued)

S102145072

HIST LTANKS:

Region of Spill: 2
Spill Number: 9702241
Investigator: TOMASELLO
Caller Name: Not reported
Caller Agency: Not reported
Caller Phone: Not reported
Caller Extension: Not reported
Notifier Name: Not reported
Notifier Agency: Not reported
Notifier Phone: Not reported
Notifier Extension: Not reported
Spill Date: 05/21/1997
Spill Time: 12:00
Reported to Department Date: 05/21/97
Reported to Department Time: 13:38
SWIS: 62
Spiller Contact: JIM LIGAS
Spiller Phone: (212) 690-8575
Spiller Extention: Not reported
Spiller Name: AMOCO GASOLINE
Spiller Address: 800 ST NICHOLAS AVE
Spiller City,St,Zip: MANHATTAN, NY 10021-
Facility Contact: SAME
Facility Phone: Not reported
Facility Extention: Not reported
Spill Cause: Tank Test Failure
Resource Affectd: On Land
Water Affected: Not reported
Spill Source: Gas Station
Spill Notifier: Tank Tester
PBS Number: 2-600647
Cleanup Ceased: / /
Cleanup Meets Standard: False
Last Inspection: 11/04/97
Recommended Penalty: Penalty Not Recommended
Spiller Cleanup Date: / /
Enforcement Date: / /
Investigation Complete: / /
UST Involvement: True
Spill Class: Known release that creates potential for fire or hazard. DEC Response.
Willing Responsible Party. Corrective action taken.
Spill Closed Dt: / /
Date Region Sent Summary to Central Office: / /
Corrective Action Plan Submitted: / /
Date Spill Entered In Computer Data File: 05/21/97
Time Spill Entered In Computer Data File: Not reported
Spill Record Last Update: 11/12/97
Is Updated: False
PBS Number: Not reported
Tank Number: WEST TANK
Tank Size: 4000
Test Method: Unknown
Leak Rate Failed Tank: 0.00
Gross Leak Rate: Not reported
Material Class Type: Petroleum
Quantity Spilled: 0

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

AMOCO GASOLINE #60030 (Continued)

EDR ID Number
EPA ID Number

Database(s)

S102145072

Unkonwn Quantity Spilled: True
Units: Gallons
Quantity Recovered: 0
Unkonwn Quantity Recovered: True
Material: GASOLINE
Class Type: GASOLINE
Times Material Entry In File: 21329
CAS Number: Not reported
Last Date: 19940929
DEC Remarks: SPILL LOCATION IS THE SITE OF AN ACTIVE PIN PROJECT SP93510, AND IS ACTIVE UNDER SPILL 93-07222. AS OF OCT. 97, THERE WAS INQUERIES BY POTENTIAL OPERATORS OF THE SITE. 11/04/97 mmm:INSPECTED STATION - OPERATOR WAS NOT AROUND. STATION DIRECTLY OVERSUBWAY TUNNELS, AND TANKS PUMPS ARE OUT OF SERVICE. SVE SYSTEM LOCATED ON SOUTHERN END OF PARCEL AND IS OPERATING. 11/12/97 mmm:RE-ASSIGNED TO TOMASELLO FOR FOLLOW UP.
Spill Cause: CALLER STATES THERE WAS A TANK FAILURE AFTER A TEST. NO PBS NUMBER AVAILABLE. TEST WAS AN AIR TEST ON PRODUCT.

AO188
WSW
1/8-1/4
1314 ft.

CITY OF NY DEPARTMENT OF H.P.D
510 W 151 ST
MANHATTAN, NY 10031

AST U003395940
HIST AST N/A

Site 5 of 6 in cluster AO

Relative:
Higher

AST:

Actual:
132 ft.

AST:

Region: STATE
Facility Id: 2-601065
UTM X: 588972.93891
UTM Y: 4520333.44072
Expiration Date: 10/21/97
Renewal Date: / /
Total Capacity: 3000
Facility Type: Not reported
Site Type Name: Apartment Building/Office Building
Site Type Status: Active
Mailing Company: CITY OF N.Y DEPARTMENT OF H.P.D
Mailing Title: Not reported
Mailing Contact: IVAN SCHWARTZ
Mailing Address: 75 MAIDEN LANE
Mailing Address 2: 4TH FL- RM 42
Mailing City: NEW YORK
Mailing State: NY
Mailing Zip Code: 10038
Mailing Phone No: (212) 806-8038
Mailing Email: Not reported
Owner Title: Not reported
Owner Name: Not reported
Owner Address: 75 MAIDEN LANE
Owner Address 2: Not reported
Owner State: NY
Owner Zip Code: 10038
Owner Phone: (212) 806-8306
Owner Company: CITY OF N.Y DEPARTMENT OF H.P.D
Emergency Contact: LOUISE BECTON
Emergency Phone: (212) 234-3656
Operator: JOHN PRASEK

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s)
EDR ID Number
EPA ID Number

CITY OF NY DEPARTMENT OF H.P.D (Continued)

U003395940

Operator Phone: (212) 234-1175
Owner City: NEW YORK
Owner Sub Type: Local Government
Program Type: PBS

Tank Number: 1
Tank Location Name: Aboveground - in contact with soil
Tank Status: In Service
Tank Model: Not reported
Pipe Model: Not reported
Active Status: Active
Install Date: / /
Capacity Gallons: 3000
Material Name: #2 Fuel Oil
Percentage: 100.00
Tank Type Name: Steel/Carbon Steel/Iron
Tank Internal Protection: None
Tank Internal Protection 1: Painted/Asphalt Coating
Tank Internal Protection 2: Not reported
Pipe Location Name: Aboveground/Underground Combination
Pipe Type Name: Steel/Carbon Steel/Iron
Pipe External Protection 1: Painted/Asphalt Coating
Pipe External Protection 2: Not reported
Tank Secondary Containment 1: Vault (w/o access)
Tank Secondary Containment 2: Not reported
Pipe Secondary Containment: Not reported
Tank Leak Detection 1: None
Tank Leak Detection 2: Not reported
Pipe Leak Detection 1: Exempt Suction Piping
Pipe Leak Detection 2: Not reported
Type Of Overfill Prevention 1: Vent Whistle
Type Of Overfill Prevention 2: Not reported
Dispenser Method: Suction
Spill Prevention: Not reported
Tightness Test Method: Testing Not Required
Date Tested: / /
Next Test Date: / /
Date Tank Closed: / /

HIST AST:

PBS Number: 2-601065
SWIS Code: 6201
Operator: JOHN PRASEK
Facility Phone: (212) 234-1175
Facility Addr2: 510 W 151 ST
Facility Type: APARTMENT BUILDING
Emergency: LOUISE BECTON
Emergency Tel: (212) 234-3656
Old PBSNO: Not reported
Date Inspected: Not reported
Inspector: Not reported
Result of Inspection: Not reported
Owner Name: CITY OF N.Y DEPARTMENT OF H.P.D
Owner Address: 75 MAIDEN LANE
Owner City,St,Zip: NEW YORK, NY 10038
Federal ID: Not reported
Owner Tel: (212) 806-8306

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

Site Database(s) EDR ID Number
EPA ID Number

CITY OF NY DEPARTMENT OF H.P.D (Continued)

U003395940

Owner Type: Local Government
Owner Subtype: Not reported
Mailing Contact: IVAN SCHWARTZ
Mailing Name: CITY OF N.Y DEPARTMENT OF H.P.D
Mailing Address: 75 MAIDEN LANE
Mailing Address 2: 4TH FL- RM 42
Mailing City,St,Zip: NEW YORK, NY 10038
Mailing Telephone: (212) 806-8038
Owner Mark: First Owner
Facility Status: 1 - Active PBS facility, i.e. total capacity of the PBS tanks is greater than 1,100 gallons, regardless if Subpart 360-14 tanks exist or not at the facility.

Certification Flag: False
Certification Date: 10/23/1992
Expiration: 10/21/1997
Renew Flag: False
Renew Date: Not reported
Total Capacity: 3000
FAMT: True
Facility Screen: No Missing Data
Owner Screen: Minor Data Missing
Tank Screen: No Missing Data
Dead Letter: False
CBS Number: Not reported
Town or City: NEW YORK CITY
County Code: 62
Town or City Code: 01
Region: 2

Tank ID: 1
Tank Location: ABOVEGROUND
Tank Status: In Service
Install Date: Not reported
Capacity (Gal): 3000
Product Stored: NOS 1,2, OR 4 FUEL OIL
Tank Type: Steel/carbon steel
Tank Internal: 0
Tank External: 01
Pipe Location: Aboveground/Underground Combination
Pipe Type: STEEL/IRON
Pipe Internal: None
Pipe External: 01
Tank Containment: Diking
Leak Detection: 00
Overfill Protection: 06
Dispenser Method: Suction
Date Tested: Not reported
Next Test Date: Not reported
Missing Data for Tank: No Missing Data
Date Closed: Not reported
Test Method: Not reported
Deleted: False
Updated: True
SPDES Number: Not reported
Lat/Long: Not reported

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

AR189
SSW
1/8-1/4
1314 ft.

408 W 150 ST
408 WEST 150TH STREET
NEW YORK, NY 10031

AST **A100175228**
N/A

Site 5 of 5 in cluster AR

Relative:
Lower

AST:

Actual:
103 ft.

AST:

Region:	STATE
Facility Id:	2-601066
UTM X:	589251.55260
UTM Y:	4520091.44035
Expiration Date:	12/30/08
Renewal Date:	05/31/02
Total Capacity:	4000
Facility Type:	Not reported
Site Type Name:	Apartment Building/Office Building
Site Type Status:	Active
Mailing Company:	WEST NICHOLAS REALTY CORP.
Mailing Title:	Not reported
Mailing Contact:	CHRIS CALHOUN
Mailing Address:	611 WEST 148TH STREET
Mailing Address 2:	Not reported
Mailing City:	NEW YORK
Mailing State:	NY
Mailing Zip Code:	10031
Mailing Phone No:	Not reported
Mailing Email:	Not reported
Owner Title:	Not reported
Owner Name:	Not reported
Owner Address:	611 W 148 ST
Owner Address 2:	Not reported
Owner State:	NY
Owner Zip Code:	10031
Owner Phone:	Not reported
Owner Company:	NEIGHBORHOOD PARTNERSHIP HDPC % W NICHOLAS REALTY
Emergency Contact:	CHRIS CALHOUN
Emergency Phone:	Not reported
Operator:	CHRIS CALHOUN
Operator Phone:	Not reported
Owner City:	NEW YORK
Owner Sub Type:	Private Resident
Program Type:	PBS
Tank Number:	1
Tank Location Name:	Aboveground - in contact with soil
Tank Status:	In Service
Tank Model:	Not reported
Pipe Model:	Not reported
Active Status:	Active
Install Date:	/ /
Capacity Gallons:	4000
Material Name:	#2 Fuel Oil
Percentage:	100.00
Tank Type Name:	Steel/Carbon Steel/Iron
Tank Internal Protection:	None
Tank Internal Protection 1:	Painted/Asphalt Coating
Tank Internal Protection 2:	Not reported
Pipe Location Name:	Aboveground/Underground Combination

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

408 W 150 ST (Continued)

EDR ID Number
EPA ID Number

Database(s)

A100175228

Pipe Type Name: Steel/Carbon Steel/Iron
Pipe External Protection 1: None
Pipe External Protection 2: Not reported
Tank Secondary Containment 1: Vault (w/o access)
Tank Secondary Containment 2: Not reported
Pipe Secondary Containment: Not reported
Tank Leak Detection 1: None
Tank Leak Detection 2: Not reported
Pipe Leak Detection 1: Exempt Suction Piping
Pipe Leak Detection 2: Not reported
Type Of Overfill Prevention 1: Vent Whistle
Type Of Overfill Prevention 2: Not reported
Dispenser Method: Suction
Spill Prevention: Not reported
Tightness Test Method: Testing Not Required
Date Tested: / /
Next Test Date: / /
Date Tank Closed: / /

AO190 512 WEST 151ST STREET
WSW 512 WEST 151ST STREET
1/8-1/4 NEW YORK, NY 10031
1318 ft.

AST U004045616
N/A

Site 6 of 6 in cluster AO

Relative:
Higher

AST:

Actual:
132 ft.

AST:

Region: STATE
Facility Id: 2-472700
UTM X: 588968.27043
UTM Y: 4520335.93802
Expiration Date: 03/27/08
Renewal Date: / /
Total Capacity: 0
Facility Type: Not reported
Site Type Name: Apartment Building/Office Building
Site Type Status: Unregulated
Mailing Company: 512 EQUITIS LLC
Mailing Title: Not reported
Mailing Contact: 512 EQUITIES LLC
Mailing Address: 207 EAST 94 STREET
Mailing Address 2: SUITE 403
Mailing City: NEW YORK
Mailing State: NY
Mailing Zip Code: 10128
Mailing Phone No: (212) 996-5100
Mailing Email: Not reported
Owner Title: Not reported
Owner Name: Not reported
Owner Address: 207 EAST 94 STREET, SUITE 403
Owner Address 2: Not reported
Owner State: NY
Owner Zip Code: 10128
Owner Phone: (212) 996-5100
Owner Company: 512 EQUITIES INC
Emergency Contact: YOAV HARON
Emergency Phone: (212) 996-5100

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

512 WEST 151ST STREET (Continued)

EDR ID Number
EPA ID Number

Database(s)

U004045616

Operator: YOAV HARON
Operator Phone: (212) 996-5100
Owner City: NEW YORK
Owner Sub Type: Corporate or Commercial
Program Type: PBS

Tank Number: 001
Tank Location Name: Aboveground - in contact with soil
Tank Status: Closed - Removed
Tank Model: Not reported
Pipe Model: Not reported
Active Status: Inactive
Install Date: / /
Capacity Gallons: 3000
Material Name: #2 Fuel Oil
Percentage: 100.00
Tank Type Name: Steel/Carbon Steel/Iron
Tank Internal Protection: None
Tank Internal Protection 1: None
Tank Internal Protection 2: Not reported
Pipe Location Name: No Piping
Pipe Type Name: Steel/Carbon Steel/Iron
Pipe External Protection 1: None
Pipe External Protection 2: Not reported
Tank Secondary Containment 1: Vault (w/o access)
Tank Secondary Containment 2: Not reported
Pipe Secondary Containment: Not reported
Tank Leak Detection 1: None
Tank Leak Detection 2: Not reported
Pipe Leak Detection 1: Not reported
Pipe Leak Detection 2: Not reported
Type Of Overfill Prevention 1: Product Level Gauge (A/G)
Type Of Overfill Prevention 2: Not reported
Dispenser Method: Suction
Spill Prevention: Not reported
Tightness Test Method: Testing Not Required
Date Tested: / /
Next Test Date: / /
Date Tank Closed: 06/01/94

AQ191 W-158 ST HARLEM HOLDING CORP
NNW 540 W 158 ST
1/8-1/4 NEW YORK, NY 10032
1319 ft.

AST U003393667
HIST AST N/A

Site 2 of 2 in cluster AQ

Relative:
Higher

AST:

Actual:
135 ft.

AST:

Region: STATE
Facility Id: 2-341177
UTM X: 589171.48557
UTM Y: 4520869.74595
Expiration Date: 04/23/12
Renewal Date: / /
Total Capacity: 5000
Facility Type: Not reported
Site Type Name: Apartment Building/Office Building

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s)
EDR ID Number
EPA ID Number

W-158 ST HARLEM HOLDING CORP (Continued)

U003393667

Site Type Status: Active
Mailing Company: Not reported
Mailing Title: Not reported
Mailing Contact: YURI GEYLIK
Mailing Address: 56 WILLOUGHBY STREET
Mailing Address 2: Not reported
Mailing City: BROOKLYN
Mailing State: NY
Mailing Zip Code: 11201
Mailing Phone No: (718) 855-6110
Mailing Email: Not reported
Owner Title: OFFICER
Owner Name: JACK JAFFA
Owner Address: 56 WILLOUGHBY STREET
Owner Address 2: Not reported
Owner State: NY
Owner Zip Code: 11201
Owner Phone: (718) 855-6110
Owner Company: 536-540 WEST 158 STREET OWNER, LLC
Emergency Contact: JACK JAFFA
Emergency Phone: (718) 781-6806
Operator: ISRAEL FRANKEL
Operator Phone: (718) 258-4288
Owner City: BROOKLYN
Owner Sub Type: Corporate or Commercial
Program Type: PBS

Tank Number: 001
Tank Location Name: Aboveground - in contact with soil
Tank Status: In Service
Tank Model: Not reported
Pipe Model: Not reported
Active Status: Active
Install Date: 07/11/58
Capacity Gallons: 5000
Material Name: #2 Fuel Oil
Percentage: 100.00
Tank Type Name: Steel/Carbon Steel/Iron
Tank Internal Protection: None
Tank Internal Protection 1: None
Tank Internal Protection 2: Not reported
Pipe Location Name: No Piping
Pipe Type Name: Steel/Carbon Steel/Iron
Pipe External Protection 1: None
Pipe External Protection 2: Not reported
Tank Secondary Containment 1: Vault (w/o access)
Tank Secondary Containment 2: Not reported
Pipe Secondary Containment: Not reported
Tank Leak Detection 1: None
Tank Leak Detection 2: Not reported
Pipe Leak Detection 1: Exempt Suction Piping
Pipe Leak Detection 2: Not reported
Type Of Overfill Prevention 1: Product Level Gauge (A/G)
Type Of Overfill Prevention 2: Not reported
Dispenser Method: Suction
Spill Prevention: Not reported
Tightness Test Method: Testing Not Required

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

W-158 ST HARLEM HOLDING CORP (Continued)

EDR ID Number
EPA ID Number

Database(s)

U003393667

Date Tested: / /
Next Test Date: / /
Date Tank Closed: / /

HIST AST:

PBS Number: 2-341177
SWIS Code: 6201
Operator: W 158 ST HARLEM HOLDING CORP
Facility Phone: (718) 978-7951
Facility Addr2: 540 W 158 ST
Facility Type: APARTMENT BUILDING
Emergency: WILLIAM J HODGES
Emergency Tel: (718) 978-7951
Old PBSNO: Not reported
Date Inspected: Not reported
Inspector: Not reported
Result of Inspection: Not reported
Owner Name: W-158 ST HARLEM HOLDING CORP
Owner Address: 163-35 130 AVE #6D
Owner City,St,Zip: JAMAICA, NY 11434
Federal ID: Not reported
Owner Tel: (718) 978-7951
Owner Type: Corporate/Commercial
Owner Subtype: Not reported
Mailing Contact: Not reported
Mailing Name: W-158 ST HARLEM HOLDING CORP
Mailing Address: 163-35 130 AVE #6D
Mailing Address 2: Not reported
Mailing City,St,Zip: JAMAICA, NY 11434
Mailing Telephone: (718) 978-7951
Owner Mark: First Owner
Facility Status: 1 - Active PBS facility, i.e. total capacity of the PBS tanks is greater than 1,100 gallons, regardless if Subpart 360-14 tanks exist or not at the facility.
Certification Flag: False
Certification Date: 07/11/1994
Expiration: 11/16/1997
Renew Flag: False
Renew Date: Not reported
Total Capacity: 5000
FAMT: True
Facility Screen: No Missing Data
Owner Screen: No Missing Data
Tank Screen: Minor Data Missing
Dead Letter: False
CBS Number: Not reported
Town or City: NEW YORK CITY
County Code: 62
Town or City Code: 01
Region: 2
Tank ID: 001
Tank Location: ABOVEGROUND
Tank Status: In Service
Install Date: Not reported
Capacity (Gal): 5000
Product Stored: NOS 1,2, OR 4 FUEL OIL

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

W-158 ST HARLEM HOLDING CORP (Continued)

EDR ID Number
EPA ID Number

U003393667

Tank Type: Steel/carbon steel
Tank Internal: Not reported
Tank External: Not reported
Pipe Location: Not reported
Pipe Type: STEEL/IRON
Pipe Internal: Not reported
Pipe External: Not reported
Tank Containment: Diking
Leak Detection: 0
Overfill Protection: 4
Dispenser Method: Suction
Date Tested: Not reported
Next Test Date: Not reported
Missing Data for Tank: Minor Data Missing
Date Closed: Not reported
Test Method: Not reported
Deleted: False
Updated: True
SPDES Number: Not reported
Lat/Long: Not reported

192
WSW
1/4-1/2
1351 ft.

518 WEST 151ST STREET
518 WEST 151ST STREET
MANHATTAN, NY

LTANKS
HIST AST
HIST LTANKS

S103517643
N/A

Relative:
Higher

Actual:
133 ft.

LTANKS:
Site ID: 115036
Spill Date: 10/29/92
Facility Addr2: Not reported
Facility ID: 9208762
Program Number: 9208762
SWIS: 3101
Region of Spill: 2
Investigator: KSTANG
Referred To: Not reported
Reported to Dept: 10/29/92
CID: 15
Spill Cause: Tank Overfill
Water Affected: Not reported
Spill Source: Commercial/Industrial
Spill Notifier: Other
Cleanup Ceased: 10/29/92
Cleanup Meets Standard: True
Last Inspection: / /
Recommended Penalty: Penalty Not Recommended
UST Involvement: False
Spill Class: Known release with minimal potential for fire or hazard. DEC Response.
Willing Responsible Party. Corrective action taken.
Spill Closed Dt: 10/29/92
Remediation Phase: 0
Date Entered In Computer: 10/30/92
Spill Record Last Update: 09/30/04
Spille Namer: Not reported
Spiller Company: Not reported
Spiller Phone: Not reported
Spiller Extention: Not reported
Spiller Address: Not reported

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

518 WEST 151ST STREET (Continued)

EDR ID Number
EPA ID Number

Database(s)

S103517643

Spiller City,St,Zip: ***Update***, ZZ
Spiller County: 001
Spiller Contact: Not reported
Spiller Phone: Not reported
Spiller Extention: Not reported
DEC Region: 2
Program Number: 9208762
DER Facility ID: 100253
Site ID: 115036
Operable Unit ID: 975523
Operable Unit: 01
Material ID: 405842
Material Code: 0002
Material Name: #4 Fuel Oil
Case No.: Not reported
Material FA: Petroleum
Quantity: 30.00
Units: Gallons
Recovered: 0.00
Resource Affected: Soil
Oxygenate: False
Site ID: Not reported
Spill Tank Test: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate: Not reported
Gross Fail: Not reported
Modified By: Not reported
Last Modified: Not reported
Test Method: Not reported
DEC Memo: Start DECRemark - 9208762 Prior to Sept, 2004 data translation this spill Lead
DEC Field was "TANG" END DECRemark - 9208762
Remarks: Start CallerRemark - 9208762 OIL LEAKED OUT TANK TOP ONTO CONCRETE BASEMENT
FLOOR-SPILL TEAM ENROUTE TO CLEAN SPILL-DRIVER STICK RDG PRE-DELIV=1070 OIL
LEAKED AT METER RDG. OF2501=TOTAL 3571 GALS IN 5K TANK. END CallerRemark -
9208762

HIST AST:

PBS Number: 2-472530
SWIS Code: 6201
Operator: MANUEL RIVERA
Facility Phone: (212) 304-9300
Facility Addr2: 518 WEST 151ST STREET
Facility Type: Not reported
Emergency: EMANUEL OSTROVSKY
Emergency Tel: (212) 304-9300
Old PBSNO: Not reported
Date Inspected: Not reported
Inspector: Not reported
Result of Inspection: Not reported
Owner Name: ARTHA MANAGEMENT INC
Owner Address: 21 NAGLE AVENUE
Owner City,St,Zip: NEW YORK, NY 10040
Federal ID: Not reported
Owner Tel: (212) 304-9300
Owner Type: Not reported

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

518 WEST 151ST STREET (Continued)

EDR ID Number
EPA ID Number

Database(s)

S103517643

Owner Subtype: Not reported
Mailing Contact: Not reported
Mailing Name: ARTHA MANAGEMENT INC
Mailing Address: 21 NAGLE AVENUE
Mailing Address 2: Not reported
Mailing City,St,Zip: NEW YORK, NY 10040
Mailing Telephone: (212) 304-9300
Owner Mark: First Owner
Facility Status: 3 - Administratively closed (reasons include business is closed and/or mail is undeliverable, and staff cannot check if tanks were removed; or a duplicate registration was generated).

Certification Flag: False
Certification Date: 03/06/1989
Expiration: 03/06/1994
Renew Flag: False
Renew Date: Not reported
Total Capacity: 0
FAMT: True
Facility Screen: Minor Data Missing
Owner Screen: Minor Data Missing
Tank Screen: Minor Data Missing
Dead Letter: False
CBS Number: Not reported
Town or City: NEW YORK CITY
County Code: 62
Town or City Code: 01
Region: 2

Tank ID: 001
Tank Location: ABOVEGROUND
Tank Status: Undefined
Install Date: Not reported
Capacity (Gal): 5000
Product Stored: NOS 1,2, OR 4 FUEL OIL
Tank Type: Steel/carbon steel
Tank Internal: Not reported
Tank External: Not reported
Pipe Location: Not reported
Pipe Type: STEEL/IRON
Pipe Internal: Not reported
Pipe External: Not reported
Tank Containment: Diking
Leak Detection: 0
Overfill Protection: 4
Dispenser Method: Suction
Date Tested: Not reported
Next Test Date: Not reported
Missing Data for Tank: Minor Data Missing
Date Closed: 10/23/2000
Test Method: Not reported
Deleted: False
Updated: False
SPDES Number: Not reported
Lat/Long: Not reported

HIST LTANKS:
Region of Spill: 2

Map ID
 Direction
 Distance
 Distance (ft.)
 Elevation Site

MAP FINDINGS

Database(s)
 EDR ID Number
 EPA ID Number

518 WEST 151ST STREET (Continued)

S103517643

Spill Number: 9208762
 Investigator: TANG
 Caller Name: Not reported
 Caller Agency: Not reported
 Caller Phone: Not reported
 Caller Extension: Not reported
 Notifier Name: Not reported
 Notifier Agency: Not reported
 Notifier Phone: Not reported
 Notifier Extension: Not reported
 Spill Date: 10/29/1992
 Spill Time: 14:25
 Reported to Department Date: 10/29/92
 Reported to Department Time: 14:40
 SWIS: 62
 Spiller Contact: Not reported
 Spiller Phone: Not reported
 Spiller Extention: Not reported
 Spiller Name: Not reported
 Spiller Address: Not reported
 Spiller City,St,Zip: Not reported
 Facility Contact: Not reported
 Facility Phone: Not reported
 Facility Extention: Not reported
 Spill Cause: Tank Overfill
 Resource Affectd: On Land
 Water Affected: Not reported
 Spill Source: Other Commercial/Industrial
 Spill Notifier: Other
 PBS Number: Not reported
 Cleanup Ceased: 10/29/92
 Cleanup Meets Standard: True
 Last Inspection: / /
 Recommended Penalty: Penalty Not Recommended
 Spiller Cleanup Date: / /
 Enforcement Date: / /
 Investigation Complete: / /
 UST Involvement: False
 Spill Class: Known release with minimal potential for fire or hazard. DEC Response.
 Willing Responsible Party. Corrective action taken.
 Spill Closed Dt: 10/29/92
 Date Region Sent Summary to Central Office: / /
 Corrective Action Plan Submitted: / /
 Date Spill Entered In Computer Data File: 10/30/92
 Time Spill Entered In Computer Data File: Not reported
 Spill Record Last Update: / /
 Is Updated: False
 PBS Number: Not reported
 Tank Number: Not reported
 Tank Size: Not reported
 Test Method: Not reported
 Leak Rate Failed Tank: Not reported
 Gross Leak Rate: Not reported
 Material Class Type: Petroleum
 Quantity Spilled: 30
 Unkonwn Quantity Spilled: False
 Units: Gallons

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

518 WEST 151ST STREET (Continued)

EDR ID Number
EPA ID Number

Database(s)

S103517643

Quantity Recovered: 0
Unkonwn Quantity Recovered: False
Material: #4 FUEL OIL
Class Type: #4 FUEL OIL
Times Material Entry In File: 1751
CAS Number: Not reported
Last Date: 19941205
DEC Remarks: Not reported
Spill Cause: OIL LEAKED OUT TANK TOP ONTO CONCRETE BASEMENT FLOOR-SPILL TEAM ENROUTE TO CLEAN SPILL-DRIVER STICK RDG PRE-DELIV=1070 OIL LEAKED AT METER RDG. OF2501=TOTAL 3571 GALS IN 5K TANK.

193
NNE
1/4-1/2
1361 ft.

APT BLDG
425 W 160TH ST
MANHATTAN, NY

LTANKS
HIST LTANKS
S103238490
N/A

Relative:
Higher

Actual:
165 ft.

LTANKS:
Site ID: 150759
Spill Date: 06/26/98
Facility Addr2: Not reported
Facility ID: 9803880
Program Number: 9803880
SWIS: 3101
Region of Spill: 2
Investigator: GWHEITZM
Referred To: Not reported
Reported to Dept: 06/26/98
CID: 15
Spill Cause: Tank Test Failure
Water Affected: Not reported
Spill Source: Commercial/Industrial
Spill Notifier: Tank Tester
Cleanup Ceased: / /
Cleanup Meets Standard: False
Last Inspection: / /
Recommended Penalty: Penalty Not Recommended
UST Involvement: False
Spill Class: Known release that creates potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken.
Spill Closed Dt: 06/13/05
Remediation Phase: 0
Date Entered In Computer: 06/26/98
Spill Record Last Update: 06/13/05
Spille Namer: SAL PASCALE
Spiller Company: APT BLDG
Spiller Phone: (212) 736-6888
Spiller Extention: Not reported
Spiller Address: 425 W 160TH ST
Spiller City,St,Zip: MANHATTAN, NY -
Spiller County: 001
Spiller Contact: SAL PASCALE
Spiller Phone: (212) 736-6888
Spiller Extention: Not reported
DEC Region: 2
Program Number: 9803880
DER Facility ID: 128160
Site ID: 150759

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

APT BLDG (Continued)

EDR ID Number
EPA ID Number

Database(s)

S103238490

Operable Unit ID: 1064613
Operable Unit: 01
Material ID: 322202
Material Code: 0002
Material Name: #4 Fuel Oil
Case No.: Not reported
Material FA: Petroleum
Quantity: 0.00
Units: Gallons
Recovered: 0.00
Resource Affected: Soil
Oxygenate: False
Site ID: 150759
Spill Tank Test: 1546034
Tank Number: 001
Tank Size: 5000
Test Method: 03
Leak Rate: 0.00
Gross Fail: Not reported
Modified By: Spills
Last Modified: 10/01/04
Test Method: Horner EZ Check I or II
DEC Memo: Start DECRemark - 9803880 6/13/05 Heitzman - See PBS 2-253367, Jumal Terrace Realty. Old 5000-gallon tank was closed and replaced with new tank 5/1/99, approximately 11 months after reported spill. No contamination reported in PBS file. Spill closed. END DECRemark - 9803880
Remarks: Start CallerRemark - 9803880 OWNER TO BE CONTACTED WITH RESULTS OF TANK TEST- WILL ISOLATE AND RE-TEST. END CallerRemark - 9803880

HIST LTANKS:

Region of Spill: 2
Spill Number: 9803880
Investigator: O'DOWD
Caller Name: Not reported
Caller Agency: Not reported
Caller Phone: Not reported
Caller Extension: Not reported
Notifier Name: Not reported
Notifier Agency: Not reported
Notifier Phone: Not reported
Notifier Extension: Not reported
Spill Date: 06/26/1998
Spill Time: 14:20
Reported to Department Date: 06/26/98
Reported to Department Time: 14:24
SWIS: 62
Spiller Contact: SAL PASCALE
Spiller Phone: (212) 736-6888
Spiller Extension: Not reported
Spiller Name: APT BLDG
Spiller Address: 425 W 160TH ST
Spiller City,St,Zip: MANHATTAN, NY -
Facility Contact: SAL PASCALE
Facility Phone: (212) 736-6888
Facility Extension: Not reported
Spill Cause: Tank Test Failure
Resource Affectd: On Land

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

APT BLDG (Continued)

EDR ID Number
EPA ID Number

Database(s)

S103238490

Water Affected: Not reported
Spill Source: Other Commercial/Industrial
Spill Notifier: Tank Tester
PBS Number: 0-000000
Cleanup Ceased: / /
Cleanup Meets Standard: False
Last Inspection: / /
Recommended Penalty: Penalty Not Recommended
Spiller Cleanup Date: / /
Enforcement Date: / /
Investigation Complete: / /
UST Involvement: False
Spill Class: Known release that creates potential for fire or hazard. DEC Response.
Willing Responsible Party. Corrective action taken.
Spill Closed Dt: / /
Date Region Sent Summary to Central Office: / /
Corrective Action Plan Submitted: / /
Date Spill Entered In Computer Data File: 06/26/98
Time Spill Entered In Computer Data File: Not reported
Spill Record Last Update: 06/29/98
Is Updated: False
PBS Number: Not reported
Tank Number: 001
Tank Size: 5000
Test Method: Horner EZ Check
Leak Rate Failed Tank: 0.00
Gross Leak Rate: Not reported
Material Class Type: Petroleum
Quantity Spilled: 0
Unkonwn Quantity Spilled: True
Units: Gallons
Quantity Recovered: 0
Unkonwn Quantity Recovered: True
Material: #4 FUEL OIL
Class Type: #4 FUEL OIL
Times Material Entry In File: 1751
CAS Number: Not reported
Last Date: 19941205
DEC Remarks: Not reported
Spill Cause: OWNER TO BE CONTACTED WITH RESULTS OF TANK TEST- WILL ISOLATE AND RE-TEST.

194
South
1/4-1/2
1403 ft.

EDGEComb BUILDINGS
345 EDGEComb AVE
NEW YORK, NY

AST U001840967
LTANKS N/A
HIST AST
HIST LTANKS

Relative:
Lower

AST:

AST:

Actual:
76 ft.

Region: STATE
Facility Id: 2-480061
UTM X: 589379.12364
UTM Y: 4520247.52717
Expiration Date: 03/13/10
Renewal Date: / /
Total Capacity: 1500
Facility Type: Not reported
Site Type Name: Apartment Building/Office Building

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s)
EDR ID Number
EPA ID Number

EDGEComb BUILDINGS (Continued)

U001840967

Site Type Status: Active
Mailing Company: BROADWAY HOUSING DEVELOPMENT FUND
Mailing Title: Not reported
Mailing Contact: HAILE GHEBRE
Mailing Address: 10 FORT WASHINGTON AVENUE
Mailing Address 2: Not reported
Mailing City: NEW YORK
Mailing State: NY
Mailing Zip Code: 10032
Mailing Phone No: (212) 568-2030
Mailing Email: Not reported
Owner Title: FACILITIES DIRECTOR
Owner Name: FRANK WILSON
Owner Address: 10 FORT WASHINGTON AVENUE
Owner Address 2: Not reported
Owner State: NY
Owner Zip Code: 10032
Owner Phone: (212) 568-2030
Owner Company: BROADWAY HOUSING DEVELOPMENT FUND
Emergency Contact: HAILE GHEBRE
Emergency Phone: (212) 368-5199
Operator: HAILE GHEBRE
Operator Phone: (212) 234-4303
Owner City: NEW YORK
Owner Sub Type: Corporate or Commercial
Program Type: PBS

Tank Number: 001
Tank Location Name: Aboveground on crib, rack, or cradle
Tank Status: In Service
Tank Model: Not reported
Pipe Model: Not reported
Active Status: Active
Install Date: / /
Capacity Gallons: 1500
Material Name: #2 Fuel Oil
Percentage: 100.00
Tank Type Name: Steel/Carbon Steel/Iron
Tank Internal Protection: None
Tank Internal Protection 1: Painted/Asphalt Coating
Tank Internal Protection 2: Not reported
Pipe Location Name: Aboveground
Pipe Type Name: Steel/Carbon Steel/Iron
Pipe External Protection 1: Painted/Asphalt Coating
Pipe External Protection 2: Not reported
Tank Secondary Containment 1: Diking (Aboveground)
Tank Secondary Containment 2: Not reported
Pipe Secondary Containment: Not reported
Tank Leak Detection 1: Impervious Barrier/Concrete Pad (A/G)
Tank Leak Detection 2: Not reported
Pipe Leak Detection 1: Exempt Suction Piping
Pipe Leak Detection 2: Not reported
Type Of Overfill Prevention 1: Vent Whistle
Type Of Overfill Prevention 2: Not reported
Dispenser Method: Suction
Spill Prevention: Not reported
Tightness Test Method: Testing Not Required

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

EDGECOMB BUILDINGS (Continued)

EDR ID Number
EPA ID Number

Database(s)

U001840967

Date Tested: / /
Next Test Date: / /
Date Tank Closed: / /

LTANKS:

Site ID: 99602
Spill Date: 07/14/98
Facility Addr2: Not reported
Facility ID: 9804675
Program Number: 9804675
SWIS: 3101
Region of Spill: 2
Investigator: SIGONA
Referred To: Not reported
Reported to Dept: 07/14/98
CID: 15
Spill Cause: Tank Test Failure
Water Affected: Not reported
Spill Source: Private Dwelling
Spill Notifier: Tank Tester
Cleanup Ceased: / /
Cleanup Meets Standard: True
Last Inspection: / /
Recommended Penalty: Penalty Not Recommended
UST Involvement: False
Spill Class: Known release with minimal potential for fire or hazard. DEC Response.
Willing Responsible Party. Corrective action taken.
Spill Closed Dt: 02/09/99
Remediation Phase: 0
Date Entered In Computer: 07/14/98
Spill Record Last Update: 02/09/99
Spille Namer: GAYLORD SEAMON
Spiller Company: EDGECOMB BUILDINGS
Spiller Phone: (212) 568-8507
Spiller Extention: Not reported
Spiller Address: 345 EDGECOMB AVE
Spiller City,St,Zip: NEW YORK, NY 10031-
Spiller County: 001
Spiller Contact: GAYLORD SEAMON
Spiller Phone: (212) 568-8507
Spiller Extention: Not reported
DEC Region: 2
Program Number: 9804675
DER Facility ID: 88491
Site ID: 99602
Operable Unit ID: 1065545
Operable Unit: 01
Material ID: 319445
Material Code: 0001
Material Name: #2 Fuel Oil
Case No.: Not reported
Material FA: Petroleum
Quantity: 0.00
Units: Gallons
Recovered: 0.00
Resource Affected: Soil
Oxygenate: False

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

EDGECOMB BUILDINGS (Continued)

EDR ID Number
EPA ID Number

Database(s)

U001840967

Site ID: 99602
Spill Tank Test: 1546070
Tank Number: 1
Tank Size: 1500
Test Method: 03
Leak Rate: 63.60
Gross Fail: Not reported
Modified By: Spills
Last Modified: 10/01/04
Test Method: Horner EZ Check I or II
DEC Memo: Not reported
Remarks: Start CallerRemark - 9804675 TANK TEST AT ABOVE LOCATION. PROPERTY OWNER ADVISED OF RESULTS AND TANK WILL BE PUMPED OUT AND FURTHER TESTING TO BE DONE. END CallerRemark - 9804675

HIST AST:

PBS Number: 2-480061
SWIS Code: 6201
Operator: GAILARD SEAMON
Facility Phone: (212) 234-4303
Facility Addr2: 345 EDGECOMBE AVE
Facility Type: APARTMENT BUILDING
Emergency: GAILARD SEAMON
Emergency Tel: (212) 368-5199
Old PBSNO: 092770
Date Inspected: Not reported
Inspector: Not reported
Result of Inspection: Not reported
Owner Name: BROADWAY HOUSING DEVELOPMENT FUND
Owner Address: 10 FORT WASHINGTON AVENUE
Owner City,St,Zip: NEW YORK, NY 10032
Federal ID: Not reported
Owner Tel: (212) 568-2030
Owner Type: Corporate/Commercial
Owner Subtype: Not reported
Mailing Contact: GAILAND SEAMON
Mailing Name: BROADWAY HOUSING DEVELOPMENT FUND
Mailing Address: 10 FORT WASHINGTON AVENUE
Mailing Address 2: Not reported
Mailing City,St,Zip: NEW YORK, NY 10032
Mailing Telephone: (212) 568-2030
Owner Mark: Second Owner
Facility Status: 1 - Active PBS facility, i.e. total capacity of the PBS tanks is greater than 1,100 gallons, regardless if Subpart 360-14 tanks exist or not at the facility.

Certification Flag: False
Certification Date: 02/29/2000
Expiration: 03/13/2005
Renew Flag: False
Renew Date: Not reported
Total Capacity: 1500
FAMT: True
Facility Screen: No Missing Data
Owner Screen: No Missing Data
Tank Screen: No Missing Data
Dead Letter: False
CBS Number: Not reported

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

EDGECOMB BUILDINGS (Continued)

EDR ID Number
EPA ID Number

Database(s)

U001840967

Town or City: NEW YORK CITY
County Code: 62
Town or City Code: 01
Region: 2

Tank ID: 001
Tank Location: ABOVEGROUND ON SADDLES LEGS, STILTS, RACK, OR CRADLE
Tank Status: In Service
Install Date: Not reported
Capacity (Gal): 1500
Product Stored: NOS 1,2, OR 4 FUEL OIL
Tank Type: Steel/carbon steel
Tank Internal: 0
Tank External: 01
Pipe Location: Aboveground
Pipe Type: STEEL/IRON
Pipe Internal: None
Pipe External: 01
Tank Containment: 08
Leak Detection: 05
Overfill Protection: 06
Dispenser Method: Suction
Date Tested: Not reported
Next Test Date: Not reported
Missing Data for Tank: No Missing Data
Date Closed: Not reported
Test Method: Not reported
Deleted: False
Updated: True
SPDES Number: Not reported
Lat/Long: Not reported

HIST LTANKS:

Region of Spill: 2
Spill Number: 9804675
Investigator: SIGONA
Caller Name: Not reported
Caller Agency: Not reported
Caller Phone: Not reported
Caller Extension: Not reported
Notifier Name: Not reported
Notifier Agency: Not reported
Notifier Phone: Not reported
Notifier Extension: Not reported
Spill Date: 07/14/1998
Spill Time: 12:00
Reported to Department Date: 07/14/98
Reported to Department Time: 15:53
SWIS: 62
Spiller Contact: GAYLORD SEAMON
Spiller Phone: (212) 568-8507
Spiller Extension: Not reported
Spiller Name: EDGECOMB BUILDINGS
Spiller Address: 345 EDGECOMB AVE
Spiller City,St,Zip: NEW YORK, NY 10031-
Facility Contact: GAYLORD SEAMON
Facility Phone: (212) 568-8507

U001840967

Facility Extension:	Not reported
Spill Cause:	Tank Test Failure
Resource Affectd:	On Land
Water Affected:	Not reported
Spill Source:	Private Dwelling
Spill Notifier:	Tank Tester
PBS Number:	2-480061
Cleanup Ceased:	/ /
Cleanup Meets Standard:	True
Last Inspection:	/ /
Recommended Penalty:	Penalty Not Recommended
Spiller Cleanup Date:	/ /
Enforcement Date:	/ /
Investigation Complete:	/ /
UST Involvement:	False
Spill Class:	Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken.
Spill Closed Dt:	02/09/99
Date Region Sent Summary to Central Office:	/ /
Corrective Action Plan Submitted:	/ /
Date Spill Entered In Computer Data File:	07/14/98
Time Spill Entered In Computer Data File:	Not reported
Spill Record Last Update:	02/09/99
Is Updated:	False
PBS Number:	Not reported
Tank Number:	1
Tank Size:	1500
Test Method:	Horner EZ Check
Leak Rate Failed Tank:	63.60
Gross Leak Rate:	Not reported
Material Class Type:	Petroleum
Quantity Spilled:	0
Unkonwn Quantity Spilled:	False
Units:	Gallons
Quantity Recovered:	0
Unkonwn Quantity Recovered:	False
Material:	#2 FUEL OIL
Class Type:	#2 FUEL OIL
Times Material Entry In File:	24464
CAS Number:	Not reported
Last Date:	19941207
DEC Remarks:	DEC Sigona) arranged an on-site meeting with tank owner. The tank may be ASTMounded 1300 gals. Inspection scheduled for 2/8/1999 at 1 P.M. DEC Sigona) inspected on 2/8/99 at 1 P.M. met with superintendent Mr. Seamons. Found 1500 gallon aboveground tank in basement with jacket cement) along with 3 large weep holes along the base. The top of the tank was removed by State Environmental, exposing an opening which was secured with screws, an signs of minor leakage. They plan to hire a contractor to re-weld the tank top after the tank is cleaned. DEC Sigona) recommended the closure of the extension for the fill fipecan be disconnected at the side of the building to create a direct fill only. DEC Sigona) contacted Jack Aversato advise that the violation for tank testing should be removed, and the tank will be revised on the PBS data base. An application was sent to the owner on 2/9/99.
Spill Cause:	TANK TEST AT ABOVE LOCATION. PROPERTY OWNER ADVISED OF RESULTS AND TANK WILL BE PUMPED OUT AND FURTHER TESTING TO BE DONE.

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

195
West
1/4-1/2
1413 ft.

RESIDENCE
555 WEST 152ND ST
MANHATTAN, NY

LTANKS
HIST LTANKS

EDR ID Number
EPA ID Number

S104877193
N/A

Relative:
Higher

Actual:
137 ft.

LTANKS:

Site ID: 222855
Spill Date: 11/10/00
Facility Addr2: Not reported
Facility ID: 0009259
Program Number: 0009259
SWIS: 3101
Region of Spill: 2
Investigator: MCTIBBE
Referred To: Not reported
Reported to Dept: 11/10/00
CID: 15
Spill Cause: Tank Overfill
Water Affected: Not reported
Spill Source: Private Dwelling
Spill Notifier: Local Agency
Cleanup Ceased: / /
Cleanup Meets Standard: False
Last Inspection: / /
Recommended Penalty: Penalty Not Recommended
UST Involvement: False
Spill Class: Known release with minimal potential for fire or hazard. DEC Response.
Willing Responsible Party. Corrective action taken.
Spill Closed Dt: 02/05/04
Remediation Phase: 0
Date Entered In Computer: 11/10/00
Spill Record Last Update: 02/05/04
Spille Namer: UNKNOWN
Spiller Company: UNKNOWN
Spiller Phone: Not reported
Spiller Extention: Not reported
Spiller Address: UNKNOWN
Spiller City,St,Zip: UNKNOWN, ZZ
Spiller County: 001
Spiller Contact: UNK
Spiller Phone: (000) 000-0000
Spiller Extention: Not reported
DEC Region: 2
Program Number: 0009259
DER Facility ID: 184277
Site ID: 222855
Operable Unit ID: 830065
Operable Unit: 01
Material ID: 543215
Material Code: 0001
Material Name: #2 Fuel Oil
Case No.: Not reported
Material FA: Petroleum
Quantity: 0.00
Units: Gallons
Recovered: 0.00
Resource Affected: Sewer
Oxygenate: False
Site ID: Not reported

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s) EDR ID Number
EPA ID Number

RESIDENCE (Continued)

S104877193

Spill Tank Test: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate: Not reported
Gross Fail: Not reported
Modified By: Not reported
Last Modified: Not reported
Test Method: Not reported
DEC Memo: Start DECRemark - 0009259 Prior to Sept, 2004 data translation this spill Lead
 DEC Field was "TIBBE" handled by fdny & nycdep. END DECRemark - 0009259
Remarks: Start CallerRemark - 0009259 CALLER STATES FD NOTIFIED HIM OF POSSIBLE SPILL
 INTO SEWERS. UNK NAME OF DELIVERY COMPANY. END CallerRemark - 0009259

HIST LTANKS:

Region of Spill: 2
Spill Number: 0009259
Investigator: TIBBE
Caller Name: Not reported
Caller Agency: Not reported
Caller Phone: Not reported
Caller Extension: Not reported
Notifier Name: Not reported
Notifier Agency: Not reported
Notifier Phone: Not reported
Notifier Extension: Not reported
Spill Date: 11/10/2000
Spill Time: 12:00
Reported to Department Date: 11/10/00
Reported to Department Time: 18:43
SWIS: 62
Spiller Contact: UNK
Spiller Phone: (000) 000-0000
Spiller Extention: Not reported
Spiller Name: UNK
Spiller Address: UNK
Spiller City,St,Zip: UNK, UN
Facility Contact: UNK
Facility Phone: (000) 000-0000
Facility Extention: Not reported
Spill Cause: Tank Overfill
Resource Affectd: In Sewer
Water Affected: Not reported
Spill Source: Private Dwelling
Spill Notifier: Local Agency
PBS Number: Not reported
Cleanup Ceased: / /
Cleanup Meets Standard: False
Last Inspection: / /
Recommended Penalty: Penalty Not Recommended
Spiller Cleanup Date: / /
Enforcement Date: / /
Investigation Complete: / /
UST Involvement: False
Spill Class: Known release with minimal potential for fire or hazard. DEC Response.
 Willing Responsible Party. Corrective action taken.
Spill Closed Dt: / /

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s) EDR ID Number
EPA ID Number

RESIDENCE (Continued)

S104877193

Date Region Sent Summary to Central Office: / /
Corrective Action Plan Submitted: / /
Date Spill Entered In Computer Data File: 11/10/00
Time Spill Entered In Computer Data File: Not reported
Spill Record Last Update: 11/13/00
Is Updated: False
PBS Number: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate Failed Tank: Not reported
Gross Leak Rate: Not reported
Material Class Type: Petroleum
Quantity Spilled: 0
Unkonwn Quantity Spilled: True
Units: Gallons
Quantity Recovered: 0
Unkonwn Quantity Recovered: True
Material: #2 FUEL OIL
Class Type: #2 FUEL OIL
Times Material Entry In File: 24464
CAS Number: Not reported
Last Date: 19941207
DEC Remarks: Not reported
Spill Cause: CALLER STATES FD NOTIFIED HIM OF POSSIBLE SPILL INTO SEWERS. UNK NAME OF DELIVERY COMPANY.

196
North
1/4-1/2
1422 ft.

1003 SAINT NICHOLAS AVE
NEW YORK, NY

LTANKS S105995893
N/A

Relative:
Higher

LTANKS:

Actual:
164 ft.

Site ID: 214389
Spill Date: 05/17/02
Facility Addr2: Not reported
Facility ID: 0201769
Program Number: 0201769
SWIS: 3101
Region of Spill: 2
Investigator: SMSANGES
Referred To: Not reported
Reported to Dept: 05/17/02
CID: 15
Spill Cause: Tank Failure
Water Affected: Not reported
Spill Source: Commercial/Industrial
Spill Notifier: Other
Cleanup Ceased: / /
Cleanup Meets Standard: False
Last Inspection: / /
Recommended Penalty: Penalty Not Recommended
UST Involvement: False
Spill Class: Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken.
Spill Closed Dt: 07/29/04
Remediation Phase: 0
Date Entered In Computer: 05/17/02

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s) EDR ID Number
EPA ID Number

(Continued)

S105995893

Spill Record Last Update: 07/29/04
 Spille Namer: MR RAM
 Spiller Company: CHATMAN MANAGMENT CO
 Spiller Phone: (718) 824-5001
 Spiller Extention: Not reported
 Spiller Address: 2123 WILLIAMS BRIDGE RD
 Spiller City,St,Zip: BRONX, NY 10461-001
 Spiller County: 001
 Spiller Contact: RAY LARA
 Spiller Phone: (718) 624-4842
 Spiller Extention: Not reported
 DEC Region: 2
 Program Number: 0201769
 DER Facility ID: 177630
 Site ID: Not reported
 Operable Unit ID: Not reported
 Operable Unit: Not reported
 Material ID: Not reported
 Material Code: Not reported
 Material Name: Not reported
 Case No.: Not reported
 Material FA: Not reported
 Quantity: Not reported
 Units: Not reported
 Recovered: Not reported
 Resource Affected: Not reported
 Oxygenate: Not reported
 Site ID: Not reported
 Spill Tank Test: Not reported
 Tank Number: Not reported
 Tank Size: Not reported
 Test Method: Not reported
 Leak Rate: Not reported
 Gross Fail: Not reported
 Modified By: Not reported
 Last Modified: Not reported
 Test Method: Not reported
 DEC Memo: Start DECRemark - 0201769 Prior to Sept, 2004 data translation this spill Lead DEC Field was "SANGESLAND" 5/17/2002 Sangesland responded to the scene of a tank failure. Property manager Mr. Ram hired a welding company to make welded patch repairs to a 5,000 gal tank in a tankroom of an apartment building. After the welding was finished, the property manager ordered 3,000 gallons of #6 (?) fuel oil. Within 1 hour the tank let go and started pouring the oil into the tank vault room floor. Eventually it overflowed into the boiler room floor and filled up several inches thick. Petroleum Tank Cleaners was called to the scene with a vac truck and clean up crew. 5/28/2002 Ray Lara at PTC stated that his crew was back cleaning up on Saturday May 18th and then several times during the week of May 20 to 24th. Apparently the Boilerroom was cleaned by PTC 3 times, but oil keeps coming up through the cracks in the floor. 6/3/2002 Sangesland left a message with Mr. Ram (Property Manager) that the DEC needs to do a site inspection. Major question is how much (if any) oil is under the slab floor. 6/20/2002 Sangesland spoke with Mr. Ram and requested an appointment to do an inspection of the basement floor. As part of this inspection, several 1" diameter drill holes will be required to investigate the condition of the soil under the slab floor. DEC has reason to believe there continues to be oil rising up out of floor cracks in the boiler room. 7/2/2002 - Sangesland left a message for Mr. Ram 7/16/2002 - Sangesland left

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s)
EDR ID Number
EPA ID Number

(Continued)

S105995893

a message for Mr. Ram requesting Mr. Ram to provide someone to drill the floor on Friday 7/19 at 9AM Sangesland will be at the site. 7/17/2002 - Sangesland left another message to findout if Mr. Ram received the message from 7/16. 7/17/2002 - Mr. Ram returned the call. The super is on vacation, Mr. Ram does not know if he can have someone on site for Friday morning. 7/17/2002 - Mr. Bernie Bauer (718-731-7011) - contractorfor Mr. Ram made an appointment to do borings on site Thurs Aug 1 -3PM 8/2/2002 - Sangesland met on site with Abraham Wachslar- employee of Mr. Bernie Bauer of New York City Tank Testing Inc. (1624 Webster Ave, Bronx) 718-731-7011. Upon arrival, Mr. Wachslar had already made several borings and a few open trenches around the basement (boiler room, tank room and connecting hallways). In each room there were locations with significant soil contamination under the cement slab floor. Sangesland prepared a letter to Mr. Ram outlining the need for contamination delineation, the preparation of a "Site Remediation Plan" and the review/approval process with the NYSDEC before work is done. The letter gives the following deadlines: 1)Owner must select an environmental contractor by Sept 5, 2002. 2)Submittal of a Delineation/Remediation Work Plan by Oct 20,2002 This letter was mailed registered to Mr. Gupta on 8/2/02. 8/7/2002 - Sangesland received the return receipt for the registered letter. 8/29/2002 - Sangesland spoke with Todd Sarett of Key Environmental (973-347-9430). Mr. Sarett is bidding on doing the environmental work on the site and asked for a description of what the DEC was looking for. Sangesland said a 2 phase project: Phase 1 - Delineation - several soil borings around the basement to determine the vertical and horizontal extent of the contamination. Phase 2 - Excavation with possible biological applications at the end. 3/17/2003 - Sangesland spoke with Dwayne Monaco of Northeast Environmental (914-777-1930). He said his company conducted a soil boring survey of the basement and determined that bedrock is very shallow and most of the contaminated soil is near the surface.He has a report ready for submittal as soon as Mr. Bernie Bauer pays for it. 5/12/2003 - Sangesland reviewed a "Sub-Surface Investigation Report". This report confirmed that there is contamination throughout the basement. The report also pointsout that bedrock is within 1 to 3 feet depth and excavation is probably the best way to address the contamination problem. Sangesland sent an e-mail response to Dwayne Monaco at: DM@northeastenvironmental.com confirming their results and requesting a "Remediation Plan". Now that the contamination is defined, a remediation plan is needed. 5/29/2003 - Sangesland forwarded a letter to Mr. Gupta stating that a Remediation Plan needs to be submitted to the DEC by July 15, 2003 7/29/2003 John Savatino from AB Environmental faxed a short work plan for the site. Sangesland reviewed it and said it looked OK. Work Plans says: 1) Remove standing product and water from floor drain and hole in boiler room via vacuum truck. 2) Break upall concrete that is located all over the contaminated areas and dispose the material. 3) Remove all contaminated sand and soil from the impacted areas, down to the bedrock and dispose the material. This will require removal of approximately 54 yards of impacted concrete, soils and sand. 4) The locations of where the impacted material will be removed from are in the tank room, the boiler room, and the hallways adjacent to the boiler room and the tank room. 5) Transport and dispose all impacted materials. 6/23/2004 Sangesland made a site visit and found that all of the rooms on that side of the basement had been dug down to bedrock outcropping. Eastmond submitted copies of the disposal manifests. Sangesland asked for 10-15 photos of all of these rooms for the file. 7/29/2004 Sangesland received the photographs requested of the site. All work required by the NYSDEC for this site has been completed. As much contaminated soil as possible has been removed and the siteis not impacting any off site neighbor. Once the excavations are properly backfilled and a new cement floor is poured, the environmental impacts of the remaining contamination will be minimal.

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

(Continued)

S105995893

Remarks:

Spill Closed END DECRemark - 0201769
Start CallerRemark - 0201769 TANK FAILURE AT ABOVE LOCATION. TANK TO BE DRAINED
AND REMOVED AND REPLACED. END CallerRemark - 0201769

197
SSE
1/4-1/2
1446 ft.

HARLEM RIVER II HOUSES (HARLEM RIVER I)
2850 8TH AVENUE
NEW YORK, NY 10039

UST
LTANKS
NY Spills
HIST UST
NY Hist Spills
HIST LTANKS

U001840722
N/A

Relative:
Lower

UST:

Actual:
17 ft.

UST:

Facility Id: 2-475009
Expiration Date: 03/28/09
Renewal Date: / /
Total Capacity: 25000
Facility Type: Not reported
Mailing Company: NYC HOUSING AUTHORITY
Mailing Title: FUEL OIL REMEDIATION COORDINATOR
Mailing Contact: FUEL OIL REMEDIATION COORDINATOR
Mailing Address: 23-02 49TH AVENUE
Mailing Address 2: Not reported
Mailing City: LONG ISLAND CITY
Mailing State: NY
Mailing Zip Code: 11101
Mailing Phone No: (718) 707-5725
Mailing Email: Not reported
Owner Title: FUEL OIL REMEDIATION COORDINATOR
Owner Name: FUEL OIL REMEDIATION COORDINATOR
Owner Address: 23-02 49TH AVENUE
Owner Address 2: Not reported
Owner State: NY
Owner Zip Code: 11101
Owner Phone: (718) 707-5725
Owner Company: NYC HOUSING AUTHORITY
Emergency Contact: EMERGENCY SERVICE DEPT.
Emergency Phone: (212) 289-3940
Operator: FUEL OIL REM. COORD.
Operator Phone: (718) 707-5725
Owner City: LONG ISLAND CITY
Owner Sub Type: NYC Housing Authority (Local Government)
UTM X: 589511.54717
UTM Y: 4520093.03172
Site Type Name: Apartment Building/Office Building
Site Type Status: Active
Comments: Not reported

Program Type: PBS

Tank Number: 1
Tank Location Name: Underground
Tank Status: In Service
Tank Model: Not reported
Pipe Model: Not reported
Active Status: Active
Install Date: 10/01/00

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s)
EDR ID Number
EPA ID Number

HARLEM RIVER II HOUSES (HARLEM RIVER I) (Continued)

U001840722

Capacity Gallons: 25000
Material Name: #2 Fuel Oil
Percentage: 100.00
Tank Type Name: Fiberglass Coated Steel
Tank Internal Protection: None
Tank Internal Protection 1: Fiberglass
Tank Internal Protection 2: Not reported
Pipe Location Name: Underground/On-ground
Pipe Type Name: Other
Pipe External Protection 1: Other
Pipe External Protection 2: Not reported
Tank Secondary Containment 1: Double-Walled (Underground)
Tank Secondary Containment 2: Not reported
Pipe Secondary Containment: Not reported
Tank Leak Detection 1: Interstitial - Electronic Monitoring
Tank Leak Detection 2: Not reported
Pipe Leak Detection 1: Exempt Suction Piping
Pipe Leak Detection 2: Not reported
Type Of Overfill Prevention 1: High Level Alarm
Type Of Overfill Prevention 2: Automatic Shut-Off
Dispenser Method: Suction
Spill Prevention: Not reported
Tightness Test Method: Unknown
Date Tested: / /
Next Test Date: 10/01/10
Date Tank Closed: / /

Tank Number: OLD 1
Tank Location Name: Underground
Tank Status: Closed - Removed
Tank Model: Not reported
Pipe Model: Not reported
Active Status: Inactive
Install Date: 10/01/77
Capacity Gallons: 32000
Material Name: Empty
Percentage: 100.00
Tank Type Name: Steel/Carbon Steel/Iron
Tank Internal Protection: None
Tank Internal Protection 1: None
Tank Internal Protection 2: Not reported
Pipe Location Name: Underground/On-ground
Pipe Type Name: Steel/Carbon Steel/Iron
Pipe External Protection 1: Wrapped
Pipe External Protection 2: Not reported
Tank Secondary Containment 1: None
Tank Secondary Containment 2: Not reported
Pipe Secondary Containment: Not reported
Tank Leak Detection 1: None
Tank Leak Detection 2: Not reported
Pipe Leak Detection 1: Not reported
Pipe Leak Detection 2: Not reported
Type Of Overfill Prevention 1: Product Level Gauge (A/G)
Type Of Overfill Prevention 2: Not reported
Dispenser Method: Suction
Spill Prevention: Not reported

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s)
EDR ID Number
EPA ID Number

HARLEM RIVER II HOUSES (HARLEM RIVER I) (Continued)

U001840722

Tightness Test Method: Testing Not Required
Date Tested: / /
Next Test Date: / /
Date Tank Closed: 07/01/00

LTANKS:

Site ID: 165770
Spill Date: 04/17/92
Facility Addr2: Not reported
Facility ID: 9200682
Program Number: 9200682
SWIS: 3101
Region of Spill: 2
Investigator: SWKRASZE
Referred To: Not reported
Reported to Dept: 04/17/92
CID: 15
Spill Cause: Tank Test Failure
Water Affected: Not reported
Spill Source: Institutional, Educational, Gov., Other
Spill Notifier: Tank Tester
Cleanup Ceased: / /
Cleanup Meets Standard: False
Last Inspection: / /
Recommended Penalty: Penalty Not Recommended
UST Involvement: False
Spill Class: Known release with minimal potential for fire or hazard. DEC Response.
 Willing Responsible Party. Corrective action taken.
Spill Closed Dt: 10/24/05
Remediation Phase: 0
Date Entered In Computer: 04/22/92
Spill Record Last Update: 01/03/06
Spille Namer: Not reported
Spiller Company: NYCHA
Spiller Phone: Not reported
Spiller Extention: Not reported
Spiller Address: Not reported
Spiller City,St,Zip: ZZ
Spiller County: 001
Spiller Contact: Not reported
Spiller Phone: Not reported
Spiller Extention: Not reported
DEC Region: 2
Program Number: 9200682
DER Facility ID: 95757
Site ID: 165770
Operable Unit ID: 964533
Operable Unit: 01
Material ID: 415460
Material Code: 0002
Material Name: #4 Fuel Oil
Case No.: Not reported
Material FA: Petroleum
Quantity: -1.00
Units: Not reported
Recovered: 0.00
Resource Affected: Soil

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

HARLEM RIVER II HOUSES (HARLEM RIVER I) (Continued)

EDR ID Number
EPA ID Number

Database(s)

U001840722

Oxygenate: False
Site ID: 165770
Spill Tank Test: 1539882
Tank Number: 001
Tank Size: 0
Test Method: 00
Leak Rate: 0.00
Gross Fail: Not reported
Modified By: Spills
Last Modified: 10/01/04
Test Method: Unknown
DEC Memo: Start DECRemark - 9200682 10/24/05: This spill closed to consolidate with open spill #0001489. S.Kraszewski END DECRemark - 9200682
Remarks: Start CallerRemark - 9200682 E I & R 30K END CallerRemark - 9200682

Site ID: 108973
Spill Date: 04/23/91
Facility Addr2: Not reported
Facility ID: 9100897
Program Number: 9100897
SWIS: 3101
Region of Spill: 2
Investigator: HEALY
Referred To: Not reported
Reported to Dept: 04/23/91
CID: 15
Spill Cause: Tank Test Failure
Water Affected: Not reported
Spill Source: Institutional, Educational, Gov., Other
Spill Notifier: Tank Tester
Cleanup Ceased: 04/26/95
Cleanup Meets Standard: True
Last Inspection: / /
Recommended Penalty: Penalty Not Recommended
UST Involvement: False
Spill Class: Known release that creates potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken.

Spill Closed Dt: 04/26/95
Remediation Phase: 0
Date Entered In Computer: 04/25/91
Spill Record Last Update: 01/03/06
Spille Namer: Not reported
Spiller Company: NYCHA
Spiller Phone: (212) 306-3142
Spiller Extention: Not reported
Spiller Address: 250 BROADWAY
Spiller City,St,Zip: NEW YORK, NY
Spiller County: 001
Spiller Contact: Not reported
Spiller Phone: Not reported
Spiller Extention: Not reported
DEC Region: 2
Program Number: 9100897
DER Facility ID: 95757
Site ID: 108973
Operable Unit ID: 954425
Operable Unit: 01

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

HARLEM RIVER II HOUSES (HARLEM RIVER I) (Continued)

EDR ID Number
EPA ID Number

Database(s)

U001840722

Material ID: 427063
Material Code: 0002
Material Name: #4 Fuel Oil
Case No.: Not reported
Material FA: Petroleum
Quantity: -1.00
Units: Not reported
Recovered: 0.00
Resource Affected: Groundwater
Oxygenate: False
Site ID: 108973
Spill Tank Test: 1538483
Tank Number: 001
Tank Size: 0
Test Method: 00
Leak Rate: 0.00
Gross Fail: Not reported
Modified By: Spills
Last Modified: 10/01/04
Test Method: Unknown
DEC Memo: Not reported
Remarks: Start CallerRemark - 9100897 30K TANK FAILED HORNER EZY CHECK,VISUAL LEAK, TO REPAIR & RETEST. SEE SPILL # 9200682 END CallerRemark - 9100897

NY Spills:

Site ID: 127707
Facility Addr2: Not reported
Facility ID: 0001489
Spill Number: 0001489
Facility Type: ER
SWIS: 3101
Region of Spill: 2
Investigator: jkkann
Referred To: NYCHA RQST DEC REVIEW
Spill Date: 05/05/00
Reported to Dept: 05/05/00
CID: 15
Spill Cause: Equipment Failure
Water Affected: Not reported
Spill Source: Institutional, Educational, Gov., Other
Spill Notifier: Responsible Party
Cleanup Ceased: / /
Cleanup Meets Std: False
Last Inspection: / /
Recommended Penalty: Penalty Not Recommended
UST Trust: False
Spill Class: Known release that creates potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken.
Spill Closed Dt: / /
Remediation Phase: 1
Date Entered In Computer: 05/05/00
Spill Record Last Update: 02/08/07
Spiller Name: LOUIS PONCE
Spiller Company: NYC HOUSING AUTHORITY
Spiller Address: 123 WILLIAM ST
Spiller City,St,Zip: MANHATTAN, NY
Spiller Company: 001

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

HARLEM RIVER II HOUSES (HARLEM RIVER I) (Continued)

EDR ID Number
EPA ID Number

Database(s)

U001840722

Spiller Phone: (212) 306-8894
Contact Name: LOUIS PONCE
Contact Phone: (212) 306-8894
DEC Region: 2
Program Number: 0001489
DER Facility ID: 95757
Site ID: 127707
Operable Unit ID: 823376
Operable Unit: 01
Material ID: 289709
Material Code: 0001
Material Name: #2 Fuel Oil
Case No.: Not reported
Material FA: Petroleum
Quantity: 0.00
Units: Gallons
Recovered: 0.00
Resource Affected: Soil
Oxygenate: False
DEC Memo: Start DECRemark - 0001489 11/22/05: This spill transferred from J.Kolleeny to S.Kraszewski. 01/03/06: Site Assessment said to be complete by Sept. 2000, by Yellowstone Industries. No record of report on file. Need site assessment report. - SK07/10/06: NYCHA update summary states that one 32K UST installed in 1977 and stored #4 and #6 oil was replaced by a 25K UST that currently stores #2 oil. Contaminated soil was encountered during the tank replacement, no product recovery system and no MWs. A site assessment is available and NYCHA recommends DEC review it. - SK 02/08/07 : DEC lead changed from S. Kraszewski to J. Kann. J.Kann END DECRemark - 0001489
Remarks: Start CallerRemark - 0001489 SOIL CONTAMINATION DISCOVERED AT ABOVE LOCATION DURING TANK REPLACEMENT. SOIL EXCAVATED FURTHER TESTING TO BE DONE. NO CALL BACK REQUESTED. END CallerRemark - 0001489

HIST UST:

PBS Number: 2-475009
SPDES Number: Not reported
Emergency Contact: EMERGENCY SERVICE DEPT.
Emergency Telephone: (718) 289-3940
Operator: LUIS PONCE
Operator Telephone: (718) 707-5725
Owner Name: NYC HOUSING AUTHORITY
Owner Address: 23-02 49TH AVENUE
Owner City,St,Zip: LONG ISLAND CITY, NY 11101
Owner Telephone: (718) 707-5725
Owner Type: Local Government
Owner Subtype: 51
Mailing Name: NYC HOUSING AUTHORITY
Mailing Address: 23-02 49TH AVENUE
Mailing Address 2: Not reported
Mailing City,St,Zip: LONG ISLAND CITY, NY 11101
Mailing Contact: LUIS PONCE
Mailing Telephone: (718) 707-5725
Owner Mark: First Owner
Facility Status: 1 - Active PBS facility, i.e. total capacity of the PBS tanks is greater than 1,100 gallons, regardless if Subpart 360-14 tanks exist or not at the facility.
Facility Addr2: 211-D-1 WEST 151ST STREET (MGMT OFFICE)
SWIS ID: 6201

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

HARLEM RIVER II HOUSES (HARLEM RIVER I) (Continued)

EDR ID Number
EPA ID Number

Database(s)

U001840722

Old PBS Number: Not reported
Facility Type: APARTMENT BUILDING
Inspected Date: Not reported
Inspector: Not reported
Inspection Result: Not reported
Federal ID: Not reported
Certification Flag: False
Certification Date: 01/05/2001
Expiration Date: 03/28/2004
Renew Flag: False
Renewal Date: Not reported
Total Capacity: 25000
FAMT: True
Facility Screen: No Missing Data
Owner Screen: Minor Data Missing
Tank Screen: Minor Data Missing
Dead Letter: False
CBS Number: Not reported
Town or City: NEW YORK CITY
County Code: 62
Town or City: 01
Region: 2

Tank Id: NEW TK#1
Tank Location: UNDERGROUND
Tank Status: In Service
Install Date: 20001001
Capacity (gals): 25000
Product Stored: NOS 1,2, OR 4 FUEL OIL
Tank Type: Fiberglass coated steel
Tank Internal: Not reported
Tank External: Fiberglass
Pipe Location: Underground
Pipe Type: OTHER
Pipe Internal: Other
Pipe External: Other
Second Containment: Vault (w/access)
Leak Detection: Electronic
Overfill Prot: High Level Alarm
Dispenser: Suction
Date Tested: Not reported
Next Test Date: 10/01/2015
Missing Data for Tank: Minor Data Missing
Date Closed: Not reported
Test Method: Not reported
Deleted: False
Updated: True
Lat/long: Not reported

Tank Id: OLD TK#1
Tank Location: UNDERGROUND
Tank Status: Closed-Removed
Install Date: 19771001
Capacity (gals): 32000
Product Stored: EMPTY
Tank Type: Steel/carbon steel

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

HARLEM RIVER II HOUSES (HARLEM RIVER I) (Continued)

EDR ID Number
EPA ID Number

Database(s)

U001840722

Tank Internal: Not reported
Tank External: Not reported
Pipe Location: Underground
Pipe Type: STEEL/IRON
Pipe Internal: Not reported
Pipe External: Wrapped (Piping)
Second Containment: Not reported
Leak Detection: Not reported
Overfill Prot: Product Level Gauge
Dispenser: Suction
Date Tested: Not reported
Next Test Date: Not reported
Missing Data for Tank: Minor Data Missing
Date Closed: 07/01/2000
Test Method: Not reported
Deleted: False
Updated: True
Lat/long: Not reported

NY Hist Spills:

Region of Spill: 2
Spill Number: 0001489
Investigator: SACCACIO
Caller Name: Not reported
Caller Agency: Not reported
Caller Phone: Not reported
Notifier Name: Not reported
Notifier Agency: Not reported
Notifier Phone: Not reported
Spill Date/Time: 05/05/2000 15:00
Reported to Dept Date/Time: 05/05/00 15:52
SWIS: 62
Spiller Name: NYC HOUSING AUTHORITY
Spiller Contact: LOUIS PONCE
Spiller Phone: (212) 306-8894
Spiller Contact: LOUIS PONCE
Spiller Phone: (212) 306-8894
Spiller Address: 123 WILLIAM ST
Spiller City,St,Zip: MANHATTAN, NY
Spill Cause: Equipment Failure
Reported to Dept: On Land
Water Affected: Not reported
Spill Source: 02
Spill Notifier: Responsible Party
PBS Number: Not reported
Cleanup Ceased: / /
Cleanup Meets Std: False
Last Inspection: / /
Recommended Penalty: Penalty Not Recommended
Spiller Cleanup Dt: / /
Enforcement Date: / /
Invstgn Complete: / /
UST Involvement: False
Spill Class: Known release that creates potential for fire or hazard. DEC Response.
Willing Responsible Party. Corrective action taken.
Spill Closed Dt: / /
Corrective Action Plan Submitted: / /

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s)
EDR ID Number
EPA ID Number

HARLEM RIVER II HOUSES (HARLEM RIVER I) (Continued)

U001840722

Date Region Sent Summary to Central Office: / /
Date Spill Entered In Computer Data File: 05/05/00
Date Spill Entered In Computer Data File: Not reported
Update Date: 05/08/00
Is Updated: False
PBS Number: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate Failed Tank: Not reported
Gross Leak Rate: Not reported
Material Class Type: Petroleum
Quantity Spilled: 0
Unkonwn Quantity Spilled: True
Units: Gallons
Quantity Recovered: 0
Unkonwn Quantity Recovered: True
Material: #2 FUEL OIL
Class Type: #2 FUEL OIL
Times Material Entry In File: 24464
CAS Number: Not reported
Last Date: 19941207
DEC Remarks: Not reported
Remark: SOIL CONTAMINATION DISCOVERED AT ABOVE LOCATION DURING TANK REPLACEMENT. SOIL EXCAVATED FURTHER TESTING TO BE DONE. NO CALL BACK REQUESTED.

HIST LTANKS:

Region of Spill: 2
Spill Number: 9200682
Investigator: SACCACIO
Caller Name: Not reported
Caller Agency: Not reported
Caller Phone: Not reported
Caller Extension: Not reported
Notifier Name: Not reported
Notifier Agency: Not reported
Notifier Phone: Not reported
Notifier Extension: Not reported
Spill Date: 04/17/1992
Spill Time: 11:00
Reported to Department Date: 04/17/92
Reported to Department Time: 12:31
SWIS: 62
Spiller Contact: Not reported
Spiller Phone: Not reported
Spiller Extention: Not reported
Spiller Name: NYCHA
Spiller Address: Not reported
Spiller City,St,Zip: Not reported
Facility Contact: Not reported
Facility Phone: Not reported
Facility Extention: Not reported
Spill Cause: Tank Test Failure
Resource Affectd: On Land
Water Affected: Not reported
Spill Source: Other Non Commercial/Industrial
Spill Notifier: Tank Tester

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s)
EDR ID Number
EPA ID Number

HARLEM RIVER II HOUSES (HARLEM RIVER I) (Continued)

U001840722

PBS Number: 2-475009
Cleanup Ceased: / /
Cleanup Meets Standard: False
Last Inspection: / /
Recommended Penalty: Penalty Not Recommended
Spiller Cleanup Date: / /
Enforcement Date: / /
Investigation Complete: / /
UST Involvement: False
Spill Class: Known release with minimal potential for fire or hazard. DEC Response.
Willing Responsible Party. Corrective action taken.
Spill Closed Dt: / /
Date Region Sent Summary to Central Office: / /
Corrective Action Plan Submitted: / /
Date Spill Entered In Computer Data File: 04/22/92
Time Spill Entered In Computer Data File: Not reported
Spill Record Last Update: 11/10/94
Is Updated: False
PBS Number: Not reported
Tank Number: 001
Tank Size: 0
Test Method: Not reported
Leak Rate Failed Tank: 0.00
Gross Leak Rate: Not reported
Material Class Type: Petroleum
Quantity Spilled: -1
Unkonwn Quantity Spilled: False
Units: Not reported
Quantity Recovered: 0
Unkonwn Quantity Recovered: False
Material: #4 FUEL OIL
Class Type: #4 FUEL OIL
Times Material Entry In File: 1751
CAS Number: Not reported
Last Date: 19941205
DEC Remarks: Not reported
Spill Cause: E I R 30K

Region of Spill: 2
Spill Number: 9100897
Investigator: HEALY
Caller Name: Not reported
Caller Agency: Not reported
Caller Phone: Not reported
Caller Extension: Not reported
Notifier Name: Not reported
Notifier Agency: Not reported
Notifier Phone: Not reported
Notifier Extension: Not reported
Spill Date: 04/23/1991
Spill Time: 10:00
Reported to Department Date: 04/23/91
Reported to Department Time: 14:58
SWIS: 62
Spiller Contact: Not reported
Spiller Phone: Not reported
Spiller Extention: Not reported

Map ID
 Direction
 Distance
 Distance (ft.)
 Elevation Site

MAP FINDINGS

Database(s)
 EDR ID Number
 EPA ID Number

HARLEM RIVER II HOUSES (HARLEM RIVER I) (Continued)

U001840722

Spiller Name: NYCHA
 Spiller Address: 250 BROADWAY
 Spiller City,St,Zip: NEW YORK, N.Y.
 Facility Contact: Not reported
 Facility Phone: (212) 306-3142
 Facility Extention: Not reported
 Spill Cause: Tank Test Failure
 Resource Affectd: Groundwater
 Water Affected: Not reported
 Spill Source: Other Non Commercial/Industrial
 Spill Notifier: Tank Tester
 PBS Number: 2-475009
 Cleanup Ceased: 04/26/95
 Cleanup Meets Standard: True
 Last Inspection: / /
 Recommended Penalty: Penalty Not Recommended
 Spiller Cleanup Date: / /
 Enforcement Date: / /
 Investigation Complete: / /
 UST Involvement: False
 Spill Class: Known release that creates potential for fire or hazard. DEC Response.
 Willing Responsible Party. Corrective action taken.
 Spill Closed Dt: 04/26/95
 Date Region Sent Summary to Central Office: / /
 Corrective Action Plan Submitted: / /
 Date Spill Entered In Computer Data File: 04/25/91
 Time Spill Entered In Computer Data File: Not reported
 Spill Record Last Update: 04/26/95
 Is Updated: False
 PBS Number: Not reported
 Tank Number: 001
 Tank Size: 0
 Test Method: Not reported
 Leak Rate Failed Tank: 0.00
 Gross Leak Rate: Not reported
 Material Class Type: Petroleum
 Quantity Spilled: -1
 Unkonwn Quantity Spilled: False
 Units: Not reported
 Quantity Recovered: 0
 Unkonwn Quantity Recovered: False
 Material: #4 FUEL OIL
 Class Type: #4 FUEL OIL
 Times Material Entry In File: 1751
 CAS Number: Not reported
 Last Date: 19941205
 DEC Remarks: Not reported
 Spill Cause: 30K TANK FAILED HORNER EZY CHECK,VISUAL LEAK, TO REPAIR RETEST. SEE SPILL
 9200682

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

198
WSW
1/4-1/2
1479 ft.

501 W 150 ST.
501 W 150 ST.
MAN., NY

LTANKS
HIST LTANKS

S106703611
N/A

Relative:
Higher

LTANKS:

Actual:
130 ft.

Site ID: 60752
Spill Date: 03/29/92
Facility Addr2: Not reported
Facility ID: 9113196
Program Number: 9113196
SWIS: 3101
Region of Spill: 2
Investigator: KSTANG
Referred To: Not reported
Reported to Dept: 03/29/92
CID: 15
Spill Cause: Tank Overfill
Water Affected: Not reported
Spill Source: Private Dwelling
Spill Notifier: Responsible Party
Cleanup Ceased: 03/29/92
Cleanup Meets Standard: True
Last Inspection: / /
Recommended Penalty: Penalty Not Recommended
UST Involvement: False
Spill Class: Known release with minimal potential for fire or hazard. DEC Response.
Willing Responsible Party. Corrective action taken.
Spill Closed Dt: 03/29/92
Remediation Phase: 0
Date Entered In Computer: 04/07/92
Spill Record Last Update: 01/21/04
Spille Namer: Not reported
Spiller Company: BAERENKLAU OIL
Spiller Phone: Not reported
Spiller Extention: Not reported
Spiller Address: Not reported
Spiller City,St,Zip: ZZ
Spiller County: 001
Spiller Contact: Not reported
Spiller Phone: Not reported
Spiller Extention: Not reported
DEC Region: 2
Program Number: 9113196
DER Facility ID: 59248
Site ID: 60752
Operable Unit ID: 966789
Operable Unit: 01
Material ID: 414717
Material Code: 0001
Material Name: #2 Fuel Oil
Case No.: Not reported
Material FA: Petroleum
Quantity: 0.00
Units: Gallons
Recovered: 0.00
Resource Affected: Soil
Oxygenate: False
Site ID: Not reported

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

501 W 150 ST. (Continued)

EDR ID Number
EPA ID Number

Database(s)

S106703611

Spill Tank Test: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate: Not reported
Gross Fail: Not reported
Modified By: Not reported
Last Modified: Not reported
Test Method: Not reported
DEC Memo: Start DECRemark - 9113196 Prior to Sept, 2004 data translation this spill Lead
DEC Field was "TANG" END DECRemark - 9113196
Remarks: Start CallerRemark - 9113196 CUSTOMER ORDERED TOO MUCH, OIL OVERFILLED, USE
DRI-SOL TO CLEAN & PICK UP. END CallerRemark - 9113196

HIST LTANKS:

Region of Spill: 2
Spill Number: 9113196
Investigator: TANG
Caller Name: Not reported
Caller Agency: Not reported
Caller Phone: Not reported
Caller Extension: Not reported
Notifier Name: Not reported
Notifier Agency: Not reported
Notifier Phone: Not reported
Notifier Extension: Not reported
Spill Date: 03/29/1992
Spill Time: 08:30
Reported to Department Date: 03/29/92
Reported to Department Time: 09:40
SWIS: 62
Spiller Contact: Not reported
Spiller Phone: Not reported
Spiller Extension: Not reported
Spiller Name: BAERENKLAU OIL
Spiller Address: Not reported
Spiller City,St,Zip: Not reported
Facility Contact: Not reported
Facility Phone: Not reported
Facility Extension: Not reported
Spill Cause: Tank Overfill
Resource Affectd: On Land
Water Affected: Not reported
Spill Source: Private Dwelling
Spill Notifier: Responsible Party
PBS Number: Not reported
Cleanup Ceased: 03/29/92
Cleanup Meets Standard: True
Last Inspection: / /
Recommended Penalty: Penalty Not Recommended
Spiller Cleanup Date: / /
Enforcement Date: / /
Investigation Complete: / /
UST Involvement: False
Spill Class: Known release with minimal potential for fire or hazard. DEC Response.
Willing Responsible Party. Corrective action taken.
Spill Closed Dt: 03/29/92

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s)
EDR ID Number
EPA ID Number

501 W 150 ST. (Continued)

S106703611

Date Region Sent Summary to Central Office: / /
Corrective Action Plan Submitted: / /
Date Spill Entered In Computer Data File: 04/07/92
Time Spill Entered In Computer Data File: Not reported
Spill Record Last Update: / /
Is Updated: False
PBS Number: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate Failed Tank: Not reported
Gross Leak Rate: Not reported
Material Class Type: Petroleum
Quantity Spilled: 0
Unkonwn Quantity Spilled: False
Units: Gallons
Quantity Recovered: 0
Unkonwn Quantity Recovered: False
Material: #2 FUEL OIL
Class Type: #2 FUEL OIL
Times Material Entry In File: 24464
CAS Number: Not reported
Last Date: 19941207
DEC Remarks: Not reported
Spill Cause: CUSTOMER ORDERED TOO MUCH, OIL OVERFILLED, USE DRI-SOL TO CLEAN PICK UP.

AS199
ENE
1/4-1/2
1521 ft.

POLO GROUNDS
2994 8TH AVENUE
NEW YORK, NY

LTANKS S101102888
HIST LTANKS N/A

Site 1 of 4 in cluster AS

Relative:
Lower

LTANKS:

Actual:
7 ft.

Site ID: 76600
Spill Date: 08/28/91
Facility Addr2: Not reported
Facility ID: 9315381
Program Number: 9315381
SWIS: 3101
Region of Spill: 2
Investigator: SWKRASZE
Referred To: Not reported
Reported to Dept: 03/29/94
CID: 15
Spill Cause: Tank Test Failure
Water Affected: Not reported
Spill Source: Institutional, Educational, Gov., Other
Spill Notifier: DEC
Cleanup Ceased: / /
Cleanup Meets Standard: False
Last Inspection: / /
Recommended Penalty: Penalty Not Recommended
UST Involvement: False
Spill Class: Known release with minimal potential for fire or hazard. DEC Response.
Willing Responsible Party. Corrective action taken.
Spill Closed Dt: 12/21/05
Remediation Phase: 0
Date Entered In Computer: 03/30/94

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

POLO GROUNDS (Continued)

S101102888

Spill Record Last Update: 12/21/05
Spille Namer: Not reported
Spiller Company: NYCHA - JOE MONTELLA
Spiller Phone: (212) 306-3142
Spiller Extention: Not reported
Spiller Address: 2975 8TH AVE
Spiller City,St,Zip: ZZ
Spiller County: 001
Spiller Contact: Not reported
Spiller Phone: Not reported
Spiller Extention: Not reported
DEC Region: 2
Program Number: 9315381
DER Facility ID: 71591
Site ID: 76600
Operable Unit ID: 997441
Operable Unit: 01
Material ID: 387138
Material Code: 0002
Material Name: #4 Fuel Oil
Case No.: Not reported
Material FA: Petroleum
Quantity: -1.00
Units: Pounds
Recovered: 0.00
Resource Affected: Groundwater
Oxygenate: False
Site ID: 76600
Spill Tank Test: 1542548
Tank Number: 003
Tank Size: 0
Test Method: 00
Leak Rate: 0.00
Gross Fail: Not reported
Modified By: Spills
Last Modified: 10/01/04
Test Method: Unknown
DEC Memo: Start DECRemark - 9315381 11/28/05: This spill transferred from J.Kolleeny to S.Kraszewski. 12/21/05: This spill closed to consolidate with open spill #9911207. - SK END DECRemark - 9315381
Remarks: Start CallerRemark - 9315381 LEAK RATE -0.1 GPH REPORTED AS PASSED BY TESTER. END CallerRemark - 9315381

HIST LTANKS:

Region of Spill: 2
Spill Number: 9315381
Investigator: SACCACIO
Caller Name: Not reported
Caller Agency: Not reported
Caller Phone: Not reported
Caller Extension: Not reported
Notifier Name: Not reported
Notifier Agency: Not reported
Notifier Phone: Not reported
Notifier Extension: Not reported
Spill Date: 08/28/1991
Spill Time: 12:00

Map ID
 Direction
 Distance
 Distance (ft.)
 Elevation Site

MAP FINDINGS

Database(s)
 EDR ID Number
 EPA ID Number

POLO GROUNDS (Continued)

S101102888

Reported to Department Date: 03/29/94
 Reported to Department Time: 12:30
 SWIS: 62
 Spiller Contact: Not reported
 Spiller Phone: Not reported
 Spiller Extention: Not reported
 Spiller Name: NYCHA - JOE MONTELLA
 Spiller Address: Not reported
 Spiller City,St,Zip: Not reported
 Facility Contact: Not reported
 Facility Phone: (212) 306-3142
 Facility Extention: Not reported
 Spill Cause: Tank Test Failure
 Resource Affectd: Groundwater
 Water Affected: Not reported
 Spill Source: Other Non Commercial/Industrial
 Spill Notifier: DEC
 PBS Number: 2-474932
 Cleanup Ceased: / /
 Cleanup Meets Standard: False
 Last Inspection: / /
 Recommended Penalty: Penalty Not Recommended
 Spiller Cleanup Date: / /
 Enforcement Date: / /
 Investigation Complete: / /
 UST Involvement: False
 Spill Class: Known release with minimal potential for fire or hazard. DEC Response.
 Willing Responsible Party. Corrective action taken.
 Spill Closed Dt: / /
 Date Region Sent Summary to Central Office: / /
 Corrective Action Plan Submitted: / /
 Date Spill Entered In Computer Data File: 03/30/94
 Time Spill Entered In Computer Data File: Not reported
 Spill Record Last Update: 11/10/94
 Is Updated: False
 PBS Number: Not reported
 Tank Number: 003
 Tank Size: 0
 Test Method: Not reported
 Leak Rate Failed Tank: 0.00
 Gross Leak Rate: Not reported
 Material Class Type: Petroleum
 Quantity Spilled: -1
 Unkonwn Quantity Spilled: False
 Units: Not reported
 Quantity Recovered: 0
 Unkonwn Quantity Recovered: False
 Material: #4 FUEL OIL
 Class Type: #4 FUEL OIL
 Times Material Entry In File: 1751
 CAS Number: Not reported
 Last Date: 19941205
 DEC Remarks: Not reported
 Spill Cause: LEAK RATE -0.1 GPH REPORTED AS PASSED BY TESTER.

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

EDR ID Number
EPA ID Number

AS200
ENE
1/4-1/2
1550 ft.

APT HOUSE
2999 8TH AVE
MANHATTEN, NY

LTANKS
HIST LTANKS

S104516523
N/A

Relative:
Lower

Site 2 of 4 in cluster AS

Actual:
5 ft.

LTANKS:

Site ID: 216413
Spill Date: 02/11/00
Facility Addr2: Not reported
Facility ID: 9912887
Program Number: 9912887
SWIS: 3101
Region of Spill: 2
Investigator: KSTANG
Referred To: Not reported
Reported to Dept: 02/11/00
CID: 15
Spill Cause: Tank Overfill
Water Affected: Not reported
Spill Source: Commercial Vehicle
Spill Notifier: Fire Department
Cleanup Ceased: / /
Cleanup Meets Standard: False
Last Inspection: / /
Recommended Penalty: Penalty Not Recommended
UST Involvement: False
Spill Class: Known release with minimal potential for fire or hazard. DEC Response.
Willing Responsible Party. Corrective action taken.
Spill Closed Dt: / /
Remediation Phase: 1
Date Entered In Computer: 02/11/00
Spill Record Last Update: 07/17/06
Spille Namer: UNK
Spiller Company: NYC HOUSING
Spiller Phone: Not reported
Spiller Extention: Not reported
Spiller Address: Not reported
Spiller City,St,Zip: ZZ
Spiller County: 001
Spiller Contact: PHILIP MCARDLE
Spiller Phone: (718) 476-6288
Spiller Extention: Not reported
DEC Region: 2
Program Number: 9912887
DER Facility ID: 71591
Site ID: 216413
Operable Unit ID: 1091591
Operable Unit: 01
Material ID: 294750
Material Code: 0008
Material Name: Diesel
Case No.: Not reported
Material FA: Petroleum
Quantity: 55.00
Units: Gallons
Recovered: 0.00
Resource Affected: Sewer
Oxygenate: False

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

APT HOUSE (Continued)

EDR ID Number
EPA ID Number

Database(s)

S104516523

Site ID: Not reported
Spill Tank Test: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate: Not reported
Gross Fail: Not reported
Modified By: Not reported
Last Modified: Not reported
Test Method: Not reported
DEC Memo: Start DECRemark - 9912887 11/22/05: This spill transferred from J.Kolleeny to S.Kraszewski. 01/30/06: This spill transferred from S.Kraszewski to Q.Abidi. 04/03/06: This spill transferred from Q. Abidi to Koon Tang. 07/17/06: NYCHA Updatesummary states three 35K USTs that stored #4 and #6 oil and installed in 1968 were closed in 1968 (???) and replaced by a 25K UST in July 2000 and currently stores #2 oil. NYCHA will have a Site Assessment completed and forwarded to the Department.- SK END DECRemark - 9912887
Remarks: Start CallerRemark - 9912887 FIRE DEPT ON SCENE OF SPILL-APPROX 20 GALLONS WENT INTO SEWER- DISPATCH IS TRYING TO CONTACT PERSON FROM NYC HOUSING TO FIND OUT WHO OIL DELIVERY COMPANY IS. END CallerRemark - 9912887

HIST LTANKS:

Region of Spill: 2
Spill Number: 9912887
Investigator: SACCACIO
Caller Name: Not reported
Caller Agency: Not reported
Caller Phone: Not reported
Caller Extension: Not reported
Notifier Name: Not reported
Notifier Agency: Not reported
Notifier Phone: Not reported
Notifier Extension: Not reported
Spill Date: 02/11/2000
Spill Time: 19:44
Reported to Department Date: 02/11/00
Reported to Department Time: 20:20
SWIS: 62
Spiller Contact: PHILIP MCARDLE
Spiller Phone: (718) 476-6288
Spiller Extention: Not reported
Spiller Name: NYC HOUSING
Spiller Address: Not reported
Spiller City,St,Zip: Not reported
Facility Contact: UNK
Facility Phone: (000) 000-0000
Facility Extention: Not reported
Spill Cause: Tank Overfill
Resource Affectd: In Sewer
Water Affected: Not reported
Spill Source: Commercial Vehicle
Spill Notifier: Fire Department
PBS Number: Not reported
Cleanup Ceased: / /
Cleanup Meets Standard: False
Last Inspection: / /
Recommended Penalty: Penalty Not Recommended

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

APT HOUSE (Continued)

EDR ID Number
EPA ID Number

Database(s)

S104516523

Spiller Cleanup Date: / /
Enforcement Date: / /
Investigation Complete: / /
UST Involvement: False
Spill Class: Known release with minimal potential for fire or hazard. DEC Response.
Willing Responsible Party. Corrective action taken.
Spill Closed Dt: / /
Date Region Sent Summary to Central Office: / /
Corrective Action Plan Submitted: / /
Date Spill Entered In Computer Data File: 02/11/00
Time Spill Entered In Computer Data File: Not reported
Spill Record Last Update: 03/08/00
Is Updated: False
PBS Number: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate Failed Tank: Not reported
Gross Leak Rate: Not reported
Material Class Type: Petroleum
Quantity Spilled: 55
Unkonwn Quantity Spilled: False
Units: Gallons
Quantity Recovered: 0
Unkonwn Quantity Recovered: True
Material: DIESEL
Class Type: DIESEL
Times Material Entry In File: 10625
CAS Number: Not reported
Last Date: 19940728
DEC Remarks: On 2/11/00 Spills Staff Saccacio) responded to a 80 gallon No. 2 fuel oil spill located at NYCHA s Polo Grounds Housing Project. It a appears that the spill was caused by a leaky ball valve which allowed oil to be sucked from one tank and returned into another. the latter tank eventually overflowed spilling the product onto the parking lot and into the storm sewer. Most of the spill was cleaned up that night by the NYCHA and the rest was cleaned up several days later by PTC who pressure washed the area and cleaned out the catch. Since ther was oil that could not be cleaned underneath the tank, the spill will remain open until the temp tanks are removed and the are is re-washed.
Spill Cause: FIRE DEPT ON SCENE OF SPILL-APPROX 20 GALLONS WENT INTO SEWER- DISPATCH IS TRYING TO CONTACT PERSON FROM NYC HOUSING TO FIND OUT WHO OIL DELIVERY COMPANY IS.

AS201
ENE
1/4-1/2
1550 ft.

POLO GROUNDS HOUSING
2999 8TH AVENUE
HARLEM, NY

LTANKS
HIST LTANKS

S104279094
N/A

Site 3 of 4 in cluster AS

Relative:
Lower

LTANKS:

Actual:
5 ft.

Site ID: 76603
Spill Date: 12/22/99
Facility Addr2: Not reported
Facility ID: 9911207
Program Number: 9911207
SWIS: 3101
Region of Spill: 2
Investigator: jkkann

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

POLO GROUNDS HOUSING (Continued)

EDR ID Number
EPA ID Number

Database(s)

S104279094

Referred To: NYCHA WILL SUBMIT ASSMT
Reported to Dept: 12/22/99
CID: 15
Spill Cause: Tank Failure
Water Affected: Not reported
Spill Source: Commercial/Industrial
Spill Notifier: Other
Cleanup Ceased: / /
Cleanup Meets Standard: False
Last Inspection: / /
Recommended Penalty: Penalty Not Recommended
UST Involvement: False
Spill Class: Known release with minimal potential for fire or hazard. DEC Response.
Willing Responsible Party. Corrective action taken.
Spill Closed Dt: / /
Remediation Phase: 1
Date Entered In Computer: 12/22/99
Spill Record Last Update: 02/08/07
Spille Namer: Not reported
Spiller Company: NYC HOUSING AUTHORITY
Spiller Phone: Not reported
Spiller Extention: Not reported
Spiller Address: 250 BROADWAY
Spiller City,St,Zip: NEW YORK, NY
Spiller County: 001
Spiller Contact: CALLER
Spiller Phone: Not reported
Spiller Extention: Not reported
DEC Region: 2
Program Number: 9911207
DER Facility ID: 71591
Site ID: 76603
Operable Unit ID: 1085888
Operable Unit: 01
Material ID: 296673
Material Code: 0002
Material Name: #4 Fuel Oil
Case No.: Not reported
Material FA: Petroleum
Quantity: 0.00
Units: Gallons
Recovered: 0.00
Resource Affected: Soil
Oxygenate: False
Site ID: Not reported
Spill Tank Test: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate: Not reported
Gross Fail: Not reported
Modified By: Not reported
Last Modified: Not reported
Test Method: Not reported
DEC Memo: Start DECRemark - 9911207 11/28/05: This spill transferred from J.Kolleeny to S.Kraszewski. 07/17/06: NYCHA Update summary states three 35K USTs that stored #4 and #6 oil and installed in 1968 were closed in 1968 (???) and

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s)
EDR ID Number
EPA ID Number

POLO GROUNDS HOUSING (Continued)

S104279094

Remarks: replaced by a 25K UST in July 2000 and currently stores #2 oil. NYCHA will have a Site Assessment completed and forwarded to the Department. - SK 02/08/07 : DEC lead changed from S. Kraszewski to J. Kann. J.Kann END DECRemark - 9911207 Start CallerRemark - 9911207 caller reporting a spill of material from a leaking oil tank and no clean up as of yet no callback necessary END CallerRemark - 9911207

HIST LTANKS:

Region of Spill: 2
Spill Number: 9911207
Investigator: SACCACIO
Caller Name: Not reported
Caller Agency: Not reported
Caller Phone: Not reported
Caller Extension: Not reported
Notifier Name: Not reported
Notifier Agency: Not reported
Notifier Phone: Not reported
Notifier Extension: Not reported
Spill Date: 12/22/1999
Spill Time: 14:15
Reported to Department Date: 12/22/99
Reported to Department Time: 14:28
SWIS: 62
Spiller Contact: CALLER
Spiller Phone: () -
Spiller Extension: Not reported
Spiller Name: NYC HOUSING AUTHORITY
Spiller Address: 250 BROADWAY
Spiller City,St,Zip: MANHATTAN, NY
Facility Contact: Not reported
Facility Phone: () -
Facility Extension: Not reported
Spill Cause: Tank Failure
Resource Affectd: On Land
Water Affected: Not reported
Spill Source: Other Commercial/Industrial
Spill Notifier: Other
PBS Number: Not reported
Cleanup Ceased: / /
Cleanup Meets Standard: False
Last Inspection: / /
Recommended Penalty: Penalty Not Recommended
Spiller Cleanup Date: / /
Enforcement Date: / /
Investigation Complete: / /
UST Involvement: False
Spill Class: Known release with minimal potential for fire or hazard. DEC Response.
Willing Responsible Party. Corrective action taken.
Spill Closed Dt: / /
Date Region Sent Summary to Central Office: / /
Corrective Action Plan Submitted: / /
Date Spill Entered In Computer Data File: 12/22/99
Time Spill Entered In Computer Data File: Not reported
Spill Record Last Update: 02/17/00
Is Updated: False
PBS Number: Not reported

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

POLO GROUNDS HOUSING (Continued)

EDR ID Number
EPA ID Number

Database(s)

S104279094

Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate Failed Tank: Not reported
Gross Leak Rate: Not reported
Material Class Type: Petroleum
Quantity Spilled: 0
Unkonwn Quantity Spilled: True
Units: Gallons
Quantity Recovered: 0
Unkonwn Quantity Recovered: False
Material: #4 FUEL OIL
Class Type: #4 FUEL OIL
Times Material Entry In File: 1751
CAS Number: Not reported
Last Date: 19941205
DEC Remarks: Not reported
Spill Cause: caller reporting a spill of material from a leaking oil tank and no clean up as of yet no callback necessary

AS202
ENE
1/4-1/2
1550 ft.

Relative:
Lower

POLO GROUNDS (POLO GROUNDS TOWERS)
2999 EIGHTH AVENUE
NEW YORK, NY 10039

Site 4 of 4 in cluster AS

UST
LTANKS
NY Spills
HIST UST
NY Hist Spills
HIST LTANKS

U001840717
N/A

Actual:
5 ft.

UST:

UST:

Facility Id: 2-474932
Expiration Date: 03/28/09
Renewal Date: / /
Total Capacity: 50000
Facility Type: Not reported
Mailing Company: NYC HOUSING AUTHORITY
Mailing Title: FUEL OIL REMEDIATION COORDINATOR
Mailing Contact: FUEL OIL REMEDIATION COORDINATOR
Mailing Address: 23-02 49TH AVENUE
Mailing Address 2: Not reported
Mailing City: LONG ISLAND CITY
Mailing State: NY
Mailing Zip Code: 11101
Mailing Phone No: (718) 707-5725
Mailing Email: Not reported
Owner Title: FUEL OIL REMEDIATION COORDINATOR
Owner Name: FUEL OIL REMEDIATION COORD.
Owner Address: 23-02 49TH AVENUE
Owner Address 2: Not reported
Owner State: NY
Owner Zip Code: 11101
Owner Phone: (718) 707-5725
Owner Company: NYC HOUSING AUTHORITY
Emergency Contact: EMERGENCY SERVICE DEPT.
Emergency Phone: (718) 707-5725
Operator: FUEL OIL REM. COORD.
Operator Phone: (718) 707-5725
Owner City: LONG ISLAND CITY

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s)
EDR ID Number
EPA ID Number

POLO GROUNDS (POLO GROUNDS TOWERS) (Continued)

U001840717

Owner Sub Type: NYC Housing Authority (Local Government)
UTM X: 589717.97328
UTM Y: 4520505.65658
Site Type Name: Apartment Building/Office Building
Site Type Status: Active
Comments: Not reported

Program Type: PBS

Tank Number: 1
Tank Location Name: Underground
Tank Status: In Service
Tank Model: Not reported
Pipe Model: Not reported
Active Status: Active
Install Date: 07/01/00
Capacity Gallons: 25000
Material Name: #2 Fuel Oil
Percentage: 100.00
Tank Type Name: Fiberglass Coated Steel
Tank Internal Protection: None
Tank Internal Protection 1: Fiberglass
Tank Internal Protection 2: Not reported
Pipe Location Name: Underground/On-ground
Pipe Type Name: Equivalent Technology
Pipe External Protection 1: Other
Pipe External Protection 2: Not reported
Tank Secondary Containment 1: Double-Walled (Underground)
Tank Secondary Containment 2: Not reported
Pipe Secondary Containment: Not reported
Tank Leak Detection 1: Interstitial - Electronic Monitoring
Tank Leak Detection 2: In-Tank System (ATG)
Pipe Leak Detection 1: Exempt Suction Piping
Pipe Leak Detection 2: Not reported
Type Of Overfill Prevention 1: High Level Alarm
Type Of Overfill Prevention 2: Automatic Shut-Off
Dispenser Method: Suction
Spill Prevention: Not reported
Tightness Test Method: Testing Not Required
Date Tested: / /
Next Test Date: / /
Date Tank Closed: / /

Tank Number: 2
Tank Location Name: Underground
Tank Status: In Service
Tank Model: Not reported
Pipe Model: Not reported
Active Status: Active
Install Date: 07/01/00
Capacity Gallons: 25000
Material Name: #2 Fuel Oil
Percentage: 100.00
Tank Type Name: Fiberglass Coated Steel
Tank Internal Protection: None
Tank Internal Protection 1: Fiberglass

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s)
EDR ID Number
EPA ID Number

POLO GROUNDS (POLO GROUNDS TOWERS) (Continued)

U001840717

Tank Internal Protection 2: Not reported
Pipe Location Name: Underground/On-ground
Pipe Type Name: Equivalent Technology
Pipe External Protection 1: Other
Pipe External Protection 2: Not reported
Tank Secondary Containment 1: Double-Walled (Underground)
Tank Secondary Containment 2: Not reported
Pipe Secondary Containment: Not reported
Tank Leak Detection 1: Interstitial - Electronic Monitoring
Tank Leak Detection 2: In-Tank System (ATG)
Pipe Leak Detection 1: Exempt Suction Piping
Pipe Leak Detection 2: Not reported
Type Of Overfill Prevention 1: High Level Alarm
Type Of Overfill Prevention 2: Automatic Shut-Off
Dispenser Method: Suction
Spill Prevention: Not reported
Tightness Test Method: Testing Not Required
Date Tested: / /
Next Test Date: / /
Date Tank Closed: / /

Tank Number: OLD 1
Tank Location Name: Underground
Tank Status: Closed - Removed
Tank Model: Not reported
Pipe Model: Not reported
Active Status: Inactive
Install Date: 03/01/68
Capacity Gallons: 35000
Material Name: #2 Fuel Oil
Percentage: 100.00
Tank Type Name: Steel/Carbon Steel/Iron
Tank Internal Protection: None
Tank Internal Protection 1: None
Tank Internal Protection 2: Not reported
Pipe Location Name: Underground/On-ground
Pipe Type Name: Steel/Carbon Steel/Iron
Pipe External Protection 1: Wrapped
Pipe External Protection 2: Not reported
Tank Secondary Containment 1: None
Tank Secondary Containment 2: Not reported
Pipe Secondary Containment: Not reported
Tank Leak Detection 1: None
Tank Leak Detection 2: Not reported
Pipe Leak Detection 1: Not reported
Pipe Leak Detection 2: Not reported
Type Of Overfill Prevention 1: Product Level Gauge (A/G)
Type Of Overfill Prevention 2: Not reported
Dispenser Method: Suction
Spill Prevention: Not reported
Tightness Test Method: Testing Not Required
Date Tested: / /
Next Test Date: / /
Date Tank Closed: 03/01/00

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s)
EDR ID Number
EPA ID Number

POLO GROUNDS (POLO GROUNDS TOWERS) (Continued)

U001840717

Tank Number: OLD 2
Tank Location Name: Underground
Tank Status: Closed - Removed
Tank Model: Not reported
Pipe Model: Not reported
Active Status: Inactive
Install Date: 03/01/68
Capacity Gallons: 35000
Material Name: #2 Fuel Oil
Percentage: 100.00
Tank Type Name: Steel/Carbon Steel/Iron
Tank Internal Protection: None
Tank Internal Protection 1: None
Tank Internal Protection 2: Not reported
Pipe Location Name: Underground/On-ground
Pipe Type Name: Steel/Carbon Steel/Iron
Pipe External Protection 1: Wrapped
Pipe External Protection 2: Not reported
Tank Secondary Containment 1: None
Tank Secondary Containment 2: Not reported
Pipe Secondary Containment: Not reported
Tank Leak Detection 1: None
Tank Leak Detection 2: Not reported
Pipe Leak Detection 1: Not reported
Pipe Leak Detection 2: Not reported
Type Of Overfill Prevention 1: Product Level Gauge (A/G)
Type Of Overfill Prevention 2: Not reported
Dispenser Method: Suction
Spill Prevention: Not reported
Tightness Test Method: Horner EZ Check I or II
Date Tested: 12/01/96
Next Test Date: / /
Date Tank Closed: 03/01/00

Tank Number: OLD 3
Tank Location Name: Underground
Tank Status: Closed - Removed
Tank Model: Not reported
Pipe Model: Not reported
Active Status: Inactive
Install Date: 03/01/68
Capacity Gallons: 35000
Material Name: #2 Fuel Oil
Percentage: 100.00
Tank Type Name: Steel/Carbon Steel/Iron
Tank Internal Protection: None
Tank Internal Protection 1: None
Tank Internal Protection 2: Not reported
Pipe Location Name: Underground/On-ground
Pipe Type Name: Steel/Carbon Steel/Iron
Pipe External Protection 1: Wrapped
Pipe External Protection 2: Not reported
Tank Secondary Containment 1: None
Tank Secondary Containment 2: Not reported
Pipe Secondary Containment: Not reported
Tank Leak Detection 1: None

Map ID
 Direction
 Distance
 Distance (ft.)
 Elevation Site

MAP FINDINGS

Database(s) EDR ID Number
 EPA ID Number

POLO GROUNDS (POLO GROUNDS TOWERS) (Continued)

U001840717

Tank Leak Detection 2: Not reported
 Pipe Leak Detection 1: Not reported
 Pipe Leak Detection 2: Not reported
 Type Of Overfill Prevention 1: Product Level Gauge (A/G)
 Type Of Overfill Prevention 2: Not reported
 Dispenser Method: Suction
 Spill Prevention: Not reported
 Tightness Test Method: Testing Not Required
 Date Tested: / /
 Next Test Date: / /
 Date Tank Closed: 03/01/00

LTANKS:

Site ID: 76597
 Spill Date: 02/05/90
 Facility Addr2: Not reported
 Facility ID: 8910568
 Program Number: 8910568
 SWIS: 3101
 Region of Spill: 2
 Investigator: HEALY
 Referred To: Not reported
 Reported to Dept: 02/05/90
 CID: 15
 Spill Cause: Tank Overfill
 Water Affected: Not reported
 Spill Source: Non Major Facility > 1,100 gal
 Spill Notifier: Affected Persons
 Cleanup Ceased: 02/05/90
 Cleanup Meets Standard: True
 Last Inspection: / /
 Recommended Penalty: Penalty Not Recommended
 UST Involvement: False
 Spill Class: Not reported
 Spill Closed Dt: 02/05/90
 Remediation Phase: 0
 Date Entered In Computer: 02/07/90
 Spill Record Last Update: 12/27/93
 Spille Namer: Not reported
 Spiller Company: HUNTS POINT
 Spiller Phone: (212) 378-5939
 Spiller Extention: Not reported
 Spiller Address: 1281 BONIELEN AVENUE
 Spiller City,St,Zip: BRONX, NY
 Spiller County: 001
 Spiller Contact: Not reported
 Spiller Phone: Not reported
 Spiller Extention: Not reported
 DEC Region: 2
 Program Number: 8910568
 DER Facility ID: 71591
 Site ID: 76597
 Operable Unit ID: 935945
 Operable Unit: 01
 Material ID: 559361
 Material Code: 0002
 Material Name: #4 Fuel Oil

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

POLO GROUNDS (POLO GROUNDS TOWERS) (Continued)

EDR ID Number
EPA ID Number

Database(s)

U001840717

Case No.: Not reported
Material FA: Petroleum
Quantity: 100.00
Units: Gallons
Recovered: 0.00
Resource Affected: Soil
Oxygenate: False
Site ID: Not reported
Spill Tank Test: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate: Not reported
Gross Fail: Not reported
Modified By: Not reported
Last Modified: Not reported
Test Method: Not reported
DEC Memo: Not reported
Remarks: Start CallerRemark - 8910568 UPON DELIVERY FUEL PUMPED TOO FAST & SPILLED, NO AGENCIES NOTIFIED, HUNTS POINT CLEANED UP, REMOVED CONTAMINANTS, USED SORBENTS. END CallerRemark - 8910568

Site ID: 76598
Spill Date: 08/06/91
Facility Addr2: Not reported
Facility ID: 9104892
Program Number: 9104892
SWIS: 3101
Region of Spill: 2
Investigator: HEALY
Referred To: Not reported
Reported to Dept: 08/06/91
CID: 15
Spill Cause: Tank Test Failure
Water Affected: Not reported
Spill Source: Institutional, Educational, Gov., Other
Spill Notifier: Tank Tester
Cleanup Ceased: 04/26/95
Cleanup Meets Standard: True
Last Inspection: / /
Recommended Penalty: Penalty Not Recommended
UST Involvement: False
Spill Class: Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken.

Spill Closed Dt: 04/26/95
Remediation Phase: 0
Date Entered In Computer: 08/07/91
Spill Record Last Update: 04/26/95
Spille Namer: Not reported
Spiller Company: NYCHA
Spiller Phone: (212) 306-3142
Spiller Extention: Not reported
Spiller Address: 250 BROADWAY
Spiller City,St,Zip: NEW YORK, NY
Spiller County: 001
Spiller Contact: Not reported
Spiller Phone: Not reported

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

POLO GROUNDS (POLO GROUNDS TOWERS) (Continued)

EDR ID Number
EPA ID Number

Database(s)

U001840717

Spiller Extention: Not reported
DEC Region: 2
Program Number: 9104892
DER Facility ID: 71591
Site ID: 76598
Operable Unit ID: 955638
Operable Unit: 01
Material ID: 423943
Material Code: 0002
Material Name: #4 Fuel Oil
Case No.: Not reported
Material FA: Petroleum
Quantity: -1.00
Units: Not reported
Recovered: 0.00
Resource Affected: Soil
Oxygenate: False
Site ID: 76598
Spill Tank Test: 1538856
Tank Number: 003
Tank Size: 0
Test Method: 00
Leak Rate: 0.00
Gross Fail: Not reported
Modified By: Spills
Last Modified: 10/01/04
Test Method: Unknown
DEC Memo: Not reported
Remarks: Start CallerRemark - 9104892 35K TANK, FAILED HORNER EZY CHECK,GROSS
LEAK,SYSTEM TEST,STICK LINE BROKE BY EXCAVATING,WILL REPAIR & RETEST. SEE
SPILL # 9315381 END CallerRemark - 9104892

Site ID: 76599
Spill Date: 06/20/91
Facility Addr2: Not reported
Facility ID: 9315380
Program Number: 9315380
SWIS: 3101
Region of Spill: 2
Investigator: HEALY
Referred To: Not reported
Reported to Dept: 03/29/94
CID: 15
Spill Cause: Tank Test Failure
Water Affected: Not reported
Spill Source: Institutional, Educational, Gov., Other
Spill Notifier: DEC
Cleanup Ceased: / /
Cleanup Meets Standard: False
Last Inspection: / /
Recommended Penalty: Penalty Not Recommended
UST Involvement: False
Spill Class: Known release with minimal potential for fire or hazard. DEC Response.
Willing Responsible Party. Corrective action taken.
Spill Closed Dt: 04/03/97
Remediation Phase: 0
Date Entered In Computer: 03/30/94

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s)

EDR ID Number
EPA ID Number

POLO GROUNDS (POLO GROUNDS TOWERS) (Continued)

U001840717

Spill Record Last Update: 04/03/97
Spille Namer: Not reported
Spiller Company: NYCHA - JOE MONTELLA
Spiller Phone: (212) 306-3142
Spiller Extention: Not reported
Spiller Address: Not reported
Spiller City,St,Zip: ZZ
Spiller County: 001
Spiller Contact: Not reported
Spiller Phone: Not reported
Spiller Extention: Not reported
DEC Region: 2
Program Number: 9315380
DER Facility ID: 71591
Site ID: 76599
Operable Unit ID: 993521
Operable Unit: 01
Material ID: 387137
Material Code: 0002
Material Name: #4 Fuel Oil
Case No.: Not reported
Material FA: Petroleum
Quantity: -1.00
Units: Pounds
Recovered: 0.00
Resource Affected: Groundwater
Oxygenate: False
Site ID: 76599
Spill Tank Test: 1542547
Tank Number: 001
Tank Size: 0
Test Method: 00
Leak Rate: 0.00
Gross Fail: Not reported
Modified By: Spills
Last Modified: 10/01/04
Test Method: Unknown
DEC Memo: Not reported
Remarks: Start CallerRemark - 9315380 LEAK RATE -0.09 GPH REPORTED AS PASSED BY TESTER.
END CallerRemark - 9315380

Site ID: 76602
Spill Date: 04/03/97
Facility Addr2: Not reported
Facility ID: 9700182
Program Number: 9700182
SWIS: 3101
Region of Spill: 2
Investigator: SWKRASZE
Referred To: Not reported
Reported to Dept: 04/03/97
CID: 15
Spill Cause: Tank Test Failure
Water Affected: Not reported
Spill Source: Private Dwelling
Spill Notifier: Responsible Party
Cleanup Ceased: / /

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

POLO GROUNDS (POLO GROUNDS TOWERS) (Continued)

EDR ID Number
EPA ID Number

Database(s)

U001840717

Cleanup Meets Standard: False
Last Inspection: / /
Recommended Penalty: Penalty Not Recommended
UST Involvement: False
Spill Class: Known release with minimal potential for fire or hazard. DEC Response.
Willing Responsible Party. Corrective action taken.
Spill Closed Dt: 12/29/05
Remediation Phase: 0
Date Entered In Computer: 04/03/97
Spill Record Last Update: 12/29/05
Spille Namer: SEBASTIAN LOREFICE
Spiller Company: NYC HOUSING AUTHORITY
Spiller Phone: (212) 306-3229
Spiller Extention: Not reported
Spiller Address: 250 BROADWAY
Spiller City,St,Zip: NEW YORK, NY
Spiller County: 001
Spiller Contact: Not reported
Spiller Phone: Not reported
Spiller Extention: Not reported
DEC Region: 2
Program Number: 9700182
DER Facility ID: 71591
Site ID: 76602
Operable Unit ID: 1042900
Operable Unit: 01
Material ID: 336792
Material Code: 0001
Material Name: #2 Fuel Oil
Case No.: Not reported
Material FA: Petroleum
Quantity: 0.00
Units: Gallons
Recovered: 0.00
Resource Affected: Soil
Oxygenate: False
Site ID: 76602
Spill Tank Test: 1545060
Tank Number: 1
Tank Size: 35000
Test Method: 03
Leak Rate: 0.00
Gross Fail: F
Modified By: Spills
Last Modified: 10/01/04
Test Method: Horner EZ Check I or II
DEC Memo: Start DECRemark - 9700182 11/28/05: This spill transferred from J.Kolleeny to S.Kraszewski. 12/29/05: This spill closed to consolidate with open spill #9911207. - SK END DECRemark - 9700182
Remarks: Start CallerRemark - 9700182 TANK TO BE ISOLATED AND RETESTED. END CallerRemark - 9700182
Site ID: 216410
Spill Date: 05/10/95
Facility Addr2: Not reported
Facility ID: 9501718
Program Number: 9501718

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

POLO GROUNDS (POLO GROUNDS TOWERS) (Continued)

EDR ID Number
EPA ID Number

Database(s)

U001840717

SWIS: 3101
Region of Spill: 2
Investigator: HEALY
Referred To: Not reported
Reported to Dept: 05/10/95
CID: 15
Spill Cause: Tank Overfill
Water Affected: Not reported
Spill Source: Institutional, Educational, Gov., Other
Spill Notifier: Affected Persons
Cleanup Ceased: 05/11/95
Cleanup Meets Standard: True
Last Inspection: / /
Recommended Penalty: Penalty Not Recommended
UST Involvement: False
Spill Class: Known release with minimal potential for fire or hazard. DEC Response.
Willing Responsible Party. Corrective action taken.
Spill Closed Dt: 05/11/95
Remediation Phase: 0
Date Entered In Computer: 05/11/95
Spill Record Last Update: 09/30/04
Spille Namer: Not reported
Spiller Company: BROOK FUEL
Spiller Phone: (718) 665-7070
Spiller Extention: Not reported
Spiller Address: Not reported
Spiller City,St,Zip: ZZ
Spiller County: 001
Spiller Contact: Not reported
Spiller Phone: Not reported
Spiller Extention: Not reported
DEC Region: 2
Program Number: 9501718
DER Facility ID: 179171
Site ID: 216410
Operable Unit ID: 1012736
Operable Unit: 01
Material ID: 366791
Material Code: 0001
Material Name: #2 Fuel Oil
Case No.: Not reported
Material FA: Petroleum
Quantity: 30.00
Units: Gallons
Recovered: 0.00
Resource Affected: Soil
Oxygenate: False
Site ID: Not reported
Spill Tank Test: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate: Not reported
Gross Fail: Not reported
Modified By: Not reported
Last Modified: Not reported
Test Method: Not reported

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

POLO GROUNDS (POLO GROUNDS TOWERS) (Continued)

EDR ID Number
EPA ID Number

Database(s)

U001840717

DEC Memo: Not reported
Remarks: Start CallerRemark - 9501718 DUPLICATE REPORT OF SPILL # 9501714 - TANK
OVERFILL ONTO SOIL END CallerRemark - 9501718

Site ID: 216411
Spill Date: 09/04/96
Facility Addr2: Not reported
Facility ID: 9607082
Program Number: 9607082
SWIS: 3101
Region of Spill: 2
Investigator: HEALY
Referred To: Not reported
Reported to Dept: 09/04/96
CID: 15
Spill Cause: Tank Test Failure
Water Affected: Not reported
Spill Source: Commercial/Industrial
Spill Notifier: Responsible Party
Cleanup Ceased: / /
Cleanup Meets Standard: False
Last Inspection: / /
Recommended Penalty: Penalty Not Recommended
UST Involvement: False
Spill Class: Known release with minimal potential for fire or hazard. DEC Response.
Willing Responsible Party. Corrective action taken.

Spill Closed Dt: 10/28/96
Remediation Phase: 0
Date Entered In Computer: 09/04/96
Spill Record Last Update: 11/28/05
Spille Namer: FRANK OCELLO
Spiller Company: NYC HOUSING AUTHORITY
Spiller Phone: (212) 306-3229
Spiller Extention: Not reported
Spiller Address: 250 BROADWAY
Spiller City,St,Zip: NEW YORK, NY 10007-
Spiller County: 001
Spiller Contact: Not reported
Spiller Phone: Not reported
Spiller Extention: Not reported
DEC Region: 2
Program Number: 9607082
DER Facility ID: 71591
Site ID: 216411
Operable Unit ID: 1038226
Operable Unit: 01
Material ID: 346348
Material Code: 0001
Material Name: #2 Fuel Oil
Case No.: Not reported
Material FA: Petroleum
Quantity: 0.00
Units: Gallons
Recovered: 0.00
Resource Affected: Soil
Oxygenate: False
Site ID: 216411

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

POLO GROUNDS (POLO GROUNDS TOWERS) (Continued)

EDR ID Number
EPA ID Number

Database(s)

U001840717

Spill Tank Test: 1544727
Tank Number: 2
Tank Size: 35000
Test Method: 03
Leak Rate: 0.00
Gross Fail: Not reported
Modified By: Spills
Last Modified: 10/01/04
Test Method: Horner EZ Check I or II
DEC Memo: Not reported
Remarks: Start CallerRemark - 9607082 tank failed retest to be performed END
CallerRemark - 9607082

Site ID: 216412
Spill Date: 10/23/96
Facility Addr2: Not reported
Facility ID: 9609218
Program Number: 9609218
SWIS: 3101
Region of Spill: 2
Investigator: SWKRASZE
Referred To: Not reported
Reported to Dept: 10/23/96
CID: 15
Spill Cause: Tank Test Failure
Water Affected: Not reported
Spill Source: Private Dwelling
Spill Notifier: Responsible Party
Cleanup Ceased: / /
Cleanup Meets Standard: False
Last Inspection: / /
Recommended Penalty: Penalty Not Recommended
UST Involvement: False
Spill Class: Known release with minimal potential for fire or hazard. DEC Response.
Willing Responsible Party. Corrective action taken.
Spill Closed Dt: 12/29/05
Remediation Phase: 0
Date Entered In Computer: 10/23/96
Spill Record Last Update: 12/29/05
Spille Namer: FRANK OCELLO
Spiller Company: NYC HOUSING AUTHORITY
Spiller Phone: (212) 306-3229
Spiller Extention: Not reported
Spiller Address: Not reported
Spiller City,St,Zip: ZZ
Spiller County: 001
Spiller Contact: CALLER
Spiller Phone: (212) 306-3233
Spiller Extention: Not reported
DEC Region: 2
Program Number: 9609218
DER Facility ID: 71591
Site ID: 216412
Operable Unit ID: 1037306
Operable Unit: 01
Material ID: 344945
Material Code: 0001

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

Database(s)
EDR ID Number
EPA ID Number

POLO GROUNDS (POLO GROUNDS TOWERS) (Continued)

U001840717

Material Name: #2 Fuel Oil
Case No.: Not reported
Material FA: Petroleum
Quantity: 0.00
Units: Gallons
Recovered: 0.00
Resource Affected: Soil
Oxygenate: False
Site ID: 216412
Spill Tank Test: 1544838
Tank Number: 2
Tank Size: 35127
Test Method: 99
Leak Rate: 0.00
Gross Fail: Not reported
Modified By: Spills
Last Modified: 10/01/04
Test Method: Alternate Test per 613.5a2v
DEC Memo: Start DECRemark - 9609218 11/22/05: This spill transferred from J.Kolleeny to S.Kraszewski. 12/29/05: This spill closed to consolidate with open spill #9911207. - SK END DECRemark - 9609218
Remarks: Start CallerRemark - 9609218 horner III test method - failed END CallerRemark - 9609218

Site ID: 76601
Spill Date: 05/10/95
Facility Addr2: Not reported
Facility ID: 9501714
Program Number: 9501714
SWIS: 3101
Region of Spill: 2
Investigator: HEALY
Referred To: Not reported
Reported to Dept: 05/10/95
CID: 15
Spill Cause: Tank Overfill
Water Affected: Not reported
Spill Source: Institutional, Educational, Gov., Other
Spill Notifier: Other
Cleanup Ceased: 05/19/95
Cleanup Meets Standard: True
Last Inspection: / /
Recommended Penalty: Penalty Not Recommended
UST Involvement: False
Spill Class: Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken.
Spill Closed Dt: 05/19/95
Remediation Phase: 0
Date Entered In Computer: 05/11/95
Spill Record Last Update: 05/19/95
Spille Namer: Not reported
Spiller Company: BROOK FUEL
Spiller Phone: (718) 665-7070
Spiller Extention: Not reported
Spiller Address: 490 EAST 163RD STREET
Spiller City,St,Zip: BRONX, ZZ
Spiller County: 001

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

POLO GROUNDS (POLO GROUNDS TOWERS) (Continued)

EDR ID Number
EPA ID Number

Database(s)

U001840717

Spiller Contact: Not reported
Spiller Phone: Not reported
Spiller Extention: Not reported
DEC Region: 2
Program Number: 9501714
DER Facility ID: 71591
Site ID: 76601
Operable Unit ID: 1016075
Operable Unit: 01
Material ID: 366787
Material Code: 0001
Material Name: #2 Fuel Oil
Case No.: Not reported
Material FA: Petroleum
Quantity: 50.00
Units: Gallons
Recovered: 0.00
Resource Affected: Soil
Oxygenate: False
Site ID: Not reported
Spill Tank Test: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate: Not reported
Gross Fail: Not reported
Modified By: Not reported
Last Modified: Not reported
Test Method: Not reported
DEC Memo: Not reported
Remarks: Start CallerRemark - 9501714 PROJECT ORDERED THREE 6600 GALLON LOADS-TANK
COULDN'T HOLD IT. SPILL CAME OUT STICK LINE ONTO SOIL. PROJECT APPLIED SORBENT,
IS DRUMMING SOIL. END CallerRemark - 9501714

NY Spills:

Site ID: 216414
Facility Addr2: Not reported
Facility ID: 9913306
Spill Number: 9913306
Facility Type: ER
SWIS: 3101
Region of Spill: 2
Investigator: jkkann
Referred To: CLOSED PER NYCHA INFO
Spill Date: 02/24/00
Reported to Dept: 02/24/00
CID: 15
Spill Cause: Equipment Failure
Water Affected: Not reported
Spill Source: Institutional, Educational, Gov., Other
Spill Notifier: Affected Persons
Cleanup Ceased: / /
Cleanup Meets Std: False
Last Inspection: / /
Recommended Penalty: Penalty Not Recommended
UST Trust: False
Spill Class: Known release with minimal potential for fire or hazard. DEC Response.

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

POLO GROUNDS (POLO GROUNDS TOWERS) (Continued)

EDR ID Number
EPA ID Number

Database(s)

U001840717

Willing Responsible Party. Corrective action taken.
Spill Closed Dt: 01/26/07
Remediation Phase: 0
Date Entered In Computer: 02/24/00
Spill Record Last Update: 01/26/07
Spiller Name: Not reported
Spiller Company: CRESENT CONSTRUCTION
Spiller Address: 2800 WEBSTER AV
Spiller City,St,Zip: BRONX, NY 10458-
Spiller Company: 001
Spiller Phone: (718) 220-4200
Contact Name: MARIO MANDALONE
Contact Phone: (718) 649-7017
DEC Region: 2
Program Number: 9913306
DER Facility ID: 179171
Site ID: 216414
Operable Unit ID: 1091957
Operable Unit: 01
Material ID: 295165
Material Code: 0001
Material Name: #2 Fuel Oil
Case No.: Not reported
Material FA: Petroleum
Quantity: 40.00
Units: Gallons
Recovered: 0.00
Resource Affected: Soil
Oxygenate: False
DEC Memo: Start DECRemark - 9913306 11/22/05: This spill transferred from J.Kolleeny to S.Kraszewski. 01/30/06: This spill transferred from S.Kraszewski to Q.Abidi. 04/03/06: This spill transferred from Q. Abidi to Koon Tang. 1/26/07 - Spill transferred to J. Kann. Spill closed as per information on clean up provided by NYCHA. - J.Kann END DECRemark - 9913306
Remarks: Start CallerRemark - 9913306 over flowing portable tank - 2 tanks one lower than the other - cleanup is in progress END CallerRemark - 9913306

HIST UST:

PBS Number: 2-474932
SPDES Number: Not reported
Emergency Contact: EMERGENCY SERVICE DEPT.
Emergency Telephone: (718) 289-3940
Operator: LUIS PONCE
Operator Telephone: (718) 707-5725
Owner Name: NYC HOUSING AUTHORITY
Owner Address: 23-02 49TH AVENUE
Owner City,St,Zip: LONG ISLAND CITY, NY 11101
Owner Telephone: (718) 707-5725
Owner Type: Local Government
Owner Subtype: 51
Mailing Name: NYC HOUSING AUTHORITY
Mailing Address: 23-02 49TH AVENUE
Mailing Address 2: Not reported
Mailing City,St,Zip: LONG ISLAND CITY, NY 11101
Mailing Contact: LUIS PONCE
Mailing Telephone: (718) 707-5725
Owner Mark: First Owner

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

POLO GROUNDS (POLO GROUNDS TOWERS) (Continued)

EDR ID Number
EPA ID Number

Database(s)

U001840717

Facility Status: 1 - Active PBS facility, i.e. total capacity of the PBS tanks is greater than 1,100 gallons, regardless if Subpart 360-14 tanks exist or not at the facility.

Facility Addr2: 2975 8TH AVENUE (MANAGEMENT OFFICE)

SWIS ID: 6201

Old PBS Number: Not reported

Facility Type: APARTMENT BUILDING

Inspected Date: Not reported

Inspector: Not reported

Inspection Result: Not reported

Federal ID: Not reported

Certification Flag: False

Certification Date: 10/13/2000

Expiration Date: 03/28/2004

Renew Flag: False

Renewal Date: Not reported

Total Capacity: 50000

FAMT: True

Facility Screen: No Missing Data

Owner Screen: Minor Data Missing

Tank Screen: Minor Data Missing

Dead Letter: False

CBS Number: Not reported

Town or City: NEW YORK CITY

County Code: 62

Town or City: 01

Region: 2

Tank Id: #1

Tank Location: UNDERGROUND

Tank Status: In Service

Install Date: 20000301

Capacity (gals): 25000

Product Stored: NOS 1,2, OR 4 FUEL OIL

Tank Type: Fiberglass coated steel

Tank Internal: Not reported

Tank External: Fiberglass

Pipe Location: Underground

Pipe Type: FIBERGLASS REINFORCED PLASTIC

Pipe Internal: Other

Pipe External: Other

Second Containment: Vault (w/access)

Leak Detection: 14

Overfill Prot: High Level Alarm, Automatic Shut-Off

Dispenser: Suction

Date Tested: Not reported

Next Test Date: Not reported

Missing Data for Tank: Minor Data Missing

Date Closed: Not reported

Test Method: Not reported

Deleted: False

Updated: True

Lat/long: Not reported

Tank Id: #2

Tank Location: UNDERGROUND

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

POLO GROUNDS (POLO GROUNDS TOWERS) (Continued)

EDR ID Number
EPA ID Number

Database(s)

U001840717

Tank Status: In Service
Install Date: 20000701
Capacity (gals): 25000
Product Stored: NOS 1,2, OR 4 FUEL OIL
Tank Type: Fiberglass coated steel
Tank Internal: Not reported
Tank External: Fiberglass
Pipe Location: Underground
Pipe Type: FIBERGLASS REINFORCED PLASTIC
Pipe Internal: Other
Pipe External: Other
Second Containment: Vault (w/access)
Leak Detection: 14
Overfill Prot: High Level Alarm, Automatic Shut-Off
Dispenser: Suction
Date Tested: Not reported
Next Test Date: Not reported
Missing Data for Tank: Minor Data Missing
Date Closed: Not reported
Test Method: Not reported
Deleted: False
Updated: True
Lat/long: Not reported

Tank Id: 001
Tank Location: UNDERGROUND
Tank Status: Closed-Removed
Install Date: 19680301
Capacity (gals): 35000
Product Stored: NOS 1,2, OR 4 FUEL OIL
Tank Type: Steel/carbon steel
Tank Internal: None
Tank External: None
Pipe Location: Underground
Pipe Type: STEEL/IRON
Pipe Internal: None
Pipe External: Wrapped (Piping)
Second Containment: None
Leak Detection: None
Overfill Prot: Product Level Gauge
Dispenser: Suction
Date Tested: Not reported
Next Test Date: Not reported
Missing Data for Tank: No Missing Data
Date Closed: 03/01/2000
Test Method: Not reported
Deleted: False
Updated: True
Lat/long: Not reported

Tank Id: 002
Tank Location: UNDERGROUND
Tank Status: Closed-Removed
Install Date: 19680301
Capacity (gals): 35000

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

POLO GROUNDS (POLO GROUNDS TOWERS) (Continued)

U001840717

Product Stored: NOS 1,2, OR 4 FUEL OIL
Tank Type: Steel/carbon steel
Tank Internal: None
Tank External: None
Pipe Location: Underground
Pipe Type: STEEL/IRON
Pipe Internal: None
Pipe External: Wrapped (Piping)
Second Containment: None
Leak Detection: None
Overfill Prot: Product Level Gauge
Dispenser: Suction
Date Tested: 12/01/1996
Next Test Date: Not reported
Missing Data for Tank: No Missing Data
Date Closed: 03/01/2000
Test Method: Horner EZ Check
Deleted: False
Updated: True
Lat/long: Not reported

Tank Id: 003
Tank Location: UNDERGROUND
Tank Status: Closed-Removed
Install Date: 19680301
Capacity (gals): 35000
Product Stored: NOS 1,2, OR 4 FUEL OIL
Tank Type: Steel/carbon steel
Tank Internal: None
Tank External: None
Pipe Location: Underground
Pipe Type: STEEL/IRON
Pipe Internal: None
Pipe External: Wrapped (Piping)
Second Containment: None
Leak Detection: None
Overfill Prot: Product Level Gauge
Dispenser: Suction
Date Tested: Not reported
Next Test Date: Not reported
Missing Data for Tank: No Missing Data
Date Closed: 03/01/2000
Test Method: Not reported
Deleted: False
Updated: True
Lat/long: Not reported

NY Hist Spills:

Region of Spill: 2
Spill Number: 9913306
Investigator: SACCACIO
Caller Name: Not reported
Caller Agency: Not reported
Caller Phone: Not reported
Notifier Name: Not reported
Notifier Agency: Not reported

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s)
EDR ID Number
EPA ID Number

POLO GROUNDS (POLO GROUNDS TOWERS) (Continued)

U001840717

Notifier Phone: Not reported
Spill Date/Time: 02/24/2000 05:20
Reported to Dept Date/Time: 02/24/00 07:09
SWIS: 62
Spiller Name: CRESENT CONSTRUCTION
Spiller Contact: Not reported
Spiller Phone: (718) 220-4200
Spiller Contact: MARIO MANDALONE
Spiller Phone: (718) 649-7017
Spiller Address: 2800 WEBSTER AV
Spiller City,St,Zip: BRONX, NY 10458-
Spill Cause: Equipment Failure
Reported to Dept: On Land
Water Affected: Not reported
Spill Source: 02
Spill Notifier: Affected Persons
PBS Number: Not reported
Cleanup Ceased: / /
Cleanup Meets Std: False
Last Inspection: / /
Recommended Penalty: Penalty Not Recommended
Spiller Cleanup Dt: / /
Enforcement Date: / /
Invstgn Complete: / /
UST Involvement: False
Spill Class: Known release with minimal potential for fire or hazard. DEC Response.
Willing Responsible Party. Corrective action taken.
Spill Closed Dt: / /
Corrective Action Plan Submitted: / /
Date Region Sent Summary to Central Office: / /
Date Spill Entered In Computer Data File: 02/24/00
Date Spill Entered In Computer Data File: Not reported
Update Date: 02/24/00
Is Updated: False
PBS Number: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate Failed Tank: Not reported
Gross Leak Rate: Not reported
Material Class Type: Petroleum
Quantity Spilled: 40
Unkonwn Quantity Spilled: False
Units: Gallons
Quantity Recovered: 0
Unkonwn Quantity Recovered: False
Material: #2 FUEL OIL
Class Type: #2 FUEL OIL
Times Material Entry In File: 24464
CAS Number: Not reported
Last Date: 19941207
DEC Remarks: Not reported
Remark: over flowing portable tank - 2 tanks one lower than the other - cleanup is in progress

HIST LTANKS:
Region of Spill: 2

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s)
EDR ID Number
EPA ID Number

POLO GROUNDS (POLO GROUNDS TOWERS) (Continued)

U001840717

Spill Number: 8910568
Investigator: HEALY
Caller Name: Not reported
Caller Agency: Not reported
Caller Phone: Not reported
Caller Extension: Not reported
Notifier Name: Not reported
Notifier Agency: Not reported
Notifier Phone: Not reported
Notifier Extension: Not reported
Spill Date: 02/05/1990
Spill Time: 14:40
Reported to Department Date: 02/05/90
Reported to Department Time: 16:43
SWIS: 62
Spiller Contact: Not reported
Spiller Phone: Not reported
Spiller Extention: Not reported
Spiller Name: HUNTS POINT
Spiller Address: 1281 BONIELEN AVENUE
Spiller City,St,Zip: BRONX, NY
Facility Contact: Not reported
Facility Phone: (212) 378-5939
Facility Extention: Not reported
Spill Cause: Tank Overfill
Resource Affectd: On Land
Water Affected: Not reported
Spill Source: Non Major Facility > 1,100 gallons
Spill Notifier: Affected Persons
PBS Number: Not reported
Cleanup Ceased: 02/05/90
Cleanup Meets Standard: True
Last Inspection: / /
Recommended Penalty: Penalty Not Recommended
Spiller Cleanup Date: / /
Enforcement Date: / /
Investigation Complete: / /
UST Involvement: False
Spill Class: Not reported
Spill Closed Dt: 02/05/90
Date Region Sent Summary to Central Office: / /
Corrective Action Plan Submitted: / /
Date Spill Entered In Computer Data File: 02/07/90
Time Spill Entered In Computer Data File: Not reported
Spill Record Last Update: 12/27/93
Is Updated: False
PBS Number: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate Failed Tank: Not reported
Gross Leak Rate: Not reported
Material Class Type: Petroleum
Quantity Spilled: 100
Unkonwn Quantity Spilled: False
Units: Gallons
Quantity Recovered: 0

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s)
EDR ID Number
EPA ID Number

POLO GROUNDS (POLO GROUNDS TOWERS) (Continued)

U001840717

Unkonwn Quantity Recovered: False
Material: #4 FUEL OIL
Class Type: #4 FUEL OIL
Times Material Entry In File: 1751
CAS Number: Not reported
Last Date: 19941205
DEC Remarks: Not reported
Spill Cause: UPON DELIVERY FUEL PUMPED TOO FAST SPILLED, NO AGENCIES NOTIFIED, HUNTS POINT
CLEANED UP, REMOVED CONTAMINANTS, USED SORBENTS.

Region of Spill: 2
Spill Number: 9104892
Investigator: HEALY
Caller Name: Not reported
Caller Agency: Not reported
Caller Phone: Not reported
Caller Extension: Not reported
Notifier Name: Not reported
Notifier Agency: Not reported
Notifier Phone: Not reported
Notifier Extension: Not reported
Spill Date: 08/06/1991
Spill Time: 11:00
Reported to Department Date: 08/06/91
Reported to Department Time: 13:35
SWIS: 62
Spiller Contact: Not reported
Spiller Phone: Not reported
Spiller Extention: Not reported
Spiller Name: NYCHA
Spiller Address: 250 BROADWAY
Spiller City,St,Zip: NEW YORK, N.Y.
Facility Contact: Not reported
Facility Phone: (212) 306-3142
Facility Extention: Not reported
Spill Cause: Tank Test Failure
Resource Affectd: On Land
Water Affected: Not reported
Spill Source: Other Non Commercial/Industrial
Spill Notifier: Tank Tester
PBS Number: 2-474932
Cleanup Ceased: 04/26/95
Cleanup Meets Standard: True
Last Inspection: / /
Recommended Penalty: Penalty Not Recommended
Spiller Cleanup Date: / /
Enforcement Date: / /
Investigation Complete: / /
UST Involvement: False
Spill Class: Known release with minimal potential for fire or hazard. DEC Response.
Willing Responsible Party. Corrective action taken.
Spill Closed Dt: 04/26/95
Date Region Sent Summary to Central Office: / /
Corrective Action Plan Submitted: / /
Date Spill Entered In Computer Data File: 08/07/91
Time Spill Entered In Computer Data File: Not reported
Spill Record Last Update: 04/26/95

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s)
EDR ID Number
EPA ID Number

POLO GROUNDS (POLO GROUNDS TOWERS) (Continued)

U001840717

Is Updated: False
PBS Number: Not reported
Tank Number: 003
Tank Size: 0
Test Method: Not reported
Leak Rate Failed Tank: 0.00
Gross Leak Rate: Not reported
Material Class Type: Petroleum
Quantity Spilled: -1
Unkonwn Quantity Spilled: False
Units: Not reported
Quantity Recovered: 0
Unkonwn Quantity Recovered: False
Material: #4 FUEL OIL
Class Type: #4 FUEL OIL
Times Material Entry In File: 1751
CAS Number: Not reported
Last Date: 19941205
DEC Remarks: Not reported
Spill Cause: 35K TANK, FAILED HORNER EZY CHECK,GROSS LEAK,SYSTEM TEST,STICK LINE BROKE BY EXCAVATING,WILL REPAIR RETEST. SEE SPILL 9315381

Region of Spill: 2
Spill Number: 9315380
Investigator: HEALY
Caller Name: Not reported
Caller Agency: Not reported
Caller Phone: Not reported
Caller Extension: Not reported
Notifier Name: Not reported
Notifier Agency: Not reported
Notifier Phone: Not reported
Notifier Extension: Not reported
Spill Date: 06/20/1991
Spill Time: 12:00
Reported to Department Date: 03/29/94
Reported to Department Time: 12:30
SWIS: 62
Spiller Contact: Not reported
Spiller Phone: Not reported
Spiller Extention: Not reported
Spiller Name: NYCHA - JOE MONTELLA
Spiller Address: Not reported
Spiller City,St,Zip: Not reported
Facility Contact: Not reported
Facility Phone: (212) 306-3142
Facility Extention: Not reported
Spill Cause: Tank Test Failure
Resource Affectd: Groundwater
Water Affected: Not reported
Spill Source: Other Non Commercial/Industrial
Spill Notifier: DEC
PBS Number: 2-474932
Cleanup Ceased: / /
Cleanup Meets Standard: False
Last Inspection: / /
Recommended Penalty: Penalty Not Recommended

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s)
EDR ID Number
EPA ID Number

POLO GROUNDS (POLO GROUNDS TOWERS) (Continued)

U001840717

Spiller Cleanup Date: / /
Enforcement Date: / /
Investigation Complete: / /
UST Involvement: False
Spill Class: Known release with minimal potential for fire or hazard. DEC Response.
 Willing Responsible Party. Corrective action taken.
Spill Closed Dt: 04/03/97
Date Region Sent Summary to Central Office: / /
Corrective Action Plan Submitted: / /
Date Spill Entered In Computer Data File: 03/30/94
Time Spill Entered In Computer Data File: Not reported
Spill Record Last Update: 04/03/97
Is Updated: False
PBS Number: Not reported
Tank Number: 001
Tank Size: 0
Test Method: Not reported
Leak Rate Failed Tank: 0.00
Gross Leak Rate: Not reported
Material Class Type: Petroleum
Quantity Spilled: -1
Unkonwn Quantity Spilled: False
Units: Pounds
Quantity Recovered: 0
Unkonwn Quantity Recovered: False
Material: #4 FUEL OIL
Class Type: #4 FUEL OIL
Times Material Entry In File: 1751
CAS Number: Not reported
Last Date: 19941205
DEC Remarks: SEE SPILL 9700182, SUBSEQUENT TANK TEST FAILURE.
Spill Cause: LEAK RATE -0.09 GPH REPORTED AS PASSED BY TESTER.

Region of Spill: 2
Spill Number: 9700182
Investigator: SACCACIO
Caller Name: Not reported
Caller Agency: Not reported
Caller Phone: Not reported
Caller Extension: Not reported
Notifier Name: Not reported
Notifier Agency: Not reported
Notifier Phone: Not reported
Notifier Extension: Not reported
Spill Date: 04/03/1997
Spill Time: 13:30
Reported to Department Date: 04/03/97
Reported to Department Time: 14:58
SWIS: 62
Spiller Contact: Not reported
Spiller Phone: Not reported
Spiller Extention: Not reported
Spiller Name: NYC HOUSING AUTHORITY
Spiller Address: 250 BROADWAY
Spiller City,St,Zip: NEW YORK, NY
Facility Contact: SEBASTIAN LOREFICE
Facility Phone: (212) 306-3229

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s)
EDR ID Number
EPA ID Number

POLO GROUNDS (POLO GROUNDS TOWERS) (Continued)

U001840717

Facility Extension: Not reported
Spill Cause: Tank Test Failure
Resource Affectd: On Land
Water Affected: Not reported
Spill Source: Private Dwelling
Spill Notifier: Responsible Party
PBS Number: 2-474932
Cleanup Ceased: / /
Cleanup Meets Standard: False
Last Inspection: / /
Recommended Penalty: Penalty Not Recommended
Spiller Cleanup Date: / /
Enforcement Date: / /
Investigation Complete: / /
UST Involvement: False
Spill Class: Known release with minimal potential for fire or hazard. DEC Response.
Willing Responsible Party. Corrective action taken.
Spill Closed Dt: / /
Date Region Sent Summary to Central Office: / /
Corrective Action Plan Submitted: / /
Date Spill Entered In Computer Data File: 04/03/97
Time Spill Entered In Computer Data File: Not reported
Spill Record Last Update: 04/04/97
Is Updated: False
PBS Number: Not reported
Tank Number: 1
Tank Size: 35000
Test Method: Horner EZ Check
Leak Rate Failed Tank: 0.00
Gross Leak Rate: Tank Test Failures only pass or fail
Material Class Type: Petroleum
Quantity Spilled: 0
Unkonwn Quantity Spilled: True
Units: Gallons
Quantity Recovered: 0
Unkonwn Quantity Recovered: True
Material: #2 FUEL OIL
Class Type: #2 FUEL OIL
Times Material Entry In File: 24464
CAS Number: Not reported
Last Date: 19941207
DEC Remarks: Not reported
Spill Cause: TANK TO BE ISOLATED AND RETESTED.

Region of Spill: 2
Spill Number: 9501718
Investigator: HEALY
Caller Name: Not reported
Caller Agency: Not reported
Caller Phone: Not reported
Caller Extension: Not reported
Notifier Name: Not reported
Notifier Agency: Not reported
Notifier Phone: Not reported
Notifier Extension: Not reported
Spill Date: 05/10/1995
Spill Time: 14:45

Map ID
 Direction
 Distance
 Distance (ft.)
 Elevation Site

MAP FINDINGS

Database(s)
 EDR ID Number
 EPA ID Number

POLO GROUNDS (POLO GROUNDS TOWERS) (Continued)

U001840717

Reported to Department Date: 05/10/95
 Reported to Department Time: 15:09
 SWIS: 62
 Spiller Contact: Not reported
 Spiller Phone: Not reported
 Spiller Extention: Not reported
 Spiller Name: BROOK FUEL
 Spiller Address: Not reported
 Spiller City,St,Zip: Not reported
 Facility Contact: Not reported
 Facility Phone: (718) 665-7070
 Facility Extention: Not reported
 Spill Cause: Tank Overfill
 Resource Affectd: On Land
 Water Affected: Not reported
 Spill Source: Other Non Commercial/Industrial
 Spill Notifier: Affected Persons
 PBS Number: Not reported
 Cleanup Ceased: 05/11/95
 Cleanup Meets Standard: True
 Last Inspection: / /
 Recommended Penalty: Penalty Not Recommended
 Spiller Cleanup Date: / /
 Enforcement Date: / /
 Investigation Complete: / /
 UST Involvement: False
 Spill Class: Known release with minimal potential for fire or hazard. DEC Response.
 Willing Responsible Party. Corrective action taken.
 Spill Closed Dt: 05/11/95
 Date Region Sent Summary to Central Office: / /
 Corrective Action Plan Submitted: / /
 Date Spill Entered In Computer Data File: 05/11/95
 Time Spill Entered In Computer Data File: Not reported
 Spill Record Last Update: / /
 Is Updated: False
 PBS Number: Not reported
 Tank Number: Not reported
 Tank Size: Not reported
 Test Method: Not reported
 Leak Rate Failed Tank: Not reported
 Gross Leak Rate: Not reported
 Material Class Type: Petroleum
 Quantity Spilled: 30
 Unkonwn Quantity Spilled: False
 Units: Gallons
 Quantity Recovered: 0
 Unkonwn Quantity Recovered: False
 Material: #2 FUEL OIL
 Class Type: #2 FUEL OIL
 Times Material Entry In File: 24464
 CAS Number: Not reported
 Last Date: 19941207
 DEC Remarks: Not reported
 Spill Cause: DUPLICATE REPORT OF SPILL 9501714 - TANK OVERFILL ONTO SOIL

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

POLO GROUNDS (POLO GROUNDS TOWERS) (Continued)

EDR ID Number
EPA ID Number

U001840717

[Click this hyperlink](#) while viewing on your computer to access additional NY_HIST_LTANK: detail in the EDR Site Report.

AT203
WNW
1/4-1/2
1555 ft.

MOBIL S/S
3740 BROADWAY
NEW YORK, NY

LTANKS
HIST LTANKS

S100168131
N/A

Relative:
Higher

Site 1 of 3 in cluster AT

Actual:
123 ft.

LTANKS:
Site ID: 59282
Spill Date: 12/03/90
Facility Addr2: Not reported
Facility ID: 9009562
Program Number: 9009562
SWIS: 3101
Region of Spill: 2
Investigator: JXGRECO
Referred To: Not reported
Reported to Dept: 12/03/90
CID: 15
Spill Cause: Tank Test Failure
Water Affected: Not reported
Spill Source: Gasoline Station
Spill Notifier: Responsible Party
Cleanup Ceased: 09/21/94
Cleanup Meets Standard: False
Last Inspection: / /
Recommended Penalty: Penalty Not Recommended
UST Involvement: True
Spill Class: Known release that creates a file or hazard. DEC Response. Willing Responsible Party. Corrective action taken.
Spill Closed Dt: 09/21/94
Remediation Phase: 0
Date Entered In Computer: 12/11/90
Spill Record Last Update: 09/11/03
Spille Namer: MIKE MEOLA
Spiller Company: EXXONMOBIL CORPORATION
Spiller Phone: (212) 283-8774
Spiller Extention: Not reported
Spiller Address: 464 DOUGHTY BLVD.
Spiller City,St,Zip: INWOOD, NY 11096
Spiller County: 001
Spiller Contact: Not reported
Spiller Phone: Not reported
Spiller Extention: Not reported
DEC Region: 2
Program Number: 9009562
DER Facility ID: 56716
Site ID: 59282
Operable Unit ID: 949968
Operable Unit: 01
Material ID: 429775
Material Code: 0009
Material Name: Gasoline
Case No.: Not reported
Material FA: Petroleum
Quantity: 0.00

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

MOBIL S/S (Continued)

EDR ID Number
EPA ID Number

Database(s)

S100168131

Units: Gallons
Recovered: 0.00
Resource Affected: Groundwater
Oxygenate: False
Site ID: 59282
Spill Tank Test: 1537982
Tank Number: Not reported
Tank Size: 0
Test Method: 00
Leak Rate: 0.00
Gross Fail: Not reported
Modified By: Spills
Last Modified: 10/01/04
Test Method: Unknown
DEC Memo: Start DECRemark - 9009562 Prior to Sept, 2004 data translation this spill Lead
DEC Field was "GRECO" This spill site has been transferred from DEC Sigona to
Remedial Bureau B, on August 4, 2003. 09/21/94: CROSS REFERENCE TO
SPILL # 8910288. reassigned from sullivan to sigona on 11/1/00 This spill
site has been consolidated under Spill No. 8910288 & 0109628. END
DECRemark - 9009562
Remarks: Start CallerRemark - 9009562 LINE TEST, FAILED PETRO TITE WITH A LEAK RATE OF
.0196GPH, GASSERVICE TO REPAIR & RETEST, TONY KHOURY (FIELD ENGINEER)
516-239-0266. END CallerRemark - 9009562

HIST LTANKS:

Region of Spill: 2
Spill Number: 9009562
Investigator: SIGONA
Caller Name: Not reported
Caller Agency: Not reported
Caller Phone: Not reported
Caller Extension: Not reported
Notifier Name: Not reported
Notifier Agency: Not reported
Notifier Phone: Not reported
Notifier Extension: Not reported
Spill Date: 12/03/1990
Spill Time: 13:45
Reported to Department Date: 12/03/90
Reported to Department Time: 14:37
SWIS: 62
Spiller Contact: Not reported
Spiller Phone: Not reported
Spiller Extention: Not reported
Spiller Name: EXXONMOBIL CORP
Spiller Address: 464 DOUGHTY BLVD.
Spiller City,St,Zip: INWOOD, NY 11096-
Facility Contact: MIKE MEOLA
Facility Phone: (212) 283-8774
Facility Extention: Not reported
Spill Cause: Tank Test Failure
Resource Affectd: Groundwater
Water Affected: Not reported
Spill Source: Gas Station
Spill Notifier: Responsible Party
PBS Number: 2-157805
Cleanup Ceased: 09/21/94

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

MOBIL S/S (Continued)

EDR ID Number
EPA ID Number

Database(s)

S100168131

Cleanup Meets Standard: False
Last Inspection: / /
Recommended Penalty: Penalty Not Recommended
Spiller Cleanup Date: / /
Enforcement Date: / /
Investigation Complete: / /
UST Involvement: True
Spill Class: Known release that creates a file or hazard. DEC Response. Willing
Responsible Party. Corrective action taken.
Spill Closed Dt: 09/21/94
Date Region Sent Summary to Central Office: / /
Corrective Action Plan Submitted: / /
Date Spill Entered In Computer Data File: 12/11/90
Time Spill Entered In Computer Data File: Not reported
Spill Record Last Update: 11/01/00
Is Updated: False
PBS Number: Not reported
Tank Number: Not reported
Tank Size: 0
Test Method: Not reported
Leak Rate Failed Tank: 0.00
Gross Leak Rate: Not reported
Material Class Type: Petroleum
Quantity Spilled: 0
Unkonwn Quantity Spilled: True
Units: Gallons
Quantity Recovered: 0
Unkonwn Quantity Recovered: True
Material: GASOLINE
Class Type: GASOLINE
Times Material Entry In File: 21329
CAS Number: Not reported
Last Date: 19940929
DEC Remarks: 09/21/94: CROSS REFERENCE TO SPILL 8910288. reassigned from sullivan to sigona
on 11/1/00
Spill Cause: LINE TEST, FAILED PETRO TITE WITH A LEAK RATE OF .0196GPH, GASSERVICE TO REPAIR
RETEST, TONY KHOURY FIELD ENGINEER) 516-239-0266.

AT204
WNW
1/4-1/2
1555 ft.

MOBIL S/S
3740 BROADWAY
NEW YORK, NY

LTANKS
NY Spills
HIST LTANKS

S100145825
N/A

Site 2 of 3 in cluster AT

Relative:
Higher

LTANKS:

Actual:
123 ft.

Site ID: 59281
Spill Date: 01/26/90
Facility Addr2: Not reported
Facility ID: 8910288
Program Number: 8910288
SWIS: 3101
Region of Spill: 2
Investigator: JXGRECO
Referred To: P1
Reported to Dept: 01/26/90
CID: 15
Spill Cause: Tank Test Failure
Water Affected: Not reported

S100145825

Spill Source:	Gasoline Station
Spill Notifier:	Tank Tester
Cleanup Ceased:	/ /
Cleanup Meets Standard:	False
Last Inspection:	/ /
Recommended Penalty:	Penalty Not Recommended
UST Involvement:	True
Spill Class:	Known release that creates a file or hazard. DEC Response. Willing Responsible Party. Corrective action taken.
Spill Closed Dt:	/ /
Remediation Phase:	1
Date Entered In Computer:	01/31/90
Spill Record Last Update:	06/25/07
Spille Namer:	MIKE MEOLA
Spiller Company:	EXXONMOBIL CORPORATION
Spiller Phone:	(212) 368-2785
Spiller Extention:	Not reported
Spiller Address:	464 DOUGHTY BLVD.
Spiller City,St,Zip:	INWOOD, NY 11096
Spiller County:	001
Spiller Contact:	Not reported
Spiller Phone:	Not reported
Spiller Extention:	Not reported
DEC Region:	2
Program Number:	8910288
DER Facility ID:	56716
Site ID:	59281
Operable Unit ID:	935369
Operable Unit:	01
Material ID:	443396
Material Code:	0009
Material Name:	Gasoline
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	0.00
Units:	Gallons
Recovered:	0.00
Resource Affected:	Soil
Oxygenate:	False
Site ID:	59281
Spill Tank Test:	1536728
Tank Number:	Not reported
Tank Size:	0
Test Method:	00
Leak Rate:	0.00
Gross Fail:	Not reported
Modified By:	Spills
Last Modified:	10/01/04
Test Method:	Unknown
DEC Memo:	Start DECRemark - 8910288 Prior to Sept, 2004 data translation this spill Lead DEC Field was "GRECO" This spill site has been transferred from DEC Sigona to Remedial Bureau B, on August 4, 2003. REASSIGNED from Sullivan to Sigonaon 11/1/00 This spill site has been consolidated under Spill No. 8910288 & 0109628. NOTE: Spill 0109628 is for 3750 Broadway, an apartment building affected by the release at 3740 Broadway. The spill number at 3750 is being kept openso a search of the data base will reveal an ongoing activity is taking place at the site. There is an SVE/Vapor

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

MOBIL S/S (Continued)

S100145825

Remarks:

depressurization unit installed at 3750 Broadway that is being managed under 8910288, as are all investigative activities. Reassigned to Greco in 2003: An RI/FS was completed in January 2006. ExxonMobil is proceeding with a pilot study/pre-design work for dual phase extraction (i.e., groundwater and soil vapor). This work should be complete in June, 2006. END DECRemark- 8910288
Start CallerRemark - 8910288 TANK FAILED PETRO TITE TEST WITH A GROSS LEAK, 3 LINES FAILED, ALL 3 PRODUCT LINES FAILED. END CallerRemark - 8910288

NY Spills:

Site ID: 59276
Facility Addr2: Not reported
Facility ID: 0206077
Spill Number: 0206077
Facility Type: ER
SWIS: 3101
Region of Spill: 2
Investigator: JXGRECO
Referred To: Not reported
Spill Date: 09/12/02
Reported to Dept: 09/12/02
CID: 15
Spill Cause: Equipment Failure
Water Affected: Not reported
Spill Source: Gasoline Station
Spill Notifier: Responsible Party
Cleanup Ceased: / /
Cleanup Meets Std: False
Last Inspection: / /
Recommended Penalty: Penalty Not Recommended
UST Trust: True
Spill Class: Known release that creates a file or hazard. DEC Response. Willing Responsible Party. Corrective action taken.
Spill Closed Dt: 09/11/03
Remediation Phase: 0
Date Entered In Computer: 09/12/02
Spill Record Last Update: 09/11/03
Spiller Name: DON ENGLERT
Spiller Company: EXXONMOBIL
Spiller Address: 464 DOUGHTY BLVD
Spiller City,St,Zip: INWOOD, NY
Spiller Company: 001
Spiller Phone: (516) 371-1527
Contact Name: JOANNE WALLACH
Contact Phone: (908) 474-2745
DEC Region: 2
Program Number: 0206077
DER Facility ID: 56716
Site ID: 59276
Operable Unit ID: 858560
Operable Unit: 01
Material ID: 516688
Material Code: 0009
Material Name: Gasoline
Case No.: Not reported
Material FA: Petroleum
Quantity: 0.00
Units: Gallons

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

MOBIL S/S (Continued)

EDR ID Number
EPA ID Number

Database(s)

S100145825

Recovered: 0.00
Resource Affected: Groundwater
Oxygenate: False
DEC Memo: Start DECRemark - 0206077 Prior to Sept, 2004 data translation this spill Lead DEC Field was "GRECO" This spill site has been transferred from DEC Sigona to Remedial Bureau B, on August 4, 2003. This spill site has been consolidated under SpillNo. 8910288 & 0109628. See also Spill Nos. 0109628, 0109955, 9009562, 8910288, 8903673 & 8801733. DEC Sigona requested through DEC Conlon on Friday September 6, 2002, ordering ExxonMobil to empty tanks and replace fill piping after receiving results of Tracer Tightness Testing conducted by DEC under PIN for 3750 Broadway. GSC and Fenely & Nicol removed the fill catch basins and found free product underneath the piping and overflow protection systems. MEG (Wilson) responded and collected two samples with DEC Sigona on September 12, 2002 at 2:30 to 3:30 P.M. One sample was collected under the fill boxes at 4 feet below grade, which consisted of gasoline saturated pea gravel mixed with sand. The second sample was collected at 4.5 feet below grade on the top of Tank No. 1, adjacent to the fill lines. The sample taken from the top of the Tank was gasoline saturated. Both samples will be sent to ECO test by MEG for fingerprint and BTEX and MTBE analysis. While at the station digital photos were taken by DEC Sigona of sampling locations. DEC Sigona observed natural gas vapors in the office and notified Con Edison CIG (212)580-6763. A gas operations crew is being dispatched to the site for investigation of the odors in the gas station office. On October 7, 2002, DEC Sigona issued Exxon-Mobil Corporation with an executed copy of a Stipulation Agreement to address pipeline replacement work, at the above referenced site. END DECRemark - 0206077
Remarks: Start CallerRemark - 0206077 Caller replacing spill buckets and found impacted soil. END CallerRemark - 0206077

Site ID: 59275
Facility Addr2: Not reported
Facility ID: 0109955
Spill Number: 0109955
Facility Type: ER
SWIS: 3101
Region of Spill: 2
Investigator: JXGRECO
Referred To: Not reported
Spill Date: 01/15/02
Reported to Dept: 01/15/02
CID: 15
Spill Cause: Equipment Failure
Water Affected: Not reported
Spill Source: Gasoline Station
Spill Notifier: Responsible Party
Cleanup Ceased: / /
Cleanup Meets Std: False
Last Inspection: / /
Recommended Penalty: Penalty Not Recommended
UST Trust: False
Spill Class: Known release that creates a file or hazard. DEC Response. Unknown Responsible Party. Corrective action taken. (ISR)
Spill Closed Dt: 09/11/03
Remediation Phase: 0
Date Entered In Computer: 01/15/02
Spill Record Last Update: 09/11/03
Spiller Name: JOANNE WALLACH

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

MOBIL S/S (Continued)

EDR ID Number
EPA ID Number

Database(s)

S100145825

Spiller Company: EXXONMOBIL
Spiller Address: 3225 GALLOWS ROAD
Spiller City,St,Zip: FAIRFAX, VA 22037-
Spiller Company: 001
Spiller Phone: (908) 474-2745
Contact Name: Not reported
Contact Phone: Not reported
DEC Region: 2
Program Number: 0109955
DER Facility ID: 56716
Site ID: 59275
Operable Unit ID: 847076
Operable Unit: 01
Material ID: 527593
Material Code: 0022
Material Name: Waste Oil/Used Oil
Case No.: Not reported
Material FA: Petroleum
Quantity: 0.00
Units: Gallons
Recovered: 0.00
Resource Affected: Surface Water
Oxygenate: False
DEC Memo: Start DECRemark - 0109955 Prior to Sept, 2004 data translation this spill Lead
DEC Field was "GRECO" This spill site has been transferred from DEC Sigona to
Remedial Bureau B, on August 4, 2003. This spill site has been consolidated
under SpillNo. 8910288 & 0109628. END DECRemark - 0109955
Remarks: Start CallerRemark - 0109955 Caller was installing a spill bucket on an
existing i/g waste oil tank contaminated gravel was encountered material
has been removed and will be disposed of spill seems to have been caused by
tank overfills in the past or spills during the filling process c/r spill
number 90-07288 END CallerRemark - 0109955

[Click this hyperlink](#) while viewing on your computer to access
additional NY_SPILL: detail in the EDR Site Report.

HIST LTANKS:

Region of Spill: 2
Spill Number: 8910288
Investigator: SIGONA
Caller Name: Not reported
Caller Agency: Not reported
Caller Phone: Not reported
Caller Extension: Not reported
Notifier Name: Not reported
Notifier Agency: Not reported
Notifier Phone: Not reported
Notifier Extension: Not reported
Spill Date: 01/26/1990
Spill Time: 14:30
Reported to Department Date: 01/26/90
Reported to Department Time: 14:52
SWIS: 62
Spiller Contact: Not reported
Spiller Phone: Not reported
Spiller Extention: Not reported
Spiller Name: EXXONMOBIL CORP.

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s)
EDR ID Number
EPA ID Number

MOBIL S/S (Continued)

S100145825

Spiller Address: 464 DOUGHTY BLVD.
Spiller City,St,Zip: INWOOD, NY 11096-
Facility Contact: MIKE MEOLA
Facility Phone: (212) 368-2785
Facility Extention: Not reported
Spill Cause: Tank Test Failure
Resource Affectd: On Land
Water Affected: Not reported
Spill Source: Gas Station
Spill Notifier: Tank Tester
PBS Number: 2-157805
Cleanup Ceased: / /
Cleanup Meets Standard: False
Last Inspection: / /
Recommended Penalty: Penalty Not Recommended
Spiller Cleanup Date: / /
Enforcement Date: / /
Investigation Complete: / /
UST Involvement: True
Spill Class: Known release that creates a file or hazard. DEC Response. Willing
Responsible Party. Corrective action taken.
Spill Closed Dt: / /
Date Region Sent Summary to Central Office: / /
Corrective Action Plan Submitted: / /
Date Spill Entered In Computer Data File: 01/31/90
Time Spill Entered In Computer Data File: Not reported
Spill Record Last Update: 11/01/00
Is Updated: False
PBS Number: Not reported
Tank Number: Not reported
Tank Size: 0
Test Method: Not reported
Leak Rate Failed Tank: 0.00
Gross Leak Rate: Not reported
Material Class Type: Petroleum
Quantity Spilled: 0
Unkonwn Quantity Spilled: True
Units: Gallons
Quantity Recovered: 0
Unkonwn Quantity Recovered: True
Material: GASOLINE
Class Type: GASOLINE
Times Material Entry In File: 21329
CAS Number: Not reported
Last Date: 19940929
DEC Remarks: REASSIGNED from Sullivan to Sigona on 11/1/00
Spill Cause: TANK FAILED PETRO TITE TEST WITH A GROSS LEAK, 3 LINES FAILED, ALL 3 PRODUCT
LINES FAILED.

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

Site Database(s) EDR ID Number
EPA ID Number

AT205 **MOBIL S/S** **LTANKS** **S103560302**
WNW **3740 BROADWAY** **NY Hist Spills** **N/A**
1/4-1/2 **NEW YORK, NY**
1555 ft.

Relative: **Site 3 of 3 in cluster AT**

Higher

Actual:
123 ft.

LTANKS:

Site ID: 59280
Spill Date: 07/12/89
Facility Addr2: Not reported
Facility ID: 8903673
Program Number: 8903673
SWIS: 3101
Region of Spill: 2
Investigator: JXGRECO
Referred To: Not reported
Reported to Dept: 07/12/89
CID: 15
Spill Cause: Tank Failure
Water Affected: Not reported
Spill Source: Gasoline Station
Spill Notifier: Responsible Party
Cleanup Ceased: 09/21/94
Cleanup Meets Standard: True
Last Inspection: / /
Recommended Penalty: Penalty Not Recommended
UST Involvement: False
Spill Class: Known release that creates potential for fire or hazard. DEC Response.
Willing Responsible Party. Corrective action taken.
Spill Closed Dt: 09/21/94
Remediation Phase: 0
Date Entered In Computer: 07/14/89
Spill Record Last Update: 09/11/03
Spille Namer: MIKE MEOLA
Spiller Company: EXXONMOBIL CORPORATION
Spiller Phone: (703) 849-5384
Spiller Extention: Not reported
Spiller Address: 3225 GALLOWS RD
Spiller City,St,Zip: FAIRFAX, VA 22037-
Spiller County: 001
Spiller Contact: Not reported
Spiller Phone: Not reported
Spiller Extention: Not reported
DEC Region: 2
Program Number: 8903673
DER Facility ID: 56716
Site ID: 59280
Operable Unit ID: 931185
Operable Unit: 01
Material ID: 447754
Material Code: 0022
Material Name: Waste Oil/Used Oil
Case No.: Not reported
Material FA: Petroleum
Quantity: 0.00
Units: Gallons
Recovered: 0.00
Resource Affected: Groundwater
Oxygenate: False

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s)
EDR ID Number
EPA ID Number

MOBIL S/S (Continued)

S103560302

Site ID: Not reported
Spill Tank Test: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate: Not reported
Gross Fail: Not reported
Modified By: Not reported
Last Modified: Not reported
Test Method: Not reported
DEC Memo: Start DECRemark - 8903673 Prior to Sept, 2004 data translation this spill Lead
DEC Field was "GRECO" This spill site has been transferred from DEC Sigona to
Remedial Bureau B, on August 4, 2003. 09/21/94: CROSS REFERENCE TO
SPILL # 8910288. This spill site has been consolidated under Spill No.
8910288 & 0109628. END DECRemark - 8903673
Remarks: Start CallerRemark - 8903673 WHILE REPLACING TANK DISCOVERED OIL & WATER
MIXTURE. END CallerRemark - 8903673

NY Hist Spills:

Region of Spill: 2
Spill Number: 8903673
Investigator: SIGONA
Caller Name: Not reported
Caller Agency: Not reported
Caller Phone: Not reported
Notifier Name: Not reported
Notifier Agency: Not reported
Notifier Phone: Not reported
Spill Date/Time: 07/12/1989 12:00
Reported to Dept Date/Time: 07/12/89 15:23
SWIS: 62
Spiller Name: EXXONMOBIL CORP.
Spiller Contact: MIKE MEOLA
Spiller Phone: (703) 849-5384
Spiller Address: 3225 GALLOWES RD
Spiller City,St,Zip: FAIRFAX, VA 22037-
Spill Cause: Housekeeping
Reported to Dept: Groundwater
Water Affected: Not reported
Spill Source: 05
Spill Notifier: Responsible Party
PBS Number: 2-157805
Cleanup Ceased: 09/21/94
Cleanup Meets Std: True
Last Inspection: / /
Recommended Penalty: Penalty Not Recommended
Spiller Cleanup Dt: / /
Enforcement Date: / /
Invstgn Complete: / /
UST Involvement: False
Spill Class: Known release that creates potential for fire or hazard. DEC Response.
Willing Responsible Party. Corrective action taken.
Spill Closed Dt: 09/21/94
Corrective Action Plan Submitted: / /
Date Region Sent Summary to Central Office: / /
Date Spill Entered In Computer Data File: 07/14/89
Date Spill Entered In Computer Data File: Not reported

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

MOBIL S/S (Continued)

EDR ID Number
EPA ID Number

Database(s)

S103560302

Update Date: 11/01/00
Is Updated: False
PBS Number: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate Failed Tank: Not reported
Gross Leak Rate: Not reported
Material Class Type: Petroleum
Quantity Spilled: 0
Unkonwn Quantity Spilled: True
Units: Gallons
Quantity Recovered: 0
Unkonwn Quantity Recovered: True
Material: WASTE OIL
Class Type: WASTE OIL
Times Material Entry In File: 9509
CAS Number: Not reported
Last Date: 19940927
DEC Remarks: 09/21/94: CROSS REFERENCE TO SPILL 8910288.
Remark: WHILE REPLACING TANK DISCOVERED OIL WATER MIXTURE.

AU206
SW
1/4-1/2
1587 ft.

CHURCH
444 EAST 149TH STREET
MANHATTAN, NY

LTANKS S106737584
N/A

Site 1 of 2 in cluster AU

Relative:
Equal

Actual:
111 ft.

LTANKS:
Site ID: 335168
Spill Date: 12/15/04
Facility Addr2: Not reported
Facility ID: 0410246
Program Number: 0410246
SWIS: 3101
Region of Spill: 2
Investigator: rmpiper
Referred To: Not reported
Reported to Dept: 12/15/04
CID: 15
Spill Cause: Tank Overfill
Water Affected: Not reported
Spill Source: Institutional, Educational, Gov., Other
Spill Notifier: Other
Cleanup Ceased: / /
Cleanup Meets Standard: False
Last Inspection: / /
Recommended Penalty: Penalty Not Recommended
UST Involvement: False
Spill Class: Known release with minimal potential for fire or hazard. DEC Response.
Willing Responsible Party. Corrective action taken.
Spill Closed Dt: 11/14/05
Remediation Phase: 0
Date Entered In Computer: 12/15/04
Spill Record Last Update: 11/14/05
Spille Namer: JOHN
Spiller Company: T & S TRUCKING
Spiller Phone: (718) 499-2900

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

CHURCH (Continued)

EDR ID Number
EPA ID Number

Database(s)

S106737584

Spiller Extention: Not reported
Spiller Address: 53 2ND AVE
Spiller City,St,Zip: BROOKLYN, NY
Spiller County: 001
Spiller Contact: CARMEN
Spiller Phone: (212) 534-0740
Spiller Extention: Not reported
DEC Region: 2
Program Number: 0410246
DER Facility ID: 270394
Site ID: 335168
Operable Unit ID: 1097271
Operable Unit: 01
Material ID: 577244
Material Code: 0001
Material Name: #2 Fuel Oil
Case No.: Not reported
Material FA: Petroleum
Quantity: 7.00
Units: Gallons
Recovered: 0.00
Resource Affected: Soil
Oxygenate: False
Site ID: Not reported
Spill Tank Test: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate: Not reported
Gross Fail: Not reported
Modified By: Not reported
Last Modified: Not reported
Test Method: Not reported
DEC Memo: Not reported
Remarks: Start CallerRemark - 0410246 5-6 GALLONS CAME OUT OF VENT: IN PROCESS OF
CLEANING UP: END CallerRemark - 0410246

AU207
SW
1/4-1/2
1649 ft.

435 CONVENT AVE
MANHATTAN, NY

LTANKS S104877161
HIST LTANKS N/A

Site 2 of 2 in cluster AU

Relative:
Higher

LTANKS:

Actual:
112 ft.

Site ID: 296284
Spill Date: 11/07/00
Facility Addr2: Not reported
Facility ID: 0009114
Program Number: 0009114
SWIS: 3101
Region of Spill: 2
Investigator: MXTIPPLE
Referred To: Not reported
Reported to Dept: 11/07/00
CID: 15
Spill Cause: Tank Failure
Water Affected: Not reported
Spill Source: Private Dwelling

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

(Continued)

S104877161

Spill Notifier: Other
Cleanup Ceased: / /
Cleanup Meets Standard: False
Last Inspection: / /
Recommended Penalty: Penalty Not Recommended
UST Involvement: False
Spill Class: Known release that creates potential for fire or hazard. DEC Response.
Willing Responsible Party. Corrective action taken.
Spill Closed Dt: 02/06/02
Remediation Phase: 0
Date Entered In Computer: 11/07/00
Spill Record Last Update: 02/06/02
Spille Namer: ANTHONY
Spiller Company: Not reported
Spiller Phone: (212) 283-1113
Spiller Extention: Not reported
Spiller Address: 435 CONVENT AVE
Spiller City,St,Zip: MANHATTAN, NY
Spiller County: 001
Spiller Contact: ANTHONY
Spiller Phone: (212) 283-1113
Spiller Extention: Not reported
DEC Region: 2
Program Number: 0009114
DER Facility ID: 239758
Site ID: 296284
Operable Unit ID: 829699
Operable Unit: 01
Material ID: 546610
Material Code: 0002
Material Name: #4 Fuel Oil
Case No.: Not reported
Material FA: Petroleum
Quantity: 1000.00
Units: Gallons
Recovered: 0.00
Resource Affected: Soil
Oxygenate: False
Site ID: Not reported
Spill Tank Test: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate: Not reported
Gross Fail: Not reported
Modified By: Not reported
Last Modified: Not reported
Test Method: Not reported
DEC Memo: Start DECRemark - 0009114 Prior to Sept, 2004 data translation this spill Lead
DEC Field was "TIPPLE" CLEANUP COMPLETE END DECRemark - 0009114
Start CallerRemark - 0009114 spiller stated that spill was caused by leaking
boiler line. only 100 gals on floor rest went into sump pump. al eastman
enroute END CallerRemark - 0009114
Remarks:
HIST LTANKS:
Region of Spill: 2
Spill Number: 0009114

MAP FINDINGS

EDR ID Number
EPA ID Number

S104877161

S104877161

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

(Continued)

S104877161

Unkonwn Quantity Recovered: True
Material: #4 FUEL OIL
Class Type: #4 FUEL OIL
Times Material Entry In File: 1751
CAS Number: Not reported
Last Date: 19941205
DEC Remarks: Not reported
Spill Cause: spiller stated that spill was caused by leaking boiler line. only 100 gals on floor rest went into sump pump. al eastman enroute

208
WSW
1/4-1/2
1685 ft.

MULTI DWELLING
542 WEST 150TH ST
MANHATTAN, NY

LTANKS
NY Hist Spills

S104502653
N/A

Relative:
Higher

Actual:
129 ft.

LTANKS:
Site ID: 129254
Spill Date: 01/03/97
Facility Addr2: Not reported
Facility ID: 9611957
Program Number: 9611957
SWIS: 3101
Region of Spill: 2
Investigator: EXHAMPST
Referred To: Not reported
Reported to Dept: 01/03/97
CID: 15
Spill Cause: Tank Overfill
Water Affected: Not reported
Spill Source: Tank Truck
Spill Notifier: Responsible Party
Cleanup Ceased: / /
Cleanup Meets Standard: False
Last Inspection: / /
Recommended Penalty: Penalty Not Recommended
UST Involvement: False
Spill Class: Known release with minimal potential for fire or hazard. DEC Response.
Willing Responsible Party. Corrective action taken.
Spill Closed Dt: 12/28/05
Remediation Phase: 0
Date Entered In Computer: 01/03/97
Spill Record Last Update: 12/28/05
Spille Namer: MRS MIRIAM BANTHAM
Spiller Company: MULTI DWELLING
Spiller Phone: (212) 664-8501
Spiller Extention: Not reported
Spiller Address: 542 WEST 150TH ST
Spiller City,St,Zip: MANHATTAN, NY
Spiller County: 001
Spiller Contact: MRS MIRIAM BANTHAM
Spiller Phone: (212) 664-8501
Spiller Extention: Not reported
DEC Region: 2
Program Number: 9611957
DER Facility ID: 111435
Site ID: 129254
Operable Unit ID: 1039818
Operable Unit: 01

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

MULTI DWELLING (Continued)

S104502653

Material ID: 340604
Material Code: 0001
Material Name: #2 Fuel Oil
Case No.: Not reported
Material FA: Petroleum
Quantity: 30.00
Units: Gallons
Recovered: 30.00
Resource Affected: Soil
Oxygenate: False
Site ID: Not reported
Spill Tank Test: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate: Not reported
Gross Fail: Not reported
Modified By: Not reported
Last Modified: Not reported
Test Method: Not reported
DEC Memo: Start DECRemark - 9611957 12/28/05 Transferred to E. Hampston via Spill Initiative. Owner at time of spill deceased and property transferred to new ownership in 1998. No complaints or reports of problems at or since transfer. Report notes spill cleaned. Spill greater than 9 years old and approximately 30 gallons fits closeout strategy. Close spill. END DECRemark - 9611957
Remarks: Start CallerRemark - 9611957 OIL CO MADE DELIVERY TO DWELLING OF #2 OIL-OIL CAME BACK OUT OF VENT ON TOP OF THE TANK-HAS BEEN CLEANED UP END CallerRemark - 9611957

NY Hist Spills:

Region of Spill: 2
Spill Number: 9611957
Investigator: SIGONA
Caller Name: Not reported
Caller Agency: Not reported
Caller Phone: Not reported
Notifier Name: Not reported
Notifier Agency: Not reported
Notifier Phone: Not reported
Spill Date/Time: 01/03/1997 13:00
Reported to Dept Date/Time: 01/03/97 16:30
SWIS: 62
Spiller Name: MULTI DWELLING
Spiller Contact: MRS MIRIAM BANTHAM
Spiller Phone: (212) 664-8501
Spiller Contact: MRS MIRIAM BANTHAM
Spiller Phone: (212) 664-8501
Spiller Address: 542 WEST 150TH ST
Spiller City,St,Zip: MANHATTAN
Spill Cause: Other
Reported to Dept: On Land
Water Affected: Not reported
Spill Source: 12
Spill Notifier: Other
PBS Number: Not reported
Cleanup Ceased: / /
Cleanup Meets Std: False

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s)
EDR ID Number
EPA ID Number

MULTI DWELLING (Continued)

S104502653

Last Inspection: / /
Recommended Penalty: Penalty Not Recommended
Spiller Cleanup Dt: / /
Enforcement Date: / /
Invstgn Complete: / /
UST Involvement: False
Spill Class: Known release with minimal potential for fire or hazard. DEC Response.
 Willing Responsible Party. Corrective action taken.
Spill Closed Dt: / /
Corrective Action Plan Submitted: / /
Date Region Sent Summary to Central Office: / /
Date Spill Entered In Computer Data File: 01/03/97
Date Spill Entered In Computer Data File: Not reported
Update Date: 03/13/97
Is Updated: False
PBS Number: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate Failed Tank: Not reported
Gross Leak Rate: Not reported
Material Class Type: Petroleum
Quantity Spilled: 30
Unkonwn Quantity Spilled: False
Units: Gallons
Quantity Recovered: 30
Unkonwn Quantity Recovered: False
Material: #2 FUEL OIL
Class Type: #2 FUEL OIL
Times Material Entry In File: 24464
CAS Number: Not reported
Last Date: 19941207
DEC Remarks: 2/24/97: >MRS. BANTHAM CONTACTED CONTACTED DEC INDICATING THAT A CLEANUP WAS
 NOT COMPLETED AS REPORTED ON 1/03/97. MRS. BANTHAM COMPLAINED OF VERY STRONG
 PETROLEUM ODORS IN HER RESIDENCE PRESENTLY VACANT) AND HER NEIGHBORS.
 2/24/97: >DEC, KATZ CONTACTED JAY CENTO OF WHALECO, THE SPILLER WHO INDICATED
 THE REASON FOR THE OVERFLOW INTO THE BASEMENT WAS CAUSED BY THE VENT NOT
 EXTENDING OUTSIDE THE BUILDING. WHALECO CONTENTS THEY CLEANED UP THE SPILL AND
 CLAIMS THERE IS ALSO ANOTHER SOURCE. 2/28/97: >DEC, KATZ AND SIGONA MEET
 MRS. BANTHAM AND TWO REPS ANTHONY AL) FROM WHALECO AND INFORMED THEM THAT
 THEY MUST COMPLETE THE CLEANUP. SIGONA EXPLAINED THE REQUIREMENTS FOR ADEQUATE
 CLEANUP AND WHALECO S REPS INDICATED THAT THEY WOULD HAVE TO CONTACT THEIR
 INSURANCE COMPANY AND HIRE A CLEANUP CONTRACTOR. >INFORMED MRS.BANTHAM
 THAT SHE IS RESPONSIBLE FOR EXTENDING THE VENT LINE AND MAINTANENCE OF THE 550
 GALLON TANK AND FILL. 3/13/97: >TRANSFERRED FROM KATZ TO SIGONA.
 >RECIEVED CALL FROM MRS. BANTHAM. SHE INDICATED THAT SHE MET WITH CONTRACTORS
 ON 3/6/97 BUT HAVE NOT RETURNED TO COMPLETE THE WORK. SHE ASKED DEC TO
 INTERVENE ON HER BEHALF AND FIND OUT THE STATUS OF THE PROJECT. >SIGONA
 CONTACTED WHALECO. CONTRACTOR TO SUBMIT WORKPLAN FOR REVIEW PRIOR TO
 COMMENCEMENT OF WORK. SIGONA WILL RETURN TO SITE FOR FOLLOWUP INSPECTION WHEN
 CLEANUP IS COMPLETED.
Remark: OIL CO MADE DELIVERY TO DWELLING OF 2 OIL-OIL CAME BACK OUT OF VENT ON TOP OF
 THE TANK-HAS BEEN CLEANED UP

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

Site Database(s) EDR ID Number
EPA ID Number

209
NNW
1/4-1/2
1713 ft.

575 W 159TH ST
575 W 159TH ST
NEW YORK, NY

LTANKS S105998072
N/A

Relative:
Higher

LTANKS:

Actual:
127 ft.

Site ID: 87747
Spill Date: 02/03/03
Facility Addr2: Not reported
Facility ID: 0211009
Program Number: 0211009
SWIS: 3101
Region of Spill: 2
Investigator: Needs Reassignment
Referred To: Not reported
Reported to Dept: 02/03/03
CID: 15
Spill Cause: Tank Failure
Water Affected: Not reported
Spill Source: Commercial/Industrial
Spill Notifier: Local Agency
Cleanup Ceased: / /
Cleanup Meets Standard: False
Last Inspection: / /
Recommended Penalty: Penalty Not Recommended
UST Involvement: False
Spill Class: Known release that creates potential for fire or hazard. DEC Response.
Unknown Responsible Party. Corrective action taken. (ISR)
Spill Closed Dt: / /
Remediation Phase: 1
Date Entered In Computer: 02/03/03
Spill Record Last Update: 03/14/06
Spille Namer: MARY REBINO
Spiller Company: Not reported
Spiller Phone: (212) 923-4103
Spiller Extention: Not reported
Spiller Address: 575 W 159TH ST
Spiller City,St,Zip: NEW YORK, ZZ
Spiller County: 001
Spiller Contact: MARY REBINO
Spiller Phone: (212) 923-4103
Spiller Extention: Not reported
DEC Region: 2
Program Number: 0211009
DER Facility ID: 80364
Site ID: 87747
Operable Unit ID: 864221
Operable Unit: 01
Material ID: 514374
Material Code: 0003
Material Name: #6 Fuel Oil
Case No.: Not reported
Material FA: Petroleum
Quantity: 75.00
Units: Gallons
Recovered: 0.00
Resource Affected: Soil
Oxygenate: False
Site ID: Not reported

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

575 W 159TH ST (Continued)

EDR ID Number
EPA ID Number

Database(s)

S105998072

Spill Tank Test: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate: Not reported
Gross Fail: Not reported
Modified By: Not reported
Last Modified: Not reported
Test Method: Not reported
DEC Memo: Start DECRemark - 0211009 Prior to Sept, 2004 data translation this spill Lead DEC Field was "SAWYER" DEC Sigona could not locate PBS registration for this site. 1/7/04-Vought-Spill transferred from Vought to Austin. 01/27/04 - Sawyer - Spilltransferred from Austin to Sawyer. 8/2/05- temporary transferred lead to Woodward 8/26/05- reviewed of file-contain notes implying work may have been already done but verification is needed. Tried calling and leaving message but no return calls. 2/06 Sent letter to Mary Rodino asking for information on the spill to verify that work was truly done. 3/14/06 no response to letter has been recieved. END DECRemark - 0211009
Remarks: Start CallerRemark - 0211009 Tank failure causing spill to basement - caller is having a hard time getting a hold of anyone to approve work to be done for clean up END CallerRemark - 0211009

210
SW
1/4-1/2
1744 ft.

APARTMENT BLDG AT
428 CONVENT AVE
MANHATTAN, NY

LTANKS
HIST LTANKS

S103558423
N/A

Relative:
Higher

Actual:
112 ft.

LTANKS:
Site ID: 76157
Spill Date: 11/14/98
Facility Addr2: Not reported
Facility ID: 9810289
Program Number: 9810289
SWIS: 3101
Region of Spill: 2
Investigator: MMMULQUE
Referred To: Not reported
Reported to Dept: 11/14/98
CID: 15
Spill Cause: Tank Overfill
Water Affected: Not reported
Spill Source: Private Dwelling
Spill Notifier: Affected Persons
Cleanup Ceased: / /
Cleanup Meets Standard: False
Last Inspection: / /
Recommended Penalty: Penalty Not Recommended
UST Involvement: False
Spill Class: Known release that creates potential for fire or hazard. DEC Response. Unable/unwilling Responsible Party. Corrective action taken. (ISR)
Spill Closed Dt: 11/30/98
Remediation Phase: 0
Date Entered In Computer: 11/14/98
Spill Record Last Update: 12/02/98
Spille Namer: KONATA S. RAGIN
Spiller Company: MEE-I-ENERGY, INC
Spiller Phone: (718) 991-3002
Spiller Extention: Not reported

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

APARTMENT BLDG AT (Continued)

EDR ID Number
EPA ID Number

Database(s)

S103558423

Spiller Address: 433-37 BARRETTO STREET
Spiller City,St,Zip: BRONX, NY
Spiller County: 001
Spiller Contact: ANNIE JONES
Spiller Phone: (212) 283-0750
Spiller Extention: Not reported
DEC Region: 2
Program Number: 9810289
DER Facility ID: 71236
Site ID: 76157
Operable Unit ID: 1071207
Operable Unit: 01
Material ID: 314152
Material Code: 0001
Material Name: #2 Fuel Oil
Case No.: Not reported
Material FA: Petroleum
Quantity: 0.00
Units: Gallons
Recovered: 0.00
Resource Affected: Soil
Oxygenate: False
Site ID: Not reported
Spill Tank Test: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate: Not reported
Gross Fail: Not reported
Modified By: Not reported
Last Modified: Not reported
Test Method: Not reported
DEC Memo: Start DECRemark - 9810289 Prior to Sept, 2004 data translation this spill Lead
DEC Field was "MULQUEEN" MULQUEEN RESPONDED TO SPILL AND FOUND STRONG FUEL OIL
ODOR IN BUILDING AND OIL IN BASEMENT, ON FLOOR, OIL AND SPEEDI DRY BY FILL PIPE
AND VENT.1ST FLOOR RESIDENT HAS EMPHYZEMA AND SMALL CHILDREN IN HOUSE. MULQUEEN
CONTACTED SPILLER (MEE-I-ENERGY). SPILLER, KONATA RAGIN WHO TOLD MULQUEEN THAT
HIS NAME WAS STEVEN JONES, PROVIDING FALSE INFORMATION TO STATE INSPECTOR.
KONATA RAGIN AND OTHERDRIVER RETURNED TO SPILL SITE, REMOVED SATURATED SPEEDI
DRY, RE-APPLIED, SWEPT, REMOVED OIL SATURATED INSULATION FROM SPACE ABOVE TANK
AND WAS TO REPLACE. ALLIED WASTE SVC REMOVED CONTAMINATED MAT'LS.
MEE-I-ENERGY GIVEN STRICT WARNING FOR FAILURE TO NOTIFY, FAILURE TO CONTAIN AND
CLEAN UP SPILL IN A TIMELY FASHION. MR. RAGIN WAS TOLD THAT IF HE DOES THIS
AGAIN, THEN FULL AND POSSIBLY CRIMINAL CHARGES WILL BE LEVIED. END DECRemark
- 9810289
Remarks: Start CallerRemark - 9810289 oil company spilled oil onto gate and into
basement of location there is also a drain which may go into sewer - comp
states it is a significant quantity and no cleanup has occurred - sand has been
spread but odor has madedwelling uninhabitable END CallerRemark - 9810289
HIST LTANKS:
Region of Spill: 2
Spill Number: 9810289
Investigator: MULQUEEN
Caller Name: Not reported
Caller Agency: Not reported
Caller Phone: Not reported

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s)
EDR ID Number
EPA ID Number

APARTMENT BLDG AT (Continued)

S103558423

Caller Extension: Not reported
Notifier Name: Not reported
Notifier Agency: Not reported
Notifier Phone: Not reported
Notifier Extension: Not reported
Spill Date: 11/14/1998
Spill Time: 12:00
Reported to Department Date: 11/14/98
Reported to Department Time: 18:29
SWIS: 62
Spiller Contact: ANNIE JONES
Spiller Phone: (212) 283-0750
Spiller Extension: Not reported
Spiller Name: MEE-I-ENERGY, INC
Spiller Address: 433-37 BARRETTO STREET
Spiller City,St,Zip: BRONX, NY
Facility Contact: KONATA S. RAGIN
Facility Phone: (718) 991-3002
Facility Extension: Not reported
Spill Cause: Tank Overfill
Resource Affectd: On Land
Water Affected: Not reported
Spill Source: Private Dwelling
Spill Notifier: Affected Persons
PBS Number: Not reported
Cleanup Ceased: / /
Cleanup Meets Standard: False
Last Inspection: / /
Recommended Penalty: Penalty Not Recommended
Spiller Cleanup Date: / /
Enforcement Date: / /
Investigation Complete: / /
UST Involvement: False
Spill Class: Known release that creates potential for fire or hazard. DEC Response.
Unable/unwilling Responsible Party. Corrective action taken. (ISR)
Spill Closed Dt: 11/30/98
Date Region Sent Summary to Central Office: / /
Corrective Action Plan Submitted: / /
Date Spill Entered In Computer Data File: 11/14/98
Time Spill Entered In Computer Data File: Not reported
Spill Record Last Update: 12/02/98
Is Updated: False
PBS Number: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate Failed Tank: Not reported
Gross Leak Rate: Not reported
Material Class Type: Petroleum
Quantity Spilled: 0
Unkonwn Quantity Spilled: True
Units: Gallons
Quantity Recovered: 0
Unkonwn Quantity Recovered: False
Material: #2 FUEL OIL
Class Type: #2 FUEL OIL
Times Material Entry In File: 24464

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

APARTMENT BLDG AT (Continued)

S103558423

CAS Number: Not reported
Last Date: 19941207
DEC Remarks: MULQUEEN RESPONDED TO SPILL AND FOUND STRONG FUEL OIL ODOR IN BUILDING AND OIL IN BASEMENT, ON FLOOR, OIL AND SPEEDI DRY BY FILL PIPE AND VENT. 1ST FLOOR RESIDENT HAS EMPHYZEMA AND SMALL CHILDREN IN HOUSE. MULQUEEN CONTACTED SPILLER (MEE-I-ENERGY). SPILLER, KONATA RAGIN WHO TOLD MULQUEEN THAT HIS NAME WAS STEVEN JONES, PROVIDING FALSE INFORMATION TO STATE INSPECTOR. KONATA RAGIN AND OTHER DRIVER RETURNED TO SPILL SITE, REMOVED SATURATED SPEEDI DRY, RE-APPLIED, SWEEPED, REMOVED OIL SATURATED INSULATION FROM SPACE ABOVE TANK AND WAS TO REPLACE. ALLIED WASTE SVC REMOVED CONTAMINATED MAT LS. MEE-I-ENERGY GIVEN STRICT WARNING FOR FAILURE TO NOTIFY, FAILURE TO CONTAIN AND CLEAN UP SPILL IN A TIMELY FASHION. MR. RAGIN WAS TOLD THAT IF HE DOES THIS AGAIN, THEN FULL AND POSSIBLY CRIMINAL CHARGES WILL BE LEVIED.
Spill Cause: oil company spilled oil onto gate and into basement of location there is also a drain which may go into sewer - comp states it is a significant quantity and no cleanup has occurred - sand has been spread but odor has made dwelling uninhabitable

AV211
SE
1/4-1/2
1754 ft.

99 MACOMBS PL/MANH/USPS
99 MACOMBS PLACE
NEW YORK CITY, NY

LTANKS S100167764
HIST LTANKS N/A

Site 1 of 2 in cluster AV

Relative:
Lower

LTANKS:

Actual:
31 ft.

Site ID: 281144
Spill Date: 06/23/89
Facility Addr2: Not reported
Facility ID: 8907091
Program Number: 8907091
SWIS: 3101
Region of Spill: 2
Investigator: BATTISTA
Referred To: Not reported
Reported to Dept: 10/18/89
CID: 15
Spill Cause: Tank Test Failure
Water Affected: Not reported
Spill Source: Commercial/Industrial
Spill Notifier: Responsible Party
Cleanup Ceased: 10/07/92
Cleanup Meets Standard: False
Last Inspection: / /
Recommended Penalty: Penalty Not Recommended
UST Involvement: False
Spill Class: Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken.
Spill Closed Dt: 10/07/92
Remediation Phase: 0
Date Entered In Computer: 10/20/89
Spill Record Last Update: 02/15/94
Spille Namer: Not reported
Spiller Company: U S POSTAL SERVICE
Spiller Phone: (212) 330-3125
Spiller Extention: Not reported
Spiller Address: Not reported
Spiller City,St,Zip: ZZ
Spiller County: 001

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s) EDR ID Number
EPA ID Number

99 MACOMBS PL/MANH/USPS (Continued)

S100167764

Spiller Contact: Not reported
Spiller Phone: Not reported
Spiller Extention: Not reported
DEC Region: 2
Program Number: 8907091
DER Facility ID: 228280
Site ID: 281144
Operable Unit ID: 934837
Operable Unit: 01
Material ID: 443890
Material Code: 0066A
Material Name: UNKNOWN PETROLEUM
Case No.: Not reported
Material FA: Petroleum
Quantity: -1.00
Units: Not reported
Recovered: 0.00
Resource Affected: Groundwater
Oxygenate: False
Site ID: 281144
Spill Tank Test: 1536264
Tank Number: Not reported
Tank Size: 0
Test Method: 00
Leak Rate: 0.00
Gross Fail: Not reported
Modified By: Spills
Last Modified: 10/01/04
Test Method: Unknown
DEC Memo: Not reported
Remarks: Start CallerRemark - 8907091 1.5K TANK FAILED WITH A LEAK RATE OF .588GPH, TEST METHOD (VPLT). END CallerRemark - 8907091

HIST LTANKS:

Region of Spill: 2
Spill Number: 8907091
Investigator: BATTISTA
Caller Name: Not reported
Caller Agency: Not reported
Caller Phone: Not reported
Caller Extension: Not reported
Notifier Name: Not reported
Notifier Agency: Not reported
Notifier Phone: Not reported
Notifier Extension: Not reported
Spill Date: 06/23/1989
Spill Time: 15:30
Reported to Department Date: 10/18/89
Reported to Department Time: 17:09
SWIS: 62
Spiller Contact: Not reported
Spiller Phone: Not reported
Spiller Extention: Not reported
Spiller Name: U S POSTAL SERVICE
Spiller Address: Not reported
Spiller City,St,Zip: Not reported
Facility Contact: Not reported

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

99 MACOMBS PL/MANH/USPS (Continued)

EDR ID Number
EPA ID Number

Database(s)

S100167764

Facility Phone: (212) 330-3125
Facility Extension: Not reported
Spill Cause: Tank Test Failure
Resource Affectd: Groundwater
Water Affected: Not reported
Spill Source: Other Commercial/Industrial
Spill Notifier: Responsible Party
PBS Number: 2-476099
Cleanup Ceased: 10/07/92
Cleanup Meets Standard: False
Last Inspection: / /
Recommended Penalty: Penalty Not Recommended
Spiller Cleanup Date: / /
Enforcement Date: / /
Investigation Complete: / /
UST Involvement: False
Spill Class: Known release with minimal potential for fire or hazard. DEC Response.
Willing Responsible Party. Corrective action taken.
Spill Closed Dt: 10/07/92
Date Region Sent Summary to Central Office: / /
Corrective Action Plan Submitted: / /
Date Spill Entered In Computer Data File: 10/20/89
Time Spill Entered In Computer Data File: Not reported
Spill Record Last Update: 02/15/94
Is Updated: False
PBS Number: Not reported
Tank Number: Not reported
Tank Size: 0
Test Method: Not reported
Leak Rate Failed Tank: 0.00
Gross Leak Rate: Not reported
Material Class Type: Petroleum
Quantity Spilled: -1
Unkonwn Quantity Spilled: False
Units: Not reported
Quantity Recovered: 0
Unkonwn Quantity Recovered: False
Material: UNKNOWN PETROLEUM
Class Type: UNKNOWN PETROLEUM
Times Material Entry In File: 16414
CAS Number: Not reported
Last Date: 19940929
DEC Remarks: Not reported
Spill Cause: 1.5K TANK FAILED WITH A LEAK RATE OF .588GPH, TEST METHOD VPLT).

AV212
SE
1/4-1/2
1754 ft.

99 MACCOMBS PL/MANH/USPS
99 MACCOMBS PLACE
NEW YORK CITY, NY

LTANKS S104275541
HIST LTANKS N/A

Site 2 of 2 in cluster AV

Relative:
Lower

LTANKS:
Site ID: 188977
Spill Date: 06/23/89
Facility Addr2: Not reported
Facility ID: 8903078
Program Number: 8903078
SWIS: 3101

Actual:
31 ft.

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

99 MACCOMBS PL/MANH/USPS (Continued)

EDR ID Number
EPA ID Number

Database(s)

S104275541

Region of Spill: 2
Investigator: BATTISTA
Referred To: Not reported
Reported to Dept: 06/23/89
CID: 15
Spill Cause: Tank Test Failure
Water Affected: Not reported
Spill Source: Commercial/Industrial
Spill Notifier: Other
Cleanup Ceased: 10/07/92
Cleanup Meets Standard: False
Last Inspection: / /
Recommended Penalty: Penalty Not Recommended
UST Involvement: True
Spill Class: Known release with minimal potential for fire or hazard. DEC Response.
Willing Responsible Party. Corrective action taken.
Spill Closed Dt: 10/07/92
Remediation Phase: 0
Date Entered In Computer: 10/16/89
Spill Record Last Update: 02/15/94
Spille Namer: Not reported
Spiller Company: Not reported
Spiller Phone: Not reported
Spiller Extention: Not reported
Spiller Address: Not reported
Spiller City,St,Zip: ***Update***, ZZ
Spiller County: 001
Spiller Contact: Not reported
Spiller Phone: Not reported
Spiller Extention: Not reported
DEC Region: 2
Program Number: 8903078
DER Facility ID: 157813
Site ID: 188977
Operable Unit ID: 930565
Operable Unit: 01
Material ID: 450742
Material Code: 0001
Material Name: #2 Fuel Oil
Case No.: Not reported
Material FA: Petroleum
Quantity: -1.00
Units: Not reported
Recovered: 0.00
Resource Affected: Groundwater
Oxygenate: False
Site ID: 188977
Spill Tank Test: 1535635
Tank Number: Not reported
Tank Size: 0
Test Method: 00
Leak Rate: 0.00
Gross Fail: Not reported
Modified By: Spills
Last Modified: 10/01/04
Test Method: Unknown
DEC Memo: Not reported

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s)
EDR ID Number
EPA ID Number

99 MACCOMBS PL/MANH/USPS (Continued)

S104275541

Remarks: Start CallerRemark - 8903078 1.5K TANK FAILED WITH A LEAK RATE OF .5GPH. END
CallerRemark - 8903078

HIST LTANKS:

Region of Spill: 2
Spill Number: 8903078
Investigator: BATTISTA
Caller Name: Not reported
Caller Agency: Not reported
Caller Phone: Not reported
Caller Extension: Not reported
Notifier Name: Not reported
Notifier Agency: Not reported
Notifier Phone: Not reported
Notifier Extension: Not reported
Spill Date: 06/23/1989
Spill Time: 14:00
Reported to Department Date: 06/23/89
Reported to Department Time: 16:43
SWIS: 62
Spiller Contact: Not reported
Spiller Phone: Not reported
Spiller Extension: Not reported
Spiller Name: Not reported
Spiller Address: Not reported
Spiller City,St,Zip: Not reported
Facility Contact: Not reported
Facility Phone: () -
Facility Extension: Not reported
Spill Cause: Tank Test Failure
Resource Affectd: Groundwater
Water Affected: Not reported
Spill Source: Other Commercial/Industrial
Spill Notifier: Other
PBS Number: 2-476099
Cleanup Ceased: 10/07/92
Cleanup Meets Standard: False
Last Inspection: / /
Recommended Penalty: Penalty Not Recommended
Spiller Cleanup Date: / /
Enforcement Date: / /
Investigation Complete: / /
UST Involvement: True
Spill Class: Known release with minimal potential for fire or hazard. DEC Response.
Willing Responsible Party. Corrective action taken.
Spill Closed Dt: 10/07/92
Date Region Sent Summary to Central Office: / /
Corrective Action Plan Submitted: / /
Date Spill Entered In Computer Data File: 10/16/89
Time Spill Entered In Computer Data File: Not reported
Spill Record Last Update: 02/15/94
Is Updated: False
PBS Number: Not reported
Tank Number: Not reported
Tank Size: 0
Test Method: Not reported
Leak Rate Failed Tank: 0.00

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s)
EDR ID Number
EPA ID Number

99 MACCOMBS PL/MANH/USPS (Continued)

S104275541

Gross Leak Rate: Not reported
Material Class Type: Petroleum
Quantity Spilled: -1
Unkonwn Quantity Spilled: False
Units: Not reported
Quantity Recovered: 0
Unkonwn Quantity Recovered: False
Material: #2 FUEL OIL
Class Type: #2 FUEL OIL
Times Material Entry In File: 24464
CAS Number: Not reported
Last Date: 19941207
DEC Remarks: Not reported
Spill Cause: 1.5K TANK FAILED WITH A LEAK RATE OF .5GPH.

213 APRT BUILDING
NNW 555 W. 160TH ST
1/4-1/2 NEW YORK, NY
1764 ft.

LTANKS S107789192
N/A

Relative:
Higher

LTANKS:

Actual:
146 ft.

Site ID: 362746
Spill Date: 04/18/06
Facility Addr2: Not reported
Facility ID: 0600682
Program Number: 0600682
SWIS: 3101
Region of Spill: 2
Investigator: HRPATEL
Referred To: Not reported
Reported to Dept: 04/18/06
CID: 15
Spill Cause: Tank Test Failure
Water Affected: Not reported
Spill Source: Private Dwelling
Spill Notifier: Tank Tester
Cleanup Ceased: / /
Cleanup Meets Standard: False
Last Inspection: / /
Recommended Penalty: Penalty Not Recommended
UST Involvement: False
Spill Class: Known release with minimal potential for fire or hazard. DEC Response.
Willing Responsible Party. Corrective action taken.
Spill Closed Dt: 07/12/06
Remediation Phase: 0
Date Entered In Computer: 04/18/06
Spill Record Last Update: 06/12/07
Spille Namer: MARLIN JOSEPH
Spiller Company: APRT BUILDING
Spiller Phone: (646) 772-7949
Spiller Extention: Not reported
Spiller Address: 555 WEST 160 STREET
Spiller City,St,Zip: NEW YORK, NY
Spiller County: 001
Spiller Contact: MARLIN JOSEPH
Spiller Phone: (646) 772-7949
Spiller Extention: Not reported
DEC Region: 2

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

EDR ID Number
EPA ID Number

Database(s)

APRT BUILDING (Continued)

S107789192

Program Number: 0600682
DER Facility ID: 312976
Site ID: 362746
Operable Unit ID: 1120815
Operable Unit: 01
Material ID: 2110311
Material Code: 0002
Material Name: #4 Fuel Oil
Case No.: Not reported
Material FA: Petroleum
Quantity: 0.00
Units: Gallons
Recovered: 0.00
Resource Affected: Soil
Oxygenate: False
Site ID: 362746
Spill Tank Test: 1549896
Tank Number: 1
Tank Size: 5000
Test Method: 03
Leak Rate: 0.00
Gross Fail: Not reported
Modified By: Watchdog
Last Modified: 04/18/06
Test Method: Horner EZ Check I or II
DEC Memo: Start DECRemark - 0600682 04/18/06-Hiralkumar Patel. Spoke with Marlin Joseph (FAX: 718-858-4268) at Petroleum. property has 5000 gal AST in concrete vault. they did test today and waiting to hear from owner. Mr. Joseph was on road, so once he reachoffice, he will call with the information about owner's name and number. 04/19/06-Hiralkumar Patel. spoke with Mr. Joseph at Petroleum. they did tests for Approved Oil Company Of Brooklyn Incorporated (Ph.: 718-238-1050, FAX: 718-238-1053)). Spoke with Mr. Vinny S. at Approved Oil and he gave following information about owner: Jessica Castro Beach Lane Management 555 W 160th Street LLC 280 N Central Park Ave, Suite 210 Hartsdale, NY 10530-1841 Ph. (914) 997-2435 email: jcastro@aptsny.com and Property Manager is: Mark Scharfman (Ph.: 914-997-2435 Ext. 131, FAX: 914-997-2486). 04/20/06-Hiralkumar Patel. Spoke with Mr. Scharfam. TTF letter sent out to Mr. Scharfman. faxed copy to Mr. Scharfman at Beach Lane Management, toMarlin Joseph at Petroleum & to Vinny S. at Approved Oil. 06/06/06-Hiralkumar Patel. Spoke to Vinny S. at approved oil. as per him, petroleum has removed tank and took samples. spoke to Diana at petroleum. they have removed tank but hasn't took any samples. they put proposal for endpoint samples and new tank installation. haven't heard after that. tried property manager's number but it was busy. 07/10/06-Hiralkumar Patel. Left message for Mark. 07/12/06-Hiralkumar Patel. received messagefrom Jessica Castro (914-997-2435 Ext. 118). Left message for Ms. Castro. received call from Ms. Castro. she will talk to person who handles tank at site and will call back. received call from Vincent Theurer (718-238-1050). as per Vincent, tank was aboveground. tank has removed and there is no visible sign of oil on concrete where tank was located. Vincent has submitted required documents to the Department to update PBS records. PBS#: 2-257052 tank was aboveground and had dry leak. haven't found any sign of oil leak after tank removal. based on this information, case closed. 06/12/07-Hiralkumar Patel. received call from Jessica Castro from management office asking for NFA letter. letter emailed to Ms. Castro. END DECRemark - 0600682
Remarks: Start CallerRemark - 0600682 above liquid leak END CallerRemark - 0600682

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

214
West
1/4-1/2
1942 ft.

APT COMPLEX
610 WEST 152ND ST
MANHATTAN, NY

LTANKS
HIST LTANKS

EDR ID Number
EPA ID Number

S105054974
N/A

Relative:
Higher

Actual:
124 ft.

LTANKS:

Site ID: 230589
Spill Date: 05/30/01
Facility Addr2: Not reported
Facility ID: 0102252
Program Number: 0102252
SWIS: 3101
Region of Spill: 2
Investigator: MXTIPPLE
Referred To: Not reported
Reported to Dept: 05/30/01
CID: 15
Spill Cause: Tank Overfill
Water Affected: Not reported
Spill Source: Private Dwelling
Spill Notifier: Fire Department
Cleanup Ceased: / /
Cleanup Meets Standard: False
Last Inspection: / /
Recommended Penalty: Penalty Not Recommended
UST Involvement: False
Spill Class: Known release with minimal potential for fire or hazard. DEC Response.
Willing Responsible Party. Corrective action taken.
Spill Closed Dt: 08/07/03
Remediation Phase: 0
Date Entered In Computer: 05/30/01
Spill Record Last Update: 08/07/03
Spille Namer: Not reported
Spiller Company: EASTMAN FUEL
Spiller Phone: Not reported
Spiller Extention: Not reported
Spiller Address: Not reported
Spiller City,St,Zip: ZZ
Spiller County: 001
Spiller Contact: EASTMAN
Spiller Phone: Not reported
Spiller Extention: Not reported
DEC Region: 2
Program Number: 0102252
DER Facility ID: 190033
Site ID: 230589
Operable Unit ID: 839086
Operable Unit: 01
Material ID: 534367
Material Code: 0003
Material Name: #6 Fuel Oil
Case No.: Not reported
Material FA: Petroleum
Quantity: 50.00
Units: Gallons
Recovered: 50.00
Resource Affected: Soil
Oxygenate: False
Site ID: Not reported

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

APT COMPLEX (Continued)

S105054974

Spill Tank Test: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate: Not reported
Gross Fail: Not reported
Modified By: Not reported
Last Modified: Not reported
Test Method: Not reported
DEC Memo: Start DECRemark - 0102252 Prior to Sept, 2004 data translation this spill Lead
DEC Field was "TIPPLE" 8/6/03 tippie closing//reference spill # 01-02246// same
incident/FDNY called second number in for incident at 3671 Broadway. END
DECRemark - 0102252
Remarks: Start CallerRemark - 0102252 CALLER STATES THERE WAS AN OVERFILL OF A FUEL
TANK. IT HAS ALL BEEN CLEANED END CallerRemark - 0102252

HIST LTANKS:

Region of Spill: 2
Spill Number: 0102252
Investigator: TIPPLE
Caller Name: Not reported
Caller Agency: Not reported
Caller Phone: Not reported
Caller Extension: Not reported
Notifier Name: Not reported
Notifier Agency: Not reported
Notifier Phone: Not reported
Notifier Extension: Not reported
Spill Date: 05/30/2001
Spill Time: 08:30
Reported to Department Date: 05/30/01
Reported to Department Time: 09:41
SWIS: 62
Spiller Contact: EASTMAN
Spiller Phone: () -
Spiller Extension: Not reported
Spiller Name: EASTMAN FUEL
Spiller Address: Not reported
Spiller City,St,Zip: Not reported
Facility Contact: Not reported
Facility Phone: () -
Facility Extension: Not reported
Spill Cause: Tank Overfill
Resource Affectd: On Land
Water Affected: Not reported
Spill Source: Private Dwelling
Spill Notifier: Fire Department
PBS Number: Not reported
Cleanup Ceased: / /
Cleanup Meets Standard: False
Last Inspection: / /
Recommended Penalty: Penalty Not Recommended
Spiller Cleanup Date: / /
Enforcement Date: / /
Investigation Complete: / /
UST Involvement: False
Spill Class: Known release with minimal potential for fire or hazard. DEC Response.

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s)
EDR ID Number
EPA ID Number

APT COMPLEX (Continued)

S105054974

Willing Responsible Party. Corrective action taken.
Spill Closed Dt: / /
Date Region Sent Summary to Central Office: / /
Corrective Action Plan Submitted: / /
Date Spill Entered In Computer Data File: 05/30/01
Time Spill Entered In Computer Data File: Not reported
Spill Record Last Update: 05/30/01
Is Updated: False
PBS Number: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate Failed Tank: Not reported
Gross Leak Rate: Not reported
Material Class Type: Petroleum
Quantity Spilled: 50
Unkonwn Quantity Spilled: False
Units: Gallons
Quantity Recovered: 50
Unkonwn Quantity Recovered: False
Material: #6 FUEL OIL
Class Type: #6 FUEL OIL
Times Material Entry In File: 2190
CAS Number: Not reported
Last Date: 19940728
DEC Remarks: Not reported
Spill Cause: CALLER STATES THERE WAS AN OVERFILL OF A FUEL TANK. IT HAS ALL BEEN CLEANED

AW215
NNE
1/4-1/2
1971 ft.

APARTMENT
596 EDGEcombe AVE
MANHATTAN, NY

LTANKS S106702855
N/A

Site 1 of 2 in cluster AW

Relative:
Higher

Actual:
168 ft.

LTANKS:
Site ID: 185349
Spill Date: 09/23/04
Facility Addr2: Not reported
Facility ID: 0406940
Program Number: 0406940
SWIS: 3101
Region of Spill: 2
Investigator: CESAWYER
Referred To: Not reported
Reported to Dept: 09/23/04
CID: 15
Spill Cause: Tank Failure
Water Affected: Not reported
Spill Source: Private Dwelling
Spill Notifier: Fire Department
Cleanup Ceased: / /
Cleanup Meets Standard: False
Last Inspection: / /
Recommended Penalty: Penalty Not Recommended
UST Involvement: False
Spill Class: Possible release with minimal potential for fire or hazard or Known release with no damage. DEC Response. Willing Responsible Party. Corrective action taken.

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

APARTMENT (Continued)

EDR ID Number
EPA ID Number

Database(s)

S106702855

Spill Closed Dt: 10/08/04
Remediation Phase: 0
Date Entered In Computer: 09/23/04
Spill Record Last Update: 10/08/04
Spille Namer: DISPATCHER CALL
Spiller Company: APARTMENT
Spiller Phone: (212) 628-2900
Spiller Extention: Not reported
Spiller Address: 596 EDGECOMBE AVE
Spiller City,St,Zip: MANHATEEN, NY
Spiller County: 001
Spiller Contact: DISPATCHER CALL
Spiller Phone: (212) 628-2900
Spiller Extention: Not reported
DEC Region: 2
Program Number: 0406940
DER Facility ID: 155017
Site ID: 185349
Operable Unit ID: 890283
Operable Unit: 01
Material ID: 484757
Material Code: 0001
Material Name: #2 Fuel Oil
Case No.: Not reported
Material FA: Petroleum
Quantity: 0.00
Units: Pounds
Recovered: 0.00
Resource Affected: Soil
Oxygenate: False
Site ID: 185349
Operable Unit ID: 890283
Operable Unit: 01
Material ID: 484756
Material Code: 0001
Material Name: #2 Fuel Oil
Case No.: Not reported
Material FA: Petroleum
Quantity: 0.00
Units: Not reported
Recovered: 0.00
Resource Affected: Soil
Oxygenate: False
Site ID: Not reported
Spill Tank Test: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate: Not reported
Gross Fail: Not reported
Modified By: Not reported
Last Modified: Not reported
Test Method: Not reported
DEC Memo: Start DECRemark - 0406940 Prior to Sept, 2004 data translation this spill Lead
DEC Field was "SAWYER" 9/23/04 Please refer to spill number #0406051.
Closed. END DECRemark - 0406940
Remarks: Start CallerRemark - 0406940 CROSS STREETS ARE: WEST 162 & WEST 163 STREET:

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

APARTMENT (Continued)

S106702855

THEY ARE REMOVING IT FROM A BASEMENT, AND FIRE DEPT. IS ON SCENE , BUT THEY
WOULD LIKE YOU TO RESPOND: END CallerRemark - 0406940

AW216
NNE
1/4-1/2
1971 ft.

596 EDGECOMBE AVE
596 EDGECOMBE AVE
NEW YORK, NY

LTANKS S106702669
N/A

Site 2 of 2 in cluster AW

Relative:
Higher

Actual:
168 ft.

LTANKS:

Site ID: 203353
Spill Date: 09/01/04
Facility Addr2: Not reported
Facility ID: 0406051
Program Number: 0406051
SWIS: 3101
Region of Spill: 2
Investigator: CESAUYER
Referred To: Not reported
Reported to Dept: 09/01/04
CID: 15
Spill Cause: Tank Test Failure
Water Affected: Not reported
Spill Source: Institutional, Educational, Gov., Other
Spill Notifier: Tank Tester
Cleanup Ceased: / /
Cleanup Meets Standard: False
Last Inspection: / /
Recommended Penalty: Penalty Not Recommended
UST Involvement: False
Spill Class: Possible release with minimal potential for fire or hazard or Known
release with no damage. DEC Response. Willing Responsible Party.
Corrective action taken.
Spill Closed Dt: 10/18/04
Remediation Phase: 0
Date Entered In Computer: 09/01/04
Spill Record Last Update: 10/18/04
Spille Namer: T. BURCH
Spiller Company: Not reported
Spiller Phone: (212) 795-3258
Spiller Extention: Not reported
Spiller Address: 596 EDGECOMB AVE
Spiller City,St,Zip: NEW YORK, NY
Spiller County: 001
Spiller Contact: T. BURCH
Spiller Phone: (212) 795-3258
Spiller Extention: Not reported
DEC Region: 2
Program Number: 0406051
DER Facility ID: 169141
Site ID: 203353
Operable Unit ID: 888703
Operable Unit: 01
Material ID: 487007
Material Code: 0002
Material Name: #4 Fuel Oil
Case No.: Not reported
Material FA: Petroleum

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

EDR ID Number
EPA ID Number
Database(s)

596 EDGECOMBE AVE (Continued)

S106702669

Quantity: 0.00
Units: Pounds
Recovered: 0.00
Resource Affected: Soil
Oxygenate: False
Site ID: 203353
Operable Unit ID: 888703
Operable Unit: 01
Material ID: 487006
Material Code: 0002
Material Name: #4 Fuel Oil
Case No.: Not reported
Material FA: Petroleum
Quantity: 0.00
Units: Not reported
Recovered: 0.00
Resource Affected: Soil
Oxygenate: False
Site ID: 203353
Spill Tank Test: 1529627
Tank Number: Not reported
Tank Size: 6000
Test Method: 03
Leak Rate: 0.00
Gross Fail: Not reported
Modified By: Spills
Last Modified: 10/01/04
Test Method: Horner EZ Check I or II
DEC Memo: Start DECRemark - 0406051 Prior to Sept, 2004 data translation this spill Lead
DEC Field was "SAWYER" 9/2/2004 Super- Thurman Burch 212-795-3258
Owner: Eugene Zacerous 410-459-7206 P.O. Box 518 New
York, NY 10031 *****No PBS Record
on file***** 9/3/2004 Sangesland
spoke to Mr. Burch. He said the subject tank has been taken out of service and
a temp tank has been setup in the courtyard. The tank is being cleaned out and
will be repaired/retested. 9/23/2004 Fire Dept called in a new spill
number 0406940 from the site. Tank is being removed and FD wants someone from
DEC on site. 9/23/04 - Sawyer - Responded to the site to find the FDNY and
contract workers for Atlas outside the building. The FDNY chief onsite showed
me to a tank grave in the basement. The tank grave was concrete but was
covered with #2 Fuel Oil. The work was immediately stopped and the building
manger was ordered to get an environmental clean up crew to the asap. PTC was
called at 12:15 they arrived about 13:45. Big Anthony at PTC will send clean
end-point samples, a diagram and disposal information. 10/18/04 - Sawyer -
Received a closure report from Petroleum Tank Cleaners that includes clean
end-point samples analysis, a diagram and disposal information. No further
action is required. Closed. END DECRemark - 0406051
Remarks: Start CallerRemark - 0406051 tank test failed. strong feeling that the owner is
going to try and use this tank.tank is no good END CallerRemark - 0406051

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

217
SW
1/4-1/2
1975 ft.

APARMENT COMPLEX
505 W 148TH ST
MANHATTAN, NY

LTANKS
HIST LTANKS

EDR ID Number
EPA ID Number

S105055087
N/A

Relative:
Higher

LTANKS:

Actual:
128 ft.

Site ID: 273825
Spill Date: 06/14/01
Facility Addr2: Not reported
Facility ID: 0102829
Program Number: 0102829
SWIS: 3101
Region of Spill: 2
Investigator: jwantoni
Referred To: Not reported
Reported to Dept: 06/14/01
CID: 15
Spill Cause: Tank Test Failure
Water Affected: Not reported
Spill Source: Private Dwelling
Spill Notifier: Tank Tester
Cleanup Ceased: / /
Cleanup Meets Standard: True
Last Inspection: / /
Recommended Penalty: Penalty Not Recommended
UST Involvement: False
Spill Class: Known release that creates potential for fire or hazard. DEC Response.
Willing Responsible Party. Corrective action taken.
Spill Closed Dt: 06/07/06
Remediation Phase: 0
Date Entered In Computer: 06/14/01
Spill Record Last Update: 07/11/06
Spille Namer: SHAWN AARON
Spiller Company: APARTMENT COMPLEX
Spiller Phone: (631) 586-4900
Spiller Extention: Not reported
Spiller Address: 505 W 148TH ST
Spiller City,St,Zip: MANHATTAN, ZZ
Spiller County: 001
Spiller Contact: SHAWN AARON
Spiller Phone: (631) 586-4900
Spiller Extention: Not reported
DEC Region: 2
Program Number: 0102829
DER Facility ID: 222739
Site ID: 273825
Operable Unit ID: 841522
Operable Unit: 01
Material ID: 534936
Material Code: 0001
Material Name: #2 Fuel Oil
Case No.: Not reported
Material FA: Petroleum
Quantity: 0.00
Units: Gallons
Recovered: 0.00
Resource Affected: Soil
Oxygenate: False
Site ID: 273825

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

APARMENT COMPLEX (Continued)

S105055087

Spill Tank Test: 1526376
Tank Number: Not reported
Tank Size: 2000
Test Method: 03
Leak Rate: 0.00
Gross Fail: Not reported
Modified By: Spills
Last Modified: 10/01/04
Test Method: Horner EZ Check I or II
DEC Memo: Start DECRemark - 0102829 Prior to Sept, 2004 data translation this spill Lead
DEC Field was "TIPPLE" 8/4/03 TIPPLE SENT DOCUMENTATION REQUEST June 7,
2006 - 4:00 pm - Received documentation that the failed tank was fixed and
passed a second tank test July 20, 2001. Since no spillage or cleanup was
necessary, nor further action is needed and the site can be closed. Johnathan
Antonizio, NYSDEC, 6/7/2006. END DECRemark - 0102829
Remarks: Start CallerRemark - 0102829 tank failed test - no product spillage END
CallerRemark - 0102829

HIST LTANKS:

Region of Spill: 2
Spill Number: 0102829
Investigator: TIPPLE
Caller Name: Not reported
Caller Agency: Not reported
Caller Phone: Not reported
Caller Extension: Not reported
Notifier Name: Not reported
Notifier Agency: Not reported
Notifier Phone: Not reported
Notifier Extension: Not reported
Spill Date: 06/14/2001
Spill Time: 08:15
Reported to Department Date: 06/14/01
Reported to Department Time: 08:48
SWIS: 62
Spiller Contact: SHAWN AARON
Spiller Phone: (631) 586-4900
Spiller Extention: Not reported
Spiller Name: APARMENT COMPLEX
Spiller Address: 505 W 148TH ST
Spiller City,St,Zip: MANHATTAN
Facility Contact: SHAWN AARON
Facility Phone: (631) 586-4900
Facility Extention: Not reported
Spill Cause: Tank Test Failure
Resource Affectd: On Land
Water Affected: Not reported
Spill Source: Private Dwelling
Spill Notifier: Tank Tester
PBS Number: 2-601098
Cleanup Ceased: / /
Cleanup Meets Standard: False
Last Inspection: / /
Recommended Penalty: Penalty Not Recommended
Spiller Cleanup Date: / /
Enforcement Date: / /
Investigation Complete: / /

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

APARMENT COMPLEX (Continued)

EDR ID Number
EPA ID Number

Database(s)

S105055087

UST Involvement: False
Spill Class: Known release with minimal potential for fire or hazard. DEC Response.
Willing Responsible Party. Corrective action taken.
Spill Closed Dt: / /
Date Region Sent Summary to Central Office: / /
Corrective Action Plan Submitted: / /
Date Spill Entered In Computer Data File: 06/14/01
Time Spill Entered In Computer Data File: Not reported
Spill Record Last Update: 06/14/01
Is Updated: False
PBS Number: Not reported
Tank Number: Not reported
Tank Size: 2000
Test Method: Horner EZ Check
Leak Rate Failed Tank: 0.00
Gross Leak Rate: Not reported
Material Class Type: Petroleum
Quantity Spilled: 0
Unkonwn Quantity Spilled: False
Units: Gallons
Quantity Recovered: 0
Unkonwn Quantity Recovered: False
Material: #2 FUEL OIL
Class Type: #2 FUEL OIL
Times Material Entry In File: 24464
CAS Number: Not reported
Last Date: 19941207
DEC Remarks: Not reported
Spill Cause: tank failed test - no product spillage

218
West
1/4-1/2
2071 ft.

625 W 152ND STREET
625 W. 152ND STREET
MANHATTAN, NY

LTANKS
HIST LTANKS
S101340963
N/A

Relative:
Lower

LTANKS:

Actual:
106 ft.

Site ID: 180723
Spill Date: 07/20/94
Facility Addr2: Not reported
Facility ID: 9405371
Program Number: 9405371
SWIS: 3101
Region of Spill: 2
Investigator: SMMARTIN
Referred To: Not reported
Reported to Dept: 07/20/94
CID: 15
Spill Cause: Tank Failure
Water Affected: Not reported
Spill Source: Institutional, Educational, Gov., Other
Spill Notifier: Other
Cleanup Ceased: 07/21/94
Cleanup Meets Standard: True
Last Inspection: / /
Recommended Penalty: Penalty Not Recommended
UST Involvement: False
Spill Class: Known release with minimal potential for fire or hazard. DEC Response.
Willing Responsible Party. Corrective action taken.

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

625 W 152ND STREET (Continued)

EDR ID Number
EPA ID Number

Database(s)

S101340963

Spill Closed Dt: 07/21/94
Remediation Phase: 0
Date Entered In Computer: 10/11/94
Spill Record Last Update: 09/30/04
Spille Namer: Not reported
Spiller Company: APT. BLDG
Spiller Phone: Not reported
Spiller Extention: Not reported
Spiller Address: 625 W. 152ND STREET
Spiller City,St,Zip: NEW YORK, NY
Spiller County: 001
Spiller Contact: Not reported
Spiller Phone: Not reported
Spiller Extention: Not reported
DEC Region: 2
Program Number: 9405371
DER Facility ID: 151578
Site ID: 180723
Operable Unit ID: 1002578
Operable Unit: 01
Material ID: 381960
Material Code: 0002
Material Name: #4 Fuel Oil
Case No.: Not reported
Material FA: Petroleum
Quantity: 5.00
Units: Gallons
Recovered: 0.00
Resource Affected: Soil
Oxygenate: False
Site ID: Not reported
Spill Tank Test: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate: Not reported
Gross Fail: Not reported
Modified By: Not reported
Last Modified: Not reported
Test Method: Not reported
DEC Memo: Start DECRemark - 9405371 Prior to Sept, 2004 data translation this spill Lead
DEC Field was "MARTINKAT" END DECRemark - 9405371
Remarks: Start CallerRemark - 9405371 CONTAINED - CLEAN UP CREW ON WAY. END CallerRemark
- 9405371

HIST LTANKS:
Region of Spill: 2
Spill Number: 9405371
Investigator: MARTINKAT
Caller Name: Not reported
Caller Agency: Not reported
Caller Phone: Not reported
Caller Extension: Not reported
Notifier Name: Not reported
Notifier Agency: Not reported
Notifier Phone: Not reported
Notifier Extension: Not reported

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s)
EDR ID Number
EPA ID Number

625 W 152ND STREET (Continued)

S101340963

Spill Date: 07/20/1994
Spill Time: 09:30
Reported to Department Date: 07/20/94
Reported to Department Time: 10:00
SWIS: 62
Spiller Contact: Not reported
Spiller Phone: Not reported
Spiller Extension: Not reported
Spiller Name: APT. BLDG
Spiller Address: 625 W. 152ND STREET
Spiller City,St,Zip: NEW YORK, NEW YORK
Facility Contact: Not reported
Facility Phone: Not reported
Facility Extension: Not reported
Spill Cause: Tank Failure
Resource Affectd: On Land
Water Affected: Not reported
Spill Source: Other Non Commercial/Industrial
Spill Notifier: Other
PBS Number: Not reported
Cleanup Ceased: 07/21/94
Cleanup Meets Standard: True
Last Inspection: / /
Recommended Penalty: Penalty Not Recommended
Spiller Cleanup Date: / /
Enforcement Date: / /
Investigation Complete: / /
UST Involvement: False
Spill Class: Known release with minimal potential for fire or hazard. DEC Response.
Willing Responsible Party. Corrective action taken.
Spill Closed Dt: 07/21/94
Date Region Sent Summary to Central Office: / /
Corrective Action Plan Submitted: / /
Date Spill Entered In Computer Data File: 10/11/94
Time Spill Entered In Computer Data File: Not reported
Spill Record Last Update: / /
Is Updated: False
PBS Number: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate Failed Tank: Not reported
Gross Leak Rate: Not reported
Material Class Type: Petroleum
Quantity Spilled: 5
Unkonwn Quantity Spilled: False
Units: Gallons
Quantity Recovered: 0
Unkonwn Quantity Recovered: False
Material: #4 FUEL OIL
Class Type: #4 FUEL OIL
Times Material Entry In File: 1751
CAS Number: Not reported
Last Date: 19941205
DEC Remarks: Not reported
Spill Cause: CONTAINED - CLEAN UP CREW ON WAY.

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

219
SSW
1/4-1/2
2093 ft.

PRIVATE RESIDENCE
428 W 147TH ST
NEW YORK, NY

Database(s)

EDR ID Number
EPA ID Number

LTANKS S106702524
N/A

Relative:
Lower

LTANKS:

Actual:
99 ft.

Site ID: 68845
Spill Date: 08/10/04
Facility Addr2: Not reported
Facility ID: 0405153
Program Number: 0405153
SWIS: 3101
Region of Spill: 2
Investigator: JMKRIMGO
Referred To: Not reported
Reported to Dept: 08/10/04
CID: 15
Spill Cause: Tank Overfill
Water Affected: Not reported
Spill Source: Private Dwelling
Spill Notifier: Local Agency
Cleanup Ceased: / /
Cleanup Meets Standard: True
Last Inspection: / /
Recommended Penalty: Penalty Not Recommended
UST Involvement: False
Spill Class: Known release with minimal potential for fire or hazard. DEC Response.
Willing Responsible Party. Corrective action taken.
Spill Closed Dt: 07/22/05
Remediation Phase: 0
Date Entered In Computer: 08/10/04
Spill Record Last Update: 07/22/05
Spille Namer: OGISTE,JASON
Spiller Company: PRIVATE RESIDENCE
Spiller Phone: (212) 281-0119
Spiller Extention: Not reported
Spiller Address: 428 W 147TH ST
Spiller City,St,Zip: NEW YORK, NY 10031
Spiller County: 001
Spiller Contact: OGISTE,JASON
Spiller Phone: (212) 281-0119
Spiller Extention: Not reported
DEC Region: 2
Program Number: 0405153
DER Facility ID: 65510
Site ID: 68845
Operable Unit ID: 888565
Operable Unit: 01
Material ID: 489198
Material Code: 0001
Material Name: #2 Fuel Oil
Case No.: Not reported
Material FA: Petroleum
Quantity: 0.00
Units: Not reported
Recovered: 0.00
Resource Affected: Soil
Oxygenate: False
Site ID: 68845

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

PRIVATE RESIDENCE (Continued)

EDR ID Number
EPA ID Number

Database(s)

S106702524

Operable Unit ID: 888565
Operable Unit: 01
Material ID: 489199
Material Code: 0001
Material Name: #2 Fuel Oil
Case No.: Not reported
Material FA: Petroleum
Quantity: 0.00
Units: Pounds
Recovered: 0.00
Resource Affected: Soil
Oxygenate: False
Site ID: Not reported
Spill Tank Test: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate: Not reported
Gross Fail: Not reported
Modified By: Not reported
Last Modified: Not reported
Test Method: Not reported
DEC Memo: Start DECRemark - 0405153 Prior to Sept, 2004 data translation this spill Lead DEC Field was "KRIMGOLD" 8/11/04. Tanks were already full. Stuyvesant Fuel made the delivery. As a result one of two 125 gal tanks developed a leak from the bottom. Oil contained within a tank room. USA Environmental (718-981-5710) was retained by the the homeowner Estella Job (347-351-6695) to perform a clean up. J.Krimgold ordered the RP to pump out the tank and clean up tank room. YK. 7/22/05. J.Krimgold spoke to USA Env. This job was completed the next day. Tank was removed and replaced after spill been cleaned up. NFA. END DECRemark - 0405153
Remarks: Start CallerRemark - 0405153 WHEN MAKING AN OIL DELIVERY, DRIVER DISCOVERED THAT TANK WAS ALREADY FULL, CAUSING AN OVERFILL. TECHNICIAN IS USING A SPILL KIT TO CONTAIN, BUT IT APPEARS THAT SOME MAY HAVE ENTERED A DRAIN IN THE BASEMENT. END CallerRemark - 0405153

AX220
NNW
1/4-1/2
2095 ft.

580 WEST 161ST ST
MANHATTAN, NY

LTANKS S104619683
HIST LTANKS N/A

Site 1 of 3 in cluster AX

Relative:
Higher

LTANKS:

Actual:
146 ft.

Site ID: 149669
Spill Date: 09/11/98
Facility Addr2: Not reported
Facility ID: 9807161
Program Number: 9807161
SWIS: 3101
Region of Spill: 2
Investigator: HUANG
Referred To: Not reported
Reported to Dept: 09/11/98
CID: 15
Spill Cause: Tank Overfill
Water Affected: Not reported
Spill Source: Tank Truck
Spill Notifier: Responsible Party

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

(Continued)

S104619683

Cleanup Ceased: / /
Cleanup Meets Standard: False
Last Inspection: / /
Recommended Penalty: Penalty Not Recommended
UST Involvement: False
Spill Class: Known release with minimal potential for fire or hazard. DEC Response.
Willing Responsible Party. Corrective action taken.
Spill Closed Dt: 09/11/98
Remediation Phase: 0
Date Entered In Computer: 09/11/98
Spill Record Last Update: 09/14/98
Spille Namer: Not reported
Spiller Company: Not reported
Spiller Phone: Not reported
Spiller Extention: Not reported
Spiller Address: 580 WEST 161ST ST
Spiller City,St,Zip: MANHATTAN, NY
Spiller County: 001
Spiller Contact: Not reported
Spiller Phone: Not reported
Spiller Extention: Not reported
DEC Region: 2
Program Number: 9807161
DER Facility ID: 127285
Site ID: 149669
Operable Unit ID: 1068235
Operable Unit: 01
Material ID: 318275
Material Code: 0002
Material Name: #4 Fuel Oil
Case No.: Not reported
Material FA: Petroleum
Quantity: 7.00
Units: Gallons
Recovered: 7.00
Resource Affected: Soil
Oxygenate: False
Site ID: Not reported
Spill Tank Test: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate: Not reported
Gross Fail: Not reported
Modified By: Not reported
Last Modified: Not reported
Test Method: Not reported
DEC Memo: Not reported
Remarks: Start CallerRemark - 9807161 CALLER REPORTING THAT THE DRIVER WAS MAKING A
DELIVERY AND THE GAUGE WAS OFF, CAUSING AN OVERFILL. END CallerRemark -
9807161

HIST LTANKS:
Region of Spill: 2
Spill Number: 9807161
Investigator: HUANG
Caller Name: Not reported

S104619683

Caller Agency:	Not reported
Caller Phone:	Not reported
Caller Extension:	Not reported
Notifier Name:	Not reported
Notifier Agency:	Not reported
Notifier Phone:	Not reported
Notifier Extension:	Not reported
Spill Date:	09/11/1998
Spill Time:	11:00
Reported to Department Date:	09/11/98
Reported to Department Time:	11:28
SWIS:	62
Spiller Contact:	Not reported
Spiller Phone:	Not reported
Spiller Extension:	Not reported
Spiller Name:	Not reported
Spiller Address:	580 WEST 161ST ST
Spiller City,St,Zip:	MANHATTAN, NY
Facility Contact:	Not reported
Facility Phone:	Not reported
Facility Extension:	Not reported
Spill Cause:	Tank Overfill
Resource Affectd:	On Land
Water Affected:	Not reported
Spill Source:	Tank Truck
Spill Notifier:	Responsible Party
PBS Number:	Not reported
Cleanup Ceased:	/ /
Cleanup Meets Standard:	False
Last Inspection:	/ /
Recommended Penalty:	Penalty Not Recommended
Spiller Cleanup Date:	/ /
Enforcement Date:	/ /
Investigation Complete:	/ /
UST Involvement:	False
Spill Class:	Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken.
Spill Closed Dt:	09/11/98
Date Region Sent Summary to Central Office:	/ /
Corrective Action Plan Submitted:	/ /
Date Spill Entered In Computer Data File:	09/11/98
Time Spill Entered In Computer Data File:	Not reported
Spill Record Last Update:	09/14/98
Is Updated:	False
PBS Number:	Not reported
Tank Number:	Not reported
Tank Size:	Not reported
Test Method:	Not reported
Leak Rate Failed Tank:	Not reported
Gross Leak Rate:	Not reported
Material Class Type:	Petroleum
Quantity Spilled:	7
Unkonwn Quantity Spilled:	False
Units:	Gallons
Quantity Recovered:	7
Unkonwn Quantity Recovered:	False
Material:	#4 FUEL OIL

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

(Continued)

S104619683

Class Type: #4 FUEL OIL
Times Material Entry In File: 1751
CAS Number: Not reported
Last Date: 19941205
DEC Remarks: 3-4 GALLONS SPILL ON THE PAVED SIDE WAY CONCRETE SURFACE). CLEAN-UP CREW IS ON THE WAY.
Spill Cause: CALLER REPORTING THAT THE DRIVER WAS MAKING A DELIVERY AND THE GAUGE WAS OFF, CAUSING AN OVERFILL.

AX221
NNW
1/4-1/2
2095 ft.

580 WEST 161 ST/MANH
580 WEST 161ST STREET
NEW YORK CITY, NY

LTANKS S104275620
HIST LTANKS N/A

Site 2 of 3 in cluster AX

Relative:
Higher

Actual:
146 ft.

LTANKS:
Site ID: 154053
Spill Date: 11/16/90
Facility Addr2: Not reported
Facility ID: 9009054
Program Number: 9009054
SWIS: 3101
Region of Spill: 2
Investigator: FINGER
Referred To: Not reported
Reported to Dept: 11/16/90
CID: 15
Spill Cause: Tank Failure
Water Affected: Not reported
Spill Source: Commercial/Industrial
Spill Notifier: Other
Cleanup Ceased: 07/28/95
Cleanup Meets Standard: True
Last Inspection: 07/28/95
Recommended Penalty: Penalty Not Recommended
UST Involvement: False
Spill Class: Known release with minimal potential for fire or hazard. DEC Response.
Willing Responsible Party. Corrective action taken.
Spill Closed Dt: 07/28/95
Remediation Phase: 0
Date Entered In Computer: 11/19/90
Spill Record Last Update: 07/31/95
Spille Namer: Not reported
Spiller Company: CENTURION ASSOC
Spiller Phone: (718) 454-5001
Spiller Extention: Not reported
Spiller Address: P O 1053
Spiller City,St,Zip: GEAT NECK, NY 11023
Spiller County: 001
Spiller Contact: Not reported
Spiller Phone: Not reported
Spiller Extention: Not reported
DEC Region: 2
Program Number: 9009054
DER Facility ID: 130648
Site ID: 154053
Operable Unit ID: 946246
Operable Unit: 01

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

580 WEST 161 ST/MANH (Continued)

S104275620

Material ID: 432832
Material Code: 0003
Material Name: #6 Fuel Oil
Case No.: Not reported
Material FA: Petroleum
Quantity: 300.00
Units: Gallons
Recovered: 0.00
Resource Affected: Soil
Oxygenate: False
Site ID: Not reported
Spill Tank Test: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate: Not reported
Gross Fail: Not reported
Modified By: Not reported
Last Modified: Not reported
Test Method: Not reported
DEC Memo: Start DECRemark - 9009054 Prior to Sept, 2004 data translation this spill Lead
DEC Field was "FINGER/mulqueen" 07/31/95: MULQUEEN INSPECTED LOCATION, NEW TANK
IN BOILER ROOM, NO SIGN OF #6 , NO FURTHER ACTION REQUIRED. END DECRemark -
9009054
Remarks: Start CallerRemark - 9009054 300 GALS POSSIBLY SPILLED ON FLOOR OR COULD BE IN
TANK WHICH WAS PUMPED OUT, REMAINDER ON FLOOR, MR.LEVY WILL CLEAN UP, HOLE
IN TANK FOUND IN TANK WHILE CLEANING TANK. END CallerRemark - 9009054

HIST LTANKS:

Region of Spill: 2
Spill Number: 9009054
Investigator: FINGER/mulqueen
Caller Name: Not reported
Caller Agency: Not reported
Caller Phone: Not reported
Caller Extension: Not reported
Notifier Name: Not reported
Notifier Agency: Not reported
Notifier Phone: Not reported
Notifier Extension: Not reported
Spill Date: 11/16/1990
Spill Time: 14:30
Reported to Department Date: 11/16/90
Reported to Department Time: 15:12
SWIS: 62
Spiller Contact: Not reported
Spiller Phone: Not reported
Spiller Extension: Not reported
Spiller Name: CENTURION ASSOC
Spiller Address: P O 1053
Spiller City,St,Zip: GEAT NECK, NY 11023
Facility Contact: Not reported
Facility Phone: (718) 454-5001
Facility Extension: Not reported
Spill Cause: Tank Failure
Resource Affectd: On Land
Water Affected: Not reported

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

580 WEST 161 ST/MANH (Continued)

EDR ID Number
EPA ID Number

Database(s)

S104275620

Spill Source: Other Commercial/Industrial
Spill Notifier: Other
PBS Number: Not reported
Cleanup Ceased: 07/28/95
Cleanup Meets Standard: True
Last Inspection: 07/28/95
Recommended Penalty: Penalty Not Recommended
Spiller Cleanup Date: / /
Enforcement Date: / /
Investigation Complete: / /
UST Involvement: False
Spill Class: Known release with minimal potential for fire or hazard. DEC Response.
Willing Responsible Party. Corrective action taken.
Spill Closed Dt: 07/28/95
Date Region Sent Summary to Central Office: / /
Corrective Action Plan Submitted: / /
Date Spill Entered In Computer Data File: 11/19/90
Time Spill Entered In Computer Data File: Not reported
Spill Record Last Update: 07/31/95
Is Updated: False
PBS Number: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate Failed Tank: Not reported
Gross Leak Rate: Not reported
Material Class Type: Petroleum
Quantity Spilled: 300
Unkonwn Quantity Spilled: False
Units: Gallons
Quantity Recovered: 0
Unkonwn Quantity Recovered: False
Material: #6 FUEL OIL
Class Type: #6 FUEL OIL
Times Material Entry In File: 2190
CAS Number: Not reported
Last Date: 19940728
DEC Remarks: 07/31/95: MULQUEEN INSPECTED LOCATION, NEW TANK IN BOILER ROOM, NO SIGN OF 6 ,
NO FURTHER ACTION REQUIRED.
Spill Cause: 300 GALS POSSIBLY SPILLED ON FLOOR OR COULD BE IN TANK WHICH WAS PUMPED OUT,
REMAINDER ON FLOOR, MR.LEVY WILL CLEAN UP, HOLE IN TANK FOUND IN TANK WHILE
CLEANING TANK.

AX222 580 161ST ST/MANH
NNW 580 161ST STREET
1/4-1/2 NEW YORK CITY, NY
2095 ft.

LTANKS S104275622
HIST LTANKS N/A

Site 3 of 3 in cluster AX

Relative:
Higher

LTANKS:
Site ID: 80562
Spill Date: 11/21/90
Facility Addr2: Not reported
Facility ID: 9009214
Program Number: 9009214
SWIS: 3101
Region of Spill: 2
Investigator: KSTANG

Actual:
146 ft.

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

580 161ST ST/MANH (Continued)

EDR ID Number
EPA ID Number

Database(s)

S104275622

Referred To: Not reported
Reported to Dept: 11/23/90
CID: 15
Spill Cause: Tank Failure
Water Affected: Not reported
Spill Source: Commercial/Industrial
Spill Notifier: Other
Cleanup Ceased: 11/26/90
Cleanup Meets Standard: True
Last Inspection: / /
Recommended Penalty: Penalty Not Recommended
UST Involvement: False
Spill Class: Not reported
Spill Closed Dt: 11/26/90
Remediation Phase: 0
Date Entered In Computer: 11/28/90
Spill Record Last Update: 09/30/04
Spille Namer: Not reported
Spiller Company: CLK MGNT CO
Spiller Phone: (914) 683-8891
Spiller Extention: Not reported
Spiller Address: 185 GREAT NECK ROAD
Spiller City,St,Zip: GREAT NECK, NY
Spiller County: 001
Spiller Contact: Not reported
Spiller Phone: Not reported
Spiller Extention: Not reported
DEC Region: 2
Program Number: 9009214
DER Facility ID: 74653
Site ID: 80562
Operable Unit ID: 949702
Operable Unit: 01
Material ID: 557383
Material Code: 0002
Material Name: #4 Fuel Oil
Case No.: Not reported
Material FA: Petroleum
Quantity: 200.00
Units: Gallons
Recovered: 0.00
Resource Affected: Soil
Oxygenate: False
Site ID: Not reported
Spill Tank Test: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate: Not reported
Gross Fail: Not reported
Modified By: Not reported
Last Modified: Not reported
Test Method: Not reported
DEC Memo: Start DECRemark - 9009214 Prior to Sept, 2004 data translation this spill Lead
DEC Field was "TANG" 11/26/90: DEC CONFIRMED CLEAN UP, PETROLEUM TANK CLEANERS
TO REPAIR TANK,TANK HAS BAD SEAM NEAR BOTTOM,TANK WILL BE PUT ON SUPPORT.
END DECRemark- 9009214

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s) EDR ID Number
EPA ID Number

580 161ST ST/MANH (Continued)

S104275622

Remarks: Start CallerRemark - 9009214 5K TANK IN BASEMENT WAS LEAKING, CALLED PETRO TANK
CLEANERS TO PUMP TANK BELOW LEAK LINE, ALSO CLEANED CONCRETE FLOOR WITH VAC
TRUCK & SPEEDY DRY. END CallerRemark - 9009214

HIST LTANKS:

Region of Spill: 2
Spill Number: 9009214
Investigator: TANG
Caller Name: Not reported
Caller Agency: Not reported
Caller Phone: Not reported
Caller Extension: Not reported
Notifier Name: Not reported
Notifier Agency: Not reported
Notifier Phone: Not reported
Notifier Extension: Not reported
Spill Date: 11/21/1990
Spill Time: 21:00
Reported to Department Date: 11/23/90
Reported to Department Time: 08:33
SWIS: 62
Spiller Contact: Not reported
Spiller Phone: Not reported
Spiller Extension: Not reported
Spiller Name: CLK MGNT CO
Spiller Address: 185 GREAT NECK ROAD
Spiller City,St,Zip: GREAT NECK, NY
Facility Contact: Not reported
Facility Phone: (914) 683-8891
Facility Extension: Not reported
Spill Cause: Tank Failure
Resource Affectd: On Land
Water Affected: Not reported
Spill Source: Other Commercial/Industrial
Spill Notifier: Other
PBS Number: Not reported
Cleanup Ceased: 11/26/90
Cleanup Meets Standard: True
Last Inspection: / /
Recommended Penalty: Penalty Not Recommended
Spiller Cleanup Date: / /
Enforcement Date: / /
Investigation Complete: / /
UST Involvement: False
Spill Class: Not reported
Spill Closed Dt: 11/26/90
Date Region Sent Summary to Central Office: / /
Corrective Action Plan Submitted: / /
Date Spill Entered In Computer Data File: 11/28/90
Time Spill Entered In Computer Data File: Not reported
Spill Record Last Update: / /
Is Updated: False
PBS Number: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate Failed Tank: Not reported

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

580 161ST ST/MANH (Continued)

EDR ID Number
EPA ID Number

Database(s)

S104275622

Gross Leak Rate: Not reported
Material Class Type: Petroleum
Quantity Spilled: 200
Unkonwn Quantity Spilled: False
Units: Gallons
Quantity Recovered: 0
Unkonwn Quantity Recovered: False
Material: #4 FUEL OIL
Class Type: #4 FUEL OIL
Times Material Entry In File: 1751
CAS Number: Not reported
Last Date: 19941205
DEC Remarks: 11/26/90: DEC CONFIRMED CLEAN UP, PETROLEUM TANK CLEANERS TO REPAIR TANK,TANK HAS BAD SEAM NEAR BOTTOM,TANK WILL BE PUT ON SUPPORT.
Spill Cause: 5K TANK IN BASEMENT WAS LEAKING, CALLED PETRO TANK CLEANERS TO PUMP TANK BELOW LEAK LINE, ALSO CLEANED CONCRETE FLOOR WITH VAC TRUCK SPEEDY DRY.

223
WSW
1/4-1/2
2098 ft.

540 WEST 148TH ST
540 WEST 148TH S
NEW YORK CITY, NY

LTANKS
HIST LTANKS
S104276717
N/A

Relative:
Higher

LTANKS:

Actual:
125 ft.

Site ID: 234371
Spill Date: 01/26/96
Facility Addr2: Not reported
Facility ID: 9513605
Program Number: 9513605
SWIS: 3101
Region of Spill: 2
Investigator: LUCE
Referred To: Not reported
Reported to Dept: 01/26/96
CID: 15
Spill Cause: Tank Overfill
Water Affected: Not reported
Spill Source: Private Dwelling
Spill Notifier: Responsible Party
Cleanup Ceased: / /
Cleanup Meets Standard: False
Last Inspection: / /
Recommended Penalty: Penalty Not Recommended
UST Involvement: False
Spill Class: Known release with minimal potential for fire or hazard. DEC Response.
Willing Responsible Party. Corrective action taken.
Spill Closed Dt: 01/26/96
Remediation Phase: 0
Date Entered In Computer: 01/26/96
Spill Record Last Update: 11/28/06
Spille Namer: NICK CHRONOPOULOS
Spiller Company: PETRO ASTORIA
Spiller Phone: (718) 545-4500
Spiller Extention: Not reported
Spiller Address: 636-16 19 AVE
Spiller City,St,Zip: ASTORIA, NY 11105-
Spiller County: 001
Spiller Contact: BENJAMIN GRANT
Spiller Phone: (212) 234-7006

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

540 WEST 148TH ST (Continued)

EDR ID Number
EPA ID Number

Database(s)

S104276717

Spiller Extention: Not reported
DEC Region: 2
Program Number: 9513605
DER Facility ID: 193080
Site ID: 234371
Operable Unit ID: 1024490
Operable Unit: 01
Material ID: 357321
Material Code: 0001
Material Name: #2 Fuel Oil
Case No.: Not reported
Material FA: Petroleum
Quantity: 1.00
Units: Gallons
Recovered: 1.00
Resource Affected: Soil
Oxygenate: False
Site ID: Not reported
Spill Tank Test: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate: Not reported
Gross Fail: Not reported
Modified By: Not reported
Last Modified: Not reported
Test Method: Not reported
DEC Memo: Not reported
Remarks: Start CallerRemark - 9513605 the driver overfilled the tank causing the spill.
actual spill was 1 ounce and all was cleaned up. END CallerRemark - 9513605

HIST LTANKS:

Region of Spill: 2
Spill Number: 9513605
Investigator: LUCE
Caller Name: Not reported
Caller Agency: Not reported
Caller Phone: Not reported
Caller Extension: Not reported
Notifier Name: Not reported
Notifier Agency: Not reported
Notifier Phone: Not reported
Notifier Extension: Not reported
Spill Date: 01/26/1996
Spill Time: 15:30
Reported to Department Date: 01/26/96
Reported to Department Time: 15:53
SWIS: 62
Spiller Contact: BENJAMIN GRANT
Spiller Phone: (212) 234-7006
Spiller Extention: Not reported
Spiller Name: PETRO ASTORIA
Spiller Address: 636-16 19 AVE
Spiller City,St,Zip: ASTORIA, NY 11105-
Facility Contact: NICK CHRONOPOULOS
Facility Phone: (718) 545-4500
Facility Extention: Not reported

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

540 WEST 148TH ST (Continued)

EDR ID Number
EPA ID Number

Database(s)

S104276717

Spill Cause: Tank Overfill
Resource Affectd: On Land
Water Affected: Not reported
Spill Source: Private Dwelling
Spill Notifier: Responsible Party
PBS Number: Not reported
Cleanup Ceased: / /
Cleanup Meets Standard: False
Last Inspection: / /
Recommended Penalty: Penalty Not Recommended
Spiller Cleanup Date: / /
Enforcement Date: / /
Investigation Complete: / /
UST Involvement: False
Spill Class: Known release with minimal potential for fire or hazard. DEC Response.
Willing Responsible Party. Corrective action taken.
Spill Closed Dt: 01/26/96
Date Region Sent Summary to Central Office: / /
Corrective Action Plan Submitted: / /
Date Spill Entered In Computer Data File: 01/26/96
Time Spill Entered In Computer Data File: Not reported
Spill Record Last Update: 02/12/96
Is Updated: False
PBS Number: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate Failed Tank: Not reported
Gross Leak Rate: Not reported
Material Class Type: Petroleum
Quantity Spilled: 1
Unkonwn Quantity Spilled: False
Units: Gallons
Quantity Recovered: 1
Unkonwn Quantity Recovered: False
Material: #2 FUEL OIL
Class Type: #2 FUEL OIL
Times Material Entry In File: 24464
CAS Number: Not reported
Last Date: 19941207
DEC Remarks: Not reported
Spill Cause: the driver overfilled the tank causing the spill. actual spill was 1 ounce and
all was cleaned up.

224
SSW
1/4-1/2
2099 ft.

SANDERS HOME
406 WEST 147TH STREET
NEW YORK, NY

LTANKS S107489322
N/A

Relative:
Lower

LTANKS:
Site ID: 356456
Spill Date: 12/06/05
Facility Addr2: Not reported
Facility ID: 0510471
Program Number: 0510471
SWIS: 3101
Region of Spill: 2
Investigator: SFRAHMAN

Actual:
95 ft.

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

SANDERS HOME (Continued)

EDR ID Number
EPA ID Number

Database(s)

S107489322

Referred To: Not reported
Reported to Dept: 12/06/05
CID: 15
Spill Cause: Tank Failure
Water Affected: Not reported
Spill Source: Private Dwelling
Spill Notifier: Other
Cleanup Ceased: / /
Cleanup Meets Standard: False
Last Inspection: / /
Recommended Penalty: Penalty Not Recommended
UST Involvement: False
Spill Class: Known release with minimal potential for fire or hazard. DEC Response.
Willing Responsible Party. Corrective action taken.
Spill Closed Dt: 02/28/07
Remediation Phase: 0
Date Entered In Computer: 12/06/05
Spill Record Last Update: 02/28/07
Spille Namer: KAREN SANDERS
Spiller Company: SANDERS HOME
Spiller Phone: (212) 690-2288
Spiller Extention: Not reported
Spiller Address: 406 WEST 147TH STREET
Spiller City,St,Zip: NEW YORK, NY
Spiller County: 001
Spiller Contact: VINNY LOVRI
Spiller Phone: (718) 509-5900
Spiller Extention: CELL
DEC Region: 2
Program Number: 0510471
DER Facility ID: 306514
Site ID: 356456
Operable Unit ID: 1113762
Operable Unit: 01
Material ID: 2103822
Material Code: 0001
Material Name: #2 Fuel Oil
Case No.: Not reported
Material FA: Petroleum
Quantity: 0.00
Units: Gallons
Recovered: 0.00
Resource Affected: Groundwater
Oxygenate: False
Site ID: Not reported
Spill Tank Test: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate: Not reported
Gross Fail: Not reported
Modified By: Not reported
Last Modified: Not reported
Test Method: Not reported
DEC Memo: Start DECRemark - 0510471 12/6/2005 Sangesland spoke to Vinny at Island Tank.
He said there was a 275 gal tank in the basement with rot holes in it. The
tank has been removed and Island tank has already started digging out a layer

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

SANDERS HOME (Continued)

S107489322

Remarks: of contaminated soil. Sharif will visit the site within the next day or two.
03/16/06 Sharif Rahman- Left a message for Vinny@Island Tank-(718)509-5900.
07/20/06 Rahman- Vinny will send DEC the closure report shortly. 02/28/07
Rahman-Island Tank removed 275 gallon UST, contaminated soil was also
removed. End point samples were taken from the tank excavation. Residual
contamination within acceptable limit. Waste disposal manifest was provided. NFA
required. Report on edocs. END DEC Remark - 0510471
Start Caller Remark - 0510471 TANK IS LEAKING AND WENT DOWN INTO DIRT: END
Caller Remark - 0510471

**225
South
1/4-1/2
2172 ft.**

**POLICE SERVICE AREA #6
2786 8TH AVE
MANHATTAN, NY**

**LTANKS S104877480
HIST LTANKS N/A**

**Relative:
Lower**

LTANKS:
Site ID: 68740
Spill Date: 12/21/00
Facility Addr2: Not reported
Facility ID: 0010609
Program Number: 0010609
SWIS: 3101
Region of Spill: 2
Investigator: jkkann
Referred To: CLOSED BASED ON NYCHA INFO
Reported to Dept: 12/21/00
CID: 15
Spill Cause: Tank Overfill
Water Affected: Not reported
Spill Source: Commercial Vehicle
Spill Notifier: Responsible Party
Cleanup Ceased: / /
Cleanup Meets Standard: False
Last Inspection: / /
Recommended Penalty: Penalty Not Recommended
UST Involvement: False
Spill Class: Known release with minimal potential for fire or hazard. DEC Response.
Willing Responsible Party. Corrective action taken.
Spill Closed Dt: 06/14/07
Remediation Phase: 0
Date Entered In Computer: 12/21/00
Spill Record Last Update: 06/14/07
Spille Namer: CALLER
Spiller Company: NYC HOUSING
Spiller Phone: Not reported
Spiller Extention: Not reported
Spiller Address: 123 WILLIAMS ST
Spiller City, St, Zip: NYC, NY 10038-
Spiller County: 001
Spiller Contact: ED MALONE
Spiller Phone: (718) 649-7017
Spiller Extention: Not reported
DEC Region: 2
Program Number: 0010609
DER Facility ID: 65434
Site ID: 68740
Operable Unit ID: 832639
Operable Unit: 01

**Actual:
25 ft.**

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s)
EDR ID Number
EPA ID Number

POLICE SERVICE AREA #6 (Continued)

S104877480

Material ID: 563269
Material Code: 0008
Material Name: Diesel
Case No.: Not reported
Material FA: Petroleum
Quantity: 20.00
Units: Gallons
Recovered: 0.00
Resource Affected: Soil
Oxygenate: False
Site ID: Not reported
Spill Tank Test: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate: Not reported
Gross Fail: Not reported
Modified By: Not reported
Last Modified: Not reported
Test Method: Not reported
DEC Memo: Start DECRemark - 0010609 Prior to Sept, 2004 data translation this spill Lead DEC Field was "ROMMEL" 10/15/04- The Spill was reassigned to John Kolleeny. 11/08/05: This spill transferred from J.Kolleeny to S.Kraszewski. 01/27/06: This spill transferred from S.Kraszewski to Q.Abidi. 03/31/06: This spill transferred from Q. Abidi to Koon Tang. 06/14/07: Spill transferred to J.Kann. Based on NYCHA info, spill contained to concrete and parking lot, nothing entered the sewer. Area properly cleaned, therefore spill is closed. END DECRemark - 0010609
Remarks: Start CallerRemark - 0010609 tank overfill caused spill - one small drain that goes to a sump in the basement was affected - clean venture enroute to clean up spill END CallerRemark - 0010609

HIST LTANKS:

Region of Spill: 2
Spill Number: 0010609
Investigator: ROMMEL
Caller Name: Not reported
Caller Agency: Not reported
Caller Phone: Not reported
Caller Extension: Not reported
Notifier Name: Not reported
Notifier Agency: Not reported
Notifier Phone: Not reported
Notifier Extension: Not reported
Spill Date: 12/21/2000
Spill Time: 12:15
Reported to Department Date: 12/21/00
Reported to Department Time: 12:43
SWIS: 62
Spiller Contact: ED MALONE
Spiller Phone: (718) 649-7017
Spiller Extension: Not reported
Spiller Name: NYC HOUSING
Spiller Address: 123 WILLIAMS ST
Spiller City,St,Zip: NYC, NY 10038-
Facility Contact: CALLER
Facility Phone: () -

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s) EDR ID Number
EPA ID Number

POLICE SERVICE AREA #6 (Continued)

S104877480

Facility Extention: Not reported
Spill Cause: Tank Overfill
Resource Affectd: On Land
Water Affected: Not reported
Spill Source: Commercial Vehicle
Spill Notifier: Responsible Party
PBS Number: Not reported
Cleanup Ceased: / /
Cleanup Meets Standard: False
Last Inspection: / /
Recommended Penalty: Penalty Not Recommended
Spiller Cleanup Date: / /
Enforcement Date: / /
Investigation Complete: / /
UST Involvement: False
Spill Class: Known release with minimal potential for fire or hazard. DEC Response.
Willing Responsible Party. Corrective action taken.
Spill Closed Dt: / /
Date Region Sent Summary to Central Office: / /
Corrective Action Plan Submitted: / /
Date Spill Entered In Computer Data File: 12/21/00
Time Spill Entered In Computer Data File: Not reported
Spill Record Last Update: 12/21/00
Is Updated: False
PBS Number: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate Failed Tank: Not reported
Gross Leak Rate: Not reported
Material Class Type: Petroleum
Quantity Spilled: 20
Unkonwn Quantity Spilled: False
Units: Gallons
Quantity Recovered: 0
Unkonwn Quantity Recovered: False
Material: DIESEL
Class Type: DIESEL
Times Material Entry In File: 10625
CAS Number: Not reported
Last Date: 19940728
DEC Remarks: Not reported
Spill Cause: tank overfill caused spill - one small drain that goes to a sump in the
basement was affected - clean venture enroute to clean up spill

AY226
WSW
1/4-1/2
2256 ft.

601 W 149TH ST
MANHATTAN, NY

LTANKS S105054550
NY Spills N/A
HIST LTANKS

Site 1 of 2 in cluster AY

Relative:
Higher

LTANKS:
Site ID: 244958
Spill Date: 01/10/01
Facility Addr2: Not reported
Facility ID: 0011074
Program Number: 0011074
SWIS: 3101

Actual:
113 ft.

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

(Continued)

S105054550

Region of Spill: 2
Investigator: CESAUYER
Referred To: Not reported
Reported to Dept: 01/10/01
CID: 15
Spill Cause: Tank Overfill
Water Affected: Not reported
Spill Source: Non Major Facility > 1,100 gal
Spill Notifier: Responsible Party
Cleanup Ceased: / /
Cleanup Meets Standard: False
Last Inspection: / /
Recommended Penalty: Penalty Not Recommended
UST Involvement: False
Spill Class: Known release with minimal potential for fire or hazard. DEC Response.
Willing Responsible Party. Corrective action taken.
Spill Closed Dt: 02/10/04
Remediation Phase: 0
Date Entered In Computer: 01/10/01
Spill Record Last Update: 02/10/04
Spille Namer: CALLER
Spiller Company: L B TRANSPORTATION
Spiller Phone: (718) 401-9130
Spiller Extention: Not reported
Spiller Address: 401 TARRYTOWN RD
Spiller City,St,Zip: WHITE PLAINS, NY
Spiller County: 001
Spiller Contact: MR LOPEZ
Spiller Phone: (718) 401-9130
Spiller Extention: Not reported
DEC Region: 2
Program Number: 0011074
DER Facility ID: 201218
Site ID: 244958
Operable Unit ID: 832478
Operable Unit: 01
Material ID: 541400
Material Code: 0002
Material Name: #4 Fuel Oil
Case No.: Not reported
Material FA: Petroleum
Quantity: 50.00
Units: Gallons
Recovered: 50.00
Resource Affected: Soil
Oxygenate: False
Site ID: Not reported
Spill Tank Test: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate: Not reported
Gross Fail: Not reported
Modified By: Not reported
Last Modified: Not reported
Test Method: Not reported
DEC Memo: Start DECRemark - 0011074 Prior to Sept, 2004 data translation this spill Lead

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

(Continued)

S105054550

DEC Field was "SAWYER" No further information available. 02/10/2004
TRANSFERRED FROM SIGONA TO SAWYER/// REFERRED TO SPILL # 03-03476 END DECRemark
- 0011074

Remarks: Start CallerRemark - 0011074 Storage tank overfill END CallerRemark - 0011074

NY Spills:

Site ID: 129892
Facility Addr2: Not reported
Facility ID: 0303476
Spill Number: 0303476
Facility Type: ER
SWIS: 3101
Region of Spill: 2
Investigator: CESAWYER
Referred To: Not reported
Spill Date: 10/01/01
Reported to Dept: 07/02/03
CID: 15
Spill Cause: Unknown
Water Affected: Not reported
Spill Source: Commercial/Industrial
Spill Notifier: Other
Cleanup Ceased: / /
Cleanup Meets Std: False
Last Inspection: / /
Recommended Penalty: Penalty Not Recommended
UST Trust: False
Spill Class: Known release that creates potential for fire or hazard. (Highly
Improbable)
Spill Closed Dt: 07/08/04
Remediation Phase: 0
Date Entered In Computer: 07/02/03
Spill Record Last Update: 07/08/04
Spiller Name: EDWARD KIM
Spiller Company: B&B DRY CLEANING
Spiller Address: 3621 BROADWAY
Spiller City,St,Zip: MANHATTAN, NY
Spiller Company: 001
Spiller Phone: (212) 283-9227
Contact Name: EDWARD KIM
Contact Phone: (212) 283-9227
DEC Region: 2
Program Number: 0303476
DER Facility ID: 111942
Site ID: 129892
Operable Unit ID: 871509
Operable Unit: 01
Material ID: 504341
Material Code: 0002
Material Name: #4 Fuel Oil
Case No.: Not reported
Material FA: Petroleum
Quantity: 0.00
Units: Gallons
Recovered: 0.00
Resource Affected: Soil
Oxygenate: False

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

(Continued)

S105054550

Site ID: 129892
Operable Unit ID: 871509
Operable Unit: 01
Material ID: 504342
Material Code: 0059A
Material Name: SOLVENTS
Case No.: Not reported
Material FA: Other
Quantity: 0.00
Units: Gallons
Recovered: 0.00
Resource Affected: Soil
Oxygenate: False
DEC Memo: Start DECRemark - 0303476 Prior to Sept, 2004 data translation this spill Lead DEC Field was "SAWYER" 7/3/2003-Vought-Received fax of subsurface investigation report on 7/2. Report summary: A subsurface boring investigation was conducted in Oct 2001 in response to an AST overfill in the basement of 601 W.149th Street. Concrete floor was broken resulting in subsurface penetration of petroleum. Ten borings were hand dug to refusal (max boring depth was 4.5' due to construction debris under floor. Five soil samples analyzed for EPA Method 8260/8270 (analyticals provided). Fuel oil and solvent compounds detected in analyticals. 7/3/2003-Vought-NYSDEC requires the following before submittal to NYSDEC Haz Waste Unit (Vadiim Brevdo): 1) property owner information 2) clarification of address of both dry cleaners and fuel oil tank location (are they both on same property?) 3) site plan including streets and surrounding properties, scale, TCE tank and sump pit. Vought spoke with NYSDEC Rommel and oil delivery company will be responsible for cleanup until all fuel oil compounds are removed. The oil company can then bill the dry cleaners for the difference in disposal cost of the Haz waste versus non haz waste. If all petroleum compounds are removed and solvents remain then spill 0013456 will be closed and this spill referred to NYSDEC Brevdo. Vought called Carol Karp (Phoenix) and left message to return call to NYSDEC. 7/3/2003-Vought-Spoke with Carol Karp and management agency is Manhattan North Management-David DiSilva 212-662-1100x204. Owner of dry cleaning is Edward Kim (212-283-9227). Dry cleaners is on first floor and tank is in basement of the same property. Site plan not necessary after discussion with Carol because dry cleaning and oil spill at same site. Excavation will be continued until petroleum constituents are removed. Vought will fax Karp copy of spill report. Vought will contact Brevdo with regard to immediate response to ensure no continued source. 12/24/2003-Vought-See closed spill #0013476 at same location. 02/09/04 As per Austin's request, transferred from Vought to Sawyer (Rommel) 3/18/04 - Sawyer - Paul Sherwood of Phoenix Environmental called to notify the Department that his company has taken 17 borings for analysis. In addition to the hazardous problems, the new samples showed constituents that exceed RSCO in TAGM 4046 for Toluene, Ethyl Benzene, Isopropylbenzene, 1,3,5-Trimethylbenzene, 1,2,4-Trimethylbenzene, M&P Xylenes, Benzos and Chrysene. 4/12/04 - Sawyer - Paul is going to fax over a work plan to review so the work can be started asap. 7/8/04 - Sawyer - Paul sent result and location of samples taken from the end points of the excavation. There were some minor hits for semi volatiles, like the Benzo's and Chrysene in the sw sidewall sample and due to the position of this contamination (near foundation) it is not able to be recovered. No further action needed. Closed. END DECRemark - 0303476
Remarks: Not reported
HIST LTANKS:
Region of Spill: 2
Spill Number: 0011074

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s)
EDR ID Number
EPA ID Number

(Continued)

S105054550

Investigator: SIGONA
Caller Name: Not reported
Caller Agency: Not reported
Caller Phone: Not reported
Caller Extension: Not reported
Notifier Name: Not reported
Notifier Agency: Not reported
Notifier Phone: Not reported
Notifier Extension: Not reported
Spill Date: 01/10/2001
Spill Time: 09:30
Reported to Department Date: 01/10/01
Reported to Department Time: 14:53
SWIS: 62
Spiller Contact: MR LOPEZ
Spiller Phone: (718) 401-9130
Spiller Extension: Not reported
Spiller Name: L B TRANSPORTATION
Spiller Address: 401 TARRYTOWN RD
Spiller City,St,Zip: WHITE PLAINS, NY
Facility Contact: CALLER
Facility Phone: (718) 401-9130
Facility Extension: Not reported
Spill Cause: Tank Overfill
Resource Affectd: On Land
Water Affected: Not reported
Spill Source: Other Non Commercial/Industrial
Spill Notifier: Affected Persons
PBS Number: Not reported
Cleanup Ceased: / /
Cleanup Meets Standard: False
Last Inspection: / /
Recommended Penalty: Penalty Not Recommended
Spiller Cleanup Date: / /
Enforcement Date: / /
Investigation Complete: / /
UST Involvement: False
Spill Class: Known release with minimal potential for fire or hazard. DEC Response.
Willing Responsible Party. Corrective action taken.
Spill Closed Dt: / /
Date Region Sent Summary to Central Office: / /
Corrective Action Plan Submitted: / /
Date Spill Entered In Computer Data File: 01/10/01
Time Spill Entered In Computer Data File: Not reported
Spill Record Last Update: 06/13/01
Is Updated: False
PBS Number: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate Failed Tank: Not reported
Gross Leak Rate: Not reported
Material Class Type: Petroleum
Quantity Spilled: 50
Unkonwn Quantity Spilled: False
Units: Gallons
Quantity Recovered: 50

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

(Continued)

S105054550

Unkonwn Quantity Recovered: False
Material: #4 FUEL OIL
Class Type: #4 FUEL OIL
Times Material Entry In File: 1751
CAS Number: Not reported
Last Date: 19941205
DEC Remarks: Not reported
Spill Cause: storage tank overflow

AY227 DRY CLEANERS BUSINESS
WSW 601 W 149TH ST
1/4-1/2 MANHATTAN, NY
2256 ft.

LTANKS S104951115
HIST LTANKS N/A

Site 2 of 2 in cluster AY

Relative:
Higher

LTANKS:

Actual:
113 ft.

Site ID: 129891
Spill Date: 03/24/01
Facility Addr2: Not reported
Facility ID: 0013456
Program Number: 0013456
SWIS: 3101
Region of Spill: 2
Investigator: JBVOUGHT
Referred To: Not reported
Reported to Dept: 03/24/01
CID: 15
Spill Cause: Tank Overfill
Water Affected: Not reported
Spill Source: Tank Truck
Spill Notifier: Responsible Party
Cleanup Ceased: / /
Cleanup Meets Standard: False
Last Inspection: / /
Recommended Penalty: Penalty Not Recommended
UST Involvement: False
Spill Class: Known release with minimal potential for fire or hazard. DEC Response.
Willing Responsible Party. Corrective action taken.
Spill Closed Dt: 12/24/03
Remediation Phase: 0
Date Entered In Computer: 03/24/01
Spill Record Last Update: 02/20/04
Spille Namer: Not reported
Spiller Company: CASTLE OIL CORP
Spiller Phone: (718) 579-3414
Spiller Extention: Not reported
Spiller Address: 290 LOCUST AV
Spiller City,St,Zip: BRONX, NY 10454-
Spiller County: 001
Spiller Contact: Not reported
Spiller Phone: Not reported
Spiller Extention: Not reported
DEC Region: 2
Program Number: 0013456
DER Facility ID: 111942
Site ID: 129891
Operable Unit ID: 835397
Operable Unit: 01

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

DRY CLEANERS BUSINESS (Continued)

EDR ID Number
EPA ID Number

Database(s)

S104951115

Material ID: 540166
Material Code: 0003
Material Name: #6 Fuel Oil
Case No.: Not reported
Material FA: Petroleum
Quantity: 50.00
Units: Gallons
Recovered: 0.00
Resource Affected: Soil
Oxygenate: False
Site ID: Not reported
Spill Tank Test: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate: Not reported
Gross Fail: Not reported
Modified By: Not reported
Last Modified: Not reported
Test Method: Not reported
DEC Memo: Start DECRemark - 0013456 Prior to Sept, 2004 data translation this spill Lead DEC Field was "VOUGHT" 10/2/01: On this date K.Goertz inspected the site. Phoenix Environmental was on scene performing hand borings at 9 seperate locations. There was a large #6 oil stain on the basement wall and some staining in the soils but the odor exhibited more than just a six oil smell. There could have been a chlorinated solvent odor. K.Goertz directed Carrol Karp of Phoenix Environmental to analyze the two soil samples with the highest PID readings for both petroleum and chlorinated solvents. (KG)
7/3/2003-Vought-Spill transferred from Tibbe to Vought. 7/3/2003-Vought-See spill #0303476 at same location reported when solvents found in soil disposal sample. 7/3/2003-Vought-Received fax of subsurface investigation report on 7/2. Report summary: A subsurface boring investigation was conducted in Oct 2001 in response to an AST overfill in the basement of 601 W.149th Street. Concrete floor was broken resulting in subsurface penetration of petroleum. Ten borings were hand dug to refusal (max boring depth was 4.5' due to construction debris under floor. Five soil samples analyzed for EPA Method 8260/8270 (analyticals provided). Fuel oil and solvent compounds detected in analyticals. 7/3/2003-Vought- Vought spoke with NYSDEC Rommel and oil delivery company will be responsible for cleanup until all fuel oil compounds are removed. The oil company can then bill the dry cleaners for the difference in disposal cost of the Haz waste versus non haz waste. If all petroleum compounds are removed and solvents remain then spill 0013456 will be closed and this spill referred to NYSDEC Brevdo. Vought called Carol Karp (Phoenix) and left message to return call to NYSDEC. 7/16/2003-Vought-Spoke with Karp and faxed her a copy of this spill report. 12/24/2003-Vought-Spill closed due to open spill #0303476 at same location. END DECRemark - 0013456
Remarks: Start CallerRemark - 0013456 storage tank overfill - petroleum tank cleaners is responding for clean up END CallerRemark - 0013456

HIST LTANKS:

Region of Spill: 2
Spill Number: 0013456
Investigator: TIBBE
Caller Name: Not reported
Caller Agency: Not reported
Caller Phone: Not reported
Caller Extension: Not reported

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s)
EDR ID Number
EPA ID Number

DRY CLEANERS BUSINESS (Continued)

S104951115

Notifier Name: Not reported
Notifier Agency: Not reported
Notifier Phone: Not reported
Notifier Extension: Not reported
Spill Date: 03/24/2001
Spill Time: 14:00
Reported to Department Date: 03/24/01
Reported to Department Time: 15:47
SWIS: 62
Spiller Contact: Not reported
Spiller Phone: Not reported
Spiller Extention: Not reported
Spiller Name: CASTLE OIL CORP
Spiller Address: 290 LOCUST AV
Spiller City,St,Zip: BRONX, NY 10454-
Facility Contact: Not reported
Facility Phone: (718) 579-3414
Facility Extention: Not reported
Spill Cause: Tank Overfill
Resource Affectd: On Land
Water Affected: Not reported
Spill Source: Tank Truck
Spill Notifier: Responsible Party
PBS Number: Not reported
Cleanup Ceased: / /
Cleanup Meets Standard: False
Last Inspection: / /
Recommended Penalty: Penalty Not Recommended
Spiller Cleanup Date: / /
Enforcement Date: / /
Investigation Complete: / /
UST Involvement: False
Spill Class: Known release with minimal potential for fire or hazard. DEC Response.
Willing Responsible Party. Corrective action taken.
Spill Closed Dt: / /
Date Region Sent Summary to Central Office: / /
Corrective Action Plan Submitted: / /
Date Spill Entered In Computer Data File: 03/24/01
Time Spill Entered In Computer Data File: Not reported
Spill Record Last Update: 10/02/01
Is Updated: False
PBS Number: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate Failed Tank: Not reported
Gross Leak Rate: Not reported
Material Class Type: Petroleum
Quantity Spilled: 50
Unkonwn Quantity Spilled: False
Units: Gallons
Quantity Recovered: 0
Unkonwn Quantity Recovered: True
Material: #6 FUEL OIL
Class Type: #6 FUEL OIL
Times Material Entry In File: 2190
CAS Number: Not reported

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

DRY CLEANERS BUSINESS (Continued)

EDR ID Number
EPA ID Number

S104951115

Last Date: 19940728
DEC Remarks: 10/2/01: On this date K.Goert inspected the site. Phoenix Environmental was on scene performing hand borings at 9 separate locations. There was a large 6 oil stain on the basement wall and some staining in the soils but the odor exhibited more than just a six oil smell. There could have been a chlorinated solvent odor. K.Goert directed Carol Karp of Phoenix Environmental to analyze the two soil samples with the highest PID readings for both petroleum and chlorinated solvents. KG)
Spill Cause: storage tank overflow - petroleum tank cleaners is responding for clean up

**228
NNE
1/4-1/2
2289 ft.**

**APARTMENT BUILDING
2090-92 AMSTERDAM AVE
NEW YORK CITY, NY**

**LTANKS S107658555
N/A**

**Relative:
Higher**

**Actual:
159 ft.**

LTANKS:
Site ID: 359546
Spill Date: 02/14/06
Facility Addr2: Not reported
Facility ID: 0513122
Program Number: 0513122
SWIS: 3101
Region of Spill: 2
Investigator: HRPATEL
Referred To: Not reported
Reported to Dept: 02/14/06
CID: 15
Spill Cause: Tank Test Failure
Water Affected: Not reported
Spill Source: Private Dwelling
Spill Notifier: Tank Tester
Cleanup Ceased: / /
Cleanup Meets Standard: False
Last Inspection: / /
Recommended Penalty: Penalty Not Recommended
UST Involvement: False
Spill Class: Known release with minimal potential for fire or hazard. DEC Response.
Willing Responsible Party. Corrective action taken.
Spill Closed Dt: 05/05/06
Remediation Phase: 0
Date Entered In Computer: 02/14/06
Spill Record Last Update: 05/05/06
Spiller Namer: MARLON JOESPH
Spiller Company: APARTMENT BUILDING
Spiller Phone: (718) 772-7949
Spiller Extention: Not reported
Spiller Address: 2090-92 AMSTERDAM AVE
Spiller City,St,Zip: NEW YORK CITY, NY
Spiller County: 001
Spiller Contact: MARLON JOESPH
Spiller Phone: (718) 772-7949
Spiller Extention: Not reported
DEC Region: 2
Program Number: 0513122
DER Facility ID: 309634
Site ID: 359546
Operable Unit ID: 1116752
Operable Unit: 01

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

APARTMENT BUILDING (Continued)

EDR ID Number
EPA ID Number

Database(s)

S107658555

Material ID: 2107201
Material Code: 0001
Material Name: #2 Fuel Oil
Case No.: Not reported
Material FA: Petroleum
Quantity: 0.00
Units: Gallons
Recovered: 0.00
Resource Affected: Soil
Oxygenate: False
Site ID: Not reported
Spill Tank Test: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate: Not reported
Gross Fail: Not reported
Modified By: Not reported
Last Modified: Not reported
Test Method: Not reported
DEC Memo: Start DECRemark - 0513122 02/14/06. Feroze , PBS of this spill is # 2-472883. TTF is sent to : New Realty Management Corp, Inc. 450 Seventh Ave, Suit 907. New York, NY 10123 Attn: 2090 Amsterdam Corp. 02/21/06 Feroze, Mr. Deno of New Realty Management Corp, Inc. 212-643-8117 called and informed that he sold that property 4 yrs ago. Present owner of that property is: Barbary Rose Real Estate 100 Cedarhurst Ave, Suit 202 Cedarhurst, NY 11516 Phone:516-779-0915, Fax 516-374-4068. TTF is sent to them. 04/21/06-Hiralkumar Patel. Left message at 516-779-0915. 05/05/06-Hiralkumar Patel. Spoke to Marlin at Petroleum. as per him, they found problem at vent line. they repaired it and tested again. system passed the test. case closed. END DECRemark - 0513122
Remarks: Start CallerRemark - 0513122 ABOVE LIQUID LEAK, MIGHT BE THE NET LINE. END CallerRemark - 0513122

229
WSW
1/4-1/2
2359 ft.

APARTMENT
3609 BROADWAY
NEW YORK, NY

LTANKS S107789312
N/A

Relative:
Higher

Actual:
112 ft.

LTANKS:
Site ID: 363453
Spill Date: 05/03/06
Facility Addr2: Not reported
Facility ID: 0601264
Program Number: 0601264
SWIS: 3101
Region of Spill: 2
Investigator: KSTANG
Referred To: Not reported
Reported to Dept: 05/03/06
CID: 15
Spill Cause: Tank Test Failure
Water Affected: Not reported
Spill Source: Private Dwelling
Spill Notifier: Tank Tester
Cleanup Ceased: / /
Cleanup Meets Standard: False
Last Inspection: / /

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s)
EDR ID Number
EPA ID Number

APARTMENT (Continued)

S107789312

Recommended Penalty: Penalty Not Recommended
UST Involvement: False
Spill Class: Not reported
Spill Closed Dt: / /
Remediation Phase: 1
Date Entered In Computer: 05/03/06
Spill Record Last Update: 05/22/07
Spille Namer: NICK
Spiller Company: APARTMENT
Spiller Phone: (516) 658-1497
Spiller Extention: Not reported
Spiller Address: 3609 BROADWAY
Spiller City,St,Zip: NEW YORK, NY
Spiller County: 001
Spiller Contact: NICK
Spiller Phone: (516) 658-1497
Spiller Extention: Not reported
DEC Region: 2
Program Number: 0601264
DER Facility ID: 313629
Site ID: 363453
Operable Unit ID: 1121507
Operable Unit: 01
Material ID: 2111004
Material Code: 0002
Material Name: #4 Fuel Oil
Case No.: Not reported
Material FA: Petroleum
Quantity: 0.00
Units: Gallons
Recovered: 0.00
Resource Affected: Soil
Oxygenate: False
Site ID: 363453
Spill Tank Test: 1549946
Tank Number: 1
Tank Size: 5000
Test Method: 03
Leak Rate: 0.00
Gross Fail: Not reported
Modified By: Watchdog
Last Modified: 05/03/06
Test Method: Horner EZ Check I or II
DEC Memo: Start DECRemark - 0601264 Initial spill# is 0601179. DEC Piper received call after hours on 5/1/06. DEC Piper contacted Rene Lewis from Eastmond. As per conversation oil seeping up thorough the sumps (3) at 601 w. 149th St. 601 was already dealingwith a water issue which was coming up through these sumps. On Monday, oil appeared and Eastmond was hired to vac out. Upon furhter investigation the oil seems and is believed to be coming from adjecnt building -3609 Broadway. 3609 has a 5,000 gal#4 oil tank which is underlain by a steam line. The steam line has recently been discovered to be leaking. Unknown how long. Because of this steam line leak, the tank is believed to be rotted and comprimised. Eastmond to pump out tank and perform tightness test on 3609 Broadway on Wed. morning. 5/3/06- DEC Piper responded to site. Upon arrival it was noted that there was a recent overfill through the vent line. It appeared to be 50 gal. though in speaking with HESS (Eric Sutton- 908.392.0136), they were told 2 gal by driver and super(646.523.8506) cleaned it up. (Poor Job-

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s)
EDR ID Number
EPA ID Number

APARTMENT (Continued)

S107789312

evidence of spill, staining, contaminated soil still on ground). As per conversations w/ super, Eastmond and Job Super of 601, there was a delivery made on Friday Apr.28. 2700 gal was delivered to top off the tank. On monday morning the tank read 22 inches of oil which is 1200. These numbers do not add up. The tightness test revealed six (6) holes in the bottom of the tank. Due to the tanktest failure, Sp #0601179 was closed and this spill opened in lieu of these recent findings. DEC Piper initially told Managing agent to setup temporary tank for heating and hot water. HESS has contracted Eastmond to cleanup overfill on sidewalk and sewer. 5/31/06 -there is no GW or soil samples taken and no RI report to review. Will wait for additional information from RP. - KST OWNERSHIP- BNS Building LLC. C/O Nicholas Conway Alma Realty Corp. 28-18 31st St. Suite 201 Astoria, NY 11102 (718.267.0300) It is estimated by tank capacity and contents on Monday that approximately 3500-3800 gallons missing. This spill referred to Remediation. 5/9/06- As per Sharima of RND Services, they have been contracted to perform the subsurface investigation. 3/8/07- DEC Piper recieved tank closure report. From Fon Carlo. Tank was replaced and 15 drums of soil was removed. however the report mentions nothing about a subsurface investigation for the missing 2800 gallons of oil. Piper psoke with Danny at Don Carlo. Additional investigatin is warranted. This spill is referred to remediation. 4/27/07 - Received call from Ted Yen. I requested subsurface investigation work plan to be submitted to asceratin whether there are any impacts to groundwater. Mr. Yen agreed to prepare and submit work plan for subsurface investigation. V. Brevdo 5/22/07 The following e-mail was sent to Mr. Ted Yen. "May 22, 2007 Dear Mr. Yen, This is in response to your e-mail of 5/2/2007 and letter-report (letter with Don Carlo Environmental Services, undated, received in the DEC Region 2 office on May 7, 2007). In a letter-report you requested that groundwater sampling be waived and that the spill number be closed. Please be informedthat the Department can not close the aforementioned spill. The rationale for this determination is as follows. DEC staff inspected the site on May 21, 2007. DEC Staff performed an inspection of the downgradient building and met with that site's supervisor. Through observation of the sump pits, it was determined that oil is still entering the pits during rainfall events. There is currently oil soaked adsorbents and patches of free phase product in the nearest sump closest to the spill source. An additional sump located towards the back of the property also contained oil staining. Through conversation with the supervisor, the nearest pit is cleaned on a weekly basis as to not fowl up the pumps and discharge to sewer. The Department recommends that Don Carlo investigate this further and make the necessary arrangements to have this pit cleaned by the RP on a weekly basis. Additionally since this pit is not designed as the collection point and only some oil may have collected in it, there is reason to believe that an unknown amount may have passed this pit and is continuing downgradient. Space is very limited between buildings, therefore it is our recommendation that bedrock wells be installed along W 149th St. and Riverside Drive. The affected building's main address is 603 W. 148th St., however the back of property is 608 w 149th St. This latter address will be a church and the pits can be accessed through this "back" entrance. Contact info for the affected building is Greg Baron Riverview West Contracting ph. 212.722.3671 fax 212.534.5021. Please feel free to contact me at (718) 482-4928 or via e-mail if you have any questions. Respectfully, Vadim Brevdo" END DECRemark -0601264

Not reported

Remarks:

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

230
SSE
1/4-1/2
2366 ft.

225 EAST 149TH ST/BX
225 EAST 149TH STREET
NEW YORK CITY, NY

LTANKS
HIST LTANKS

EDR ID Number
EPA ID Number
S104275642
N/A

Relative:
Lower

Actual:
21 ft.

LTANKS:

Site ID: 64449
Spill Date: 02/12/91
Facility Addr2: Not reported
Facility ID: 9011867
Program Number: 9011867
SWIS: 0301
Region of Spill: 2
Investigator: WILSON
Referred To: Not reported
Reported to Dept: 02/12/91
CID: 15
Spill Cause: Tank Failure
Water Affected: Not reported
Spill Source: Commercial/Industrial
Spill Notifier: Other
Cleanup Ceased: 05/25/95
Cleanup Meets Standard: True
Last Inspection: / /
Recommended Penalty: Penalty Not Recommended
UST Involvement: False
Spill Class: Known release with minimal potential for fire or hazard. DEC Response.
Willing Responsible Party. Corrective action taken.
Spill Closed Dt: 05/25/95
Remediation Phase: 0
Date Entered In Computer: 02/13/91
Spill Record Last Update: 05/25/95
Spille Namer: Not reported
Spiller Company: Not reported
Spiller Phone: Not reported
Spiller Extention: Not reported
Spiller Address: Not reported
Spiller City,St,Zip: ***Update***, ZZ
Spiller County: 001
Spiller Contact: Not reported
Spiller Phone: Not reported
Spiller Extention: Not reported
DEC Region: 2
Program Number: 9011867
DER Facility ID: 62110
Site ID: 64449
Operable Unit ID: 951791
Operable Unit: 01
Material ID: 428383
Material Code: 0001
Material Name: #2 Fuel Oil
Case No.: Not reported
Material FA: Petroleum
Quantity: 40.00
Units: Gallons
Recovered: 0.00
Resource Affected: Soil
Oxygenate: False
Site ID: Not reported

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

225 EAST 149TH ST/BX (Continued)

EDR ID Number
EPA ID Number

Database(s)

S104275642

Spill Tank Test: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate: Not reported
Gross Fail: Not reported
Modified By: Not reported
Last Modified: Not reported
Test Method: Not reported
DEC Memo: Not reported
Remarks: Start CallerRemark - 9011867 MANHOLE COVER GASKET BROKE ON TANK,OIL COMING OUT OF TANK TOP(2K TANK)IN TANK ROOM,A L EASTMOND TO DO CLEAN UP. END CallerRemark - 9011867

HIST LTANKS:

Region of Spill: 2
Spill Number: 9011867
Investigator: WILSON
Caller Name: Not reported
Caller Agency: Not reported
Caller Phone: Not reported
Caller Extension: Not reported
Notifier Name: Not reported
Notifier Agency: Not reported
Notifier Phone: Not reported
Notifier Extension: Not reported
Spill Date: 02/12/1991
Spill Time: 11:00
Reported to Department Date: 02/12/91
Reported to Department Time: 12:44
SWIS: 60
Spiller Contact: Not reported
Spiller Phone: Not reported
Spiller Extension: Not reported
Spiller Name: Not reported
Spiller Address: Not reported
Spiller City,St,Zip: Not reported
Facility Contact: Not reported
Facility Phone: Not reported
Facility Extension: Not reported
Spill Cause: Tank Failure
Resource Affectd: On Land
Water Affected: Not reported
Spill Source: Other Commercial/Industrial
Spill Notifier: Other
PBS Number: Not reported
Cleanup Ceased: 05/25/95
Cleanup Meets Standard: True
Last Inspection: / /
Recommended Penalty: Penalty Not Recommended
Spiller Cleanup Date: / /
Enforcement Date: / /
Investigation Complete: / /
UST Involvement: False
Spill Class: Known release with minimal potential for fire or hazard. DEC Response.
Willing Responsible Party. Corrective action taken.
Spill Closed Dt: 05/25/95

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s)
EDR ID Number
EPA ID Number

225 EAST 149TH ST/BX (Continued)

S104275642

Date Region Sent Summary to Central Office: / /
Corrective Action Plan Submitted: / /
Date Spill Entered In Computer Data File: 02/13/91
Time Spill Entered In Computer Data File: Not reported
Spill Record Last Update: 05/25/95
Is Updated: False
PBS Number: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate Failed Tank: Not reported
Gross Leak Rate: Not reported
Material Class Type: Petroleum
Quantity Spilled: 40
Unkonwn Quantity Spilled: False
Units: Gallons
Quantity Recovered: 0
Unkonwn Quantity Recovered: False
Material: #2 FUEL OIL
Class Type: #2 FUEL OIL
Times Material Entry In File: 24464
CAS Number: Not reported
Last Date: 19941207
DEC Remarks: Not reported
Spill Cause: MANHOLE COVER GASKET BROKE ON TANK,OIL COMING OUT OF TANK TOP 2K TANK)IN TANK ROOM,A L EASTMOND TO DO CLEAN UP.

231 JACKIE ROBINSON POOL
South 88 BRADHURST AV
1/4-1/2 MANHATTAN, NY
2393 ft.

LTANKS S105054976
HIST LTANKS N/A

Relative:
Lower

LTANKS:

Actual:
31 ft.

Site ID: 78327
Spill Date: 05/30/01
Facility Addr2: Not reported
Facility ID: 0102259
Program Number: 0102259
SWIS: 3101
Region of Spill: 2
Investigator: AHMED
Referred To: Not reported
Reported to Dept: 05/30/01
CID: 15
Spill Cause: Tank Test Failure
Water Affected: Not reported
Spill Source: Commercial/Industrial
Spill Notifier: Tank Tester
Cleanup Ceased: / /
Cleanup Meets Standard: False
Last Inspection: / /
Recommended Penalty: Penalty Not Recommended
UST Involvement: False
Spill Class: Known release that creates potential for fire or hazard. DEC Response.
Willing Responsible Party. Corrective action taken.
Spill Closed Dt: / /
Remediation Phase: 1
Date Entered In Computer: 05/30/01

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

JACKIE ROBINSON POOL (Continued)

S105054976

Spill Record Last Update: 04/30/04
Spille Namer: SEAN AARON
Spiller Company: JACKIE ROBINSON POOL
Spiller Phone: (631) 586-4900
Spiller Extention: Not reported
Spiller Address: 88 BRADHURST AV
Spiller City,St,Zip: MANHATTAN, NY
Spiller County: 001
Spiller Contact: SEAN AARON
Spiller Phone: (631) 586-4900
Spiller Extention: Not reported
DEC Region: 2
Program Number: 0102259
DER Facility ID: 72898
Site ID: 78327
Operable Unit ID: 839089
Operable Unit: 01
Material ID: 534374
Material Code: 0001
Material Name: #2 Fuel Oil
Case No.: Not reported
Material FA: Petroleum
Quantity: 0.00
Units: Gallons
Recovered: 0.00
Resource Affected: Soil
Oxygenate: False
Site ID: 78327
Spill Tank Test: 1526337
Tank Number: 1
Tank Size: 10000
Test Method: 03
Leak Rate: 0.00
Gross Fail: F
Modified By: Spills
Last Modified: 10/01/04
Test Method: Horner EZ Check I or II
DEC Memo: Not reported
Remarks: Start CallerRemark - 0102259 TANK IS IN VAULT SPACE - CONFINED SPACE ENTRY
REQUIRED END CallerRemark - 0102259

HIST LTANKS:

Region of Spill: 2
Spill Number: 0102259
Investigator: TIPPLE
Caller Name: Not reported
Caller Agency: Not reported
Caller Phone: Not reported
Caller Extension: Not reported
Notifier Name: Not reported
Notifier Agency: Not reported
Notifier Phone: Not reported
Notifier Extension: Not reported
Spill Date: 05/30/2001
Spill Time: 11:00
Reported to Department Date: 05/30/01
Reported to Department Time: 11:38

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s)
EDR ID Number
EPA ID Number

JACKIE ROBINSON POOL (Continued)

S105054976

SWIS: 62
Spiller Contact: SEAN AARON
Spiller Phone: (631) 586-4900
Spiller Extention: Not reported
Spiller Name: JACKIE ROBINSON POOL
Spiller Address: 88 BRADHURST AV
Spiller City,St,Zip: MANHATTAN, NY
Facility Contact: SEAN AARON
Facility Phone: (631) 586-4900
Facility Extention: Not reported
Spill Cause: Tank Test Failure
Resource Affectd: On Land
Water Affected: Not reported
Spill Source: Other Commercial/Industrial
Spill Notifier: Tank Tester
PBS Number: 2-604973
Cleanup Ceased: / /
Cleanup Meets Standard: False
Last Inspection: / /
Recommended Penalty: Penalty Not Recommended
Spiller Cleanup Date: / /
Enforcement Date: / /
Investigation Complete: / /
UST Involvement: False
Spill Class: Known release with minimal potential for fire or hazard. DEC Response.
Willing Responsible Party. Corrective action taken.
Spill Closed Dt: / /
Date Region Sent Summary to Central Office: / /
Corrective Action Plan Submitted: / /
Date Spill Entered In Computer Data File: 05/30/01
Time Spill Entered In Computer Data File: Not reported
Spill Record Last Update: 05/30/01
Is Updated: False
PBS Number: Not reported
Tank Number: 1
Tank Size: 10000
Test Method: Horner EZ Check
Leak Rate Failed Tank: 0.00
Gross Leak Rate: Talk Test Failures only pass or fail
Material Class Type: Petroleum
Quantity Spilled: 0
Unkonwn Quantity Spilled: False
Units: Gallons
Quantity Recovered: 0
Unkonwn Quantity Recovered: False
Material: #2 FUEL OIL
Class Type: #2 FUEL OIL
Times Material Entry In File: 24464
CAS Number: Not reported
Last Date: 19941207
DEC Remarks: Not reported
Spill Cause: TANK IS IN VAULT SPACE - CONFINED SPACE ENTRY REQUIRED

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

232
NW
1/4-1/2
2406 ft.

838 RIVERSIDE DR
838 RIVERSIDE DR
NYC, NY

LTANKS
HIST LTANKS

EDR ID Number
EPA ID Number
S102671844
N/A

Relative:
Lower

Actual:
105 ft.

LTANKS:
Site ID: 92210
Spill Date: 03/06/92
Facility Addr2: Not reported
Facility ID: 9112431
Program Number: 9112431
SWIS: 3101
Region of Spill: 2
Investigator: KSTANG
Referred To: Not reported
Reported to Dept: 03/06/92
CID: 15
Spill Cause: Tank Overfill
Water Affected: Not reported
Spill Source: Commercial/Industrial
Spill Notifier: Other
Cleanup Ceased: 03/06/92
Cleanup Meets Standard: True
Last Inspection: / /
Recommended Penalty: Penalty Not Recommended
UST Involvement: False
Spill Class: Not reported
Spill Closed Dt: 03/06/92
Remediation Phase: 0
Date Entered In Computer: 03/11/92
Spill Record Last Update: 09/30/04
Spille Namer: Not reported
Spiller Company: Not reported
Spiller Phone: Not reported
Spiller Extention: Not reported
Spiller Address: Not reported
Spiller City,St,Zip: ***Update***, ZZ
Spiller County: 001
Spiller Contact: Not reported
Spiller Phone: Not reported
Spiller Extention: Not reported
DEC Region: 2
Program Number: 9112431
DER Facility ID: 82818
Site ID: 92210
Operable Unit ID: 966027
Operable Unit: 01
Material ID: 417406
Material Code: 0002
Material Name: #4 Fuel Oil
Case No.: Not reported
Material FA: Petroleum
Quantity: 15.00
Units: Gallons
Recovered: 0.00
Resource Affected: Soil
Oxygenate: False
Site ID: Not reported
Spill Tank Test: Not reported

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

838 RIVERSIDE DR (Continued)

EDR ID Number
EPA ID Number

Database(s)

S102671844

Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate: Not reported
Gross Fail: Not reported
Modified By: Not reported
Last Modified: Not reported
Test Method: Not reported
DEC Memo: Start DECRemark - 9112431 Prior to Sept, 2004 data translation this spill Lead
DEC Field was "TANG" END DECRemark - 9112431
Remarks: Start CallerRemark - 9112431 PETROMETER FAILED. SPEEDY APPLIED, PICKED UP &
DISPOSED. END CallerRemark - 9112431

HIST LTANKS:

Region of Spill: 2
Spill Number: 9112431
Investigator: TANG
Caller Name: Not reported
Caller Agency: Not reported
Caller Phone: Not reported
Caller Extension: Not reported
Notifier Name: Not reported
Notifier Agency: Not reported
Notifier Phone: Not reported
Notifier Extension: Not reported
Spill Date: 03/06/1992
Spill Time: 08:20
Reported to Department Date: 03/06/92
Reported to Department Time: 09:57
SWIS: 62
Spiller Contact: Not reported
Spiller Phone: Not reported
Spiller Extension: Not reported
Spiller Name: Not reported
Spiller Address: Not reported
Spiller City,St,Zip: Not reported
Facility Contact: Not reported
Facility Phone: Not reported
Facility Extension: Not reported
Spill Cause: Tank Overfill
Resource Affectd: On Land
Water Affected: Not reported
Spill Source: Other Commercial/Industrial
Spill Notifier: Other
PBS Number: Not reported
Cleanup Ceased: 03/06/92
Cleanup Meets Standard: True
Last Inspection: / /
Recommended Penalty: Penalty Not Recommended
Spiller Cleanup Date: / /
Enforcement Date: / /
Investigation Complete: / /
UST Involvement: False
Spill Class: Not reported
Spill Closed Dt: 03/06/92
Date Region Sent Summary to Central Office: / /
Corrective Action Plan Submitted: / /

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

838 RIVERSIDE DR (Continued)

EDR ID Number
EPA ID Number

Database(s)

S102671844

Date Spill Entered In Computer Data File: 03/11/92
Time Spill Entered In Computer Data File: Not reported
Spill Record Last Update: / /
Is Updated: False
PBS Number: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate Failed Tank: Not reported
Gross Leak Rate: Not reported
Material Class Type: Petroleum
Quantity Spilled: 15
Unkonwn Quantity Spilled: False
Units: Gallons
Quantity Recovered: 0
Unkonwn Quantity Recovered: False
Material: #4 FUEL OIL
Class Type: #4 FUEL OIL
Times Material Entry In File: 1751
CAS Number: Not reported
Last Date: 19941205
DEC Remarks: Not reported
Spill Cause: PETROMETER FAILED. SPEEDY APPLIED, PICKED UP DISPOSED.

233
NNW
1/4-1/2
2412 ft.

COLUMBIA PRESBYTERIAN HOSPITAL
630 W 160TH ST
NEW YORK, NY 10032

RCRA-SQG
FINDS
LTANKS
NY Spills
NY Hist Spills
HIST LTANKS

1000556621
NYD986991941

Relative:
Higher

Actual:
129 ft.

RCRAInfo:
Owner: COLUMBIA PRESBYTERIAN HOSPITAL
(212) 555-1212
EPA ID: NYD986991941
Contact: Not reported
Classification: Small Quantity Generator
TSDF Activities: Not reported
Violation Status: No violations found

FINDS:

Other Pertinent Environmental Activity Identified at Site

RCRAInfo is a national information system that supports the Resource Conservation and Recovery Act (RCRA) program through the tracking of events and activities related to facilities that generate, transport, and treat, store, or dispose of hazardous waste. RCRAInfo allows RCRA program staff to track the notification, permit, compliance, and corrective action activities required under RCRA.

LTANKS:

Site ID: 81359
Spill Date: 09/12/95
Facility Addr2: Not reported

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

COLUMBIA PRESBYTERIAN HOSPITAL (Continued)

EDR ID Number
EPA ID Number

Database(s)

1000556621

Facility ID: 9507159
Program Number: 9507159
SWIS: 3101
Region of Spill: 2
Investigator: ADZHITOM
Referred To: Not reported
Reported to Dept: 09/12/95
CID: 15
Spill Cause: Tank Test Failure
Water Affected: Not reported
Spill Source: Non Major Facility > 1,100 gal
Spill Notifier: Tank Tester
Cleanup Ceased: / /
Cleanup Meets Standard: False
Last Inspection: / /
Recommended Penalty: Penalty Not Recommended
UST Involvement: True
Spill Class: Known release that creates potential for fire or hazard. DEC Response.
Willing Responsible Party. Corrective action taken.
Spill Closed Dt: / /
Remediation Phase: 1
Date Entered In Computer: 12/27/48
Spill Record Last Update: 04/04/07
Spille Namer: BRIAN MCSHANE
Spiller Company: COLUMBIA PRESBYTERIAN
Spiller Phone: (212) 305-3127
Spiller Extention: Not reported
Spiller Address: 635 WEST 165TH STREET,B37
Spiller City,St,Zip: NEW YORK, NY 10032-
Spiller County: 001
Spiller Contact: BRIAN MCSHANE
Spiller Phone: (212) 305-3127
Spiller Extention: Not reported
DEC Region: 2
Program Number: 9507159
DER Facility ID: 75286
Site ID: 81359
Operable Unit ID: 1018021
Operable Unit: 01
Material ID: 361585
Material Code: 0009
Material Name: Gasoline
Case No.: Not reported
Material FA: Petroleum
Quantity: 0.00
Units: Gallons
Recovered: 0.00
Resource Affected: Groundwater
Oxygenate: False
Site ID: Not reported
Spill Tank Test: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate: Not reported
Gross Fail: Not reported
Modified By: Not reported

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

COLUMBIA PRESBYTERIAN HOSPITAL (Continued)

EDR ID Number
EPA ID Number

Database(s)

1000556621

Last Modified: Not reported
Test Method: Not reported
DEC Memo: Start DECRemark - 9507159 This spill was reassigned from DEC Sigona to Rommel on January 7, 2004. This spill site cleanup has been consolidated under Spill No. 9507159. On December 22, 1995 met with Clayton Environmental representatives John Gavras, Benjamin Alter & Vishal Shah - (908) 225-6040 at 10:00 AM along with Brian McShane Senior Industrial Hygienist (212) 305-3127 Columbia-Presbyterian Medical Center to follow-up Closure Report for the In-Place Abandonment of Gasoline Tanks Presbyterian Hospital Parking Garage by Clayton Environmental Consultants report November 30, 1995. Inspection of the facility found the two abandoned gasoline tanks 1,000 gallon tanks located 2 levels below street in parking garage. Tanks were closed in response to pressure tests by fire department. Tanks are older than 15 years. Soil contamination may be a pocket around buried USTs. requesting that the consultant to drill with air rotor to bedrock and any water. need to develop some monitoring wells, and possibly vent the soil. The results of the investigation found the soil to be contaminated with volatile organic hydrocarbons. Informed the reps that I would send letter and stip in a week. Gave some info on the stipulation process. DEC's executed a Stipulation Agreement, dated January 2, 20001, for the cleanup of historic petroleum contamination at the above referenced site. 1/6/05 Received call from Robert Furguson, Fenley and Nicol. A site visit is planned for 1/12/05. Planned work includes excavation of a 20 by 20' area in the lower level of the parking garage to address the hottest soil area identified during the installation of the mws. The upper level, where the tanks were, is assumed clean and will be confirmed through soil borings. Rommel 1/17/05 Received 1-page faxed workplan from F&N. 20 x 20 to 3 ft bg (wt). GW will be pumped to 55 gallon drums and properly disposed. excavation screened with pid and if all is removed, collect endpoint samples. 3/3/05 - reassigned to Alex Zhitomirsky. - KST 3/17/2005 conversation with Kristin Dillner of F&N. They excavated contaminated soil about 18 tons, took confirmation samples and are submitting report to my attention. There was an SVE and Air Parging system operated by F&N. They requested NFA. A. Zhitomirsky 4/25/2005 A letter was issued by DEC to Gregory Camacho New York Presbyterian Medical Center 635 West 165th Street, El Room B37 New York, New York 10032. The letter said that a report submitted by Fenley and Nicol and received on March 24, 2005 was reviewed. The report stated that Fenley and Nicol excavated and removed 18 tons of hydrocarbon impacted soil from the lower parking garage area. An analysis of endpoint samples indicated that no significant hydrocarbon impact remains in the excavation area with the exception of the end point sample EP-9. Air sampling data from the existing on the site air sparging system show that the system is not extracting volatile contaminants from groundwater. Nevertheless, groundwater analyses showed very high concentrations of volatile organic compounds in wells FN-1 and FN-3. DEC letter stated that based on the above facts a No Further Action (NFA) letter cannot be issued for this site. The Department recommended that the existing air sparging system should be modified to better address the groundwater contamination, or another remedial approach should be developed for this site. AZ 5/26/2005 Kristine Dillner (F&N) proposed in a phone conversation to pump out wells weekly for one quarter and then sample. Based on the sampling results they will assess the plume. AZ 10/24/2005 Robert Ferguson (F&N) will fax lab data results. Data from October 13, 2005 in FN-3 benzene 1.3 ppb, toluene - 8 ppb and ethylbenzene - 248 ppb. This is the only well with exceedances. F&N shut air sparging system off in September 2005 with the DEC concurrence. They pumped FN-1 and FN-3 out weekly for one quarter. The last pumping event took place about mid September. They pumped the wells dry. I concurred with R. Ferguson proposal to sample for two more quarters and submit their conclusions to DEC. AZ 1/10/2006 I

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s)
EDR ID Number
EPA ID Number

COLUMBIA PRESBYTERIAN HOSPITAL (Continued)

1000556621

contacted R. Fergusson (F&N). He will submit the latest monitoring report which was delayed since his client refused to pay. AZ 1/23/2006 Contacted Gregory Camacho(Presbyterian Hospital Industrial Hygenist). We discussed remedial progress. They will follow with Fenley @ Nicol on the siteremediation. AZ 4/4/2006 Left a message for Robert Fergusson (F&N 631-586-4900 Ext. 167). AZ 6/14/2006 Contacted Fenley & Nicol. Robert Fergusson left the company. Brian McCabe will handling the case. Hospital has some outstanding bills and they put the site on hold. He will submit an updated for the site. AZ 8/10/2006 Contacted Gregory Camacho (Presbyterian) @ 212-305-3127. He will try to resolve the issue and contact F& N. A report should be submitted to DEC. AZ 2/1/2007 Reviewed Quarterly Status Report submitted by Fenley & Nicol on October 5, 2006. The report showed that the latest round of gw sampling performed on August 31, 2006, exhibited a significant increase in BTEX concentrations. FN-2 exhibited 13,480 ppb of total VOCs, FN-3 exhibited 10,246 ppb of total VOCs (FN-3 had only 249 ppb in October 2005). FN-1 was not sampled. I left a message for Gregory Camacho (Presbyterian) @ 212-305-3127. I left a message for Brian McCabe (F&N)@631-586-4900. He called me back. He stated that the remedial systems were shot down for over a year, however, the report stated that it is running. He will check out why FN-1 was not sampled. The site was sampled again on December 20, 2006. F& N will forward the latest report to DEC. In December 2006 total BTEX ranged from ND to 11,626 ppb. I requested that F&N submit proposals for remedial strategy ASAP. AZ 2/2/2007 I contacted Gregory Camacho (Presbyterian). I told him that since the contaminat concentrations increased, the existing contaminant plume must be addressed. Their consultant should submit a remedial plan for the site. AZ 4/4/2007 I contacted Gregory Camacho (Presbyterian). I reiterated to him that since the contaminant concentrations increased, the existing contaminant plume must be addressed. Their consultant should submit a remedial plan for the site. AZ END DECRemark - 9507159

Remarks: Start CallerRemark - 9507159 TANK failure/Equipment failures caused gross release of gasoline to subsurface soils and groundwater at this site. END CallerRemark - 9507159

NY Spills:

Site ID: 81360
Facility Addr2: Not reported
Facility ID: 9903569
Spill Number: 9903569
Facility Type: ER
SWIS: 3101
Region of Spill: 2
Investigator: SIGONA
Referred To: Not reported
Spill Date: 06/25/99
Reported to Dept: 06/28/99
CID: 15
Spill Cause: Equipment Failure
Water Affected: Not reported
Spill Source: Non Major Facility > 1,100 gal
Spill Notifier: Responsible Party
Cleanup Ceased: / /
Cleanup Meets Std: False
Last Inspection: / /
Recommended Penalty: Penalty Not Recommended
UST Trust: False
Spill Class: Known release that creates potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken.

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s)
EDR ID Number
EPA ID Number

COLUMBIA PRESBYTERIAN HOSPITAL (Continued)

1000556621

Spill Closed Dt: 11/05/03
Remediation Phase: 0
Date Entered In Computer: 06/28/99
Spill Record Last Update: 07/08/04
Spiller Name: GREG CAMACHO
Spiller Company: COLUMBIA PRESBYTERIAN
Spiller Address: 622 WEST 168TH ST
Spiller City,St,Zip: NEW YORK, NY 10032-
Spiller Company: 001
Spiller Phone: (212) 305-3127
Contact Name: GREGORY CAMACHO
Contact Phone: (212) 305-3127
DEC Region: 2
Program Number: 9903569
DER Facility ID: 75286
Site ID: 81360
Operable Unit ID: 1082502
Operable Unit: 01
Material ID: 303485
Material Code: 0009
Material Name: Gasoline
Case No.: Not reported
Material FA: Petroleum
Quantity: 0.00
Units: Gallons
Recovered: 0.00
Resource Affected: Groundwater
Oxygenate: False
DEC Memo: Not reported
Remarks: Start CallerRemark - 9903569 A contractor was excavating and repairing floor drains in the parking garage and identified gasoline contaminated soils. The soil is on the lower level. Contractors being interviewed for cleanup/investigation. END CallerRemark - 9903569

NY Hist Spills:
Region of Spill: 2
Spill Number: 9903569
Investigator: SIGONA
Caller Name: Not reported
Caller Agency: Not reported
Caller Phone: Not reported
Notifier Name: Not reported
Notifier Agency: Not reported
Notifier Phone: Not reported
Spill Date/Time: 06/25/1999 10:30
Reported to Dept Date/Time: 06/28/99 16:01
SWIS: 62
Spiller Name: COLUMBIA PRESBYTERIAN
Spiller Contact: GREG CAMACHO
Spiller Phone: (212) 305-3127
Spiller Contact: GREGORY CAMACHO
Spiller Phone: (212) 305-3127
Spiller Address: 622 WEST 168TH ST
Spiller City,St,Zip: NEW YORK, NY 10032-
Spill Cause: Housekeeping
Reported to Dept: On Land
Water Affected: Not reported

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s)

EDR ID Number
EPA ID Number

COLUMBIA PRESBYTERIAN HOSPITAL (Continued)

1000556621

Spill Source: 04
Spill Notifier: Responsible Party
PBS Number: Not reported
Cleanup Ceased: / /
Cleanup Meets Std: False
Last Inspection: / /
Recommended Penalty: Penalty Not Recommended
Spiller Cleanup Dt: / /
Enforcement Date: / /
Invstgn Complete: / /
UST Involvement: False
Spill Class: Known release that creates potential for fire or hazard. DEC Response.
Willing Responsible Party. Corrective action taken.
Spill Closed Dt: / /
Corrective Action Plan Submitted: / /
Date Region Sent Summary to Central Office: / /
Date Spill Entered In Computer Data File: 06/28/99
Date Spill Entered In Computer Data File: Not reported
Update Date: 06/30/99
Is Updated: False
PBS Number: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate Failed Tank: Not reported
Gross Leak Rate: Not reported
Material Class Type: Petroleum
Quantity Spilled: 0
Unkonwn Quantity Spilled: True
Units: Gallons
Quantity Recovered: 0
Unkonwn Quantity Recovered: True
Material: GASOLINE
Class Type: GASOLINE
Times Material Entry In File: 21329
CAS Number: Not reported
Last Date: 19940929
DEC Remarks: DEC Sigona) responded at 6/29/1999 at 2:00 P.M. met with Gregory Camacho and Project Manager for Parking lot rehabilitation project. Met with proposed consultant BEMK. Investigation of the spill revealed that the contamination is immediately downgradient of two abandoned in-place 550 gallon gasoline USTs identified under spill No. 9507159.) The previous spill report is under a Stipulation Agreement and a case was initiated because the facility owner failed to implement corrective actions. The site was investigated by Winston Contractors who submitted a report to DEC in Sept. 1998. DEC Sigona) requested that the excavation be expanded to expose the subsurface vault which was impacted by gasoline. The impacted area is on the next lower level approximated 25-30 downgradient of the abandoned USTs. It may be seepage or runoff drainage. End point samples should be collected in the area. Greg Camacho has agreed to expedite the investigation and cleanup proposed by Winston, but would not agree on who would be hired.
Remark: A contractor was excavating and repairing flow drains in the parking garage and identified gasoline contaminated soils. The soil is on the lower level. Contractors being interviewed for cleanup/investigation.

HIST LTANKS:
Region of Spill:

2

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s)
EDR ID Number
EPA ID Number

COLUMBIA PRESBYTERIAN HOSPITAL (Continued)

1000556621

Spill Number: 9507159
Investigator: SIGONA
Caller Name: Not reported
Caller Agency: Not reported
Caller Phone: Not reported
Caller Extension: Not reported
Notifier Name: Not reported
Notifier Agency: Not reported
Notifier Phone: Not reported
Notifier Extension: Not reported
Spill Date: 09/12/1995
Spill Time: 12:30
Reported to Department Date: 09/12/95
Reported to Department Time: 12:51
SWIS: 62
Spiller Contact: Not reported
Spiller Phone: Not reported
Spiller Extension: Not reported
Spiller Name: COLUMBIA PRESBYTERIAN
Spiller Address: Not reported
Spiller City,St,Zip: Not reported
Facility Contact: BRIAN MCSHANE
Facility Phone: Not reported
Facility Extension: Not reported
Spill Cause: Tank Test Failure
Resource Affectd: Groundwater
Water Affected: Not reported
Spill Source: Non Major Facility > 1,100 gallons
Spill Notifier: Tank Tester
PBS Number: Not reported
Cleanup Ceased: / /
Cleanup Meets Standard: False
Last Inspection: / /
Recommended Penalty: Penalty Not Recommended
Spiller Cleanup Date: / /
Enforcement Date: / /
Investigation Complete: / /
UST Involvement: False
Spill Class: Known release that creates potential for fire or hazard. DEC Response.
Willing Responsible Party. Corrective action taken.
Spill Closed Dt: / /
Date Region Sent Summary to Central Office: / /
Corrective Action Plan Submitted: / /
Date Spill Entered In Computer Data File: 12/27/48
Time Spill Entered In Computer Data File: Not reported
Spill Record Last Update: 01/29/96
Is Updated: False
PBS Number: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate Failed Tank: Not reported
Gross Leak Rate: Not reported
Material Class Type: Petroleum
Quantity Spilled: 0
Unkonwn Quantity Spilled: False
Units: Gallons

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s) EDR ID Number
EPA ID Number

COLUMBIA PRESBYTERIAN HOSPITAL (Continued)

1000556621

Quantity Recovered: 0
Unkonwn Quantity Recovered: False
Material: GASOLINE
Class Type: GASOLINE
Times Material Entry In File: 21329
CAS Number: Not reported
Last Date: 19940929
DEC Remarks: On December 22, 1995 met with Clayton Environmental representatives John Gavras, Benjamin Alter Vishal Shah - 908) 225-6040 at 10:00 AM along with Brian McShane Senior Industrial Hygienist 212) 305-3127 Columbia-Presbyterian Mediacal Center to follow-up Closure Report for the In-Place Abandonment of Gasoline Tanks Presbyterian Hospital Parking Garage by Clayton Environmental Consultants report November 30, 1995. Inspection of the facility found the two abandoned gasoline tanks 1,000 gallontanks located 2 levels below street in parking garage. Tanks were closed in reponse to pressure tests by fire department. Tanks are older than 15 years. Soil contamination may be a pocket around burried USTs. requesting that the consultant to drill with air rotor to bed rock and any water. need to develop some monitoring wells, and possibly vent the soil. The results of the investigation found the soil to be contaminated with volatile organic hydrocarbons. Informed the reps that I would sent letter and stip in a week. Gave some info on the stipulation process.
Spill Cause: TANK IS IN GROUND

234
NW
1/4-1/2
2415 ft.

**APARTMENTS
779 RIVERSIDE DR
NEW YORK CITY, NY**

**LTANKS S103238491
HIST LTANKS N/A**

**Relative:
Lower**

**Actual:
81 ft.**

LTANKS:
Site ID: 140754
Spill Date: 06/26/98
Facility Addr2: Not reported
Facility ID: 9803892
Program Number: 9803892
SWIS: 3101
Region of Spill: 2
Investigator: TJDME0
Referred To: Not reported
Reported to Dept: 06/26/98
CID: 15
Spill Cause: Tank Test Failure
Water Affected: Not reported
Spill Source: Commercial/Industrial
Spill Notifier: Tank Tester
Cleanup Ceased: / /
Cleanup Meets Standard: True
Last Inspection: / /
Recommended Penalty: Penalty Not Recommended
UST Involvement: False
Spill Class: Known release that creates potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken.
Spill Closed Dt: 11/26/04
Remediation Phase: 0
Date Entered In Computer: 06/26/98
Spill Record Last Update: 02/09/06
Spille Namer: VICTOR - SUPER.
Spiller Company: APARTMENTS
Spiller Phone: (212) 740-6194

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

APARTMENTS (Continued)

S103238491

Spiller Extention: Not reported
Spiller Address: Not reported
Spiller City,St,Zip: ZZ
Spiller County: 001
Spiller Contact: FANNY GREENBURG
Spiller Phone: Not reported
Spiller Extention: Not reported
DEC Region: 2
Program Number: 9803892
DER Facility ID: 120204
Site ID: 140754
Operable Unit ID: 1061635
Operable Unit: 01
Material ID: 322214
Material Code: 0003
Material Name: #6 Fuel Oil
Case No.: Not reported
Material FA: Petroleum
Quantity: 0.00
Units: Gallons
Recovered: 0.00
Resource Affected: Soil
Oxygenate: False
Site ID: 140754
Spill Tank Test: 1546035
Tank Number: 1
Tank Size: 5000
Test Method: 03
Leak Rate: 0.00
Gross Fail: F
Modified By: Spills
Last Modified: 10/01/04
Test Method: Horner EZ Check I or II
DEC Memo: Start DECRemark - 9803892 Prior to Sept, 2004 data translation this spill Lead
DEC Field was "M TIBBE" Reviewed a submittal from Grunberg Realty dated
Sept 20, 2004. Cover letter states the tank leaked from rust holes along the
top of the tank due to a water leak in the ceiling of the basement. In Jan
2000 Tank was removed/replaced. 10 cubic yards of soil was removed from under
the tank (manifest included). End point samples taken (clean) for voc & svoc.
New tank installed by Eastmond in Feb 2000. Documentation for all of this is
included in the file. 2/9/06-Vought-Received call from Frank Farricker
(212-529-4444). END DECRemark - 9803892
Remarks: Start CallerRemark - 9803892 gross failure of horner ez 3 END CallerRemark -
9803892

HIST LTANKS:

Region of Spill: 2
Spill Number: 9803892
Investigator: TIBBE
Caller Name: Not reported
Caller Agency: Not reported
Caller Phone: Not reported
Caller Extension: Not reported
Notifier Name: Not reported
Notifier Agency: Not reported
Notifier Phone: Not reported
Notifier Extension: Not reported

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s)
EDR ID Number
EPA ID Number

APARTMENTS (Continued)

S103238491

Spill Date: 06/26/1998
Spill Time: 13:30
Reported to Department Date: 06/26/98
Reported to Department Time: 16:16
SWIS: 62
Spiller Contact: FANNY GREENBURG
Spiller Phone: Not reported
Spiller Extention: Not reported
Spiller Name: APARTMENTS
Spiller Address: Not reported
Spiller City,St,Zip: Not reported
Facility Contact: VICTOR - SUPER.
Facility Phone: (212) 740-6194
Facility Extention: Not reported
Spill Cause: Tank Test Failure
Resource Affectd: On Land
Water Affected: Not reported
Spill Source: Other Commercial/Industrial
Spill Notifier: Tank Tester
PBS Number: 2-148474
Cleanup Ceased: / /
Cleanup Meets Standard: False
Last Inspection: / /
Recommended Penalty: Penalty Not Recommended
Spiller Cleanup Date: / /
Enforcement Date: / /
Investigation Complete: / /
UST Involvement: False
Spill Class: Known release that creates potential for fire or hazard. DEC Response.
Willing Responsible Party. Corrective action taken.
Spill Closed Dt: / /
Date Region Sent Summary to Central Office: / /
Corrective Action Plan Submitted: / /
Date Spill Entered In Computer Data File: 06/26/98
Time Spill Entered In Computer Data File: Not reported
Spill Record Last Update: 08/04/98
Is Updated: False
PBS Number: Not reported
Tank Number: 1
Tank Size: 5000
Test Method: Horner EZ Check
Leak Rate Failed Tank: 0.00
Gross Leak Rate: Tank Test Failures only pass or fail
Material Class Type: Petroleum
Quantity Spilled: 0
Unkonwn Quantity Spilled: False
Units: Gallons
Quantity Recovered: 0
Unkonwn Quantity Recovered: False
Material: #6 FUEL OIL
Class Type: #6 FUEL OIL
Times Material Entry In File: 2190
CAS Number: Not reported
Last Date: 19940728
DEC Remarks: Not reported
Spill Cause: gross failure of horner e 3

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

Site Database(s) EDR ID Number
EPA ID Number

AZ235
North
1/4-1/2
2461 ft.

1070 ST. NICHOLAS AVENUE
1070 ST. NICOLAS AVE
MANHATTAN, NY

LTANKS **S106123776**
N/A

Site 1 of 2 in cluster AZ

Relative:
Higher

LTANKS:

Actual:
160 ft.

Site ID: 94574
Spill Date: 01/27/04
Facility Addr2: Not reported
Facility ID: 0312046
Program Number: 0312046
SWIS: 3101
Region of Spill: 2
Investigator: jdjarrat
Referred To: Not reported
Reported to Dept: 01/27/04
CID: 15
Spill Cause: Tank Test Failure
Water Affected: Not reported
Spill Source: Private Dwelling
Spill Notifier: Tank Tester
Cleanup Ceased: / /
Cleanup Meets Standard: False
Last Inspection: / /
Recommended Penalty: Penalty Not Recommended
UST Involvement: False
Spill Class: Known release with minimal potential for fire or hazard. DEC Response.
Willing Responsible Party. Corrective action taken.
Spill Closed Dt: / /
Remediation Phase: 1
Date Entered In Computer: 01/27/04
Spill Record Last Update: 12/29/05
Spille Namer: Not reported
Spiller Company: Not reported
Spiller Phone: Not reported
Spiller Extention: Not reported
Spiller Address: Not reported
Spiller City,St,Zip: ***Update***, ZZ
Spiller County: 001
Spiller Contact: RAY KAHN
Spiller Phone: (917) 939-7366
Spiller Extention: Not reported
DEC Region: 2
Program Number: 0312046
DER Facility ID: 84670
Site ID: 94574
Operable Unit ID: 879546
Operable Unit: 01
Material ID: 497278
Material Code: 0002
Material Name: #4 Fuel Oil
Case No.: Not reported
Material FA: Petroleum
Quantity: 0.00
Units: Pounds
Recovered: 0.00
Resource Affected: Soil
Oxygenate: False

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

1070 ST. NICHOLAS AVENUE (Continued)

S106123776

Site ID: 94574
Spill Tank Test: 1528945
Tank Number: 1
Tank Size: 5000
Test Method: 03
Leak Rate: 0.00
Gross Fail: Not reported
Modified By: Spills
Last Modified: 10/01/04
Test Method: Horner EZ Check I or II
DEC Memo: Start DECRemark - 0312046 Prior to Sept, 2004 data translation this spill Lead
DEC Field was "SANGESLAND" Sent TTF ltr sent to owner: Ina McCarther
1070 Saint Nicholas Ave NY, NY 10032-3832 file transferred to co
(Jarratt), 7/05.NYCDEP Haz. Mats. contacted for more information. 9/1/05:
NYCDEP contacted again for information. (718) 595-4650. END DECRemark - 0312046
Remarks: Not reported

AZ236
North
1/4-1/2
2472 ft.

1071 ST NICHOLAS AVE
1071 ST NICHOLAS AVE
MANHATTAN, NY

LTANKS S102660631
HIST LTANKS N/A

Site 2 of 2 in cluster AZ

Relative:
Higher

Actual:
160 ft.

LTANKS:
Site ID: 250495
Spill Date: 12/02/92
Facility Addr2: Not reported
Facility ID: 9210463
Program Number: 9210463
SWIS: 3101
Region of Spill: 2
Investigator: jdjarrat
Referred To: Not reported
Reported to Dept: 12/10/92
CID: 15
Spill Cause: Tank Failure
Water Affected: Not reported
Spill Source: Commercial/Industrial
Spill Notifier: Affected Persons
Cleanup Ceased: / /
Cleanup Meets Standard: False
Last Inspection: / /
Recommended Penalty: Penalty Not Recommended
UST Involvement: False
Spill Class: Known release with minimal potential for fire or hazard. DEC Response.
Willing Responsible Party. Corrective action taken.
Spill Closed Dt: / /
Remediation Phase: 1
Date Entered In Computer: 12/15/92
Spill Record Last Update: 12/29/05
Spille Namer: Not reported
Spiller Company: Not reported
Spiller Phone: Not reported
Spiller Extention: Not reported
Spiller Address: Not reported
Spiller City,St,Zip: ***Update***, ZZ
Spiller County: 001
Spiller Contact: Not reported

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s)
EDR ID Number
EPA ID Number

1071 ST NICHOLAS AVE (Continued)

S102660631

Spiller Phone: Not reported
Spiller Extension: Not reported
DEC Region: 2
Program Number: 9210463
DER Facility ID: 205322
Site ID: 250495
Operable Unit ID: 977094
Operable Unit: 01
Material ID: 403924
Material Code: 0001
Material Name: #2 Fuel Oil
Case No.: Not reported
Material FA: Petroleum
Quantity: -1.00
Units: Pounds
Recovered: 0.00
Resource Affected: Soil
Oxygenate: False
Site ID: Not reported
Spill Tank Test: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate: Not reported
Gross Fail: Not reported
Modified By: Not reported
Last Modified: Not reported
Test Method: Not reported
DEC Memo: Start DECRemark - 9210463 Prior to Sept, 2004 data translation this spill Lead
DEC Field was "M TIBBE" 03/05/2003- AUSTIN As per directive to close out
spills with no recent history, close out. 02/17/04 - TRANSFERED FROM
TOMASELLO TO TIBBE. SPILL REOPENED BECAUSE A FILE EXISTS. 7/05 - (large)
file transferred to co (Jarratt). Brian McCabe of Fenley & Nicol contacted for
recent data summary: Not collecting dissolved product since it is heating oil,
also no ground water samples. Fivewells monitored, 2 periodically came back
with a trace. The data will be summarized by Geologist Brian McCabe. END
DECRemark - 9210463
Remarks: Start CallerRemark - 9210463 TANK IN BASEMENT OF APT COMPLEX WAS SEEN TO BE
BREAKING BY NYC TRANSIT PERSONNEL OIL LEAKING INTO SUBWAY AREA END CallerRemark
- 9210463

HIST LTANKS:
Region of Spill: 2
Spill Number: 9210463
Investigator: TOMASELLO
Caller Name: Not reported
Caller Agency: Not reported
Caller Phone: Not reported
Caller Extension: Not reported
Notifier Name: Not reported
Notifier Agency: Not reported
Notifier Phone: Not reported
Notifier Extension: Not reported
Spill Date: 12/02/1992
Spill Time: 10:00
Reported to Department Date: 12/10/92
Reported to Department Time: 14:47

Map ID
 Direction
 Distance
 Distance (ft.)
 Elevation Site

MAP FINDINGS

Database(s)
 EDR ID Number
 EPA ID Number

1071 ST NICHOLAS AVE (Continued)

S102660631

SWIS: 62
 Spiller Contact: Not reported
 Spiller Phone: Not reported
 Spiller Extension: Not reported
 Spiller Name: Not reported
 Spiller Address: Not reported
 Spiller City,St,Zip: Not reported
 Facility Contact: Not reported
 Facility Phone: Not reported
 Facility Extension: Not reported
 Spill Cause: Tank Failure
 Resource Affectd: On Land
 Water Affected: Not reported
 Spill Source: Other Commercial/Industrial
 Spill Notifier: Affected Persons
 PBS Number: Not reported
 Cleanup Ceased: / /
 Cleanup Meets Standard: False
 Last Inspection: / /
 Recommended Penalty: Penalty Not Recommended
 Spiller Cleanup Date: / /
 Enforcement Date: / /
 Investigation Complete: / /
 UST Involvement: False
 Spill Class: Known release with minimal potential for fire or hazard. DEC Response.
 Willing Responsible Party. Corrective action taken.
 Spill Closed Dt: / /
 Date Region Sent Summary to Central Office: / /
 Corrective Action Plan Submitted: / /
 Date Spill Entered In Computer Data File: 12/15/92
 Time Spill Entered In Computer Data File: Not reported
 Spill Record Last Update: / /
 Is Updated: False
 PBS Number: Not reported
 Tank Number: Not reported
 Tank Size: Not reported
 Test Method: Not reported
 Leak Rate Failed Tank: Not reported
 Gross Leak Rate: Not reported
 Material Class Type: Petroleum
 Quantity Spilled: -1
 Unkonwn Quantity Spilled: False
 Units: Not reported
 Quantity Recovered: 0
 Unkonwn Quantity Recovered: False
 Material: #2 FUEL OIL
 Class Type: #2 FUEL OIL
 Times Material Entry In File: 24464
 CAS Number: Not reported
 Last Date: 19941207
 DEC Remarks: Not reported
 Spill Cause: TANK IN BASEMENT OF APT COMPLEX WAS SEEN TO BE BREAKING BY NYC TRANSIT
 PERSONNEL OIL LEAKING INTO SUBWAY AREA

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

Site Database(s) EDR ID Number
EPA ID Number

237 950 UNIVERSITY AVE
East 950 UNIVERSITY AVE
1/4-1/2 BRONX, NY
2495 ft.

LTANKS S102961872
NY Spills N/A
NY Hist Spills
HIST LTANKS

Relative:
Lower

LTANKS:

Actual:
35 ft.

Site ID: 140968
Spill Date: 04/02/98
Facility Addr2: Not reported
Facility ID: 9800094
Program Number: 9800094
SWIS: 0301
Region of Spill: 2
Investigator: KSTANG
Referred To: Not reported
Reported to Dept: 04/02/98
CID: 16
Spill Cause: Tank Overfill
Water Affected: Not reported
Spill Source: Institutional, Educational, Gov., Other
Spill Notifier: Local Agency
Cleanup Ceased: / /
Cleanup Meets Standard: False
Last Inspection: / /
Recommended Penalty: Penalty Not Recommended
UST Involvement: False
Spill Class: Known release with minimal potential for fire or hazard. DEC Response.
Willing Responsible Party. Corrective action taken.
Spill Closed Dt: 04/02/98
Remediation Phase: 0
Date Entered In Computer: 04/02/98
Spill Record Last Update: 04/03/98
Spille Namer: Not reported
Spiller Company: UNKNOWN
Spiller Phone: Not reported
Spiller Extention: Not reported
Spiller Address: Not reported
Spiller City,St,Zip: NY
Spiller County: 999
Spiller Contact: ANN MARIE
Spiller Phone: (212) 374-5500
Spiller Extention: Not reported
DEC Region: 2
Program Number: 9800094
DER Facility ID: 120391
Site ID: 140968
Operable Unit ID: 1060612
Operable Unit: 01
Material ID: 325648
Material Code: 0001
Material Name: #2 Fuel Oil
Case No.: Not reported
Material FA: Petroleum
Quantity: 1.00
Units: Gallons
Recovered: 0.00
Resource Affected: Soil
Oxygenate: False
Site ID: Not reported

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

950 UNIVERSITY AVE (Continued)

EDR ID Number
EPA ID Number

Database(s)

S102961872

Spill Tank Test: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate: Not reported
Gross Fail: Not reported
Modified By: Not reported
Last Modified: Not reported
Test Method: Not reported
DEC Memo: Start DECRemark - 9800094 Prior to Sept, 2004 data translation this spill Lead
DEC Field was "TANG" END DECRemark - 9800094
Remarks: Start CallerRemark - 9800094 tank overfilled caller not sure if any got into
sewers END CallerRemark - 9800094

NY Spills:

Site ID: 140966
Facility Addr2: Not reported
Facility ID: 9709956
Spill Number: 9709956
Facility Type: ER
SWIS: 0301
Region of Spill: 2
Investigator: RWAUSTIN
Referred To: Not reported
Spill Date: 11/27/97
Reported to Dept: 11/27/97
CID: 16
Spill Cause: Human Error
Water Affected: Not reported
Spill Source: Institutional, Educational, Gov., Other
Spill Notifier: Other
Cleanup Ceased: / /
Cleanup Meets Std: False
Last Inspection: / /
Recommended Penalty: Penalty Not Recommended
UST Trust: False
Spill Class: Known release with minimal potential for fire or hazard. DEC Response.
Willing Responsible Party. Corrective action taken.
Spill Closed Dt: 02/02/04
Remediation Phase: 0
Date Entered In Computer: 11/27/97
Spill Record Last Update: 02/02/04
Spiller Name: VICENT - SUPER
Spiller Company: Not reported
Spiller Address: 950 UNIVERSITY AVE
Spiller City,St,Zip: BRONX, ZZ
Spiller Company: 001
Spiller Phone: (718) 588-8400
Contact Name: VICENT - SUPER
Contact Phone: (718) 588-8400
DEC Region: 2
Program Number: 9709956
DER Facility ID: 120391
Site ID: 140966
Operable Unit ID: 1052995
Operable Unit: 01
Material ID: 328285

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

950 UNIVERSITY AVE (Continued)

EDR ID Number
EPA ID Number

Database(s)

S102961872

Material Code: 0003
Material Name: #6 Fuel Oil
Case No.: Not reported
Material FA: Petroleum
Quantity: 50.00
Units: Gallons
Recovered: 0.00
Resource Affected: Soil
Oxygenate: False
DEC Memo: Start DECRemark - 9709956 Prior to Sept, 2004 data translation this spill Lead
DEC Field was "AUSTIN" 2/2/04 - AUSTIN - MINOR SURF. SPILL - CLOSED - ORIG.
ASSIGNED TO ENGELHARDT - END END DECRemark - 9709956
Remarks: Start CallerRemark - 9709956 super was transferring oil from one storage tank to
another tank and forgot to shut pump off - second tank was overfilled - spill
clean up crew on way END CallerRemark - 9709956

Site ID: 140965
Facility Addr2: Not reported
Facility ID: 0306932
Spill Number: 0306932
Facility Type: ER
SWIS: 0301
Region of Spill: 2
Investigator: JHOCONNE
Referred To: Not reported
Spill Date: 10/01/03
Reported to Dept: 10/01/03
CID: 16
Spill Cause: Unknown
Water Affected: Not reported
Spill Source: Unknown
Spill Notifier: Affected Persons
Cleanup Ceased: / /
Cleanup Meets Std: False
Last Inspection: / /
Recommended Penalty: Penalty Not Recommended
UST Trust: False
Spill Class: Known release with minimal potential for fire or hazard. DEC Response.
Willing Responsible Party. Corrective action taken.

Spill Closed Dt: 06/28/05
Remediation Phase: 0
Date Entered In Computer: 10/01/03
Spill Record Last Update: 06/28/05
Spiller Name: Not reported
Spiller Company: UNKNOWN
Spiller Address: Not reported
Spiller City,St,Zip: NY
Spiller Company: 999
Spiller Phone: Not reported
Contact Name: SEAN MCKEEVER
Contact Phone: (212) 580-6763
DEC Region: 2
Program Number: 0306932
DER Facility ID: 120391
Site ID: 140965
Operable Unit ID: 875686
Operable Unit: 01

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

950 UNIVERSITY AVE (Continued)

EDR ID Number
EPA ID Number

Database(s)

S102961872

Material ID: 500541
Material Code: 0541A
Material Name: DIELECTRIC FLUID
Case No.: Not reported
Material FA: Petroleum
Quantity: 5.00
Units: Gallons
Recovered: 0.00
Resource Affected: Soil
Oxygenate: False
DEC Memo: Start DECRemark - 0306932 Prior to Sept, 2004 data translation this spill Lead DEC Field was "FOLEY" 01-Oct-2003 10:15 hrs I&A mechanic D. Hernandez (18527) while inspecting V-2273, located 950 University Ave (cross st is Sedgwick Ave) reports finding 5 gallons of dielectric fluid on 50 gallons of water. No fire/smoke is/was involved. No sewers/waterways/private property affected. No injuries reported at this time. Oil sample for PCB was taken (cc-15407). Environmental tag (30900) was placed. Unit needs to be inspected to determine source of leak. 01-Oct-2003 12:30 hrs ERT A. Meyrowitz issued EPA # (NYP004-115-507) for I&A supervisor Todd Guion to obtain CFS tanker to take liquid out of structure assist with the inspection of transformer. Tanker ordered. 24-NOV-2003 11:06 Lab Sequence Number: 03-08130-001 TOTAL PCB 12 ppm 02-MAR-2004 09:30 <50 tanker reassigned to higher priority job 152315 by Shift Mgr. Thomas Curley at 06:30 this morning. This location planned to be worked on the 3-11 shift today 02-Mar-2004. 10-April-2004 19:05 Hrs Flush Mechanic Esham Gafur, 19528, reports cleanup complete, leaking transformer had been drained and removed, new transformer is being installed, structure was double washed and rinsed using 760 detergent, 1 cubic yard of flush debris was removed by flush truck, 125 gallons of nonhazardous oily liquid was removed by CFS Tanker, and environmental tag was removed. END DECRemark - 0306932
Remarks: Start CallerRemark - 0306932 on 50 gals of water - ref #150552 END CallerRemark - 0306932

[Click this hyperlink](#) while viewing on your computer to access additional NY_SPILL: detail in the EDR Site Report.

NY Hist Spills:
Region of Spill: 2
Spill Number: 9709956
Investigator: ENGELHARDT
Caller Name: Not reported
Caller Agency: Not reported
Caller Phone: Not reported
Notifier Name: Not reported
Notifier Agency: Not reported
Notifier Phone: Not reported
Spill Date/Time: 11/27/1997 06:00
Reported to Dept Date/Time: 11/27/97 08:37
SWIS: 60
Spiller Name: Not reported
Spiller Contact: VICENT - SUPER
Spiller Phone: (718) 588-8400
Spiller Contact: VICENT - SUPER
Spiller Phone: (718) 588-8400
Spiller Address: 950 UNIVERSITY AVE
Spiller City, St, Zip: BRONX
Spill Cause: Human Error
Reported to Dept: On Land

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s)
EDR ID Number
EPA ID Number

950 UNIVERSITY AVE (Continued)

S102961872

Water Affected: Not reported
Spill Source: 02
Spill Notifier: Other
PBS Number: Not reported
Cleanup Ceased: / /
Cleanup Meets Std: False
Last Inspection: / /
Recommended Penalty: Penalty Not Recommended
Spiller Cleanup Dt: / /
Enforcement Date: / /
Invstgn Complete: / /
UST Involvement: False
Spill Class: Known release with minimal potential for fire or hazard. DEC Response.
Willing Responsible Party. Corrective action taken.
Spill Closed Dt: / /
Corrective Action Plan Submitted: / /
Date Region Sent Summary to Central Office: / /
Date Spill Entered In Computer Data File: 11/27/97
Date Spill Entered In Computer Data File: Not reported
Update Date: 12/01/97
Is Updated: False
PBS Number: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate Failed Tank: Not reported
Gross Leak Rate: Not reported
Material Class Type: Petroleum
Quantity Spilled: 50
Unkonwn Quantity Spilled: False
Units: Gallons
Quantity Recovered: 0
Unkonwn Quantity Recovered: False
Material: #6 FUEL OIL
Class Type: #6 FUEL OIL
Times Material Entry In File: 2190
CAS Number: Not reported
Last Date: 19940728
DEC Remarks: Not reported
Remark: super was transferring oil from one storage tank to another tank and forgot to shut pump off - second tank was overfilled - spill clean up crew on way

Region of Spill: 2
Spill Number: 9800090
Investigator: MARTINKAT
Caller Name: Not reported
Caller Agency: Not reported
Caller Phone: Not reported
Notifier Name: Not reported
Notifier Agency: Not reported
Notifier Phone: Not reported
Spill Date/Time: 04/02/1998 13:00
Reported to Dept Date/Time: 04/02/98 13:19
SWIS: 60
Spiller Name: H W WILSON PUBLISHING CO.
Spiller Contact: Not reported
Spiller Phone: Not reported

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s)
EDR ID Number
EPA ID Number

950 UNIVERSITY AVE (Continued)

S102961872

Spiller Phone: () -
Spiller Address: Not reported
Spiller City,St,Zip: Not reported
Spill Cause: Other
Reported to Dept: In Sewer
Water Affected: Not reported
Spill Source: 01
Spill Notifier: Other
PBS Number: Not reported
Cleanup Ceased: / /
Cleanup Meets Std: False
Last Inspection: / /
Recommended Penalty: Penalty Not Recommended
Spiller Cleanup Dt: / /
Enforcement Date: / /
Invstgn Complete: / /
UST Involvement: False
Spill Class: Known release with minimal potential for fire or hazard. DEC Response.
Willing Responsible Party. Corrective action taken.
Spill Closed Dt: 04/02/98
Corrective Action Plan Submitted: / /
Date Region Sent Summary to Central Office: / /
Date Spill Entered In Computer Data File: 04/02/98
Date Spill Entered In Computer Data File: Not reported
Update Date: 04/03/98
Is Updated: False
PBS Number: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate Failed Tank: Not reported
Gross Leak Rate: Not reported
Material Class Type: Petroleum
Quantity Spilled: 1
Unkonwn Quantity Spilled: False
Units: Gallons
Quantity Recovered: 0
Unkonwn Quantity Recovered: False
Material: #6 FUEL OIL
Class Type: #6 FUEL OIL
Times Material Entry In File: 2190
CAS Number: Not reported
Last Date: 19940728
DEC Remarks: FAX TO ECS.
Remark: INFORMATION IS 3RD PARTY THROUGH CON ED. CALLER BELIEVES THER THERE WAS AN
OVERFLOW PROBLEM. NO FURTHER INFORMATION.

HIST LTANKS:

Region of Spill: 2
Spill Number: 9800094
Investigator: TANG
Caller Name: Not reported
Caller Agency: Not reported
Caller Phone: Not reported
Caller Extension: Not reported
Notifier Name: Not reported
Notifier Agency: Not reported

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s)
EDR ID Number
EPA ID Number

950 UNIVERSITY AVE (Continued)

S102961872

Notifier Phone: Not reported
Notifier Extension: Not reported
Spill Date: 04/02/1998
Spill Time: 13:30
Reported to Department Date: 04/02/98
Reported to Department Time: 13:43
SWIS: 60
Spiller Contact: ANN MARIE
Spiller Phone: (212) 374-5500
Spiller Extension: Not reported
Spiller Name: UNKNOWN
Spiller Address: Not reported
Spiller City,St,Zip: Not reported
Facility Contact: Not reported
Facility Phone: Not reported
Facility Extension: Not reported
Spill Cause: Tank Overfill
Resource Affectd: On Land
Water Affected: Not reported
Spill Source: Other Non Commercial/Industrial
Spill Notifier: Local Agency
PBS Number: Not reported
Cleanup Ceased: / /
Cleanup Meets Standard: False
Last Inspection: / /
Recommended Penalty: Penalty Not Recommended
Spiller Cleanup Date: / /
Enforcement Date: / /
Investigation Complete: / /
UST Involvement: False
Spill Class: Known release with minimal potential for fire or hazard. DEC Response.
Willing Responsible Party. Corrective action taken.
Spill Closed Dt: 04/02/98
Date Region Sent Summary to Central Office: / /
Corrective Action Plan Submitted: / /
Date Spill Entered In Computer Data File: 04/02/98
Time Spill Entered In Computer Data File: Not reported
Spill Record Last Update: 04/03/98
Is Updated: False
PBS Number: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate Failed Tank: Not reported
Gross Leak Rate: Not reported
Material Class Type: Petroleum
Quantity Spilled: 1
Unkonwn Quantity Spilled: False
Units: Gallons
Quantity Recovered: 0
Unkonwn Quantity Recovered: False
Material: #2 FUEL OIL
Class Type: #2 FUEL OIL
Times Material Entry In File: 24464
CAS Number: Not reported
Last Date: 19941207
DEC Remarks: Not reported

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

950 UNIVERSITY AVE (Continued)

EDR ID Number
EPA ID Number

Database(s)

Spill Cause: tank overfilled caller not sure if any got into sewers

S102961872

238
NW
1/4-1/2
2628 ft.

APARTMENT BLDG.
853 RIVERSIDE DR
MANHATTAN, NY

LTANKS S106471669
N/A

Relative:
Lower

LTANKS:

Actual:
95 ft.

Site ID: 320467
Spill Date: 05/17/04
Facility Addr2: Not reported
Facility ID: 0401736
Program Number: 0401736
SWIS: 3101
Region of Spill: 2
Investigator: JMKRIMGO
Referred To: Not reported
Reported to Dept: 05/17/04
CID: 15
Spill Cause: Tank Failure
Water Affected: Not reported
Spill Source: Commercial/Industrial
Spill Notifier: Responsible Party
Cleanup Ceased: / /
Cleanup Meets Standard: False
Last Inspection: / /
Recommended Penalty: Penalty Not Recommended
UST Involvement: False
Spill Class: Known release that creates potential for fire or hazard. DEC Response.
Willing Responsible Party. Corrective action taken.
Spill Closed Dt: 06/02/04
Remediation Phase: 0
Date Entered In Computer: 05/17/04
Spill Record Last Update: 06/07/04
Spille Namer: TONY PERETTA
Spiller Company: MYSTIC TRANSPORTATION
Spiller Phone: (718) 932-9075
Spiller Extention: 275
Spiller Address: 19-01 STEINWAY ST
Spiller City,St,Zip: ASTORIA, NY 11105
Spiller County: 001
Spiller Contact: SUPER
Spiller Phone: Not reported
Spiller Extention: Not reported
DEC Region: 2
Program Number: 0401736
DER Facility ID: 258196
Site ID: 320467
Operable Unit ID: 883577
Operable Unit: 01
Material ID: 492928
Material Code: 0002
Material Name: #4 Fuel Oil
Case No.: Not reported
Material FA: Petroleum
Quantity: 10.00
Units: Gallons
Recovered: 0.00

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

APARTMENT BLDG. (Continued)

EDR ID Number
EPA ID Number

Database(s)

S106471669

Resource Affected: Soil
Oxygenate: False
Site ID: Not reported
Spill Tank Test: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate: Not reported
Gross Fail: Not reported
Modified By: Not reported
Last Modified: Not reported
Test Method: Not reported
DEC Memo: Start DECRemark - 0401736 Prior to Sept, 2004 data translation this spill Lead DEC Field was "KRIMGOLD" 5/18/04. J.Krimgold at site. Eastmond performing a cleanup. During last oil delivery AST was over pressurized and an epoxy patch on the top of the tank let go. After cleaning up of the spill Eastmond will repair the tank. 6/3/04. J.Krimgold spoke to Rene. Cleanup has been completed. NFA. END DECRemark - 0401736
Remarks: Start CallerRemark - 0401736 EASTMAN AND SONS ENVIRONMENTAL WILL BE HANDLING THE CLEANUP. THE SPILL IS CONTAINED TO THE TANK ROOM OF THE APARTMENT BUILDING. PHONE NUMBER FOR EASTMAN AND SONS IS 718-378-7000 ***UPDATE: CAHNGE OF ADDRESS AND CLEAN UP IS DONE: * END CallerRemark - 0401736

BA239
SSW
1/4-1/2
2633 ft.

RESIDENTS
416 W.145TH ST
NEW YORK CITY, NY

LTANKS S105997948
N/A

Site 1 of 2 in cluster BA

Relative:
Lower

LTANKS:

Actual:
87 ft.

Site ID: 226851
Spill Date: 01/18/03
Facility Addr2: Not reported
Facility ID: 0210504
Program Number: 0210504
SWIS: 3101
Region of Spill: 2
Investigator: JXZHAO
Referred To: Not reported
Reported to Dept: 01/18/03
CID: 15
Spill Cause: Tank Failure
Water Affected: Not reported
Spill Source: Private Dwelling
Spill Notifier: Other
Cleanup Ceased: / /
Cleanup Meets Standard: False
Last Inspection: / /
Recommended Penalty: Penalty Not Recommended
UST Involvement: False
Spill Class: Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken.
Spill Closed Dt: 01/23/03
Remediation Phase: 0
Date Entered In Computer: 01/18/03
Spill Record Last Update: 02/20/03
Spille Namer: N/A
Spiller Company: OWNER OF 416 WEST 145 STR

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

RESIDENTS (Continued)

EDR ID Number
EPA ID Number

Database(s)

S105997948

Spiller Phone: Not reported
Spiller Extention: Not reported
Spiller Address: SAME]
Spiller City,St,Zip: NEW YORK CITY, NY
Spiller County: 001
Spiller Contact: FRANK RIZZO
Spiller Phone: (718) 828-3100
Spiller Extention: Not reported
DEC Region: 2
Program Number: 0210504
DER Facility ID: 187237
Site ID: 226851
Operable Unit ID: 861715
Operable Unit: 01
Material ID: 513882
Material Code: 0001
Material Name: #2 Fuel Oil
Case No.: Not reported
Material FA: Petroleum
Quantity: 6.00
Units: Gallons
Recovered: 6.00
Resource Affected: Soil
Oxygenate: False
Site ID: Not reported
Spill Tank Test: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate: Not reported
Gross Fail: Not reported
Modified By: Not reported
Last Modified: Not reported
Test Method: Not reported
DEC Memo: Start DECRemark - 0210504 Prior to Sept, 2004 data translation this spill Lead
DEC Field was "ZHAO" 1/23/2003 Spill closed. Same spill as 0210501. END
DECRemark - 0210504
Remarks: Start CallerRemark - 0210504 A 550 GALLON TANK FAILED AND LEAKED THEY REMOVED
THE TANK AND ARE GOING TO REPAIR THE TANK AND RETURN IT BACK TO THE DWELLING
LOCATION IS A 3 FAMILY APARTMENT HOUSE. END CallerRemark - 0210504

BA240
SSW
1/4-1/2
2633 ft.

416 W 145TH ST
MANHATTAN, NY

Site 2 of 2 in cluster BA

Relative:
Lower

LTANKS:
Site ID: 254582
Spill Date: 01/18/03
Facility Addr2: Not reported
Facility ID: 0210501
Program Number: 0210501
SWIS: 3101
Region of Spill: 2
Investigator: JXZHAO
Referred To: Not reported
Reported to Dept: 01/18/03

Actual:
87 ft.

LTANKS S105997946
N/A

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

(Continued)

S105997946

CID: 15
Spill Cause: Tank Failure
Water Affected: Not reported
Spill Source: Private Dwelling
Spill Notifier: Other
Cleanup Ceased: / /
Cleanup Meets Standard: False
Last Inspection: / /
Recommended Penalty: Penalty Not Recommended
UST Involvement: False
Spill Class: Known release with minimal potential for fire or hazard. DEC Response.
Willing Responsible Party. Corrective action taken.
Spill Closed Dt: 01/23/03
Remediation Phase: 0
Date Entered In Computer: 01/18/03
Spill Record Last Update: 01/23/03
Spille Namer: Not reported
Spiller Company: SAME
Spiller Phone: Not reported
Spiller Extention: Not reported
Spiller Address: Not reported
Spiller City,St,Zip: NN
Spiller County: 999
Spiller Contact: ANTHONY LARA
Spiller Phone: (718) 624-4842
Spiller Extention: Not reported
DEC Region: 2
Program Number: 0210501
DER Facility ID: 208513
Site ID: 254582
Operable Unit ID: 863924
Operable Unit: 01
Material ID: 552534
Material Code: 0001
Material Name: #2 Fuel Oil
Case No.: Not reported
Material FA: Petroleum
Quantity: 20.00
Units: Gallons
Recovered: 0.00
Resource Affected: Soil
Oxygenate: False
Site ID: Not reported
Spill Tank Test: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate: Not reported
Gross Fail: Not reported
Modified By: Not reported
Last Modified: Not reported
Test Method: Not reported
DEC Memo: Start DECRemark - 0210501 Prior to Sept, 2004 data translation this spill Lead
DEC Field was "ZHAO" 1/18/2003 - 15:15pm Zhao inspected the site during clean
up. There were two 275 gal AST connected ASTs. One had leaked. Tank was
emptied, disconnected with the another and removed. Minor spill on concrete
floor and Robani Energy was on scene for fixing the system and final clean up.

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

(Continued)

S105997946

Remarks:

Clean up was completed at 16:20pm. Spill closed. END DECRemark - 0210501
Start CallerRemark - 0210501 crystal transport called pet. tank cleaners ref to
a leaking tank at above. they are on the way for clean up. END CallerRemark -
0210501

241
SSE
1/2-1
5255 ft.

2350 FIFTH AVENUE CORP
2350 5TH AVE
NEW YORK, NY 10037

RCRA-SQG
SHWS
FINDS
DRYCLEANERS
NY MANIFEST

1000108749
NYD071026173

Relative:
Lower

RCRAInfo:

Actual:
4 ft.

Owner: 2350 FIFTH AVENUE CORP
(212) 234-5000
EPA ID: NYD071026173
Contact: JOSEPH KARTEN
(212) 234-5000

Classification: Small Quantity Generator
TSDF Activities: Not reported

Violation Status: Violations exist

Regulation Violated: Not reported
Area of Violation: GENERATOR-RECORDKEEPING REQUIREMENTS
Date Violation Determined: 08/03/1989
Actual Date Achieved Compliance: 08/03/1989

Regulation Violated: Not reported
Area of Violation: GENERATOR-RECORDKEEPING REQUIREMENTS
Date Violation Determined: 01/05/1988
Actual Date Achieved Compliance: 01/05/1988

Enforcement Action: WRITTEN INFORMAL
Enforcement Action Date: 01/05/1988
Penalty Type: Not reported

There are 2 violation record(s) reported at this site:

Evaluation	Area of Violation	Date of Compliance
Non-Financial Record Review	GENERATOR-RECORDKEEPING REQUIREMENTS	19890803
Non-Financial Record Review	GENERATOR-RECORDKEEPING REQUIREMENTS	19880105

SHWS:

Program: HW
Site Code: 57691
Classification: SIGNIFICANT THREAT TO THE PUBLIC HEALTH OR ENVIRONMENT - ACTION
REQUIRED.

Region: 2
Acres: 1.700
HW Code: 231004
Record Add: 1999-11-18 12:00:00
Record Upd: 2007-04-05 13:00:00
Updated By: dcwalsh

Site Description: The site is located on the west side of Fifth Avenue between 141st Street and 142nd Street in Manhattan. The entire site is occupied by a building comprised of three connected sections. The site is at an elevation of about 10 feet or less above mean sea level. Surrounding the Site are multi-story residential buildings on the west, south and southeast; the Harlem River Drive and the Harlem River on the east, and the 369th Regiment Armory to the north. From

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s) EDR ID Number
EPA ID Number

2350 FIFTH AVENUE CORP (Continued)

1000108749

1970 to 1994 the Site was occupied by an industrial laundry with a dry cleaning operation utilizing tetrachloroethylene (PCE) as a cleaning solvent. A portion of the building was renovated for use as a public school, but such use was discontinued. Soil Vapor Extraction system (SVE) was installed as part of the Interim Remedial Measures (IRM) to remove PCE. The SVE has been operated continuously since 1997, and was renovated in 2002. April 2005, the SVE has been shut off to evaluate the performance of the remedy, during one of the indoor air quality monitoring TCE concentration was found to be above the DOH guidance value (5 microgram per cubic meter) The SVE system was re-activated on December 18, 2006. Remedial Investigation to delineate the full extent of contamination are underway.

Environmental Problems: From 1970 to 1994 the Site was occupied by an industrial laundry with a dry cleaning operation utilizing tetrachloroethylene (PCE) as a cleaning solvent. Soils beneath the Site, and on-site and off-site groundwater are contaminated with PCE. Additional investigation is necessary to fully delineate the contamination. Exceedances of NYSDOH indoor air guidance value for TCE and PCE in the former boiler room in the basement which is below Room 112.

Health Problems Assessment: During renovations to the building in 1996-1997, several rounds of indoor air testing were conducted and on one occasion the data indicated the presence of tetrachloroethene (PCE) above the NYSDOH residential indoor air guideline of 15 parts per billion (ppb). Interim remedial measures initiated during 1997 to address the source of the contamination included the installation and operation of a shallow soil vapor extraction system. These measures have generally resulted in reducing the levels of tetrachloroethene in indoor air to levels below the 15 ppb guideline. Indoor air sampling conducted in April 2002 only detected trace concentrations of PCE. Exposure to contaminated groundwater is unlikely as public drinking water is supplied to the entire community. Exposure to contaminated soils is unlikely as the affected areas are covered by buildings or pavement.

Dump: False
Structure: True
Lagoon: False
Landfill: False
Pond: False
Disp Start: 1970
Disp Term: 1994
Lat/Long: 40:49:02:0 / 73:56:07:0
Dell: F
Record Add: 11/18/99
Record Upd: 12/23/04
Updated By: JMOCONNE
Own Op: 03
Sub Type: NNN
Owner Name: Not reported
Owner Company: INNER CITY REDEVELOPMENT CORPORATION
Owner Address: Not reported
Owner Addr2: Not reported
Owner City,St,Zip: ZZ
Owner Country: United States of America
Own Op: 01
Sub Type: NNN
Owner Name: Not reported
Owner Company: Inner City Redevelopment Corporation
Owner Address: 2350 Fifth Avenue
Owner Addr2: Not reported
Owner City,St,Zip: New York, NY 10037
Owner Country: United States of America

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

2350 FIFTH AVENUE CORP (Continued)

EDR ID Number
EPA ID Number

Database(s)

1000108749

Own Op: 01
Sub Type: E
Owner Name: Not reported
Owner Company: INNER CITY REDEVELOPMENT CORPORATION
Owner Address: 2350 FIFTH AVE.
Owner Addr2: Not reported
Owner City,St,Zip: NEW YORK, NY 10037
Owner Country: United States of America
Own Op: 04
Sub Type: NNN
Owner Name: Not reported
Owner Company: Inner City Redevelopment Corporation
Owner Address: 23050 Fifth Avenue
Owner Addr2: Not reported
Owner City,St,Zip: New York, NY 10037
Owner Country: United States of America
Own Op: 04
Sub Type: E
Owner Name: Not reported
Owner Company: INNER CITY REDEVELOPMENT CORPORATION
Owner Address: 2350 FIFTH AVE
Owner Addr2: Not reported
Owner City,St,Zip: NEW YORK, NY
Owner Country: United States of America
HW Code: 231004
Waste Type: TETRACHLOROETHYLENE (PCE)
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: 231004
Waste Type: TETRACHLOROETHYLENE (PCE)
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: 231004
Waste Type: BENZO(A)PYRENE
Waste Quantity: UNKNOWN
Waste Code: Not reported
Crossref ID: Not reported
Cross Ref Type Code: Not reported
Cross Ref Type: Not reported
Record Added Date: Not reported
Record Updated: Not reported
Updated By: Not reported

FINDS:

Other Pertinent Environmental Activity Identified at Site

RCRAInfo is a national information system that supports the Resource Conservation and Recovery Act (RCRA) program through the tracking of events and activities related to facilities that generate, transport, and treat, store, or dispose of hazardous waste. RCRAInfo allows RCRA program staff to track the notification, permit, compliance, and corrective action activities required under RCRA.

DRYCLEANERS:

Facility ID: 2-6203-00165

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

2350 FIFTH AVENUE CORP (Continued)

EDR ID Number
EPA ID Number

Database(s)

Region: NY

1000108749

NY MANIFEST:

Document ID: MNA5030458
Manifest Status: Completed copy
Trans1 State ID: NJDEPS869
Trans2 State ID: Not reported
Generator Ship Date: 861107
Trans1 Recv Date: 861107
Trans2 Recv Date: Not reported
TSD Site Recv Date: 861107
Part A Recv Date: 861118
Part B Recv Date: 861120
Generator EPA ID: NYD071026173
Trans1 EPA ID: ILD000805911
Trans2 EPA ID: Not reported
TSDF ID: NJD000768093
Waste Code: F002 - HALO SOLV + STILL BOTTOMS FM REC OF SOLV
Quantity: 01040
Units: P - Pounds
Number of Containers: 013
Container Type: CF - Fiber or plastic boxes, cartons
Handling Method: R Material recovery of more than 75 percent of the total material.
Specific Gravity: 100
Waste Code: Not reported
Quantity: 01260
Units: P - Pounds
Number of Containers: 012
Container Type: DM - Metal drums, barrels
Handling Method: R Material recovery of more than 75 percent of the total material.
Specific Gravity: 100
Year: 86
Manifest Tracking Num: Not reported
Import Ind: Not reported
Export Ind: Not reported
Discr Quantity Ind: Not reported
Discr Type Ind: Not reported
Discr Residue Ind: Not reported
Discr Partial Reject Ind: Not reported
Discr Full Reject Ind: Not reported
Manifest Ref Num: Not reported
Alt Fac RCRA Id: Not reported
Alt Fac Sign Date: Not reported
Mgmt Method Type Code: Not reported
EPA ID: NYD071026173
Facility Name: 2350 LAUNDRY & DRY CLNG CORP
Facility Address: 2350 FIFTH AVE
Facility City: NEW YORK
Facility Address 2: Not reported
Country: USA
County: NE
Mailing Name: 2350 LAUNDRY & DRY CLNG CORP
Mailing Contact: 2350 LAUNDRY & DRY CLNG CORP
Mailing Address: 2350 FIFTH AVENUE
Mailing Address 2: Not reported
Mailing City: NEW YORK
Mailing State: NY

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

2350 FIFTH AVENUE CORP (Continued)

EDR ID Number
EPA ID Number

Database(s)

1000108749

Mailing Zip:	Not reported
Mailing Zip4:	Not reported
Mailing Country:	USA
Mailing Phone:	212-862-5517
Document ID:	NJA0215392
Manifest Status:	Completed copy
Trans1 State ID:	NJDEPS869
Trans2 State ID:	Not reported
Generator Ship Date:	860811
Trans1 Recv Date:	860811
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	860811
Part A Recv Date:	860820
Part B Recv Date:	860821
Generator EPA ID:	NYD071026173
Trans1 EPA ID:	ILD000805911
Trans2 EPA ID:	Not reported
TSD ID:	NJD000768093
Waste Code:	F002 - HALO SOLV + STILL BOTTOMS FM REC OF SOLV
Quantity:	01600
Units:	P - Pounds
Number of Containers:	020
Container Type:	CM - Metal boxes, cases, roll-offs
Handling Method:	R Material recovery of more than 75 percent of the total material.
Specific Gravity:	100
Waste Code:	Not reported
Quantity:	00810
Units:	P - Pounds
Number of Containers:	009
Container Type:	DM - Metal drums, barrels
Handling Method:	R Material recovery of more than 75 percent of the total material.
Specific Gravity:	100
Year:	86
Manifest Tracking Num:	Not reported
Import Ind:	Not reported
Export Ind:	Not reported
Discr Quantity Ind:	Not reported
Discr Type Ind:	Not reported
Discr Residue Ind:	Not reported
Discr Partial Reject Ind:	Not reported
Discr Full Reject Ind:	Not reported
Manifest Ref Num:	Not reported
Alt Fac RCRA Id:	Not reported
Alt Fac Sign Date:	Not reported
Mgmt Method Type Code:	Not reported
EPA ID:	NYD071026173
Facility Name:	2350 LAUNDRY & DRY CLNG CORP
Facility Address:	2350 FIFTH AVE
Facility City:	NEW YORK
Facility Address 2:	Not reported
Country:	USA
County:	NE
Mailing Name:	2350 LAUNDRY & DRY CLNG CORP
Mailing Contact:	2350 LAUNDRY & DRY CLNG CORP
Mailing Address:	2350 FIFTH AVENUE
Mailing Address 2:	Not reported

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

2350 FIFTH AVENUE CORP (Continued)

EDR ID Number
EPA ID Number

Database(s)

1000108749

Mailing City:	NEW YORK
Mailing State:	NY
Mailing Zip:	Not reported
Mailing Zip4:	Not reported
Mailing Country:	USA
Mailing Phone:	212-862-5517
Document ID:	NJA0319671
Manifest Status:	Completed after the designated time period for a TSDF to get a copy to the DEC
Trans1 State ID:	NJDEPS869
Trans2 State ID:	Not reported
Generator Ship Date:	870506
Trans1 Recv Date:	870506
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	870506
Part A Recv Date:	870608
Part B Recv Date:	870519
Generator EPA ID:	NYD071026173
Trans1 EPA ID:	ILD000805911
Trans2 EPA ID:	Not reported
TSDF ID:	NJD000768093
Waste Code:	F002 - HALO SOLV + STILL BOTTOMS FM REC OF SOLV
Quantity:	01600
Units:	P - Pounds
Number of Containers:	020
Container Type:	CF - Fiber or plastic boxes, cartons
Handling Method:	R Material recovery of more than 75 percent of the total material.
Specific Gravity:	100
Waste Code:	Not reported
Quantity:	02925
Units:	P - Pounds
Number of Containers:	015
Container Type:	DM - Metal drums, barrels
Handling Method:	R Material recovery of more than 75 percent of the total material.
Specific Gravity:	100
Year:	87
Manifest Tracking Num:	Not reported
Import Ind:	Not reported
Export Ind:	Not reported
Discr Quantity Ind:	Not reported
Discr Type Ind:	Not reported
Discr Residue Ind:	Not reported
Discr Partial Reject Ind:	Not reported
Discr Full Reject Ind:	Not reported
Manifest Ref Num:	Not reported
Alt Fac RCRA Id:	Not reported
Alt Fac Sign Date:	Not reported
Mgmt Method Type Code:	Not reported
EPA ID:	NYD071026173
Facility Name:	2350 LAUNDRY & DRY CLNG CORP
Facility Address:	2350 FIFTH AVE
Facility City:	NEW YORK
Facility Address 2:	Not reported
Country:	USA
County:	NE
Mailing Name:	2350 LAUNDRY & DRY CLNG CORP
Mailing Contact:	2350 LAUNDRY & DRY CLNG CORP

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

2350 FIFTH AVENUE CORP (Continued)

EDR ID Number
EPA ID Number

Database(s)

1000108749

Mailing Address: 2350 FIFTH AVENUE
Mailing Address 2: Not reported
Mailing City: NEW YORK
Mailing State: NY
Mailing Zip: Not reported
Mailing Zip4: Not reported
Mailing Country: USA
Mailing Phone: 212-862-5517

Document ID: NJA0177425
Manifest Status: Completed copy
Trans1 State ID: NJSWAS284
Trans2 State ID: Not reported
Generator Ship Date: 860106
Trans1 Recv Date: 860106
Trans2 Recv Date: Not reported
TSD Site Recv Date: 860106
Part A Recv Date: 860117
Part B Recv Date: 860115
Generator EPA ID: NYD071026173
Trans1 EPA ID: NJD002200046
Trans2 EPA ID: Not reported
TSD ID: NJD002200046
Waste Code: F002 - HALO SOLV + STILL BOTTOMS FM REC OF SOLV
Quantity: 01748
Units: P - Pounds
Number of Containers: 023
Container Type: CF - Fiber or plastic boxes, cartons
Handling Method: R Material recovery of more than 75 percent of the total material.
Specific Gravity: 100
Waste Code: Not reported
Quantity: 00120
Units: P - Pounds
Number of Containers: 002
Container Type: CF - Fiber or plastic boxes, cartons
Handling Method: R Material recovery of more than 75 percent of the total material.
Specific Gravity: 100
Year: 86
Manifest Tracking Num: Not reported
Import Ind: Not reported
Export Ind: Not reported
Discr Quantity Ind: Not reported
Discr Type Ind: Not reported
Discr Residue Ind: Not reported
Discr Partial Reject Ind: Not reported
Discr Full Reject Ind: Not reported
Manifest Ref Num: Not reported
Alt Fac RCRA Id: Not reported
Alt Fac Sign Date: Not reported
Mgmt Method Type Code: Not reported
EPA ID: NYD071026173
Facility Name: 2350 LAUNDRY & DRY CLNG CORP
Facility Address: 2350 FIFTH AVE
Facility City: NEW YORK
Facility Address 2: Not reported
Country: USA
County: NE

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

2350 FIFTH AVENUE CORP (Continued)

EDR ID Number
EPA ID Number

Database(s)

1000108749

Mailing Name: 2350 LAUNDRY & DRY CLNG CORP
Mailing Contact: 2350 LAUNDRY & DRY CLNG CORP
Mailing Address: 2350 FIFTH AVENUE
Mailing Address 2: Not reported
Mailing City: NEW YORK
Mailing State: NY
Mailing Zip: Not reported
Mailing Zip4: Not reported
Mailing Country: USA
Mailing Phone: 212-862-5517

Document ID: MNA5025569
Manifest Status: Completed copy
Trans1 State ID: 000000000
Trans2 State ID: Not reported
Generator Ship Date: 861128
Trans1 Recv Date: 861128
Trans2 Recv Date: Not reported
TSD Site Recv Date: 861128
Part A Recv Date: 861212
Part B Recv Date: 861212
Generator EPA ID: NYD071026173
Trans1 EPA ID: NJD000768093
Trans2 EPA ID: Not reported
TSDF ID: NJD000768093
Waste Code: F002 - HALO SOLV + STILL BOTTOMS FM REC OF SOLV
Quantity: 00150
Units: P - Pounds
Number of Containers: 001
Container Type: DF - Fiberboard or plastic drums (glass)
Handling Method: R Material recovery of more than 75 percent of the total material.
Specific Gravity: 100
Waste Code: Not reported
Quantity: 00320
Units: P - Pounds
Number of Containers: 004
Container Type: CF - Fiber or plastic boxes, cartons
Handling Method: R Material recovery of more than 75 percent of the total material.
Specific Gravity: 100
Year: 86
Manifest Tracking Num: Not reported
Import Ind: Not reported
Export Ind: Not reported
Discr Quantity Ind: Not reported
Discr Type Ind: Not reported
Discr Residue Ind: Not reported
Discr Partial Reject Ind: Not reported
Discr Full Reject Ind: Not reported
Manifest Ref Num: Not reported
Alt Fac RCRA Id: Not reported
Alt Fac Sign Date: Not reported
Mgmt Method Type Code: Not reported
EPA ID: NYD071026173
Facility Name: 2350 LAUNDRY & DRY CLNG CORP
Facility Address: 2350 FIFTH AVE
Facility City: NEW YORK
Facility Address 2: Not reported

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

2350 FIFTH AVENUE CORP (Continued)

EDR ID Number
EPA ID Number

Database(s)

1000108749

Country: USA
County: NE
Mailing Name: 2350 LAUNDRY & DRY CLNG CORP
Mailing Contact: 2350 LAUNDRY & DRY CLNG CORP
Mailing Address: 2350 FIFTH AVENUE
Mailing Address 2: Not reported
Mailing City: NEW YORK
Mailing State: NY
Mailing Zip: Not reported
Mailing Zip4: Not reported
Mailing Country: USA
Mailing Phone: 212-862-5517

Document ID: NJA0232508
Manifest Status: Completed copy
Trans1 State ID: NJDEPS-86
Trans2 State ID: Not reported
Generator Ship Date: 861125
Trans1 Recv Date: 861125
Trans2 Recv Date: Not reported
TSD Site Recv Date: 861125
Part A Recv Date: 861208
Part B Recv Date: 861209
Generator EPA ID: NYD071026173
Trans1 EPA ID: ILD000805911
Trans2 EPA ID: Not reported
TSDF ID: NJD000768093
Waste Code: F002 - HALO SOLV + STILL BOTTOMS FM REC OF SOLV
Quantity: 01320
Units: P - Pounds
Number of Containers: 012
Container Type: CF - Fiber or plastic boxes, cartons
Handling Method: R Material recovery of more than 75 percent of the total material.
Specific Gravity: 100
Waste Code: Not reported
Quantity: 00750
Units: P - Pounds
Number of Containers: 005
Container Type: DF - Fiberboard or plastic drums (glass)
Handling Method: R Material recovery of more than 75 percent of the total material.
Specific Gravity: 100
Waste Code: Not reported
Quantity: 00360
Units: P - Pounds
Number of Containers: 006
Container Type: DM - Metal drums, barrels
Handling Method: R Material recovery of more than 75 percent of the total material.
Specific Gravity: 100
Year: 86
Manifest Tracking Num: Not reported
Import Ind: Not reported
Export Ind: Not reported
Discr Quantity Ind: Not reported
Discr Type Ind: Not reported
Discr Residue Ind: Not reported
Discr Partial Reject Ind: Not reported
Discr Full Reject Ind: Not reported

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s)
EDR ID Number
EPA ID Number

2350 FIFTH AVENUE CORP (Continued)

1000108749

Manifest Ref Num:	Not reported
Alt Fac RCRA Id:	Not reported
Alt Fac Sign Date:	Not reported
Mgmt Method Type Code:	Not reported
EPA ID:	NYD071026173
Facility Name:	2350 LAUNDRY & DRY CLNG CORP
Facility Address:	2350 FIFTH AVE
Facility City:	NEW YORK
Facility Address 2:	Not reported
Country:	USA
County:	NE
Mailing Name:	2350 LAUNDRY & DRY CLNG CORP
Mailing Contact:	2350 LAUNDRY & DRY CLNG CORP
Mailing Address:	2350 FIFTH AVENUE
Mailing Address 2:	Not reported
Mailing City:	NEW YORK
Mailing State:	NY
Mailing Zip:	Not reported
Mailing Zip4:	Not reported
Mailing Country:	USA
Mailing Phone:	212-862-5517
Document ID:	NJA0245002
Manifest Status:	Completed after the designated time period for a TSDF to get a copy to the DEC
Trans1 State ID:	NJDEPS869
Trans2 State ID:	Not reported
Generator Ship Date:	861119
Trans1 Recv Date:	861119
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	861119
Part A Recv Date:	861230
Part B Recv Date:	861201
Generator EPA ID:	NYD071026173
Trans1 EPA ID:	ILD000805911
Trans2 EPA ID:	Not reported
TSDF ID:	NJD000768093
Waste Code:	D001 - NON-LISTED IGNITABLE WASTES
Quantity:	00045
Units:	P - Pounds
Number of Containers:	001
Container Type:	DM - Metal drums, barrels
Handling Method:	R Material recovery of more than 75 percent of the total material.
Specific Gravity:	100
Year:	86
Manifest Tracking Num:	Not reported
Import Ind:	Not reported
Export Ind:	Not reported
Discr Quantity Ind:	Not reported
Discr Type Ind:	Not reported
Discr Residue Ind:	Not reported
Discr Partial Reject Ind:	Not reported
Discr Full Reject Ind:	Not reported
Manifest Ref Num:	Not reported
Alt Fac RCRA Id:	Not reported
Alt Fac Sign Date:	Not reported
Mgmt Method Type Code:	Not reported
EPA ID:	NYD071026173

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

2350 FIFTH AVENUE CORP (Continued)

EDR ID Number
EPA ID Number

Database(s)

1000108749

Facility Name:	2350 LAUNDRY & DRY CLNG CORP
Facility Address:	2350 FIFTH AVE
Facility City:	NEW YORK
Facility Address 2:	Not reported
Country:	USA
County:	NE
Mailing Name:	2350 LAUNDRY & DRY CLNG CORP
Mailing Contact:	2350 LAUNDRY & DRY CLNG CORP
Mailing Address:	2350 FIFTH AVENUE
Mailing Address 2:	Not reported
Mailing City:	NEW YORK
Mailing State:	NY
Mailing Zip:	Not reported
Mailing Zip4:	Not reported
Mailing Country:	USA
Mailing Phone:	212-862-5517
Document ID:	MNA5052590
Manifest Status:	Completed copy
Trans1 State ID:	NJDEPS869
Trans2 State ID:	Not reported
Generator Ship Date:	870411
Trans1 Recv Date:	870411
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	870411
Part A Recv Date:	870427
Part B Recv Date:	870429
Generator EPA ID:	NYD071026173
Trans1 EPA ID:	NJD000768093
Trans2 EPA ID:	Not reported
TSD ID:	NJD000768093
Waste Code:	F002 - HALO SOLV + STILL BOTTOMS FM REC OF SOLV
Quantity:	01280
Units:	P - Pounds
Number of Containers:	016
Container Type:	CF - Fiber or plastic boxes, cartons
Handling Method:	R Material recovery of more than 75 percent of the total material.
Specific Gravity:	100
Waste Code:	Not reported
Quantity:	00630
Units:	P - Pounds
Number of Containers:	009
Container Type:	DM - Metal drums, barrels
Handling Method:	R Material recovery of more than 75 percent of the total material.
Specific Gravity:	100
Waste Code:	Not reported
Quantity:	01560
Units:	P - Pounds
Number of Containers:	008
Container Type:	DF - Fiberboard or plastic drums (glass)
Handling Method:	R Material recovery of more than 75 percent of the total material.
Specific Gravity:	100
Year:	87
Manifest Tracking Num:	Not reported
Import Ind:	Not reported
Export Ind:	Not reported
Discr Quantity Ind:	Not reported

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s)
EDR ID Number
EPA ID Number

2350 FIFTH AVENUE CORP (Continued)

1000108749

Discr Type Ind:	Not reported
Discr Residue Ind:	Not reported
Discr Partial Reject Ind:	Not reported
Discr Full Reject Ind:	Not reported
Manifest Ref Num:	Not reported
Alt Fac RCRA Id:	Not reported
Alt Fac Sign Date:	Not reported
Mgmt Method Type Code:	Not reported
EPA ID:	NYD071026173
Facility Name:	2350 LAUNDRY & DRY CLNG CORP
Facility Address:	2350 FIFTH AVE
Facility City:	NEW YORK
Facility Address 2:	Not reported
Country:	USA
County:	NE
Mailing Name:	2350 LAUNDRY & DRY CLNG CORP
Mailing Contact:	2350 LAUNDRY & DRY CLNG CORP
Mailing Address:	2350 FIFTH AVENUE
Mailing Address 2:	Not reported
Mailing City:	NEW YORK
Mailing State:	NY
Mailing Zip:	Not reported
Mailing Zip4:	Not reported
Mailing Country:	USA
Mailing Phone:	212-862-5517
Document ID:	NJA1434022
Manifest Status:	Completed after the designated time period for a TSDF to get a copy to the DEC
Trans1 State ID:	NJDEPS869
Trans2 State ID:	Not reported
Generator Ship Date:	920430
Trans1 Recv Date:	920430
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	920430
Part A Recv Date:	Not reported
Part B Recv Date:	920603
Generator EPA ID:	NYD071026173
Trans1 EPA ID:	ILD051060408
Trans2 EPA ID:	Not reported
TSDF ID:	NJD000768093
Waste Code:	D001 - NON-LISTED IGNITABLE WASTES
Quantity:	00135
Units:	P - Pounds
Number of Containers:	001
Container Type:	DF - Fiberboard or plastic drums (glass)
Handling Method:	B Incineration, heat recovery, burning.
Specific Gravity:	100
Waste Code:	Not reported
Quantity:	00320
Units:	P - Pounds
Number of Containers:	006
Container Type:	DM - Metal drums, barrels
Handling Method:	B Incineration, heat recovery, burning.
Specific Gravity:	100
Waste Code:	Not reported
Quantity:	00195
Units:	P - Pounds

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

2350 FIFTH AVENUE CORP (Continued)

EDR ID Number
EPA ID Number

Database(s)

1000108749

Number of Containers: 001
Container Type: DF - Fiberboard or plastic drums (glass)
Handling Method: B Incineration, heat recovery, burning.
Specific Gravity: 100
Year: 92
Manifest Tracking Num: Not reported
Import Ind: Not reported
Export Ind: Not reported
Discr Quantity Ind: Not reported
Discr Type Ind: Not reported
Discr Residue Ind: Not reported
Discr Partial Reject Ind: Not reported
Discr Full Reject Ind: Not reported
Manifest Ref Num: Not reported
Alt Fac RCRA Id: Not reported
Alt Fac Sign Date: Not reported
Mgmt Method Type Code: Not reported
EPA ID: NYD071026173
Facility Name: 2350 LAUNDRY & DRY CLNG CORP
Facility Address: 2350 FIFTH AVE
Facility City: NEW YORK
Facility Address 2: Not reported
Country: USA
County: NE
Mailing Name: 2350 LAUNDRY & DRY CLNG CORP
Mailing Contact: 2350 LAUNDRY & DRY CLNG CORP
Mailing Address: 2350 FIFTH AVENUE
Mailing Address 2: Not reported
Mailing City: NEW YORK
Mailing State: NY
Mailing Zip: Not reported
Mailing Zip4: Not reported
Mailing Country: USA
Mailing Phone: 212-862-5517

Document ID: NJA1351869
Manifest Status: Completed copy
Trans1 State ID: NJDEPS869
Trans2 State ID: Not reported
Generator Ship Date: 921112
Trans1 Recv Date: 921112
Trans2 Recv Date: Not reported
TSD Site Recv Date: 921112
Part A Recv Date: 921123
Part B Recv Date: 921201
Generator EPA ID: NYD071026173
Trans1 EPA ID: ILD051060408
Trans2 EPA ID: Not reported
TSD ID: NJD000768093
Waste Code: F002 - HALO SOLV + STILL BOTTOMS FM REC OF SOLV
Quantity: 00960
Units: P - Pounds
Number of Containers: 016
Container Type: DM - Metal drums, barrels
Handling Method: B Incineration, heat recovery, burning.
Specific Gravity: 100
Waste Code: Not reported

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s)
EDR ID Number
EPA ID Number

2350 FIFTH AVENUE CORP (Continued)

1000108749

Quantity: 00600
Units: P - Pounds
Number of Containers: 004
Container Type: DF - Fiberboard or plastic drums (glass)
Handling Method: B Incineration, heat recovery, burning.
Specific Gravity: 100
Year: 92
Manifest Tracking Num: Not reported
Import Ind: Not reported
Export Ind: Not reported
Discr Quantity Ind: Not reported
Discr Type Ind: Not reported
Discr Residue Ind: Not reported
Discr Partial Reject Ind: Not reported
Discr Full Reject Ind: Not reported
Manifest Ref Num: Not reported
Alt Fac RCRA Id: Not reported
Alt Fac Sign Date: Not reported
Mgmt Method Type Code: Not reported
EPA ID: NYD071026173
Facility Name: 2350 LAUNDRY & DRY CLNG CORP
Facility Address: 2350 FIFTH AVE
Facility City: NEW YORK
Facility Address 2: Not reported
Country: USA
County: NE
Mailing Name: 2350 LAUNDRY & DRY CLNG CORP
Mailing Contact: 2350 LAUNDRY & DRY CLNG CORP
Mailing Address: 2350 FIFTH AVENUE
Mailing Address 2: Not reported
Mailing City: NEW YORK
Mailing State: NY
Mailing Zip: Not reported
Mailing Zip4: Not reported
Mailing Country: USA
Mailing Phone: 212-862-5517

Document ID: NJA1331836
Manifest Status: Completed copy
Trans1 State ID: NJDEPS869
Trans2 State ID: Not reported
Generator Ship Date: 920226
Trans1 Recv Date: 920226
Trans2 Recv Date: Not reported
TSD Site Recv Date: 920226
Part A Recv Date: Not reported
Part B Recv Date: 920311
Generator EPA ID: NYD071026173
Trans1 EPA ID: ILD051060408
Trans2 EPA ID: Not reported
TSDF ID: NJD000768093
Waste Code: D001 - NON-LISTED IGNITABLE WASTES
Quantity: 00045
Units: P - Pounds
Number of Containers: 001
Container Type: DM - Metal drums, barrels
Handling Method: R Material recovery of more than 75 percent of the total material.

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

2350 FIFTH AVENUE CORP (Continued)

EDR ID Number
EPA ID Number

Database(s)

1000108749

Specific Gravity:	100
Year:	92
Manifest Tracking Num:	Not reported
Import Ind:	Not reported
Export Ind:	Not reported
Discr Quantity Ind:	Not reported
Discr Type Ind:	Not reported
Discr Residue Ind:	Not reported
Discr Partial Reject Ind:	Not reported
Discr Full Reject Ind:	Not reported
Manifest Ref Num:	Not reported
Alt Fac RCRA Id:	Not reported
Alt Fac Sign Date:	Not reported
Mgmt Method Type Code:	Not reported
EPA ID:	NYD071026173
Facility Name:	2350 LAUNDRY & DRY CLNG CORP
Facility Address:	2350 FIFTH AVE
Facility City:	NEW YORK
Facility Address 2:	Not reported
Country:	USA
County:	NE
Mailing Name:	2350 LAUNDRY & DRY CLNG CORP
Mailing Contact:	2350 LAUNDRY & DRY CLNG CORP
Mailing Address:	2350 FIFTH AVENUE
Mailing Address 2:	Not reported
Mailing City:	NEW YORK
Mailing State:	NY
Mailing Zip:	Not reported
Mailing Zip4:	Not reported
Mailing Country:	USA
Mailing Phone:	212-862-5517
Document ID:	NJA1617484
Manifest Status:	Completed copy
Trans1 State ID:	NJDEPS869
Trans2 State ID:	Not reported
Generator Ship Date:	921217
Trans1 Recv Date:	921217
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	921217
Part A Recv Date:	921230
Part B Recv Date:	921230
Generator EPA ID:	NYD071026173
Trans1 EPA ID:	ILD051060408
Trans2 EPA ID:	Not reported
TSDF ID:	NJD000768093
Waste Code:	F002 - HALO SOLV + STILL BOTTOMS FM REC OF SOLV
Quantity:	01470
Units:	P - Pounds
Number of Containers:	022
Container Type:	DM - Metal drums, barrels
Handling Method:	B Incineration, heat recovery, burning.
Specific Gravity:	100
Waste Code:	Not reported
Quantity:	00195
Units:	P - Pounds
Number of Containers:	001

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s)
EDR ID Number
EPA ID Number

2350 FIFTH AVENUE CORP (Continued)

1000108749

Container Type: DF - Fiberboard or plastic drums (glass)
Handling Method: B Incineration, heat recovery, burning.
Specific Gravity: 100
Year: 92
Manifest Tracking Num: Not reported
Import Ind: Not reported
Export Ind: Not reported
Discr Quantity Ind: Not reported
Discr Type Ind: Not reported
Discr Residue Ind: Not reported
Discr Partial Reject Ind: Not reported
Discr Full Reject Ind: Not reported
Manifest Ref Num: Not reported
Alt Fac RCRA Id: Not reported
Alt Fac Sign Date: Not reported
Mgmt Method Type Code: Not reported
EPA ID: NYD071026173
Facility Name: 2350 LAUNDRY & DRY CLNG CORP
Facility Address: 2350 FIFTH AVE
Facility City: NEW YORK
Facility Address 2: Not reported
Country: USA
County: NE
Mailing Name: 2350 LAUNDRY & DRY CLNG CORP
Mailing Contact: 2350 LAUNDRY & DRY CLNG CORP
Mailing Address: 2350 FIFTH AVENUE
Mailing Address 2: Not reported
Mailing City: NEW YORK
Mailing State: NY
Mailing Zip: Not reported
Mailing Zip4: Not reported
Mailing Country: USA
Mailing Phone: 212-862-5517

Document ID: NJA1422797
Manifest Status: Completed copy
Trans1 State ID: NJDEPS869
Trans2 State ID: Not reported
Generator Ship Date: 920605
Trans1 Recv Date: 920605
Trans2 Recv Date: Not reported
TSD Site Recv Date: 920605
Part A Recv Date: Not reported
Part B Recv Date: 920619
Generator EPA ID: NYD071026173
Trans1 EPA ID: ILD051060408
Trans2 EPA ID: Not reported
TSD ID: NJD000768093
Waste Code: D001 - NON-LISTED IGNITABLE WASTES
Quantity: 00202
Units: P - Pounds
Number of Containers: 002
Container Type: DF - Fiberboard or plastic drums (glass)
Handling Method: B Incineration, heat recovery, burning.
Specific Gravity: 100
Waste Code: Not reported
Quantity: 00390

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s)
EDR ID Number
EPA ID Number

2350 FIFTH AVENUE CORP (Continued)

1000108749

Units:	P - Pounds
Number of Containers:	002
Container Type:	DF - Fiberboard or plastic drums (glass)
Handling Method:	B Incineration, heat recovery, burning.
Specific Gravity:	100
Waste Code:	Not reported
Quantity:	00550
Units:	P - Pounds
Number of Containers:	011
Container Type:	DM - Metal drums, barrels
Handling Method:	B Incineration, heat recovery, burning.
Specific Gravity:	100
Year:	92
Manifest Tracking Num:	Not reported
Import Ind:	Not reported
Export Ind:	Not reported
Discr Quantity Ind:	Not reported
Discr Type Ind:	Not reported
Discr Residue Ind:	Not reported
Discr Partial Reject Ind:	Not reported
Discr Full Reject Ind:	Not reported
Manifest Ref Num:	Not reported
Alt Fac RCRA Id:	Not reported
Alt Fac Sign Date:	Not reported
Mgmt Method Type Code:	Not reported
EPA ID:	NYD071026173
Facility Name:	2350 LAUNDRY & DRY CLNG CORP
Facility Address:	2350 FIFTH AVE
Facility City:	NEW YORK
Facility Address 2:	Not reported
Country:	USA
County:	NE
Mailing Name:	2350 LAUNDRY & DRY CLNG CORP
Mailing Contact:	2350 LAUNDRY & DRY CLNG CORP
Mailing Address:	2350 FIFTH AVENUE
Mailing Address 2:	Not reported
Mailing City:	NEW YORK
Mailing State:	NY
Mailing Zip:	Not reported
Mailing Zip4:	Not reported
Mailing Country:	USA
Mailing Phone:	212-862-5517
Document ID:	NJA1461457
Manifest Status:	Completed copy
Trans1 State ID:	NJDEPS869
Trans2 State ID:	Not reported
Generator Ship Date:	920611
Trans1 Recv Date:	920611
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	920611
Part A Recv Date:	Not reported
Part B Recv Date:	920624
Generator EPA ID:	NYD071026173
Trans1 EPA ID:	ILD051060408
Trans2 EPA ID:	Not reported
TSDF ID:	NJD000768093

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s)
EDR ID Number
EPA ID Number

2350 FIFTH AVENUE CORP (Continued)

1000108749

Waste Code: D001 - NON-LISTED IGNITABLE WASTES
Quantity: 00045
Units: P - Pounds
Number of Containers: 001
Container Type: DM - Metal drums, barrels
Handling Method: R Material recovery of more than 75 percent of the total material.
Specific Gravity: 100
Year: 92
Manifest Tracking Num: Not reported
Import Ind: Not reported
Export Ind: Not reported
Discr Quantity Ind: Not reported
Discr Type Ind: Not reported
Discr Residue Ind: Not reported
Discr Partial Reject Ind: Not reported
Discr Full Reject Ind: Not reported
Manifest Ref Num: Not reported
Alt Fac RCRA Id: Not reported
Alt Fac Sign Date: Not reported
Mgmt Method Type Code: Not reported
EPA ID: NYD071026173
Facility Name: 2350 LAUNDRY & DRY CLNG CORP
Facility Address: 2350 FIFTH AVE
Facility City: NEW YORK
Facility Address 2: Not reported
Country: USA
County: NE
Mailing Name: 2350 LAUNDRY & DRY CLNG CORP
Mailing Contact: 2350 LAUNDRY & DRY CLNG CORP
Mailing Address: 2350 FIFTH AVENUE
Mailing Address 2: Not reported
Mailing City: NEW YORK
Mailing State: NY
Mailing Zip: Not reported
Mailing Zip4: Not reported
Mailing Country: USA
Mailing Phone: 212-862-5517

Document ID: NJA1338888
Manifest Status: Completed copy
Trans1 State ID: NJDEPS869
Trans2 State ID: Not reported
Generator Ship Date: 920316
Trans1 Recv Date: 920316
Trans2 Recv Date: Not reported
TSD Site Recv Date: 920316
Part A Recv Date: Not reported
Part B Recv Date: 920324
Generator EPA ID: NYD071026173
Trans1 EPA ID: ILD051060408
Trans2 EPA ID: Not reported
TSD ID: NJD000768093
Waste Code: D001 - NON-LISTED IGNITABLE WASTES
Quantity: 00045
Units: P - Pounds
Number of Containers: 001
Container Type: DM - Metal drums, barrels

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s)
EDR ID Number
EPA ID Number

2350 FIFTH AVENUE CORP (Continued)

1000108749

Handling Method: R Material recovery of more than 75 percent of the total material.
Specific Gravity: 100
Year: 92
Manifest Tracking Num: Not reported
Import Ind: Not reported
Export Ind: Not reported
Discr Quantity Ind: Not reported
Discr Type Ind: Not reported
Discr Residue Ind: Not reported
Discr Partial Reject Ind: Not reported
Discr Full Reject Ind: Not reported
Manifest Ref Num: Not reported
Alt Fac RCRA Id: Not reported
Alt Fac Sign Date: Not reported
Mgmt Method Type Code: Not reported
EPA ID: NYD071026173
Facility Name: 2350 LAUNDRY & DRY CLNG CORP
Facility Address: 2350 FIFTH AVE
Facility City: NEW YORK
Facility Address 2: Not reported
Country: USA
County: NE
Mailing Name: 2350 LAUNDRY & DRY CLNG CORP
Mailing Contact: 2350 LAUNDRY & DRY CLNG CORP
Mailing Address: 2350 FIFTH AVENUE
Mailing Address 2: Not reported
Mailing City: NEW YORK
Mailing State: NY
Mailing Zip: Not reported
Mailing Zip4: Not reported
Mailing Country: USA
Mailing Phone: 212-862-5517

Document ID: NJA1374173
Manifest Status: Completed copy
Trans1 State ID: NJDEPS869
Trans2 State ID: Not reported
Generator Ship Date: 920116
Trans1 Recv Date: 920116
Trans2 Recv Date: Not reported
TSD Site Recv Date: 920116
Part A Recv Date: Not reported
Part B Recv Date: 920204
Generator EPA ID: NYD071026173
Trans1 EPA ID: ILD051060408
Trans2 EPA ID: Not reported
TSDF ID: NJD000768093
Waste Code: D001 - NON-LISTED IGNITABLE WASTES
Quantity: 00045
Units: P - Pounds
Number of Containers: 001
Container Type: DM - Metal drums, barrels
Handling Method: R Material recovery of more than 75 percent of the total material.
Specific Gravity: 100
Year: 92
Manifest Tracking Num: Not reported
Import Ind: Not reported

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s)
EDR ID Number
EPA ID Number

2350 FIFTH AVENUE CORP (Continued)

1000108749

Export Ind:	Not reported
Discr Quantity Ind:	Not reported
Discr Type Ind:	Not reported
Discr Residue Ind:	Not reported
Discr Partial Reject Ind:	Not reported
Discr Full Reject Ind:	Not reported
Manifest Ref Num:	Not reported
Alt Fac RCRA Id:	Not reported
Alt Fac Sign Date:	Not reported
Mgmt Method Type Code:	Not reported
EPA ID:	NYD071026173
Facility Name:	2350 LAUNDRY & DRY CLNG CORP
Facility Address:	2350 FIFTH AVE
Facility City:	NEW YORK
Facility Address 2:	Not reported
Country:	USA
County:	NE
Mailing Name:	2350 LAUNDRY & DRY CLNG CORP
Mailing Contact:	2350 LAUNDRY & DRY CLNG CORP
Mailing Address:	2350 FIFTH AVENUE
Mailing Address 2:	Not reported
Mailing City:	NEW YORK
Mailing State:	NY
Mailing Zip:	Not reported
Mailing Zip4:	Not reported
Mailing Country:	USA
Mailing Phone:	212-862-5517
Document ID:	NJA1423039
Manifest Status:	Completed copy
Trans1 State ID:	NJDEPS869
Trans2 State ID:	Not reported
Generator Ship Date:	920319
Trans1 Recv Date:	920319
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	920319
Part A Recv Date:	920326
Part B Recv Date:	920330
Generator EPA ID:	NYD071026173
Trans1 EPA ID:	ILD051060408
Trans2 EPA ID:	Not reported
TSD ID:	NJD000768093
Waste Code:	F002 - HALO SOLV + STILL BOTTOMS FM REC OF SOLV
Quantity:	00300
Units:	P - Pounds
Number of Containers:	005
Container Type:	DM - Metal drums, barrels
Handling Method:	B Incineration, heat recovery, burning.
Specific Gravity:	100
Waste Code:	Not reported
Quantity:	00195
Units:	P - Pounds
Number of Containers:	001
Container Type:	DF - Fiberboard or plastic drums (glass)
Handling Method:	B Incineration, heat recovery, burning.
Specific Gravity:	100
Year:	92

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

2350 FIFTH AVENUE CORP (Continued)

EDR ID Number
EPA ID Number

Database(s)

1000108749

Manifest Tracking Num:	Not reported
Import Ind:	Not reported
Export Ind:	Not reported
Discr Quantity Ind:	Not reported
Discr Type Ind:	Not reported
Discr Residue Ind:	Not reported
Discr Partial Reject Ind:	Not reported
Discr Full Reject Ind:	Not reported
Manifest Ref Num:	Not reported
Alt Fac RCRA Id:	Not reported
Alt Fac Sign Date:	Not reported
Mgmt Method Type Code:	Not reported
EPA ID:	NYD071026173
Facility Name:	2350 LAUNDRY & DRY CLNG CORP
Facility Address:	2350 FIFTH AVE
Facility City:	NEW YORK
Facility Address 2:	Not reported
Country:	USA
County:	NE
Mailing Name:	2350 LAUNDRY & DRY CLNG CORP
Mailing Contact:	2350 LAUNDRY & DRY CLNG CORP
Mailing Address:	2350 FIFTH AVENUE
Mailing Address 2:	Not reported
Mailing City:	NEW YORK
Mailing State:	NY
Mailing Zip:	Not reported
Mailing Zip4:	Not reported
Mailing Country:	USA
Mailing Phone:	212-862-5517
Document ID:	NJA1436697
Manifest Status:	Completed copy
Trans1 State ID:	NJDEPS869
Trans2 State ID:	Not reported
Generator Ship Date:	920625
Trans1 Recv Date:	920625
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	920625
Part A Recv Date:	Not reported
Part B Recv Date:	920703
Generator EPA ID:	NYD071026173
Trans1 EPA ID:	ILD051060408
Trans2 EPA ID:	Not reported
TSD ID:	NJD000768093
Waste Code:	F002 - HALO SOLV + STILL BOTTOMS FM REC OF SOLV
Quantity:	01060
Units:	P - Pounds
Number of Containers:	017
Container Type:	DM - Metal drums, barrels
Handling Method:	B Incineration, heat recovery, burning.
Specific Gravity:	100
Waste Code:	Not reported
Quantity:	00195
Units:	P - Pounds
Number of Containers:	001
Container Type:	DF - Fiberboard or plastic drums (glass)
Handling Method:	B Incineration, heat recovery, burning.

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

2350 FIFTH AVENUE CORP (Continued)

EDR ID Number
EPA ID Number

Database(s)

1000108749

Specific Gravity: 100
Year: 92
Manifest Tracking Num: Not reported
Import Ind: Not reported
Export Ind: Not reported
Discr Quantity Ind: Not reported
Discr Type Ind: Not reported
Discr Residue Ind: Not reported
Discr Partial Reject Ind: Not reported
Discr Full Reject Ind: Not reported
Manifest Ref Num: Not reported
Alt Fac RCRA Id: Not reported
Alt Fac Sign Date: Not reported
Mgmt Method Type Code: Not reported
EPA ID: NYD071026173
Facility Name: 2350 LAUNDRY & DRY CLNG CORP
Facility Address: 2350 FIFTH AVE
Facility City: NEW YORK
Facility Address 2: Not reported
Country: USA
County: NE
Mailing Name: 2350 LAUNDRY & DRY CLNG CORP
Mailing Contact: 2350 LAUNDRY & DRY CLNG CORP
Mailing Address: 2350 FIFTH AVENUE
Mailing Address 2: Not reported
Mailing City: NEW YORK
Mailing State: NY
Mailing Zip: Not reported
Mailing Zip4: Not reported
Mailing Country: USA
Mailing Phone: 212-862-5517

Document ID: NJA1456871
Manifest Status: Completed copy
Trans1 State ID: NJDEPS869
Trans2 State ID: Not reported
Generator Ship Date: 920630
Trans1 Recv Date: 920630
Trans2 Recv Date: Not reported
TSD Site Recv Date: 920630
Part A Recv Date: Not reported
Part B Recv Date: 920710
Generator EPA ID: NYD071026173
Trans1 EPA ID: ILD051060408
Trans2 EPA ID: Not reported
TSDF ID: NJD000768093
Waste Code: D001 - NON-LISTED IGNITABLE WASTES
Quantity: 00045
Units: P - Pounds
Number of Containers: 001
Container Type: DM - Metal drums, barrels
Handling Method: R Material recovery of more than 75 percent of the total material.
Specific Gravity: 100
Year: 92
Manifest Tracking Num: Not reported
Import Ind: Not reported
Export Ind: Not reported

Map ID
 Direction
 Distance
 Distance (ft.)
 Elevation Site

MAP FINDINGS

Database(s)
 EDR ID Number
 EPA ID Number

2350 FIFTH AVENUE CORP (Continued)

1000108749

Discr Quantity Ind:	Not reported
Discr Type Ind:	Not reported
Discr Residue Ind:	Not reported
Discr Partial Reject Ind:	Not reported
Discr Full Reject Ind:	Not reported
Manifest Ref Num:	Not reported
Alt Fac RCRA Id:	Not reported
Alt Fac Sign Date:	Not reported
Mgmt Method Type Code:	Not reported
EPA ID:	NYD071026173
Facility Name:	2350 LAUNDRY & DRY CLNG CORP
Facility Address:	2350 FIFTH AVE
Facility City:	NEW YORK
Facility Address 2:	Not reported
Country:	USA
County:	NE
Mailing Name:	2350 LAUNDRY & DRY CLNG CORP
Mailing Contact:	2350 LAUNDRY & DRY CLNG CORP
Mailing Address:	2350 FIFTH AVENUE
Mailing Address 2:	Not reported
Mailing City:	NEW YORK
Mailing State:	NY
Mailing Zip:	Not reported
Mailing Zip4:	Not reported
Mailing Country:	USA
Mailing Phone:	212-862-5517
Document ID:	NJA1366669
Manifest Status:	Completed copy
Trans1 State ID:	NJDEPS869
Trans2 State ID:	Not reported
Generator Ship Date:	920124
Trans1 Recv Date:	920124
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	920124
Part A Recv Date:	920130
Part B Recv Date:	920207
Generator EPA ID:	NYD071026173
Trans1 EPA ID:	ILD051060408
Trans2 EPA ID:	Not reported
TSD ID:	NJD000768093
Waste Code:	F002 - HALO SOLV + STILL BOTTOMS FM REC OF SOLV
Quantity:	00932
Units:	P - Pounds
Number of Containers:	017
Container Type:	DM - Metal drums, barrels
Handling Method:	B Incineration, heat recovery, burning.
Specific Gravity:	100
Waste Code:	Not reported
Quantity:	00195
Units:	P - Pounds
Number of Containers:	001
Container Type:	DF - Fiberboard or plastic drums (glass)
Handling Method:	B Incineration, heat recovery, burning.
Specific Gravity:	100
Year:	92
Manifest Tracking Num:	Not reported

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

2350 FIFTH AVENUE CORP (Continued)

EDR ID Number
EPA ID Number

Database(s)

1000108749

Import Ind: Not reported
Export Ind: Not reported
Discr Quantity Ind: Not reported
Discr Type Ind: Not reported
Discr Residue Ind: Not reported
Discr Partial Reject Ind: Not reported
Discr Full Reject Ind: Not reported
Manifest Ref Num: Not reported
Alt Fac RCRA Id: Not reported
Alt Fac Sign Date: Not reported
Mgmt Method Type Code: Not reported
EPA ID: NYD071026173
Facility Name: 2350 LAUNDRY & DRY CLNG CORP
Facility Address: 2350 FIFTH AVE
Facility City: NEW YORK
Facility Address 2: Not reported
Country: USA
County: NE
Mailing Name: 2350 LAUNDRY & DRY CLNG CORP
Mailing Contact: 2350 LAUNDRY & DRY CLNG CORP
Mailing Address: 2350 FIFTH AVENUE
Mailing Address 2: Not reported
Mailing City: NEW YORK
Mailing State: NY
Mailing Zip: Not reported
Mailing Zip4: Not reported
Mailing Country: USA
Mailing Phone: 212-862-5517

[Click this hyperlink](#) while viewing on your computer to access
292 additional NY_MANIFEST: record(s) in the EDR Site Report.

ORPHAN SUMMARY

City	EDR ID	Site Name	Site Address	Zip	Database(s)
MANHATTAN	S108298483	564 WEST 160TH STREET	564 WEST 160TH STREET	10032	LTANKS
NEW YORK	1009237939	CONSOLIDATED EDISON	V2062-W 151ST ST / ST NICHOL		NY MANIFEST
NEW YORK	1004761989	NYCDEP - SHAFT 9B	155TH ST W OF AMSTERDAM AVE	10032	RCRA-SQG, FINDS
NEW YORK	1001203039	NEW YORK CITY DEPT OF TRANSPORTATI	158TH ST YARD OVER AMTRAC	10032	FINDS, RCRA-LQG, NY MANIFEST
NEW YORK	S104654272	133 STREET AT	AMSTERDAM AVENUE		NY Spills, NY Hist Spills
NEW YORK	A100183511	1608-10 AMSTERDAM AVENUE H.D.F.C.	1608-10 AMSTERDAM AVENUE H.D.F	10031	AST
NEW YORK	A100183519	HIGHBRIDGE PARK PARTNERS LLC	2220 AMSTERDAM AVE. A/K/A	10032	AST
NEW YORK	S106698658	MANHOLE 58594	AMSTERDAM AVE/WEST 62ND S		NY Spills
NEW YORK	A100296299	CITY COLLEGE OF NEW YORK	CONVENT AVENUE AND 138TH STREE	10031	AST
NEW YORK	U001841935	CITY COLLEGE OF NEW YORK - CUNY	CONVENT AVE./138TH ST.(NAC.BOI	10031	HIST UST
NEW YORK	U004062304	CITY COLLEGE OF NEW YORK	CONVENT AVENUE AND 138TH STREE	10031	UST
NEW YORK	S106009241	405 EDGEcombe AVE	405 EDGEcombe AVENUE	10032	NY Spills
NEW YORK	S108650388	CONED	FREDERICK DOUGLASS BLVD / 11		NY MANIFEST
NEW YORK	1009226161	CONSOLIDATED EDISON	MH24816-W 152ND ST / AMSTERD	10031	NY MANIFEST
NEW YORK	1007371335	NYSDOT BRIDGE BIN 1077050	RAMP TO NB HARLEM RIVER DR	10039	RCRA-LQG, NY MANIFEST
NEW YORK	S103560209	146TH STREET/ROCKAWAY BLV	ROCKAWAY BLVD/146TH ST.		NY Spills, NY Hist Spills
NEW YORK	1009237944	CONSOLIDATED EDISON	VS0400-153RD ST/79TH AVE		NY MANIFEST
NEW YORK	1007207403	V5274	W143RD ST AND BRADHURST AVE	10031	RCRA-SQG, NY MANIFEST
NEW YORK	1007207402	V8233	W163RD ST AND AMSTERDAM AVE	10032	RCRA-SQG, NY MANIFEST
NEW YORK CITY	1007207162	TM2097	155TH STREET 40 W SAINT NICHOL	10032	RCRA-SQG, NY MANIFEST
NEW YORK CITY	1007206876	W 157TH STREET AND BROADWAY	W 157TH STREET AND BROADWAY	10032	RCRA-SQG, NY MANIFEST
NY	U003396182	CITY COLLEGE OF NY	160 CONVENT AVE (NAC BOILER N.	10031	AST, HIST AST
WHITESTONE	U004046986	GRACE INDUSTRIES INC	6-45 152ND STREET	10031	UST

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

To maintain currency of the following federal and state databases, EDR contacts the appropriate governmental agency on a monthly or quarterly basis, as required.

Number of Days to Update: Provides confirmation that EDR is reporting records that have been updated within 90 days from the date the government agency made the information available to the public.

FEDERAL RECORDS

NPL: National Priority List

National Priorities List (Superfund). The NPL is a subset of CERCLIS and identifies over 1,200 sites for priority cleanup under the Superfund Program. NPL sites may encompass relatively large areas. As such, EDR provides polygon coverage for over 1,000 NPL site boundaries produced by EPA's Environmental Photographic Interpretation Center (EPIC) and regional EPA offices.

Date of Government Version: 07/18/2007	Source: EPA
Date Data Arrived at EDR: 08/03/2007	Telephone: N/A
Date Made Active in Reports: 08/29/2007	Last EDR Contact: 07/31/2007
Number of Days to Update: 26	Next Scheduled EDR Contact: 10/29/2007
	Data Release Frequency: Quarterly

NPL Site Boundaries

Sources:

EPA's Environmental Photographic Interpretation Center (EPIC)
Telephone: 202-564-7333

EPA Region 1
Telephone 617-918-1143

EPA Region 6
Telephone: 214-655-6659

EPA Region 3
Telephone 215-814-5418

EPA Region 7
Telephone: 913-551-7247

EPA Region 4
Telephone 404-562-8033

EPA Region 8
Telephone: 303-312-6774

EPA Region 5
Telephone 312-886-6686

EPA Region 9
Telephone: 415-947-4246

EPA Region 10
Telephone 206-553-8665

Proposed NPL: Proposed National Priority List Sites

A site that has been proposed for listing on the National Priorities List through the issuance of a proposed rule in the Federal Register. EPA then accepts public comments on the site, responds to the comments, and places on the NPL those sites that continue to meet the requirements for listing.

Date of Government Version: 08/09/2007	Source: EPA
Date Data Arrived at EDR: 09/05/2007	Telephone: N/A
Date Made Active in Reports: 10/11/2007	Last EDR Contact: 08/31/2007
Number of Days to Update: 36	Next Scheduled EDR Contact: 10/29/2007
	Data Release Frequency: Quarterly

DELISTED NPL: National Priority List Deletions

The National Oil and Hazardous Substances Pollution Contingency Plan (NCP) establishes the criteria that the EPA uses to delete sites from the NPL. In accordance with 40 CFR 300.425.(e), sites may be deleted from the NPL where no further response is appropriate.

Date of Government Version: 08/27/2007	Source: EPA
Date Data Arrived at EDR: 08/29/2007	Telephone: N/A
Date Made Active in Reports: 10/11/2007	Last EDR Contact: 08/29/2007
Number of Days to Update: 43	Next Scheduled EDR Contact: 10/29/2007
	Data Release Frequency: Quarterly

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

NPL LIENS: Federal Superfund Liens

Federal Superfund Liens. Under the authority granted the USEPA by CERCLA of 1980, the USEPA has the authority to file liens against real property in order to recover remedial action expenditures or when the property owner received notification of potential liability. USEPA compiles a listing of filed notices of Superfund Liens.

Date of Government Version: 10/15/1991

Date Data Arrived at EDR: 02/02/1994

Date Made Active in Reports: 03/30/1994

Number of Days to Update: 56

Source: EPA

Telephone: 202-564-4267

Last EDR Contact: 08/20/2007

Next Scheduled EDR Contact: 11/19/2007

Data Release Frequency: No Update Planned

CERCLIS: Comprehensive Environmental Response, Compensation, and Liability Information System

CERCLIS contains data on potentially hazardous waste sites that have been reported to the USEPA by states, municipalities, private companies and private persons, pursuant to Section 103 of the Comprehensive Environmental Response, Compensation, and Liability Act (CERCLA). CERCLIS contains sites which are either proposed to or on the National Priorities List (NPL) and sites which are in the screening and assessment phase for possible inclusion on the NPL.

Date of Government Version: 04/23/2007

Date Data Arrived at EDR: 06/20/2007

Date Made Active in Reports: 08/29/2007

Number of Days to Update: 70

Source: EPA

Telephone: 703-412-9810

Last EDR Contact: 09/19/2007

Next Scheduled EDR Contact: 12/17/2007

Data Release Frequency: Quarterly

CERCLIS-NFRAP: CERCLIS No Further Remedial Action Planned

Archived sites are sites that have been removed and archived from the inventory of CERCLIS sites. Archived status indicates that, to the best of EPA's knowledge, assessment at a site has been completed and that EPA has determined no further steps will be taken to list this site on the National Priorities List (NPL), unless information indicates this decision was not appropriate or other considerations require a recommendation for listing at a later time. This decision does not necessarily mean that there is no hazard associated with a given site; it only means that, based upon available information, the location is not judged to be a potential NPL site.

Date of Government Version: 06/21/2007

Date Data Arrived at EDR: 07/23/2007

Date Made Active in Reports: 08/29/2007

Number of Days to Update: 37

Source: EPA

Telephone: 703-412-9810

Last EDR Contact: 09/17/2007

Next Scheduled EDR Contact: 12/17/2007

Data Release Frequency: Quarterly

CORRACTS: Corrective Action Report

CORRACTS identifies hazardous waste handlers with RCRA corrective action activity.

Date of Government Version: 06/26/2007

Date Data Arrived at EDR: 08/08/2007

Date Made Active in Reports: 08/29/2007

Number of Days to Update: 21

Source: EPA

Telephone: 800-424-9346

Last EDR Contact: 09/04/2007

Next Scheduled EDR Contact: 12/03/2007

Data Release Frequency: Quarterly

RCRA: Resource Conservation and Recovery Act Information

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

RCRAInfo is EPA's comprehensive information system, providing access to data supporting the Resource Conservation and Recovery Act (RCRA) of 1976 and the Hazardous and Solid Waste Amendments (HSWA) of 1984. RCRAInfo replaces the data recording and reporting abilities of the Resource Conservation and Recovery Information System (RCRIS). The database includes selective information on sites which generate, transport, store, treat and/or dispose of hazardous waste as defined by the Resource Conservation and Recovery Act (RCRA). Conditionally exempt small quantity generators (CESQGs) generate less than 100 kg of hazardous waste, or less than 1 kg of acutely hazardous waste per month. Small quantity generators (SQGs) generate between 100 kg and 1,000 kg of hazardous waste per month. Large quantity generators (LQGs) generate over 1,000 kilograms (kg) of hazardous waste, or over 1 kg of acutely hazardous waste per month. Transporters are individuals or entities that move hazardous waste from the generator off-site to a facility that can recycle, treat, store, or dispose of the waste. TSDFs treat, store, or dispose of the waste.

Date of Government Version: 06/13/2006	Source: EPA
Date Data Arrived at EDR: 06/28/2006	Telephone: (212) 637-3660
Date Made Active in Reports: 08/23/2006	Last EDR Contact: 10/16/2007
Number of Days to Update: 56	Next Scheduled EDR Contact: 01/14/2008
	Data Release Frequency: Quarterly

ERNS: Emergency Response Notification System

Emergency Response Notification System. ERNS records and stores information on reported releases of oil and hazardous substances.

Date of Government Version: 12/31/2006	Source: National Response Center, United States Coast Guard
Date Data Arrived at EDR: 01/24/2007	Telephone: 202-267-2180
Date Made Active in Reports: 03/12/2007	Last EDR Contact: 10/19/2007
Number of Days to Update: 47	Next Scheduled EDR Contact: 01/21/2008
	Data Release Frequency: Annually

HMIRS: Hazardous Materials Information Reporting System

Hazardous Materials Incident Report System. HMIRS contains hazardous material spill incidents reported to DOT.

Date of Government Version: 07/02/2007	Source: U.S. Department of Transportation
Date Data Arrived at EDR: 07/18/2007	Telephone: 202-366-4555
Date Made Active in Reports: 09/18/2007	Last EDR Contact: 10/16/2007
Number of Days to Update: 62	Next Scheduled EDR Contact: 01/14/2008
	Data Release Frequency: Annually

US ENG CONTROLS: Engineering Controls Sites List

A listing of sites with engineering controls in place. Engineering controls include various forms of caps, building foundations, liners, and treatment methods to create pathway elimination for regulated substances to enter environmental media or effect human health.

Date of Government Version: 07/16/2007	Source: Environmental Protection Agency
Date Data Arrived at EDR: 08/03/2007	Telephone: 703-603-8905
Date Made Active in Reports: 10/11/2007	Last EDR Contact: 10/01/2007
Number of Days to Update: 69	Next Scheduled EDR Contact: 12/31/2007
	Data Release Frequency: Varies

US INST CONTROL: Sites with Institutional Controls

A listing of sites with institutional controls in place. Institutional controls include administrative measures, such as groundwater use restrictions, construction restrictions, property use restrictions, and post remediation care requirements intended to prevent exposure to contaminants remaining on site. Deed restrictions are generally required as part of the institutional controls.

Date of Government Version: 07/16/2007	Source: Environmental Protection Agency
Date Data Arrived at EDR: 08/03/2007	Telephone: 703-603-8905
Date Made Active in Reports: 10/11/2007	Last EDR Contact: 10/01/2007
Number of Days to Update: 69	Next Scheduled EDR Contact: 12/31/2007
	Data Release Frequency: Varies

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

DOD: Department of Defense Sites

This data set consists of federally owned or administered lands, administered by the Department of Defense, that have any area equal to or greater than 640 acres of the United States, Puerto Rico, and the U.S. Virgin Islands.

Date of Government Version: 12/31/2005	Source: USGS
Date Data Arrived at EDR: 11/10/2006	Telephone: 703-692-8801
Date Made Active in Reports: 01/11/2007	Last EDR Contact: 11/09/2007
Number of Days to Update: 62	Next Scheduled EDR Contact: 02/04/2008
	Data Release Frequency: Semi-Annually

FUDS: Formerly Used Defense Sites

The listing includes locations of Formerly Used Defense Sites properties where the US Army Corps of Engineers is actively working or will take necessary cleanup actions.

Date of Government Version: 12/31/2006	Source: U.S. Army Corps of Engineers
Date Data Arrived at EDR: 08/31/2007	Telephone: 202-528-4285
Date Made Active in Reports: 10/11/2007	Last EDR Contact: 10/01/2007
Number of Days to Update: 41	Next Scheduled EDR Contact: 12/31/2007
	Data Release Frequency: Varies

US BROWNFIELDS: A Listing of Brownfields Sites

Included in the listing are brownfields properties addresses by Cooperative Agreement Recipients and brownfields properties addressed by Targeted Brownfields Assessments. Targeted Brownfields Assessments-EPA's Targeted Brownfields Assessments (TBA) program is designed to help states, tribes, and municipalities--especially those without EPA Brownfields Assessment Demonstration Pilots--minimize the uncertainties of contamination often associated with brownfields. Under the TBA program, EPA provides funding and/or technical assistance for environmental assessments at brownfields sites throughout the country. Targeted Brownfields Assessments supplement and work with other efforts under EPA's Brownfields Initiative to promote cleanup and redevelopment of brownfields. Cooperative Agreement Recipients-States, political subdivisions, territories, and Indian tribes become Brownfields Cleanup Revolving Loan Fund (BCRLF) cooperative agreement recipients when they enter into BCRLF cooperative agreements with the U.S. EPA. EPA selects BCRLF cooperative agreement recipients based on a proposal and application process. BCRLF cooperative agreement recipients must use EPA funds provided through BCRLF cooperative agreement for specified brownfields-related cleanup activities.

Date of Government Version: 06/20/2007	Source: Environmental Protection Agency
Date Data Arrived at EDR: 07/09/2007	Telephone: 202-566-2777
Date Made Active in Reports: 08/29/2007	Last EDR Contact: 09/10/2007
Number of Days to Update: 51	Next Scheduled EDR Contact: 12/10/2007
	Data Release Frequency: Semi-Annually

CONSENT: Superfund (CERCLA) Consent Decrees

Major legal settlements that establish responsibility and standards for cleanup at NPL (Superfund) sites. Released periodically by United States District Courts after settlement by parties to litigation matters.

Date of Government Version: 04/13/2007	Source: Department of Justice, Consent Decree Library
Date Data Arrived at EDR: 07/16/2007	Telephone: Varies
Date Made Active in Reports: 08/29/2007	Last EDR Contact: 09/21/2007
Number of Days to Update: 44	Next Scheduled EDR Contact: 01/21/2008
	Data Release Frequency: Varies

ROD: Records Of Decision

Record of Decision. ROD documents mandate a permanent remedy at an NPL (Superfund) site containing technical and health information to aid in the cleanup.

Date of Government Version: 06/08/2007	Source: EPA
Date Data Arrived at EDR: 07/03/2007	Telephone: 703-416-0223
Date Made Active in Reports: 08/29/2007	Last EDR Contact: 11/08/2007
Number of Days to Update: 57	Next Scheduled EDR Contact: 12/31/2007
	Data Release Frequency: Annually

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

UMTRA: Uranium Mill Tailings Sites

Uranium ore was mined by private companies for federal government use in national defense programs. When the mills shut down, large piles of the sand-like material (mill tailings) remain after uranium has been extracted from the ore. Levels of human exposure to radioactive materials from the piles are low; however, in some cases tailings were used as construction materials before the potential health hazards of the tailings were recognized.

Date of Government Version: 12/31/2005	Source: Department of Energy
Date Data Arrived at EDR: 11/08/2006	Telephone: 505-845-0011
Date Made Active in Reports: 01/29/2007	Last EDR Contact: 09/19/2007
Number of Days to Update: 82	Next Scheduled EDR Contact: 12/17/2007
	Data Release Frequency: Varies

ODI: Open Dump Inventory

An open dump is defined as a disposal facility that does not comply with one or more of the Part 257 or Part 258 Subtitle D Criteria.

Date of Government Version: 06/30/1985	Source: Environmental Protection Agency
Date Data Arrived at EDR: 08/09/2004	Telephone: 800-424-9346
Date Made Active in Reports: 09/17/2004	Last EDR Contact: 06/09/2004
Number of Days to Update: 39	Next Scheduled EDR Contact: N/A
	Data Release Frequency: No Update Planned

TRIS: Toxic Chemical Release Inventory System

Toxic Release Inventory System. TRIS identifies facilities which release toxic chemicals to the air, water and land in reportable quantities under SARA Title III Section 313.

Date of Government Version: 12/31/2005	Source: EPA
Date Data Arrived at EDR: 04/27/2007	Telephone: 202-566-0250
Date Made Active in Reports: 07/05/2007	Last EDR Contact: 09/18/2007
Number of Days to Update: 69	Next Scheduled EDR Contact: 12/17/2007
	Data Release Frequency: Annually

TSCA: Toxic Substances Control Act

Toxic Substances Control Act. TSCA identifies manufacturers and importers of chemical substances included on the TSCA Chemical Substance Inventory list. It includes data on the production volume of these substances by plant site.

Date of Government Version: 12/31/2002	Source: EPA
Date Data Arrived at EDR: 04/14/2006	Telephone: 202-260-5521
Date Made Active in Reports: 05/30/2006	Last EDR Contact: 10/30/2007
Number of Days to Update: 46	Next Scheduled EDR Contact: 01/14/2008
	Data Release Frequency: Every 4 Years

FTTS: FIFRA/ TSCA Tracking System - FIFRA (Federal Insecticide, Fungicide, & Rodenticide Act)/TSCA (Toxic Substances Control Act)

FTTS tracks administrative cases and pesticide enforcement actions and compliance activities related to FIFRA, TSCA and EPCRA (Emergency Planning and Community Right-to-Know Act). To maintain currency, EDR contacts the Agency on a quarterly basis.

Date of Government Version: 07/06/2007	Source: EPA/Office of Prevention, Pesticides and Toxic Substances
Date Data Arrived at EDR: 07/20/2007	Telephone: 202-566-1667
Date Made Active in Reports: 09/18/2007	Last EDR Contact: 09/17/2007
Number of Days to Update: 60	Next Scheduled EDR Contact: 12/17/2007
	Data Release Frequency: Quarterly

FTTS INSP: FIFRA/ TSCA Tracking System - FIFRA (Federal Insecticide, Fungicide, & Rodenticide Act)/TSCA (Toxic Substances Control Act) A listing of FIFRA/TSCA Tracking System (FTTS) inspections and enforcements.

Date of Government Version: 07/06/2007	Source: EPA
Date Data Arrived at EDR: 07/20/2007	Telephone: 202-566-1667
Date Made Active in Reports: 09/18/2007	Last EDR Contact: 09/17/2007
Number of Days to Update: 60	Next Scheduled EDR Contact: 12/17/2007
	Data Release Frequency: Quarterly

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

SSTS: Section 7 Tracking Systems

Section 7 of the Federal Insecticide, Fungicide and Rodenticide Act, as amended (92 Stat. 829) requires all registered pesticide-producing establishments to submit a report to the Environmental Protection Agency by March 1st each year. Each establishment must report the types and amounts of pesticides, active ingredients and devices being produced, and those having been produced and sold or distributed in the past year.

Date of Government Version: 12/31/2005	Source: EPA
Date Data Arrived at EDR: 03/13/2007	Telephone: 202-564-4203
Date Made Active in Reports: 04/27/2007	Last EDR Contact: 10/15/2007
Number of Days to Update: 45	Next Scheduled EDR Contact: 01/14/2008
	Data Release Frequency: Annually

LUCIS: Land Use Control Information System

LUCIS contains records of land use control information pertaining to the former Navy Base Realignment and Closure properties.

Date of Government Version: 12/09/2005	Source: Department of the Navy
Date Data Arrived at EDR: 12/11/2006	Telephone: 843-820-7326
Date Made Active in Reports: 01/11/2007	Last EDR Contact: 09/12/2007
Number of Days to Update: 31	Next Scheduled EDR Contact: 12/10/2007
	Data Release Frequency: Varies

DOT OPS: Incident and Accident Data

Department of Transportation, Office of Pipeline Safety Incident and Accident data.

Date of Government Version: 08/14/2007	Source: Department of Transportation, Office of Pipeline Safety
Date Data Arrived at EDR: 08/29/2007	Telephone: 202-366-4595
Date Made Active in Reports: 10/11/2007	Last EDR Contact: 08/29/2007
Number of Days to Update: 43	Next Scheduled EDR Contact: 11/26/2007
	Data Release Frequency: Varies

ICIS: Integrated Compliance Information System

The Integrated Compliance Information System (ICIS) supports the information needs of the national enforcement and compliance program as well as the unique needs of the National Pollutant Discharge Elimination System (NPDES) program.

Date of Government Version: 07/27/2007	Source: Environmental Protection Agency
Date Data Arrived at EDR: 08/13/2007	Telephone: 202-564-5088
Date Made Active in Reports: 10/11/2007	Last EDR Contact: 10/15/2007
Number of Days to Update: 59	Next Scheduled EDR Contact: 01/14/2008
	Data Release Frequency: Quarterly

DEBRIS REGION 9: Torres Martinez Reservation Illegal Dump Site Locations

A listing of illegal dump sites location on the Torres Martinez Indian Reservation located in eastern Riverside County and northern Imperial County, California.

Date of Government Version: 07/25/2007	Source: EPA, Region 9
Date Data Arrived at EDR: 07/31/2007	Telephone: 415-972-3336
Date Made Active in Reports: 10/11/2007	Last EDR Contact: 09/24/2007
Number of Days to Update: 72	Next Scheduled EDR Contact: 12/24/2007
	Data Release Frequency: Varies

HIST FTTS: FIFRA/TSCA Tracking System Administrative Case Listing

A complete administrative case listing from the FIFRA/TSCA Tracking System (FTTS) for all ten EPA regions. The information was obtained from the National Compliance Database (NCDB). NCDB supports the implementation of FIFRA (Federal Insecticide, Fungicide, and Rodenticide Act) and TSCA (Toxic Substances Control Act). Some EPA regions are now closing out records. Because of that, and the fact that some EPA regions are not providing EPA Headquarters with updated records, it was decided to create a HIST FTTS database. It included records that may not be included in the newer FTTS database updates. This database is no longer updated.

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

Date of Government Version: 10/19/2006
Date Data Arrived at EDR: 03/01/2007
Date Made Active in Reports: 04/10/2007
Number of Days to Update: 40

Source: Environmental Protection Agency
Telephone: 202-564-2501
Last EDR Contact: 09/17/2007
Next Scheduled EDR Contact: 12/17/2007
Data Release Frequency: No Update Planned

CDL: Clandestine Drug Labs

A listing of clandestine drug lab locations. The U.S. Department of Justice ("the Department") provides this web site as a public service. It contains addresses of some locations where law enforcement agencies reported they found chemicals or other items that indicated the presence of either clandestine drug laboratories or dumpsites. In most cases, the source of the entries is not the Department, and the Department has not verified the entry and does not guarantee its accuracy. Members of the public must verify the accuracy of all entries by, for example, contacting local law enforcement and local health departments.

Date of Government Version: 12/01/2006
Date Data Arrived at EDR: 01/08/2007
Date Made Active in Reports: 01/11/2007
Number of Days to Update: 3

Source: Drug Enforcement Administration
Telephone: 202-307-1000
Last EDR Contact: 10/02/2007
Next Scheduled EDR Contact: 12/24/2007
Data Release Frequency: Quarterly

RADINFO: Radiation Information Database

The Radiation Information Database (RADINFO) contains information about facilities that are regulated by U.S. Environmental Protection Agency (EPA) regulations for radiation and radioactivity.

Date of Government Version: 07/31/2007
Date Data Arrived at EDR: 08/01/2007
Date Made Active in Reports: 08/29/2007
Number of Days to Update: 28

Source: Environmental Protection Agency
Telephone: 202-343-9775
Last EDR Contact: 10/31/2007
Next Scheduled EDR Contact: 01/28/2008
Data Release Frequency: Quarterly

LIENS 2: CERCLA Lien Information

A Federal CERCLA ('Superfund') lien can exist by operation of law at any site or property at which EPA has spent Superfund monies. These monies are spent to investigate and address releases and threatened releases of contamination. CERCLIS provides information as to the identity of these sites and properties.

Date of Government Version: 03/08/2007
Date Data Arrived at EDR: 04/12/2007
Date Made Active in Reports: 05/14/2007
Number of Days to Update: 32

Source: Environmental Protection Agency
Telephone: 202-564-6023
Last EDR Contact: 08/20/2007
Next Scheduled EDR Contact: 11/19/2007
Data Release Frequency: Varies

PADS: PCB Activity Database System

PCB Activity Database. PADS Identifies generators, transporters, commercial storers and/or brokers and disposers of PCB's who are required to notify the EPA of such activities.

Date of Government Version: 04/12/2007
Date Data Arrived at EDR: 06/08/2007
Date Made Active in Reports: 08/29/2007
Number of Days to Update: 82

Source: EPA
Telephone: 202-566-0500
Last EDR Contact: 08/09/2007
Next Scheduled EDR Contact: 11/05/2007
Data Release Frequency: Annually

MLTS: Material Licensing Tracking System

MLTS is maintained by the Nuclear Regulatory Commission and contains a list of approximately 8,100 sites which possess or use radioactive materials and which are subject to NRC licensing requirements. To maintain currency, EDR contacts the Agency on a quarterly basis.

Date of Government Version: 07/09/2007
Date Data Arrived at EDR: 07/24/2007
Date Made Active in Reports: 09/18/2007
Number of Days to Update: 56

Source: Nuclear Regulatory Commission
Telephone: 301-415-7169
Last EDR Contact: 10/01/2007
Next Scheduled EDR Contact: 12/31/2007
Data Release Frequency: Quarterly

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

MINES: Mines Master Index File

Contains all mine identification numbers issued for mines active or opened since 1971. The data also includes violation information.

Date of Government Version: 05/09/2007
Date Data Arrived at EDR: 06/28/2007
Date Made Active in Reports: 08/29/2007
Number of Days to Update: 62

Source: Department of Labor, Mine Safety and Health Administration
Telephone: 303-231-5959
Last EDR Contact: 09/26/2007
Next Scheduled EDR Contact: 12/24/2007
Data Release Frequency: Semi-Annually

FINDS: Facility Index System/Facility Registry System

Facility Index System. FINDS contains both facility information and 'pointers' to other sources that contain more detail. EDR includes the following FINDS databases in this report: PCS (Permit Compliance System), AIRS (Aerometric Information Retrieval System), DOCKET (Enforcement Docket used to manage and track information on civil judicial enforcement cases for all environmental statutes), FURS (Federal Underground Injection Control), C-DOCKET (Criminal Docket System used to track criminal enforcement actions for all environmental statutes), FFIS (Federal Facilities Information System), STATE (State Environmental Laws and Statutes), and PADS (PCB Activity Data System).

Date of Government Version: 07/19/2007
Date Data Arrived at EDR: 07/25/2007
Date Made Active in Reports: 09/18/2007
Number of Days to Update: 55

Source: EPA
Telephone: (212) 637-3000
Last EDR Contact: 10/01/2007
Next Scheduled EDR Contact: 12/31/2007
Data Release Frequency: Quarterly

RAATS: RCRA Administrative Action Tracking System

RCRA Administration Action Tracking System. RAATS contains records based on enforcement actions issued under RCRA pertaining to major violators and includes administrative and civil actions brought by the EPA. For administration actions after September 30, 1995, data entry in the RAATS database was discontinued. EPA will retain a copy of the database for historical records. It was necessary to terminate RAATS because a decrease in agency resources made it impossible to continue to update the information contained in the database.

Date of Government Version: 04/17/1995
Date Data Arrived at EDR: 07/03/1995
Date Made Active in Reports: 08/07/1995
Number of Days to Update: 35

Source: EPA
Telephone: 202-564-4104
Last EDR Contact: 08/31/2007
Next Scheduled EDR Contact: 12/03/2007
Data Release Frequency: No Update Planned

BRS: Biennial Reporting System

The Biennial Reporting System is a national system administered by the EPA that collects data on the generation and management of hazardous waste. BRS captures detailed data from two groups: Large Quantity Generators (LQG) and Treatment, Storage, and Disposal Facilities.

Date of Government Version: 12/31/2005
Date Data Arrived at EDR: 03/06/2007
Date Made Active in Reports: 04/13/2007
Number of Days to Update: 38

Source: EPA/NTIS
Telephone: 800-424-9346
Last EDR Contact: 09/12/2007
Next Scheduled EDR Contact: 12/10/2007
Data Release Frequency: Biennially

USGS WATER WELLS: National Water Information System (NWIS)

This database consists of well records in the United States. Available site descriptive information includes well location information (latitude and longitude, well depth, site use, water use, and aquifer).

Date of Government Version: 03/25/2005
Date Data Arrived at EDR: 03/25/2005
Date Made Active in Reports: N/A
Number of Days to Update: 0

Source: USGS
Telephone: N/A
Last EDR Contact: 03/25/2005
Next Scheduled EDR Contact: N/A
Data Release Frequency: N/A

PWS: Public Water System Data

This Safe Drinking Water Information System (SDWIS) file contains public water systems name and address, population served and the primary source of water

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

Date of Government Version: 02/24/2000
Date Data Arrived at EDR: 04/27/2005
Date Made Active in Reports: N/A
Number of Days to Update: 0

Source: EPA
Telephone: N/A
Last EDR Contact: 08/20/2007
Next Scheduled EDR Contact: 11/19/2007
Data Release Frequency: N/A

STATE AND LOCAL RECORDS

HSWDS: Hazardous Substance Waste Disposal Site Inventory

The list includes any known or suspected hazardous substance waste disposal sites. Also included are sites delisted from the Registry of Inactive Hazardous Waste Disposal Sites and non-Registry sites that U.S. EPA Preliminary Assessment (PA) reports or Site Investigation (SI) reports were prepared. Hazardous Substance Waste Disposal Sites are eligible to be Superfund sites now that the New York State Superfund has been refinanced and changed. This means that the study inventory has served its purpose and will no longer be maintained as a separate entity. The last version of the study inventory is frozen in time. The sites on the study will not automatically be made Superfund sites, rather each site will be further evaluated for listing on the Registry. So overtime they will be added to the registry or not.

Date of Government Version: 01/01/2003
Date Data Arrived at EDR: 10/20/2006
Date Made Active in Reports: 11/30/2006
Number of Days to Update: 41

Source: Department of Environmental Conservation
Telephone: 518-402-9564
Last EDR Contact: 08/27/2007
Next Scheduled EDR Contact: 11/26/2007
Data Release Frequency: No Update Planned

SHWS: Inactive Hazardous Waste Disposal Sites in New York State

Referred to as the State Superfund Program, the Inactive Hazardous Waste Disposal Site Remedial Program is the cleanup program for inactive hazardous waste sites and now includes hazardous substance sites

Date of Government Version: 08/15/2007
Date Data Arrived at EDR: 09/12/2007
Date Made Active in Reports: 10/17/2007
Number of Days to Update: 35

Source: Department of Environmental Conservation
Telephone: 518-402-9622
Last EDR Contact: 09/12/2007
Next Scheduled EDR Contact: 12/10/2007
Data Release Frequency: Annually

DEL SHWS: Delisted Registry Sites

A database listing of sites delisted from the Registry of Inactive Hazardous Waste Disposal Sites.

Date of Government Version: 05/01/2007
Date Data Arrived at EDR: 06/13/2007
Date Made Active in Reports: 07/24/2007
Number of Days to Update: 41

Source: Department of Environmental Conservation
Telephone: 518-402-9622
Last EDR Contact: 09/12/2007
Next Scheduled EDR Contact: 12/10/2007
Data Release Frequency: Annually

SWF/LF: Facility Register

Solid Waste Facilities/Landfill Sites. SWF/LF type records typically contain an inventory of solid waste disposal facilities or landfills in a particular state. Depending on the state, these may be active or inactive facilities or open dumps that failed to meet RCRA Subtitle D Section 4004 criteria for solid waste landfills or disposal sites.

Date of Government Version: 07/31/2007
Date Data Arrived at EDR: 08/01/2007
Date Made Active in Reports: 09/21/2007
Number of Days to Update: 51

Source: Department of Environmental Conservation
Telephone: 518-457-2051
Last EDR Contact: 10/26/2007
Next Scheduled EDR Contact: 01/28/2008
Data Release Frequency: Semi-Annually

SWTIRE: Registered Waste Tire Storage & Facility List

A listing of facilities registered to accept waste tires.

Date of Government Version: 08/01/2006
Date Data Arrived at EDR: 11/15/2006
Date Made Active in Reports: 11/30/2006
Number of Days to Update: 15

Source: Department of Environmental Conservation
Telephone: 518-402-8694
Last EDR Contact: 08/15/2007
Next Scheduled EDR Contact: 11/12/2007
Data Release Frequency: Annually

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

SWRCY: Registered Recycling Facility List

A listing of recycling facilities.

Date of Government Version: 07/31/2007
Date Data Arrived at EDR: 08/01/2007
Date Made Active in Reports: 09/21/2007
Number of Days to Update: 51

Source: Department of Environmental Conservation
Telephone: 518-402-8705
Last EDR Contact: 10/26/2007
Next Scheduled EDR Contact: 01/28/2008
Data Release Frequency: Semi-Annually

LTANKS: Spills Information Database

Leaking Storage Tank Incident Reports. These records contain an inventory of reported leaking storage tank incidents reported from 4/1/86 through the most recent update. They can be either leaking underground storage tanks or leaking aboveground storage tanks. The causes of the incidents are tank test failures, tank failures or tank overfills.

Date of Government Version: 07/11/2007
Date Data Arrived at EDR: 07/25/2007
Date Made Active in Reports: 09/21/2007
Number of Days to Update: 58

Source: Department of Environmental Conservation
Telephone: 518-402-9549
Last EDR Contact: 10/24/2007
Next Scheduled EDR Contact: 01/21/2008
Data Release Frequency: Varies

HIST LTANKS: Listing of Leaking Storage Tanks

A listing of leaking underground and aboveground storage tanks. The causes of the incidents are tank test failures, tank failures or tank overfills. In 2002, the Department of Environmental Conservation stopped providing updates to its original Spills Information Database. This database includes fields that are no longer available from the NYDEC as of January 1, 2002. Current information may be found in the NY LTANKS database. Department of Environmental Conservation.

Date of Government Version: 01/01/2002
Date Data Arrived at EDR: 07/08/2005
Date Made Active in Reports: 07/14/2005
Number of Days to Update: 6

Source: Department of Environmental Conservation
Telephone: 518-402-9549
Last EDR Contact: 07/07/2005
Next Scheduled EDR Contact: N/A
Data Release Frequency: No Update Planned

UST: Petroleum Bulk Storage (PBS) Database

Facilities that have petroleum storage capacities in excess of 1,100 gallons and less than 400,000 gallons.

Date of Government Version: 07/11/2007
Date Data Arrived at EDR: 07/25/2007
Date Made Active in Reports: 08/31/2007
Number of Days to Update: 37

Source: Department of Environmental Conservation
Telephone: 518-402-9549
Last EDR Contact: 10/24/2007
Next Scheduled EDR Contact: 01/21/2008
Data Release Frequency: No Update Planned

CBS UST: Chemical Bulk Storage Database

Facilities that store regulated hazardous substances in underground tanks of any size

Date of Government Version: 01/01/2002
Date Data Arrived at EDR: 02/20/2002
Date Made Active in Reports: 03/22/2002
Number of Days to Update: 30

Source: NYSDEC
Telephone: 518-402-9549
Last EDR Contact: 10/24/2005
Next Scheduled EDR Contact: 01/23/2006
Data Release Frequency: No Update Planned

MOSF UST: Major Oil Storage Facilities Database

Facilities that may be onshore facilities or vessels, with petroleum storage capacities of 400,000 gallons or greater.

Date of Government Version: 01/01/2002
Date Data Arrived at EDR: 02/20/2002
Date Made Active in Reports: 03/22/2002
Number of Days to Update: 30

Source: NYSDEC
Telephone: 518-402-9549
Last EDR Contact: 07/25/2005
Next Scheduled EDR Contact: 10/24/2005
Data Release Frequency: Varies

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

HIST UST: Historical Petroleum Bulk Storage Database

These facilities have petroleum storage capacities in excess of 1,100 gallons and less than 400,000 gallons. This database contains detailed information per site. It is no longer updated due to the sensitive nature of the information involved. See UST for more current data.

Date of Government Version: 01/01/2002
Date Data Arrived at EDR: 06/02/2006
Date Made Active in Reports: 07/20/2006
Number of Days to Update: 48

Source: Department of Environmental Conservation
Telephone: 518-402-9549
Last EDR Contact: 10/23/2006
Next Scheduled EDR Contact: 01/22/2007
Data Release Frequency: Varies

AST: Petroleum Bulk Storage

Registered Aboveground Storage Tanks.

Date of Government Version: 07/11/2007
Date Data Arrived at EDR: 07/25/2007
Date Made Active in Reports: 08/30/2007
Number of Days to Update: 36

Source: Department of Environmental Conservation
Telephone: 518-402-9549
Last EDR Contact: 10/24/2007
Next Scheduled EDR Contact: 01/21/2008
Data Release Frequency: No Update Planned

HIST AST: Historical Petroleum Bulk Storage Database

These facilities have petroleum storage capabilities in excess of 1,100 gallons and less than 400,000 gallons. This database contains detailed information per site. No longer updated due to the sensitive nature of the information involved. See AST for more current data.

Date of Government Version: 01/01/2002
Date Data Arrived at EDR: 06/02/2006
Date Made Active in Reports: 07/20/2006
Number of Days to Update: 48

Source: Department of Environmental Conservation
Telephone: 518-402-9549
Last EDR Contact: 10/23/2006
Next Scheduled EDR Contact: 01/22/2007
Data Release Frequency: No Update Planned

CBS AST: Chemical Bulk Storage Database

Facilities that store regulated hazardous substances in aboveground tanks with capacities of 185 gallons or greater, and/or in underground tanks of any size.

Date of Government Version: 01/01/2002
Date Data Arrived at EDR: 02/20/2002
Date Made Active in Reports: 03/22/2002
Number of Days to Update: 30

Source: NYSDEC
Telephone: 518-402-9549
Last EDR Contact: 07/25/2005
Next Scheduled EDR Contact: 10/24/2005
Data Release Frequency: No Update Planned

MOSF AST: Major Oil Storage Facilities Database

Facilities that may be onshore facilities or vessels, with petroleum storage capacities of 400,000 gallons or greater.

Date of Government Version: 01/01/2002
Date Data Arrived at EDR: 02/20/2002
Date Made Active in Reports: 03/22/2002
Number of Days to Update: 30

Source: NYSDEC
Telephone: 518-402-9549
Last EDR Contact: 07/25/2005
Next Scheduled EDR Contact: 10/24/2005
Data Release Frequency: No Update Planned

NY MANIFEST: Facility and Manifest Data

Manifest is a document that lists and tracks hazardous waste from the generator through transporters to a TSD facility.

Date of Government Version: 08/27/2007
Date Data Arrived at EDR: 08/30/2007
Date Made Active in Reports: 09/21/2007
Number of Days to Update: 22

Source: Department of Environmental Conservation
Telephone: 518-402-8651
Last EDR Contact: 08/30/2007
Next Scheduled EDR Contact: 11/26/2007
Data Release Frequency: Annually

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

SPILLS: Spills Information Database

Data collected on spills reported to NYSDEC as required by one or more of the following: Article 12 of the Navigation Law, 6 NYCRR Section 613.8 (from PBS regs), or 6 NYCRR Section 595.2 (from CBS regs). It includes spills active as of April 1, 1986, as well as spills occurring since this date.

Date of Government Version: 07/11/2007

Date Data Arrived at EDR: 07/25/2007

Date Made Active in Reports: 09/21/2007

Number of Days to Update: 58

Source: Department of Environmental Conservation

Telephone: 518-402-9549

Last EDR Contact: 10/24/2007

Next Scheduled EDR Contact: 01/21/2008

Data Release Frequency: Varies

HIST SPILLS: SPILLS Database

This database contains records of chemical and petroleum spill incidents. Under State law, petroleum and hazardous chemical spills that can impact the waters of the state must be reported by the spiller (and, in some cases, by anyone who has knowledge of the spills). In 2002, the Department of Environmental Conservation stopped providing updates to its original Spills Information Database. This database includes fields that are no longer available from the NYDEC as of January 1, 2002. Current information may be found in the NY SPILLS database. Department of Environmental Conservation.

Date of Government Version: 01/01/2002

Date Data Arrived at EDR: 07/08/2005

Date Made Active in Reports: 07/14/2005

Number of Days to Update: 6

Source: Department of Environmental Conservation

Telephone: 518-402-9549

Last EDR Contact: 07/07/2005

Next Scheduled EDR Contact: N/A

Data Release Frequency: No Update Planned

ENG CONTROLS: Registry of Engineering Controls

Environmental Remediation sites that have engineering controls in place.

Date of Government Version: 08/15/2007

Date Data Arrived at EDR: 09/12/2007

Date Made Active in Reports: 10/17/2007

Number of Days to Update: 35

Source: Department of Environmental Conservation

Telephone: 518-402-9553

Last EDR Contact: 09/12/2007

Next Scheduled EDR Contact: 12/10/2007

Data Release Frequency: Quarterly

INST CONTROL: Registry of Institutional Controls

Environmental Remediation sites that have institutional controls in place.

Date of Government Version: 08/15/2007

Date Data Arrived at EDR: 09/12/2007

Date Made Active in Reports: 10/17/2007

Number of Days to Update: 35

Source: Department of Environmental Conservation

Telephone: 518-402-9553

Last EDR Contact: 09/12/2007

Next Scheduled EDR Contact: 12/10/2007

Data Release Frequency: Quarterly

VCP: Voluntary Cleanup Agreements

New York established its Voluntary Cleanup Program (VCP) to address the environmental, legal and financial barriers that often hinder the redevelopment and reuse of contaminated properties. The Voluntary Cleanup Program was developed to enhance private sector cleanup of brownfields by enabling parties to remediate sites using private rather than public funds and to reduce the development pressures on "greenfield" sites.

Date of Government Version: 08/15/2007

Date Data Arrived at EDR: 09/12/2007

Date Made Active in Reports: 10/17/2007

Number of Days to Update: 35

Source: Department of Environmental Conservation

Telephone: 518-402-9711

Last EDR Contact: 09/12/2007

Next Scheduled EDR Contact: 12/10/2007

Data Release Frequency: Semi-Annually

DRYCLEANERS: Registered Drycleaners

A listing of all registered drycleaning facilities.

Date of Government Version: 06/15/2004

Date Data Arrived at EDR: 06/15/2004

Date Made Active in Reports: 07/29/2004

Number of Days to Update: 44

Source: Department of Environmental Conservation

Telephone: 518-402-8403

Last EDR Contact: 05/21/2004

Next Scheduled EDR Contact: N/A

Data Release Frequency: Varies

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

BROWNFIELDS: Brownfields Site List

A Brownfield is any real property where redevelopment or re-use may be complicated by the presence or potential presence of a hazardous waste, petroleum, pollutant, or contaminant.

Date of Government Version: 08/15/2007
Date Data Arrived at EDR: 09/12/2007
Date Made Active in Reports: 10/17/2007
Number of Days to Update: 35

Source: Department of Environmental Conservation
Telephone: 518-402-9764
Last EDR Contact: 09/12/2007
Next Scheduled EDR Contact: 12/10/2007
Data Release Frequency: Semi-Annually

SPDES: State Pollutant Discharge Elimination System

New York State has a state program which has been approved by the United States Environmental Protection Agency for the control of wastewater and stormwater discharges in accordance with the Clean Water Act. Under New York State law the program is known as the State Pollutant Discharge Elimination System (SPDES) and is broader in scope than that required by the Clean Water Act in that it controls point source discharges to groundwaters as well as surface waters.

Date of Government Version: 08/06/2007
Date Data Arrived at EDR: 08/07/2007
Date Made Active in Reports: 09/21/2007
Number of Days to Update: 45

Source: Department of Environmental Conservation
Telephone: 518-402-8233
Last EDR Contact: 11/05/2007
Next Scheduled EDR Contact: 02/04/2008
Data Release Frequency: No Update Planned

AIRS: Air Emissions Data

Point source emissions inventory data.

Date of Government Version: 12/31/2005
Date Data Arrived at EDR: 09/05/2007
Date Made Active in Reports: 10/17/2007
Number of Days to Update: 42

Source: Department of Environmental Conservation
Telephone: 518-402-8452
Last EDR Contact: 08/21/2007
Next Scheduled EDR Contact: 11/19/2007
Data Release Frequency: Annually

E DESIGNATION: E DESIGNATION SITE LISTING

The (E (Environmental)) designation would ensure that sampling and remediation take place on the subject properties, and would avoid any significant impacts related to hazardous materials at these locations. The (E) designations would require that the fee owner of the sites conduct a testing and sampling protocol, and remediation where appropriate, to the satisfaction of the NYCDEP before the issuance of a building permit by the Department of Buildings pursuant to the provisions of Section 11-15 of the Zoning Resolution (Environmental Requirements). The (E) designations also include a mandatory construction-related health and safety plan which must be approved by NYCDEP.

Date of Government Version: 03/28/2007
Date Data Arrived at EDR: 08/27/2007
Date Made Active in Reports: 09/21/2007
Number of Days to Update: 25

Source: New York City Department of City Planning
Telephone: 718-595-6658
Last EDR Contact: 10/16/2007
Next Scheduled EDR Contact: 01/14/2008
Data Release Frequency: Varies

MOSF: Major Oil Storage Facility Site Listing

These facilities may be onshore facilities or vessels, with petroleum storage capacities of 400,000 gallons or greater.

Date of Government Version: 07/11/2007
Date Data Arrived at EDR: 07/25/2007
Date Made Active in Reports: 09/21/2007
Number of Days to Update: 58

Source: Department of Environmental Conservation
Telephone: 518-402-9549
Last EDR Contact: 10/24/2007
Next Scheduled EDR Contact: 01/21/2008
Data Release Frequency: Quarterly

RES DECL: Restrictive Declarations Listing

A restrictive declaration is a covenant running with the land which binds the present and future owners of the property. As a condition of certain special permits, the City Planning Commission may require an applicant to sign and record a restrictive declaration that places specified conditions on the future use and development of the property. Certain restrictive declarations are indicated by a D on zoning maps.

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

Date of Government Version: 12/31/1992
Date Data Arrived at EDR: 01/31/2007
Date Made Active in Reports: 04/19/2007
Number of Days to Update: 78

Source: NYC Department of City Planning
Telephone: 212-720-3401
Last EDR Contact: 07/17/2007
Next Scheduled EDR Contact: 10/15/2007
Data Release Frequency: No Update Planned

CBS: Chemical Bulk Storage Site Listing

These facilities store regulated hazardous substances in aboveground tanks with capacities of 185 gallons or greater, and/or in underground tanks of any size

Date of Government Version: 07/11/2007
Date Data Arrived at EDR: 07/25/2007
Date Made Active in Reports: 09/21/2007
Number of Days to Update: 58

Source: Department of Environmental Conservation
Telephone: 518-402-9549
Last EDR Contact: 10/24/2007
Next Scheduled EDR Contact: 01/21/2008
Data Release Frequency: Quarterly

TRIBAL RECORDS

INDIAN RESERV: Indian Reservations

This map layer portrays Indian administered lands of the United States that have any area equal to or greater than 640 acres.

Date of Government Version: 12/31/2005
Date Data Arrived at EDR: 12/08/2006
Date Made Active in Reports: 01/11/2007
Number of Days to Update: 34

Source: USGS
Telephone: 202-208-3710
Last EDR Contact: 11/09/2007
Next Scheduled EDR Contact: 02/04/2008
Data Release Frequency: Semi-Annually

INDIAN LUST R1: Leaking Underground Storage Tanks on Indian Land

A listing of leaking underground storage tank locations on Indian Land.

Date of Government Version: 12/01/2006
Date Data Arrived at EDR: 12/01/2006
Date Made Active in Reports: 01/29/2007
Number of Days to Update: 59

Source: EPA Region 1
Telephone: 617-918-1313
Last EDR Contact: 08/20/2007
Next Scheduled EDR Contact: 11/19/2007
Data Release Frequency: Varies

INDIAN LUST R8: Leaking Underground Storage Tanks on Indian Land

LUSTs on Indian land in Colorado, Montana, North Dakota, South Dakota, Utah and Wyoming.

Date of Government Version: 08/27/2007
Date Data Arrived at EDR: 09/07/2007
Date Made Active in Reports: 10/11/2007
Number of Days to Update: 34

Source: EPA Region 8
Telephone: 303-312-6271
Last EDR Contact: 08/20/2007
Next Scheduled EDR Contact: 11/19/2007
Data Release Frequency: Quarterly

INDIAN LUST R10: Leaking Underground Storage Tanks on Indian Land

LUSTs on Indian land in Alaska, Idaho, Oregon and Washington.

Date of Government Version: 09/12/2007
Date Data Arrived at EDR: 09/14/2007
Date Made Active in Reports: 10/11/2007
Number of Days to Update: 27

Source: EPA Region 10
Telephone: 206-553-2857
Last EDR Contact: 08/20/2007
Next Scheduled EDR Contact: 11/19/2007
Data Release Frequency: Quarterly

INDIAN LUST R9: Leaking Underground Storage Tanks on Indian Land

LUSTs on Indian land in Arizona, California, New Mexico and Nevada

Date of Government Version: 09/11/2007
Date Data Arrived at EDR: 09/14/2007
Date Made Active in Reports: 10/11/2007
Number of Days to Update: 27

Source: Environmental Protection Agency
Telephone: 415-972-3372
Last EDR Contact: 08/20/2007
Next Scheduled EDR Contact: 11/19/2007
Data Release Frequency: Quarterly

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

INDIAN LUST R4: Leaking Underground Storage Tanks on Indian Land
LUSTs on Indian land in Florida, Mississippi and North Carolina.

Date of Government Version: 09/05/2007	Source: EPA Region 4
Date Data Arrived at EDR: 10/02/2007	Telephone: 404-562-8677
Date Made Active in Reports: 10/11/2007	Last EDR Contact: 08/20/2007
Number of Days to Update: 9	Next Scheduled EDR Contact: 11/19/2007
	Data Release Frequency: Semi-Annually

INDIAN LUST R6: Leaking Underground Storage Tanks on Indian Land
LUSTs on Indian land in New Mexico and Oklahoma.

Date of Government Version: 01/04/2005	Source: EPA Region 6
Date Data Arrived at EDR: 01/21/2005	Telephone: 214-665-6597
Date Made Active in Reports: 02/28/2005	Last EDR Contact: 10/18/2007
Number of Days to Update: 38	Next Scheduled EDR Contact: 11/19/2007
	Data Release Frequency: Varies

INDIAN LUST R7: Leaking Underground Storage Tanks on Indian Land
LUSTs on Indian land in Iowa, Kansas, and Nebraska

Date of Government Version: 06/01/2007	Source: EPA Region 7
Date Data Arrived at EDR: 06/14/2007	Telephone: 913-551-7003
Date Made Active in Reports: 07/05/2007	Last EDR Contact: 08/20/2007
Number of Days to Update: 21	Next Scheduled EDR Contact: 11/19/2007
	Data Release Frequency: Varies

INDIAN UST R5: Underground Storage Tanks on Indian Land

Date of Government Version: 12/02/2004	Source: EPA Region 5
Date Data Arrived at EDR: 12/29/2004	Telephone: 312-886-6136
Date Made Active in Reports: 02/04/2005	Last EDR Contact: 08/20/2007
Number of Days to Update: 37	Next Scheduled EDR Contact: 11/19/2007
	Data Release Frequency: Varies

INDIAN UST R8: Underground Storage Tanks on Indian Land

Date of Government Version: 08/27/2007	Source: EPA Region 8
Date Data Arrived at EDR: 09/07/2007	Telephone: 303-312-6137
Date Made Active in Reports: 10/11/2007	Last EDR Contact: 08/20/2007
Number of Days to Update: 34	Next Scheduled EDR Contact: 11/19/2007
	Data Release Frequency: Quarterly

INDIAN UST R10: Underground Storage Tanks on Indian Land

Date of Government Version: 09/12/2007	Source: EPA Region 10
Date Data Arrived at EDR: 09/14/2007	Telephone: 206-553-2857
Date Made Active in Reports: 10/11/2007	Last EDR Contact: 08/20/2007
Number of Days to Update: 27	Next Scheduled EDR Contact: 11/19/2007
	Data Release Frequency: Quarterly

INDIAN UST R9: Underground Storage Tanks on Indian Land

Date of Government Version: 09/11/2007	Source: EPA Region 9
Date Data Arrived at EDR: 09/14/2007	Telephone: 415-972-3368
Date Made Active in Reports: 10/11/2007	Last EDR Contact: 08/20/2007
Number of Days to Update: 27	Next Scheduled EDR Contact: 11/19/2007
	Data Release Frequency: Quarterly

INDIAN UST R7: Underground Storage Tanks on Indian Land

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

Date of Government Version: 06/01/2007
Date Data Arrived at EDR: 06/14/2007
Date Made Active in Reports: 07/05/2007
Number of Days to Update: 21

Source: EPA Region 7
Telephone: 913-551-7003
Last EDR Contact: 08/20/2007
Next Scheduled EDR Contact: 11/19/2007
Data Release Frequency: Varies

INDIAN UST R6: Underground Storage Tanks on Indian Land

Date of Government Version: 08/31/2007
Date Data Arrived at EDR: 08/31/2007
Date Made Active in Reports: 10/11/2007
Number of Days to Update: 41

Source: EPA Region 6
Telephone: 214-665-7591
Last EDR Contact: 08/20/2007
Next Scheduled EDR Contact: 11/19/2007
Data Release Frequency: Semi-Annually

INDIAN UST R4: Underground Storage Tanks on Indian Land

Date of Government Version: 09/05/2007
Date Data Arrived at EDR: 10/02/2007
Date Made Active in Reports: 10/11/2007
Number of Days to Update: 9

Source: EPA Region 4
Telephone: 404-562-9424
Last EDR Contact: 08/20/2007
Next Scheduled EDR Contact: 11/19/2007
Data Release Frequency: Semi-Annually

INDIAN UST R1: Underground Storage Tanks on Indian Land

A listing of underground storage tank locations on Indian Land.

Date of Government Version: 12/01/2006
Date Data Arrived at EDR: 12/01/2006
Date Made Active in Reports: 01/29/2007
Number of Days to Update: 59

Source: EPA, Region 1
Telephone: 617-918-1313
Last EDR Contact: 08/20/2007
Next Scheduled EDR Contact: 11/19/2007
Data Release Frequency: Varies

EDR PROPRIETARY RECORDS

Manufactured Gas Plants: EDR Proprietary Manufactured Gas Plants

The EDR Proprietary Manufactured Gas Plant Database includes records of coal gas plants (manufactured gas plants) compiled by EDR's researchers. Manufactured gas sites were used in the United States from the 1800's to 1950's to produce a gas that could be distributed and used as fuel. These plants used whale oil, rosin, coal, or a mixture of coal, oil, and water that also produced a significant amount of waste. Many of the byproducts of the gas production, such as coal tar (oily waste containing volatile and non-volatile chemicals), sludges, oils and other compounds are potentially hazardous to human health and the environment. The byproduct from this process was frequently disposed of directly at the plant site and can remain or spread slowly, serving as a continuous source of soil and groundwater contamination.

Date of Government Version: N/A
Date Data Arrived at EDR: N/A
Date Made Active in Reports: N/A
Number of Days to Update: N/A

Source: EDR, Inc.
Telephone: N/A
Last EDR Contact: N/A
Next Scheduled EDR Contact: N/A
Data Release Frequency: No Update Planned

EDR Historical Auto Stations: EDR Proprietary Historic Gas Stations

EDR has searched selected national collections of business directories and has collected listings of potential gas station/filling station/service station sites that were available to EDR researchers. EDR's review was limited to those categories of sources that might, in EDR's opinion, include gas station/filling station/service station establishments. The categories reviewed included, but were not limited to gas, gas station, gasoline station, filling station, auto, automobile repair, auto service station, service station, etc.

Date of Government Version: N/A
Date Data Arrived at EDR: N/A
Date Made Active in Reports: N/A
Number of Days to Update: N/A

Source: EDR, Inc.
Telephone: N/A
Last EDR Contact: N/A
Next Scheduled EDR Contact: N/A
Data Release Frequency: Varies

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

EDR Historical Cleaners: EDR Proprietary Historic Dry Cleaners

EDR has searched selected national collections of business directories and has collected listings of potential dry cleaner sites that were available to EDR researchers. EDR's review was limited to those categories of sources that might, in EDR's opinion, include dry cleaning establishments. The categories reviewed included, but were not limited to dry cleaners, cleaners, laundry, laundromat, cleaning/laundry, wash & dry etc.

Date of Government Version: N/A
Date Data Arrived at EDR: N/A
Date Made Active in Reports: N/A
Number of Days to Update: N/A

Source: EDR, Inc.
Telephone: N/A
Last EDR Contact: N/A
Next Scheduled EDR Contact: N/A
Data Release Frequency: Varies

FEDERAL RECORDS

PUBLIC SCHOOLS: Public Schools

The National Center for Education Statistics' primary database on elementary and secondary public education in the United States. It is a comprehensive, annual, national statistical database of all public elementary and secondary schools and school districts, which contains data that are comparable across all states.

Date of Government Version: N/A
Date Data Arrived at EDR: 07/13/2004
Date Made Active in Reports: N/A
Number of Days to Update: 0

Source: National Center for Education statistics
Telephone: 202-502-7300
Last EDR Contact: 10/10/2007
Next Scheduled EDR Contact: 01/07/2008
Data Release Frequency: N/A

PRIVATE SCHOOLS: Private Schools of the United States

The National Center for Education Statistics' primary database on private school locations in the United States.

Date of Government Version: N/A
Date Data Arrived at EDR: 10/07/2005
Date Made Active in Reports: N/A
Number of Days to Update: 0

Source: National Center for Education Statistics
Telephone: 202-502-7300
Last EDR Contact: 09/22/2006
Next Scheduled EDR Contact: N/A
Data Release Frequency: N/A

NURSING HOMES: Directory of Nursing Homes

Information on Medicare and Medicaid certified nursing homes in the United States.

Date of Government Version: N/A
Date Data Arrived at EDR: 10/11/2005
Date Made Active in Reports: N/A
Number of Days to Update: 0

Source: N/A
Telephone: 800-568-3282
Last EDR Contact: 09/22/2006
Next Scheduled EDR Contact: N/A
Data Release Frequency: N/A

MEDICAL CENTERS: Provider of Services Listing

A listing of hospitals with Medicare provider number, produced by Centers of Medicare & Medicaid Services, a federal agency within the U.S. Department of Health & Human Services.

Date of Government Version: 06/01/1998
Date Data Arrived at EDR: 11/10/2005
Date Made Active in Reports: N/A
Number of Days to Update: 0

Source: Centers for Medicare & Medicaid Services
Telephone: 410-786-3000
Last EDR Contact: 01/12/2007
Next Scheduled EDR Contact: N/A
Data Release Frequency: N/A

HOSPITALS: AHA Hospital Guide

The database includes a listing of hospitals based on the American Hospital Association's annual survey of hospitals.

Date of Government Version: N/A
Date Data Arrived at EDR: 10/19/1994
Date Made Active in Reports: N/A
Number of Days to Update: 0

Source: American Hospital Association
Telephone: 800-242-2626
Last EDR Contact: 09/22/2006
Next Scheduled EDR Contact: N/A
Data Release Frequency: N/A

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

COLLEGES: Integrated Postsecondary Education Data

The National Center for Education Statistics' primary database on integrated postsecondary education in the United States.

Date of Government Version: N/A
Date Data Arrived at EDR: 10/12/2005
Date Made Active in Reports: N/A
Number of Days to Update: 0

Source: National Center for Education Statistics
Telephone: 202-502-7300
Last EDR Contact: 09/22/2006
Next Scheduled EDR Contact: N/A
Data Release Frequency: N/A

COUNTY RECORDS

CORTLAND COUNTY:

Cortland County Storage Tank Listing

A listing of aboveground storage tank sites located in Cortland County.

Date of Government Version: 04/26/2007
Date Data Arrived at EDR: 05/02/2007
Date Made Active in Reports: 05/30/2007
Number of Days to Update: 28

Source: Cortland County Health Department
Telephone: 607-753-5035
Last EDR Contact: 08/27/2007
Next Scheduled EDR Contact: 11/26/2007
Data Release Frequency: Quarterly

Cortland County Storage Tank Listing

A listing of underground storage tank sites located in Cortland County.

Date of Government Version: 04/26/2007
Date Data Arrived at EDR: 05/02/2007
Date Made Active in Reports: 05/30/2007
Number of Days to Update: 28

Source: Cortland County Health Department
Telephone: 607-753-5035
Last EDR Contact: 08/27/2007
Next Scheduled EDR Contact: 11/26/2007
Data Release Frequency: Quarterly

NASSAU COUNTY:

Registered Tank Database

A listing of aboveground storage tank sites located in Nassau County.

Date of Government Version: 05/21/2003
Date Data Arrived at EDR: 05/27/2003
Date Made Active in Reports: 06/09/2003
Number of Days to Update: 13

Source: Nassau County Health Department
Telephone: 516-571-3314
Last EDR Contact: 10/26/2007
Next Scheduled EDR Contact: 01/28/2008
Data Release Frequency: No Update Planned

Storage Tank Database

A listing of aboveground storage tank sites located in Nassau County.

Date of Government Version: 05/03/2007
Date Data Arrived at EDR: 07/17/2007
Date Made Active in Reports: 09/06/2007
Number of Days to Update: 51

Source: Nassau County Office of the Fire Marshal
Telephone: 516-572-1000
Last EDR Contact: 11/05/2007
Next Scheduled EDR Contact: 02/04/2008
Data Release Frequency: Varies

Registered Tank Database

A listing of underground storage tank sites located in Nassau County.

Date of Government Version: 05/21/2003
Date Data Arrived at EDR: 05/27/2003
Date Made Active in Reports: 06/09/2003
Number of Days to Update: 13

Source: Nassau County Health Department
Telephone: 516-571-3314
Last EDR Contact: 10/26/2007
Next Scheduled EDR Contact: 01/28/2008
Data Release Frequency: No Update Planned

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

Storage Tank Database

A listing of underground storage tank sites located in Nassau County.

Date of Government Version: 05/03/2007
Date Data Arrived at EDR: 07/17/2007
Date Made Active in Reports: 09/06/2007
Number of Days to Update: 51

Source: Nassau County Office of the Fire Marshal
Telephone: 516-572-1000
Last EDR Contact: 11/05/2007
Next Scheduled EDR Contact: 02/04/2008
Data Release Frequency: Varies

ROCKLAND COUNTY:

Petroleum Bulk Storage Database

A listing of aboveground storage tank sites located in Rockland County.

Date of Government Version: 08/23/2007
Date Data Arrived at EDR: 08/23/2007
Date Made Active in Reports: 10/04/2007
Number of Days to Update: 42

Source: Rockland County Health Department
Telephone: 914-364-2605
Last EDR Contact: 10/01/2007
Next Scheduled EDR Contact: 12/31/2007
Data Release Frequency: Quarterly

Petroleum Bulk Storage Database

A listing of underground storage tank sites located in Rockland County.

Date of Government Version: 08/23/2007
Date Data Arrived at EDR: 08/23/2007
Date Made Active in Reports: 10/04/2007
Number of Days to Update: 42

Source: Rockland County Health Department
Telephone: 914-364-2605
Last EDR Contact: 10/01/2007
Next Scheduled EDR Contact: 12/31/2007
Data Release Frequency: Quarterly

SUFFOLK COUNTY:

Storage Tank Database

A listing of aboveground storage tank sites located in Suffolk County.

Date of Government Version: 09/13/2006
Date Data Arrived at EDR: 01/11/2007
Date Made Active in Reports: 02/07/2007
Number of Days to Update: 27

Source: Suffolk County Department of Health Services
Telephone: 631-854-2521
Last EDR Contact: 08/27/2007
Next Scheduled EDR Contact: 11/26/2007
Data Release Frequency: Annually

Storage Tank Database

A listing of underground storage tank sites located in Suffolk County.

Date of Government Version: 09/13/2006
Date Data Arrived at EDR: 01/11/2007
Date Made Active in Reports: 02/07/2007
Number of Days to Update: 27

Source: Suffolk County Department of Health Services
Telephone: 631-854-2521
Last EDR Contact: 08/27/2007
Next Scheduled EDR Contact: 11/26/2007
Data Release Frequency: Annually

WESTCHESTER COUNTY:

Listing of Storage Tanks

A listing of aboveground storage tank sites located in Westchester County.

Date of Government Version: 05/05/2005
Date Data Arrived at EDR: 05/31/2005
Date Made Active in Reports: 06/30/2005
Number of Days to Update: 30

Source: Westchester County Department of Health
Telephone: 914-813-5161
Last EDR Contact: 09/10/2007
Next Scheduled EDR Contact: 11/26/2007
Data Release Frequency: Varies

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

Listing of Storage Tanks

A listing of underground storage tank sites located in Westchester County.

Date of Government Version: 05/05/2005
Date Data Arrived at EDR: 05/31/2005
Date Made Active in Reports: 06/30/2005
Number of Days to Update: 30

Source: Westchester County Department of Health
Telephone: 914-813-5161
Last EDR Contact: 09/10/2007
Next Scheduled EDR Contact: 11/26/2007
Data Release Frequency: Varies

OTHER DATABASE(S)

Depending on the geographic area covered by this report, the data provided in these specialty databases may or may not be complete. For example, the existence of wetlands information data in a specific report does not mean that all wetlands in the area covered by the report are included. Moreover, the absence of any reported wetlands information does not necessarily mean that wetlands do not exist in the area covered by the report.

CT MANIFEST: Hazardous Waste Manifest Data

Facility and manifest data. Manifest is a document that lists and tracks hazardous waste from the generator through transporters to a tsd facility.

Date of Government Version: 12/31/2005
Date Data Arrived at EDR: 06/15/2007
Date Made Active in Reports: 08/20/2007
Number of Days to Update: 66

Source: Department of Environmental Protection
Telephone: 860-424-3375
Last EDR Contact: 09/12/2007
Next Scheduled EDR Contact: 12/10/2007
Data Release Frequency: Annually

NJ MANIFEST: Manifest Information

Hazardous waste manifest information.

Date of Government Version: 04/01/2007
Date Data Arrived at EDR: 04/05/2007
Date Made Active in Reports: 05/08/2007
Number of Days to Update: 33

Source: Department of Environmental Protection
Telephone: N/A
Last EDR Contact: 11/07/2007
Next Scheduled EDR Contact: 12/31/2007
Data Release Frequency: Annually

PA MANIFEST: Manifest Information

Hazardous waste manifest information.

Date of Government Version: 12/31/2006
Date Data Arrived at EDR: 08/23/2007
Date Made Active in Reports: 09/27/2007
Number of Days to Update: 35

Source: Department of Environmental Protection
Telephone: N/A
Last EDR Contact: 09/10/2007
Next Scheduled EDR Contact: 12/10/2007
Data Release Frequency: Annually

RI MANIFEST: Manifest information

Hazardous waste manifest information

Date of Government Version: 04/09/2007
Date Data Arrived at EDR: 04/12/2007
Date Made Active in Reports: 04/27/2007
Number of Days to Update: 15

Source: Department of Environmental Management
Telephone: 401-222-2797
Last EDR Contact: 10/16/2007
Next Scheduled EDR Contact: 12/17/2007
Data Release Frequency: Annually

VT MANIFEST: Hazardous Waste Manifest Data

Hazardous waste manifest information.

Date of Government Version: 12/31/2006
Date Data Arrived at EDR: 04/03/2007
Date Made Active in Reports: 04/24/2007
Number of Days to Update: 21

Source: Department of Environmental Conservation
Telephone: 802-241-3443
Last EDR Contact: 11/13/2007
Next Scheduled EDR Contact: 02/11/2008
Data Release Frequency: Annually

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

WI MANIFEST: Manifest Information

Hazardous waste manifest information.

Date of Government Version: 12/31/2006

Date Data Arrived at EDR: 04/27/2007

Date Made Active in Reports: 06/08/2007

Number of Days to Update: 42

Source: Department of Natural Resources

Telephone: N/A

Last EDR Contact: 10/09/2007

Next Scheduled EDR Contact: 01/07/2008

Data Release Frequency: Annually

Oil/Gas Pipelines: This data was obtained by EDR from the USGS in 1994. It is referred to by USGS as GeoData Digital Line Graphs from 1:100,000-Scale Maps. It was extracted from the transportation category including some oil, but primarily gas pipelines.

Electric Power Transmission Line Data

Source: PennWell Corporation

Telephone: (800) 823-6277

This map includes information copyrighted by PennWell Corporation. This information is provided on a best effort basis and PennWell Corporation does not guarantee its accuracy nor warrant its fitness for any particular purpose. Such information has been reprinted with the permission of PennWell.

Sensitive Receptors: There are individuals deemed sensitive receptors due to their fragile immune systems and special sensitivity to environmental discharges. These sensitive receptors typically include the elderly, the sick, and children. While the location of all sensitive receptors cannot be determined, EDR indicates those buildings and facilities - schools, daycares, hospitals, medical centers, and nursing homes - where individuals who are sensitive receptors are likely to be located.

AHA Hospitals:

Source: American Hospital Association, Inc.

Telephone: 312-280-5991

The database includes a listing of hospitals based on the American Hospital Association's annual survey of hospitals.

Medical Centers: Provider of Services Listing

Source: Centers for Medicare & Medicaid Services

Telephone: 410-786-3000

A listing of hospitals with Medicare provider number, produced by Centers of Medicare & Medicaid Services, a federal agency within the U.S. Department of Health and Human Services.

Nursing Homes

Source: National Institutes of Health

Telephone: 301-594-6248

Information on Medicare and Medicaid certified nursing homes in the United States.

Public Schools

Source: National Center for Education Statistics

Telephone: 202-502-7300

The National Center for Education Statistics' primary database on elementary and secondary public education in the United States. It is a comprehensive, annual, national statistical database of all public elementary and secondary schools and school districts, which contains data that are comparable across all states.

Private Schools

Source: National Center for Education Statistics

Telephone: 202-502-7300

The National Center for Education Statistics' primary database on private school locations in the United States.

Daycare Centers: Day Care Providers

Source: Department of Health

Telephone: 212-676-2444

Flood Zone Data: This data, available in select counties across the country, was obtained by EDR in 1999 from the Federal Emergency Management Agency (FEMA). Data depicts 100-year and 500-year flood zones as defined by FEMA.

NWI: National Wetlands Inventory. This data, available in select counties across the country, was obtained by EDR in 2002 and 2005 from the U.S. Fish and Wildlife Service.

State Wetlands Data: Freshwater Wetlands

Source: Department of Environmental Conservation

Telephone: 518-402-8961

Scanned Digital USGS 7.5' Topographic Map (DRG)

Source: United States Geologic Survey

A digital raster graphic (DRG) is a scanned image of a U.S. Geological Survey topographic map. The map images are made by scanning published paper maps on high-resolution scanners. The raster image is georeferenced and fit to the Universal Transverse Mercator (UTM) projection.

STREET AND ADDRESS INFORMATION

© 2007 Tele Atlas North America, Inc. All rights reserved. This material is proprietary and the subject of copyright protection and other intellectual property rights owned by or licensed to Tele Atlas North America, Inc. The use of this material is subject to the terms of a license agreement. You will be held liable for any unauthorized copying or disclosure of this material.

GEOCHECK[®] - PHYSICAL SETTING SOURCE ADDENDUM

TARGET PROPERTY ADDRESS

414 WEST 155TH STREET
414 WEST 155TH STREET
NEW YORK, NY 10032

TARGET PROPERTY COORDINATES

Latitude (North):	40.83064 - 40° 49' 50.3"
Longitude (West):	73.94081 - 73° 56' 26.9"
Universal Transverse Mercator:	Zone 18
UTM X (Meters):	589310.2
UTM Y (Meters):	4520285.0
Elevation:	111 ft. above sea level

USGS TOPOGRAPHIC MAP

Target Property Map:	40073-G8 CENTRAL PARK, NY
Most Recent Revision:	1995

EDR's GeoCheck Physical Setting Source Addendum is provided to assist the environmental professional in forming an opinion about the impact of potential contaminant migration.

Assessment of the impact of contaminant migration generally has two principle investigative components:

1. Groundwater flow direction, and
2. Groundwater flow velocity.

Groundwater flow direction may be impacted by surface topography, hydrology, hydrogeology, characteristics of the soil, and nearby wells. Groundwater flow velocity is generally impacted by the nature of the geologic strata.

GEOCHECK® - PHYSICAL SETTING SOURCE SUMMARY

GROUNDWATER FLOW DIRECTION INFORMATION

Groundwater flow direction for a particular site is best determined by a qualified environmental professional using site-specific well data. If such data is not reasonably ascertainable, it may be necessary to rely on other sources of information, such as surface topographic information, hydrologic information, hydrogeologic data collected on nearby properties, and regional groundwater flow information (from deep aquifers).


TOPOGRAPHIC INFORMATION

Surface topography may be indicative of the direction of surficial groundwater flow. This information can be used to assist the environmental professional in forming an opinion about the impact of nearby contaminated properties or, should contamination exist on the target property, what downgradient sites might be impacted.

TARGET PROPERTY TOPOGRAPHY

General Topographic Gradient: General SE

SURROUNDING TOPOGRAPHY: ELEVATION PROFILES

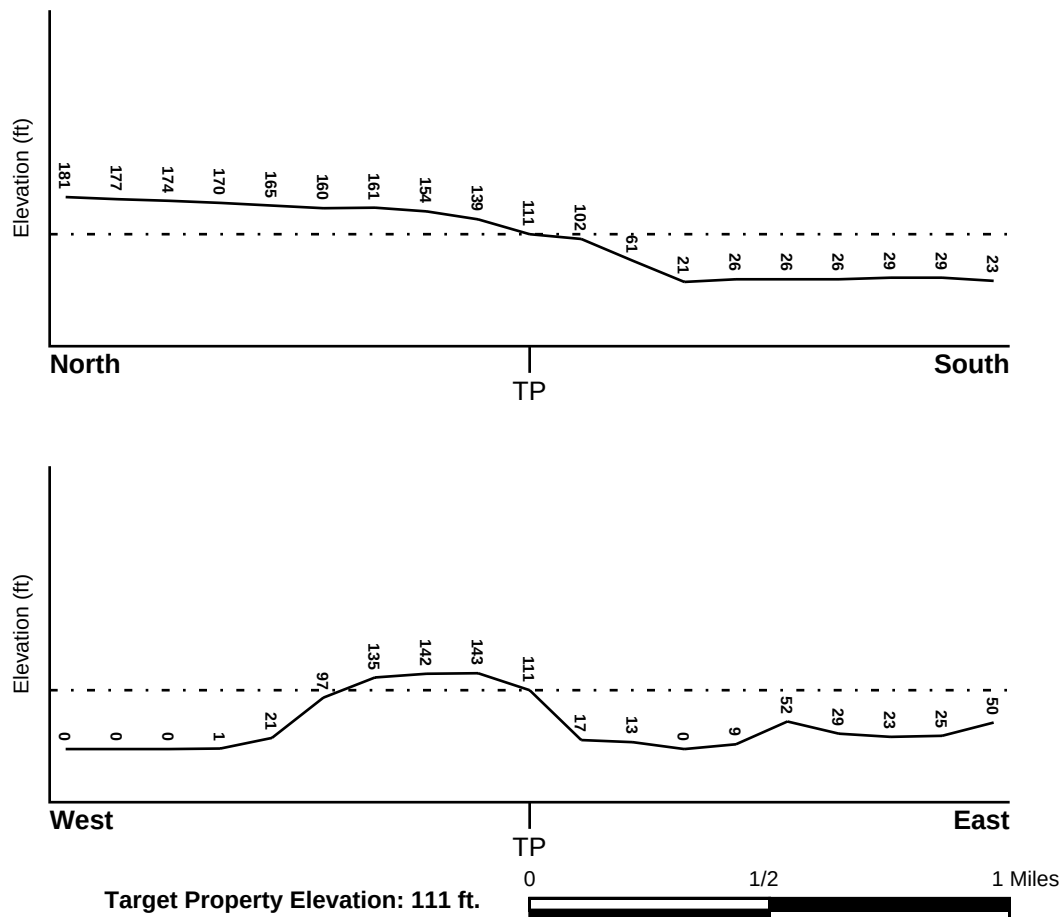

Source: Topography has been determined from the USGS 7.5' Digital Elevation Model and should be evaluated on a relative (not an absolute) basis. Relative elevation information between sites of close proximity should be field verified.

GEOCHECK® - PHYSICAL SETTING SOURCE SUMMARY

HYDROLOGIC INFORMATION

Surface water can act as a hydrologic barrier to groundwater flow. Such hydrologic information can be used to assist the environmental professional in forming an opinion about the impact of nearby contaminated properties or, should contamination exist on the target property, what downgradient sites might be impacted.

Refer to the Physical Setting Source Map following this summary for hydrologic information (major waterways and bodies of water).

FEMA FLOOD ZONE

Target Property County
NEW YORK, NY

FEMA Flood
Electronic Data
YES - refer to the Overview Map and Detail Map

Flood Plain Panel at Target Property: 3604970015B

Additional Panels in search area: 3604970014B
3604970019B
3604970020B

NATIONAL WETLAND INVENTORY

NWI Quad at Target Property
CENTRAL PARK

NWI Electronic
Data Coverage
YES - refer to the Overview Map and Detail Map

HYDROGEOLOGIC INFORMATION

Hydrogeologic information obtained by installation of wells on a specific site can often be an indicator of groundwater flow direction in the immediate area. Such hydrogeologic information can be used to assist the environmental professional in forming an opinion about the impact of nearby contaminated properties or, should contamination exist on the target property, what downgradient sites might be impacted.

Site-Specific Hydrogeological Data:*

Search Radius: 1.25 miles
Status: Not found

AQUIFLOW®

Search Radius: 1.000 Mile.

EDR has developed the AQUIFLOW Information System to provide data on the general direction of groundwater flow at specific points. EDR has reviewed reports submitted by environmental professionals to regulatory authorities at select sites and has extracted the date of the report, groundwater flow direction as determined hydrogeologically, and the depth to water table.

<u>MAP ID</u>	<u>LOCATION</u> <u>FROM TP</u>	<u>GENERAL DIRECTION</u> <u>GROUNDWATER FLOW</u>
Not Reported		

GEOCHECK® - PHYSICAL SETTING SOURCE SUMMARY

GROUNDWATER FLOW VELOCITY INFORMATION

Groundwater flow velocity information for a particular site is best determined by a qualified environmental professional using site specific geologic and soil strata data. If such data are not reasonably ascertainable, it may be necessary to rely on other sources of information, including geologic age identification, rock stratigraphic unit and soil characteristics data collected on nearby properties and regional soil information. In general, contaminant plumes move more quickly through sandy-gravelly types of soils than silty-clayey types of soils.

GEOLOGIC INFORMATION IN GENERAL AREA OF TARGET PROPERTY

Geologic information can be used by the environmental professional in forming an opinion about the relative speed at which contaminant migration may be occurring.

ROCK STRATIGRAPHIC UNIT

Era: Paleozoic
System: Ordovician
Series: Lower Ordovician and Cambrian carbonate rocks
Code: OC (*decoded above as Era, System & Series*)

GEOLOGIC AGE IDENTIFICATION

Category: Stratified Sequence

Geologic Age and Rock Stratigraphic Unit Source: P.G. Schruben, R.E. Arndt and W.J. Bawiec, Geology of the Conterminous U.S. at 1:2,500,000 Scale - a digital representation of the 1974 P.B. King and H.M. Beikman Map, USGS Digital Data Series DDS - 11 (1994).

DOMINANT SOIL COMPOSITION IN GENERAL AREA OF TARGET PROPERTY

The U.S. Department of Agriculture's (USDA) Soil Conservation Service (SCS) leads the National Cooperative Soil Survey (NCSS) and is responsible for collecting, storing, maintaining and distributing soil survey information for privately owned lands in the United States. A soil map in a soil survey is a representation of soil patterns in a landscape. Soil maps for STATSGO are compiled by generalizing more detailed (SSURGO) soil survey maps. The following information is based on Soil Conservation Service STATSGO data.

Soil Component Name: URBAN LAND

Soil Surface Texture: variable

Hydrologic Group: Not reported

Soil Drainage Class: Not reported

Hydric Status: Soil does not meet the requirements for a hydric soil.

Corrosion Potential - Uncoated Steel: Not Reported

Depth to Bedrock Min: > 10 inches

Depth to Bedrock Max: > 10 inches

GEOCHECK® - PHYSICAL SETTING SOURCE SUMMARY

Soil Layer Information							
Layer	Boundary		Soil Texture Class	Classification		Permeability Rate (in/hr)	Soil Reaction (pH)
	Upper	Lower		AASHTO Group	Unified Soil		
1	0 inches	6 inches	variable	Not reported	Not reported	Max: 0.00 Min: 0.00	Max: 0.00 Min: 0.00

OTHER SOIL TYPES IN AREA

Based on Soil Conservation Service STATSGO data, the following additional subordinant soil types may appear within the general area of target property.

Soil Surface Textures: silt loam
loamy sand
sandy loam
fine sandy loam

Surficial Soil Types: silt loam
loamy sand
sandy loam
fine sandy loam

Shallow Soil Types: sandy loam

Deeper Soil Types: unweathered bedrock
very gravelly - loamy sand
stratified
sandy loam

LOCAL / REGIONAL WATER AGENCY RECORDS

EDR Local/Regional Water Agency records provide water well information to assist the environmental professional in assessing sources that may impact ground water flow direction, and in forming an opinion about the impact of contaminant migration on nearby drinking water wells.

WELL SEARCH DISTANCE INFORMATION

<u>DATABASE</u>	<u>SEARCH DISTANCE (miles)</u>
Federal USGS	1.000
Federal FRDS PWS	Nearest PWS within 1 mile
State Database	1.000

FEDERAL USGS WELL INFORMATION

<u>MAP ID</u>	<u>WELL ID</u>	<u>LOCATION FROM TP</u>

GEOCHECK® - PHYSICAL SETTING SOURCE SUMMARY

FEDERAL USGS WELL INFORMATION

MAP ID	WELL ID	LOCATION FROM TP
1	USGS2114133	1/8 - 1/4 Mile ENE
2	USGS2114382	1/2 - 1 Mile South
3	USGS2114053	1/2 - 1 Mile NNW
4	USGS2114275	1/2 - 1 Mile ESE
5	USGS2114076	1/2 - 1 Mile NE

FEDERAL FRDS PUBLIC WATER SUPPLY SYSTEM INFORMATION


MAP ID	WELL ID	LOCATION FROM TP
No PWS System Found		

Note: PWS System location is not always the same as well location.

STATE DATABASE WELL INFORMATION

MAP ID	WELL ID	LOCATION FROM TP
No Wells Found		

PHYSICAL SETTING SOURCE MAP - 2077001.2s

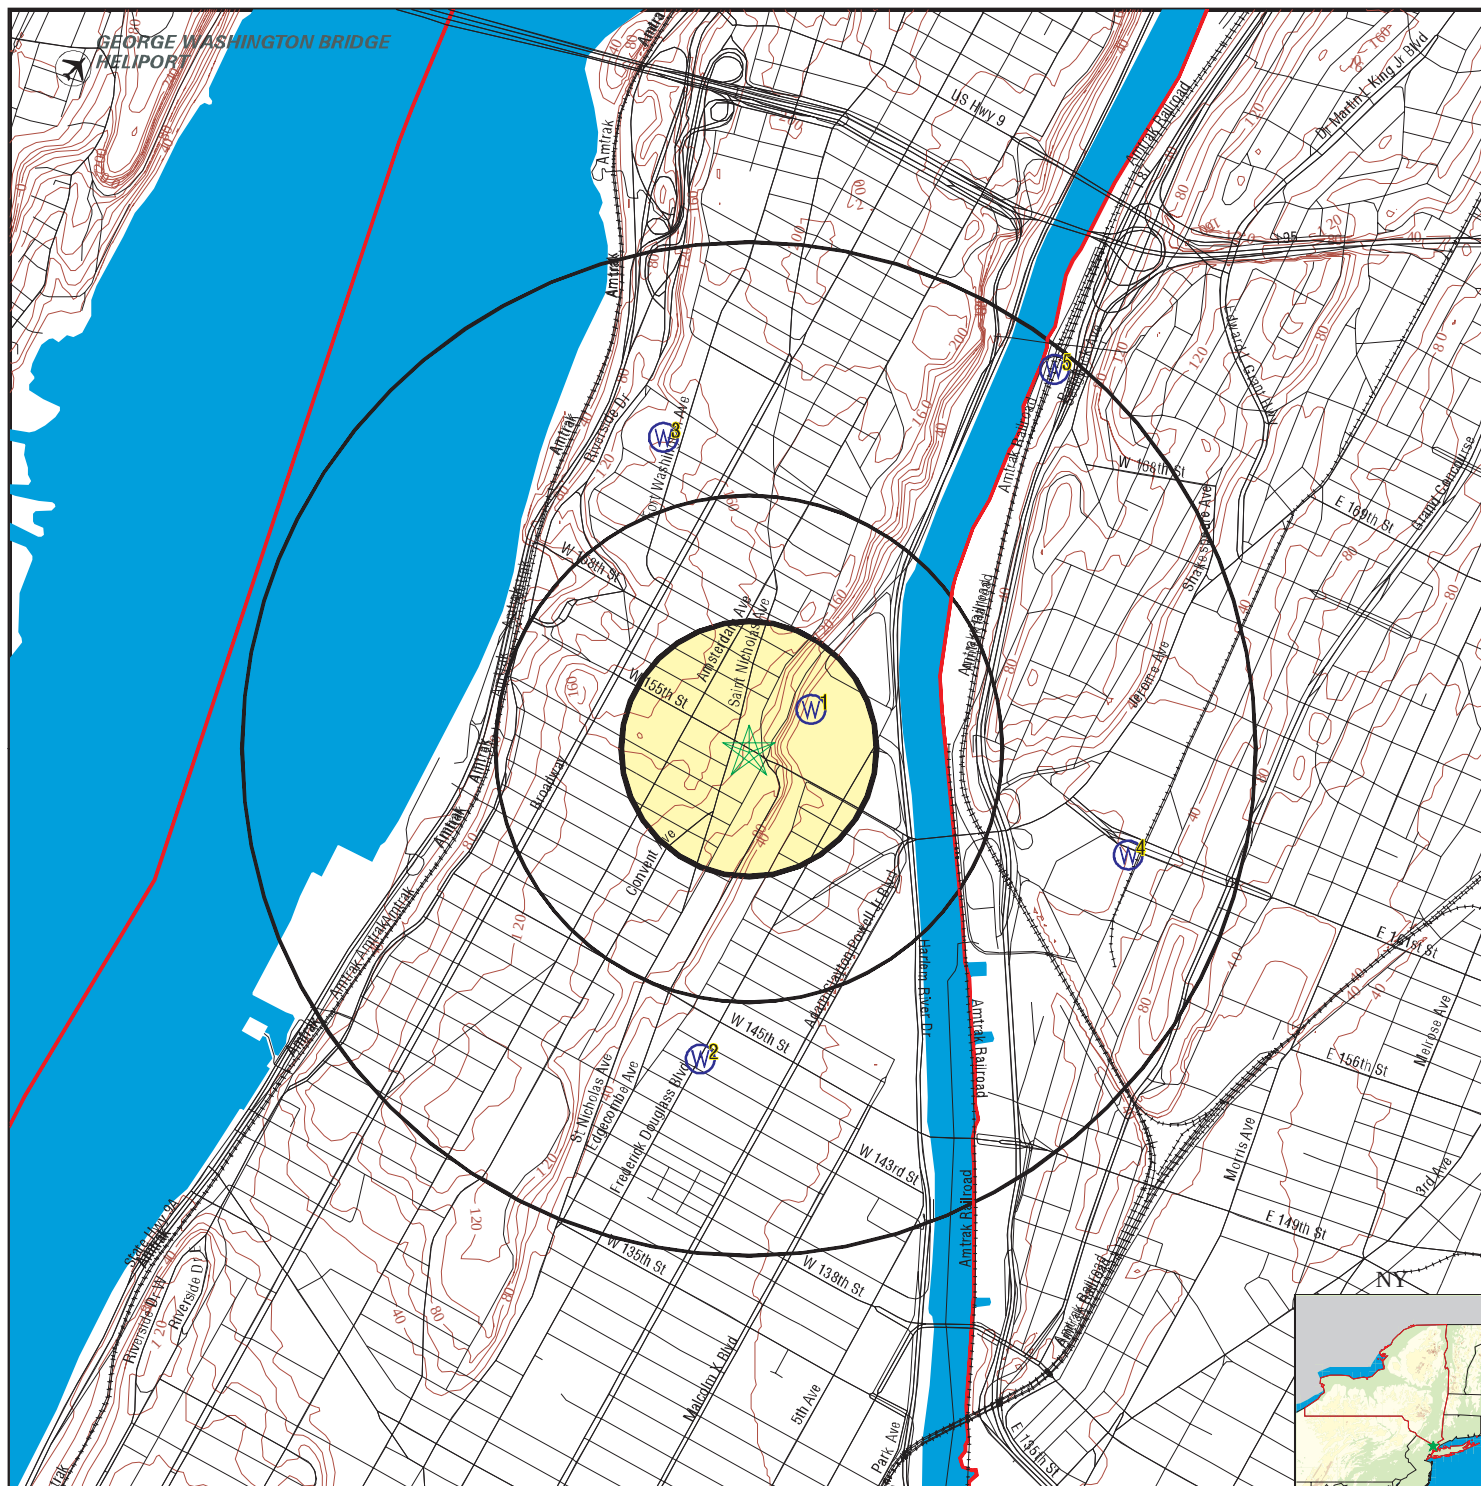

- County Boundary
- Major Roads
- Contour Lines
- Airports
- Earthquake epicenter, Richter 5 or greater
- Water Wells
- Public Water Supply Wells
- Cluster of Multiple Icons

- Groundwater Flow Direction
- Indeterminate Groundwater Flow at Location
- Groundwater Flow Varies at Location
- Closest Hydrogeological Data
- Oil, gas or related wells

SITE NAME: 414 West 155th Street
 ADDRESS: 414 West 155th Street
 New York NY 10032
 LAT/LONG: 40.8306 / 73.9408

CLIENT: ATC Associates Inc.
 CONTACT: Bedia Saray
 INQUIRY #: 2077001.2s
 DATE: November 13, 2007 7:31 pm

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Map ID
Direction
Distance
Elevation

Database EDR ID Number

1

ENE

1/8 - 1/4 Mile

Lower

FED USGS

USGS2114133

Agency cd:	USGS	Site no:	404954073562001
Site name:	NY 138		
Latitude:	404954		
Longitude:	0735620	Dec lat:	40.83176709
Dec lon:	-73.93847067	Coor meth:	M
Coor accr:	R	Latlong datum:	NAD27
Dec latlong datum:	NAD83	District:	36
State:	36	County:	061
Country:	US	Land net:	Not Reported
Location map:	CENTRAL PARK R-25-4	Map scale:	Not Reported
Altitude:	20		
Altitude method:	Interpolated from topographic map		
Altitude accuracy:	10		
Altitude datum:	National Geodetic Vertical Datum of 1929		
Hydrologic:	Not Reported		
Topographic:	Not Reported		
Site type:	Ground-water other than Spring	Date construction:	Not Reported
Date inventoried:	Not Reported	Mean greenwich time offset:	EST
Local standard time flag:	N		
Type of ground water site:	Single well, other than collector or Ranney type		
Aquifer Type:	Not Reported		
Aquifer:	Not Reported		
Well depth:	357	Hole depth:	Not Reported
Source of depth data:	driller		
Project number:	Not Reported		
Real time data flag:	Not Reported	Daily flow data begin date:	Not Reported
Daily flow data end date:	Not Reported	Daily flow data count:	Not Reported
Peak flow data begin date:	Not Reported	Peak flow data end date:	Not Reported
Peak flow data count:	Not Reported	Water quality data begin date:	Not Reported
Water quality data end date:	Not Reported	Water quality data count:	Not Reported
Ground water data begin date:	Not Reported	Ground water data end date:	Not Reported
Ground water data count:	Not Reported		

Ground-water levels, Number of Measurements: 0

2

South

1/2 - 1 Mile

Lower

FED USGS

USGS2114382

Agency cd:	USGS	Site no:	404918073563501
Site name:	NY 162		
Latitude:	404918		
Longitude:	0735635	Dec lat:	40.82176725
Dec lon:	-73.9426375	Coor meth:	M
Coor accr:	R	Latlong datum:	NAD27
Dec latlong datum:	NAD83	District:	36
State:	36	County:	061
Country:	US	Land net:	Not Reported
Location map:	Not Reported	Map scale:	Not Reported

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Altitude:	20		
Altitude method:	Interpolated from topographic map		
Altitude accuracy:	10		
Altitude datum:	National Geodetic Vertical Datum of 1929		
Hydrologic:	Not Reported		
Topographic:	Not Reported		
Site type:	Ground-water other than Spring	Date construction:	Not Reported
Date inventoried:	Not Reported	Mean greenwich time offset:	EST
Local standard time flag:	N		
Type of ground water site:	Test hole, not completed as a well		
Aquifer Type:	Not Reported		
Aquifer:	Not Reported		
Well depth:	112	Hole depth:	Not Reported
Source of depth data:	driller		
Project number:	Not Reported		
Real time data flag:	Not Reported	Daily flow data begin date:	Not Reported
Daily flow data end date:	Not Reported	Daily flow data count:	Not Reported
Peak flow data begin date:	Not Reported	Peak flow data end date:	Not Reported
Peak flow data count:	Not Reported	Water quality data begin date:	Not Reported
Water quality data end date:	Not Reported	Water quality data count:	Not Reported
Ground water data begin date:	Not Reported	Ground water data end date:	Not Reported
Ground water data count:	Not Reported		

Ground-water levels, Number of Measurements: 0

3
NNW
1/2 - 1 Mile
Higher

FED USGS USGS2114053

Agency cd:	USGS	Site no:	405022073564001
Site name:	NY 164		
Latitude:	405022		
Longitude:	0735640	Dec lat:	40.83954472
Dec lon:	-73.94402635	Coor meth:	M
Coor accr:	R	Latlong datum:	NAD27
Dec latlong datum:	NAD83	District:	36
State:	36	County:	061
Country:	US	Land net:	Not Reported
Location map:	CENTRAL PARK R-25-4	Map scale:	Not Reported
Altitude:	140		
Altitude method:	Interpolated from topographic map		
Altitude accuracy:	10		
Altitude datum:	National Geodetic Vertical Datum of 1929		
Hydrologic:	Not Reported		
Topographic:	Not Reported		
Site type:	Ground-water other than Spring	Date construction:	Not Reported
Date inventoried:	Not Reported	Mean greenwich time offset:	EST
Local standard time flag:	N		
Type of ground water site:	Test hole, not completed as a well		
Aquifer Type:	Not Reported		
Aquifer:	Not Reported		
Well depth:	48	Hole depth:	48
Source of depth data:	driller		
Project number:	Not Reported		
Real time data flag:	Not Reported	Daily flow data begin date:	Not Reported
Daily flow data end date:	Not Reported	Daily flow data count:	Not Reported
Peak flow data begin date:	Not Reported	Peak flow data end date:	Not Reported

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Peak flow data count: Not Reported
 Water quality data end date: Not Reported
 Ground water data begin date: Not Reported
 Ground water data count: Not Reported

Water quality data begin date: Not Reported
 Water quality data count: Not Reported
 Ground water data end date: Not Reported

Ground-water levels, Number of Measurements: 0

4
ESE
1/2 - 1 Mile
Lower

FED USGS USGS2114275

Agency cd:	USGS	Site no:	404939073553701
Site name:	B 26		
Latitude:	404939		
Longitude:	0735537	Dec lat:	40.82760051
Dec lon:	-73.9265259	Coor meth:	M
Coor accr:	R	Latlong datum:	NAD27
Dec latlong datum:	NAD83	District:	36
State:	36	County:	005
Country:	US	Land net:	Not Reported
Location map:	CENTRAL PARK R-25-4	Map scale:	Not Reported
Altitude:	20		
Altitude method:	Interpolated from topographic map		
Altitude accuracy:	10		
Altitude datum:	National Geodetic Vertical Datum of 1929		
Hydrologic:	Not Reported		
Topographic:	Not Reported		
Site type:	Ground-water other than Spring	Date construction:	19500200
Date inventoried:	Not Reported	Mean greenwich time offset:	EST
Local standard time flag:	N		
Type of ground water site:	Single well, other than collector or Ranney type		
Aquifer Type:	Not Reported		
Aquifer:	SAND		
Well depth:	65	Hole depth:	Not Reported
Source of depth data:	reporting agency (generally USGS)		
Project number:	Not Reported		
Real time data flag:	0	Daily flow data begin date:	0000-00-00
Daily flow data end date:	0000-00-00	Daily flow data count:	0
Peak flow data begin date:	0000-00-00	Peak flow data end date:	0000-00-00
Peak flow data count:	0	Water quality data begin date:	0000-00-00
Water quality data end date:	0000-00-00	Water quality data count:	0
Ground water data begin date:	1950-02-00	Ground water data end date:	1950-02-00
Ground water data count:	1		

Ground-water levels, Number of Measurements: 1

Date	Feet below Surface	Feet to Sealevel

1950-02	28	

5
NE
1/2 - 1 Mile
Lower

FED USGS USGS2114076

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Agency cd:	USGS	Site no:	405029073554701
Site name:	B 46		
Latitude:	405029		
Longitude:	0735547	Dec lat:	40.84148916
Dec lon:	-73.9293037	Coor meth:	M
Coor accr:	R	Latlong datum:	NAD27
Dec latlong datum:	NAD83	District:	36
State:	36	County:	005
Country:	US	Land net:	Not Reported
Location map:	CENTRAL PARK R-25-4	Map scale:	Not Reported
Altitude:	10		
Altitude method:	Interpolated from topographic map		
Altitude accuracy:	10		
Altitude datum:	National Geodetic Vertical Datum of 1929		
Hydrologic:	Not Reported		
Topographic:	Not Reported		
Site type:	Ground-water other than Spring	Date construction:	Not Reported
Date inventoried:	Not Reported	Mean greenwich time offset:	EST
Local standard time flag:	N		
Type of ground water site:	Single well, other than collector or Ranney type		
Aquifer Type:	Not Reported		
Aquifer:	Not Reported		
Well depth:	200	Hole depth:	Not Reported
Source of depth data:	Not Reported		
Project number:	Not Reported		
Real time data flag:	Not Reported		
Daily flow data end date:	Not Reported	Daily flow data begin date:	Not Reported
Peak flow data begin date:	Not Reported	Daily flow data count:	Not Reported
Peak flow data count:	Not Reported	Peak flow data end date:	Not Reported
Water quality data end date:	Not Reported	Water quality data begin date:	Not Reported
Ground water data begin date:	Not Reported	Water quality data count:	Not Reported
Ground water data count:	Not Reported	Ground water data end date:	Not Reported

Ground-water levels, Number of Measurements: 0

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS RADON

AREA RADON INFORMATION

Federal EPA Radon Zone for NEW YORK County: 3

Note: Zone 1 indoor average level > 4 pCi/L.

: Zone 2 indoor average level $\geq$ 2 pCi/L and $\leq$ 4 pCi/L.

: Zone 3 indoor average level < 2 pCi/L.

Not Reported

PHYSICAL SETTING SOURCE RECORDS SEARCHED

TOPOGRAPHIC INFORMATION

USGS 7.5' Digital Elevation Model (DEM)

Source: United States Geologic Survey

EDR acquired the USGS 7.5' Digital Elevation Model in 2002 and updated it in 2006. The 7.5 minute DEM corresponds to the USGS 1:24,000- and 1:25,000-scale topographic quadrangle maps. The DEM provides elevation data with consistent elevation units and projection.

Scanned Digital USGS 7.5' Topographic Map (DRG)

Source: United States Geologic Survey

A digital raster graphic (DRG) is a scanned image of a U.S. Geological Survey topographic map. The map images are made by scanning published paper maps on high-resolution scanners. The raster image is georeferenced and fit to the Universal Transverse Mercator (UTM) projection.

HYDROLOGIC INFORMATION

Flood Zone Data: This data, available in select counties across the country, was obtained by EDR in 1999 from the Federal Emergency Management Agency (FEMA). Data depicts 100-year and 500-year flood zones as defined by FEMA.

NWI: National Wetlands Inventory. This data, available in select counties across the country, was obtained by EDR in 2002 and 2005 from the U.S. Fish and Wildlife Service.

State Wetlands Data: Freshwater Wetlands

Source: Department of Environmental Conservation

Telephone: 518-402-8961

HYDROGEOLOGIC INFORMATION

AQUIFLOW^R Information System

Source: EDR proprietary database of groundwater flow information

EDR has developed the AQUIFLOW Information System (AIS) to provide data on the general direction of groundwater flow at specific points. EDR has reviewed reports submitted to regulatory authorities at select sites and has extracted the date of the report, hydrogeologically determined groundwater flow direction and depth to water table information.

GEOLOGIC INFORMATION

Geologic Age and Rock Stratigraphic Unit

Source: P.G. Schruben, R.E. Arndt and W.J. Bawiec, Geology of the Conterminous U.S. at 1:2,500,000 Scale - A digital representation of the 1974 P.B. King and H.M. Beikman Map, USGS Digital Data Series DDS - 11 (1994).

STATSGO: State Soil Geographic Database

Source: Department of Agriculture, Natural Resources Conservation Services

The U.S. Department of Agriculture's (USDA) Natural Resources Conservation Service (NRCS) leads the national Conservation Soil Survey (NCSS) and is responsible for collecting, storing, maintaining and distributing soil survey information for privately owned lands in the United States. A soil map in a soil survey is a representation of soil patterns in a landscape. Soil maps for STATSGO are compiled by generalizing more detailed (SSURGO) soil survey maps.

SSURGO: Soil Survey Geographic Database

Source: Department of Agriculture, Natural Resources Conservation Services (NRCS)

Telephone: 800-672-5559

SSURGO is the most detailed level of mapping done by the Natural Resources Conservation Services, mapping scales generally range from 1:12,000 to 1:63,360. Field mapping methods using national standards are used to construct the soil maps in the Soil Survey Geographic (SSURGO) database. SSURGO digitizing duplicates the original soil survey maps. This level of mapping is designed for use by landowners, townships and county natural resource planning and management.

PHYSICAL SETTING SOURCE RECORDS SEARCHED

LOCAL / REGIONAL WATER AGENCY RECORDS

FEDERAL WATER WELLS

PWS: Public Water Systems

Source: EPA/Office of Drinking Water

Telephone: 202-564-3750

Public Water System data from the Federal Reporting Data System. A PWS is any water system which provides water to at least 25 people for at least 60 days annually. PWSs provide water from wells, rivers and other sources.

PWS ENF: Public Water Systems Violation and Enforcement Data

Source: EPA/Office of Drinking Water

Telephone: 202-564-3750

Violation and Enforcement data for Public Water Systems from the Safe Drinking Water Information System (SDWIS) after August 1995. Prior to August 1995, the data came from the Federal Reporting Data System (FRDS).

USGS Water Wells: USGS National Water Inventory System (NWIS)

This database contains descriptive information on sites where the USGS collects or has collected data on surface water and/or groundwater. The groundwater data includes information on wells, springs, and other sources of groundwater.

STATE RECORDS

New York Public Water Wells

Source: New York Department of Health

Telephone: 518-458-6731

OTHER STATE DATABASE INFORMATION

Oil and Gas Well Database

Department of Environmental Conservation

Telephone: 518-402-8056

These files contain records, in the database, of wells that have been drilled.

RADON

State Database: NY Radon

Source: Department of Health

Telephone: 518-402-7556

Radon Test Results

Area Radon Information

Source: USGS

Telephone: 703-356-4020

The National Radon Database has been developed by the U.S. Environmental Protection Agency (USEPA) and is a compilation of the EPA/State Residential Radon Survey and the National Residential Radon Survey. The study covers the years 1986 - 1992. Where necessary data has been supplemented by information collected at private sources such as universities and research institutions.

EPA Radon Zones

Source: EPA

Telephone: 703-356-4020

Sections 307 & 309 of IRAA directed EPA to list and identify areas of U.S. with the potential for elevated indoor radon levels.

OTHER

Airport Landing Facilities: Private and public use landing facilities

Source: Federal Aviation Administration, 800-457-6656

Epicenters: World earthquake epicenters, Richter 5 or greater

Source: Department of Commerce, National Oceanic and Atmospheric Administration


PHYSICAL SETTING SOURCE RECORDS SEARCHED

STREET AND ADDRESS INFORMATION

© 2007 Tele Atlas North America, Inc. All rights reserved. This material is proprietary and the subject of copyright protection and other intellectual property rights owned by or licensed to Tele Atlas North America, Inc. The use of this material is subject to the terms of a license agreement. You will be held liable for any unauthorized copying or disclosure of this material.

APPENDIX F
AERIAL PHOTOGRAPHS
(NOTUSED)

APPENDIX G
HISTORICAL RESEARCH DOCUMENTATION

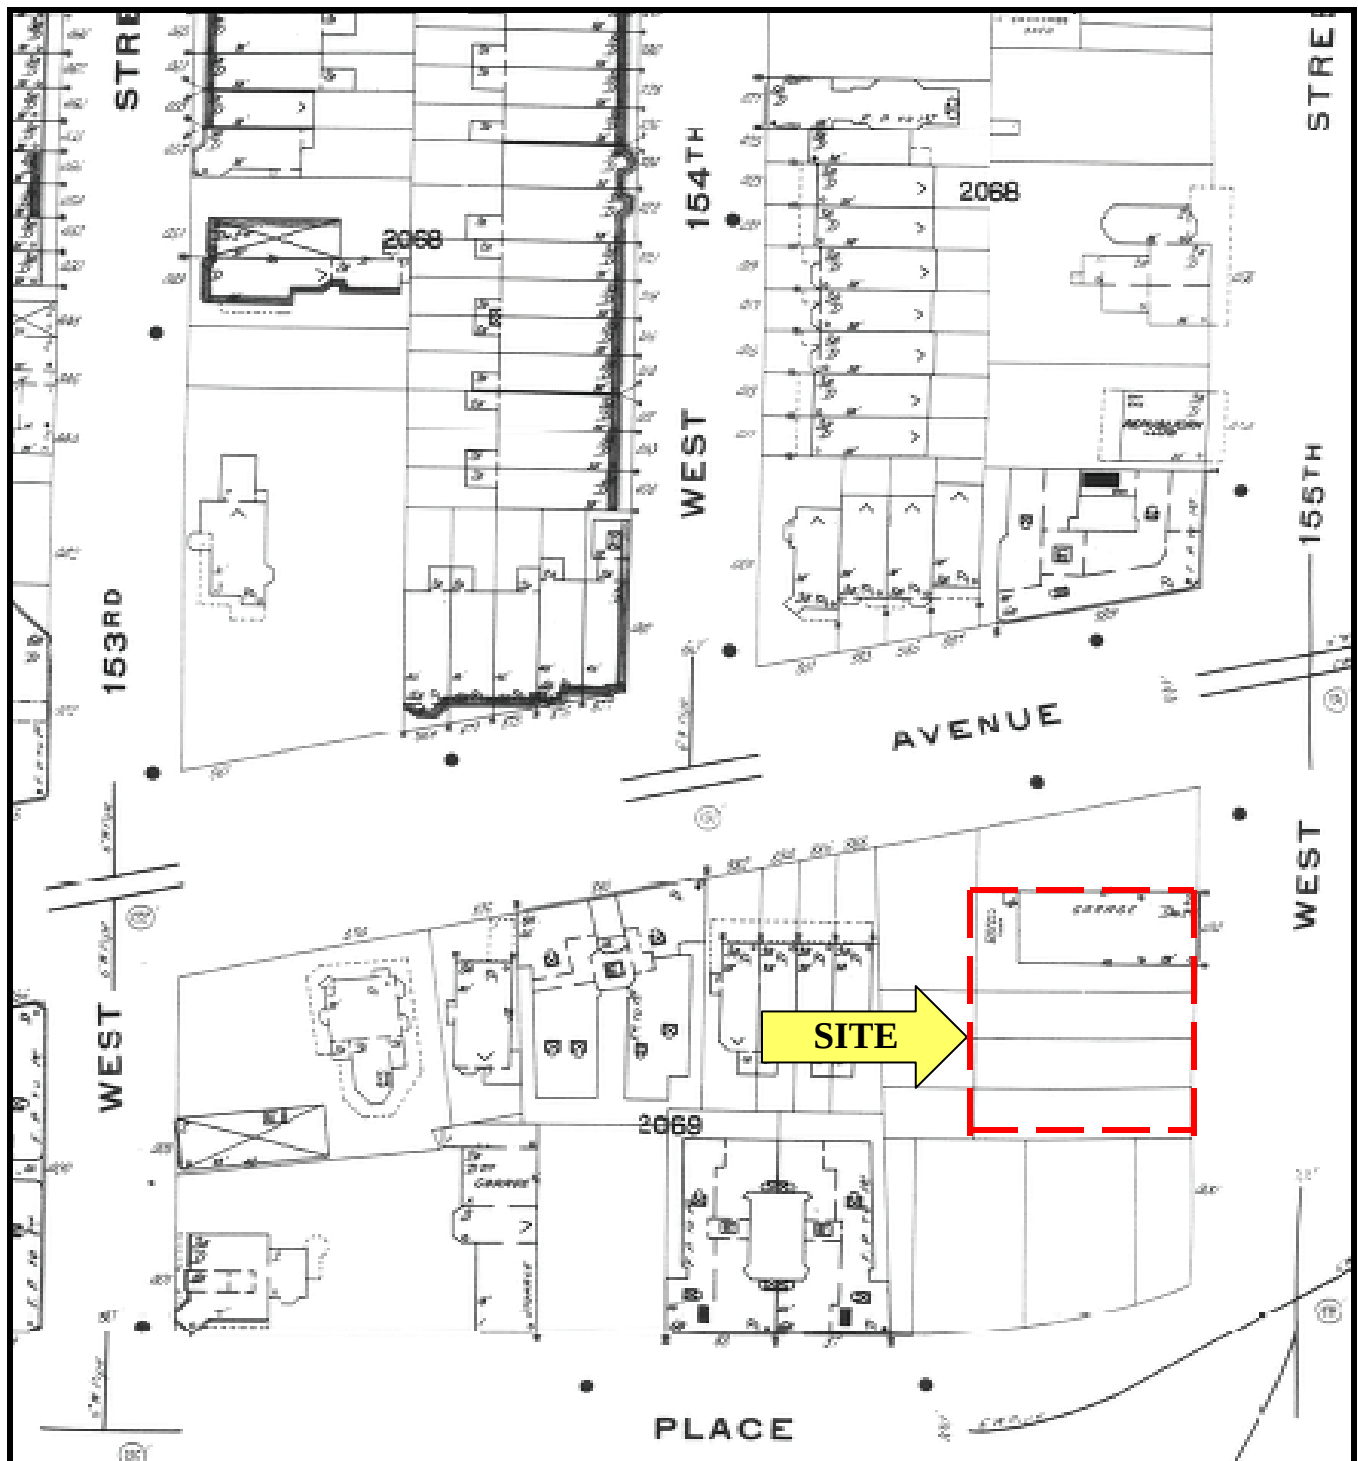

ASSOCIATES INC.
104 East 25th Street, 10th Floor
New York, NY 10010-2917
(212) 353-8280 Fax (212) 979-8447

EDR: Environmental Data Resources
(The Sanborn Library, LLC)


APPENDIX G- HISTORICAL SANBORN MAPS 1909


CLIENT: Broadway Housing Communities

SITE: 414 West 155th Street
New York, NY 10032

ATC PROJECT #: 015.26789.0002

SCALE: Not to Scale

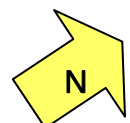

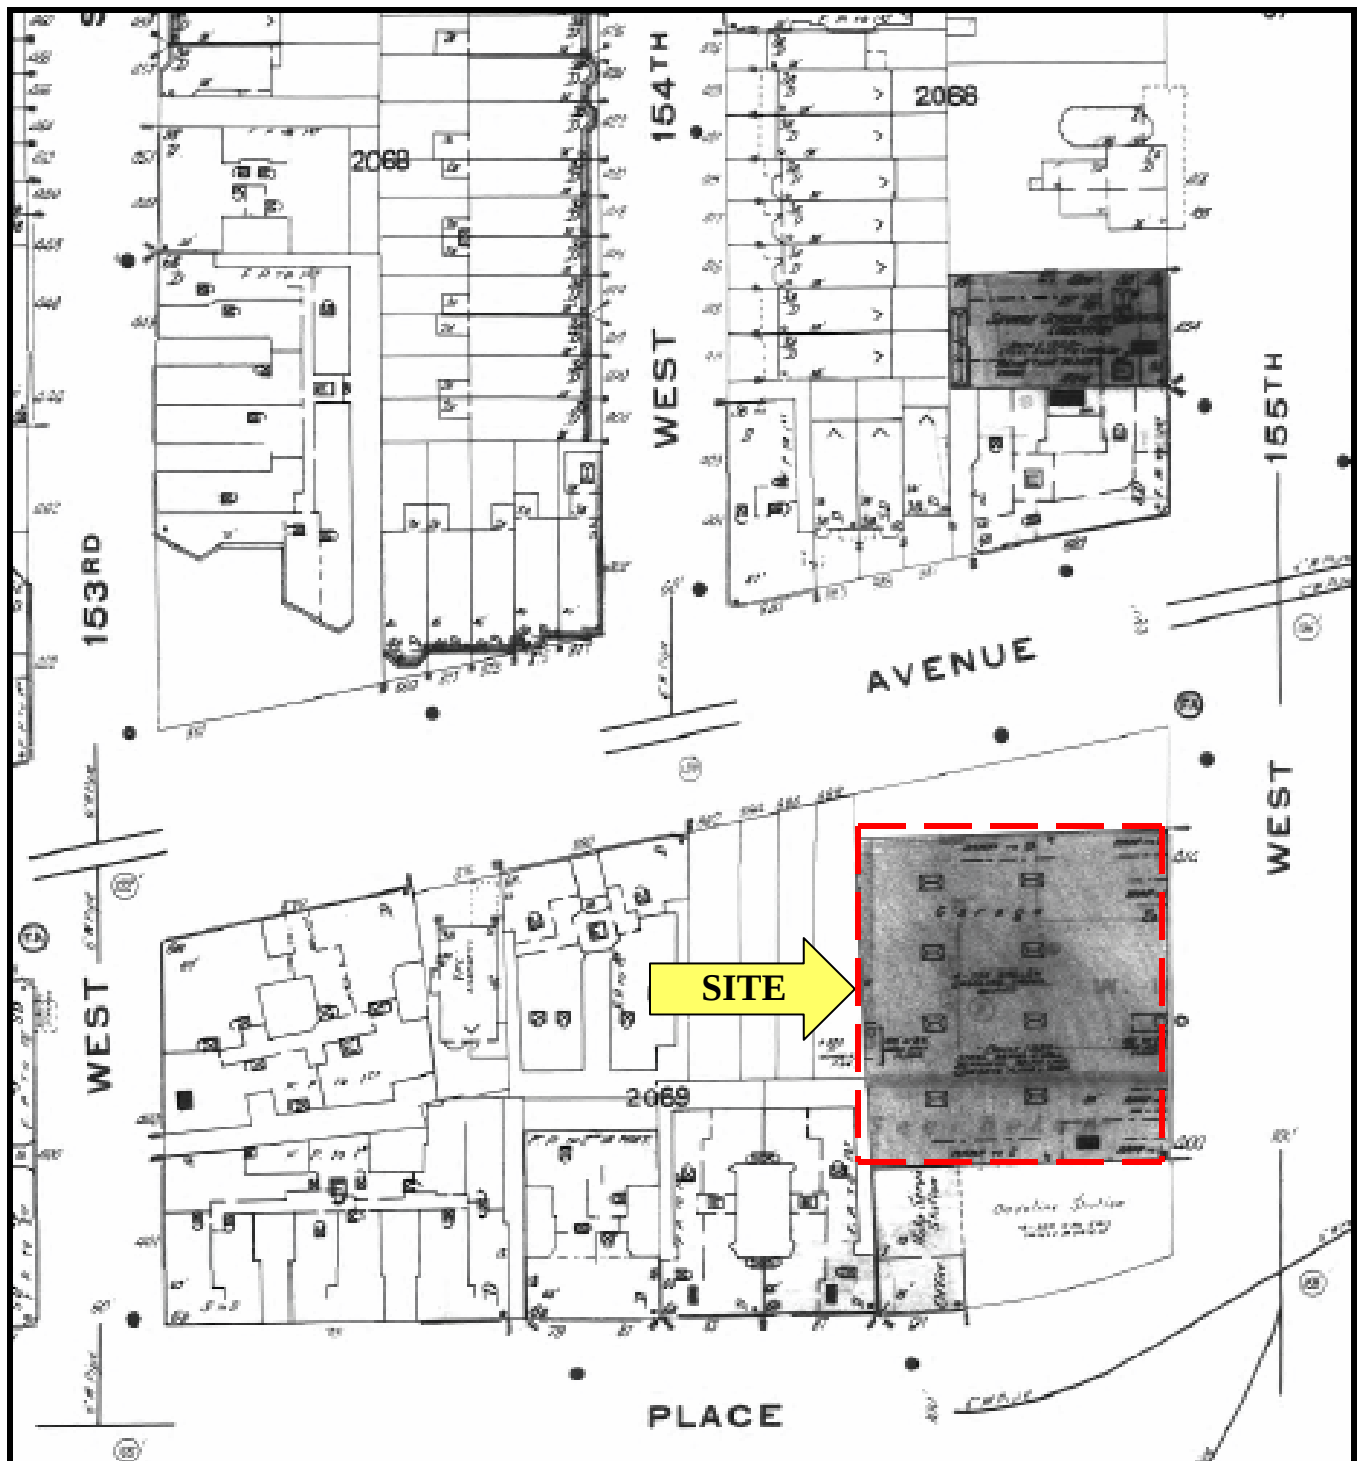

104 East 25th Street, 10th Floor
New York, NY 10010-2917
(212) 353-8280 Fax (212) 979-8447

EDR: Environmental Data Resources
(The Sanborn Library, LLC)


APPENDIX G- HISTORICAL SANBORN MAPS 1939


CLIENT: Broadway Housing Communities

SITE: 414 West 155th Street
New York, NY 10032

ATC PROJECT #: 015.26789.0002

SCALE: Not to Scale

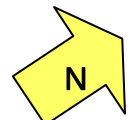

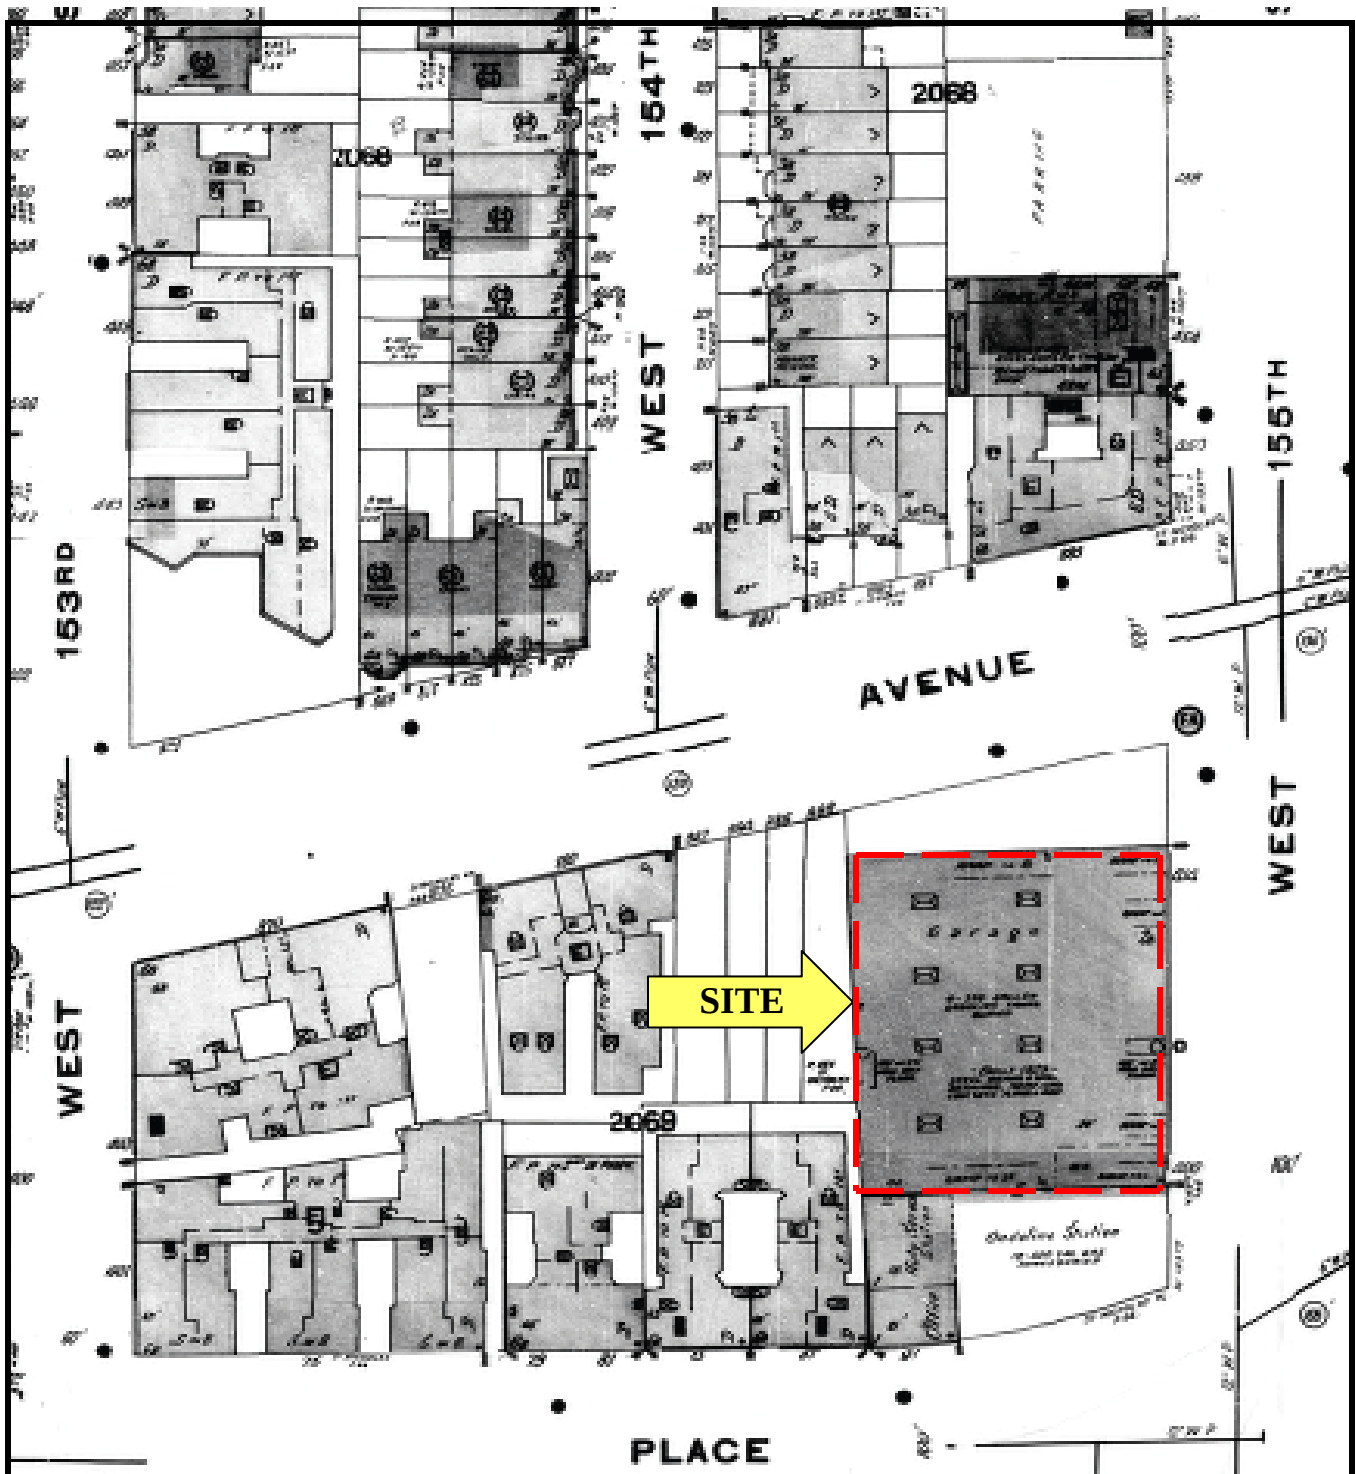

104 East 25th Street, 10th Floor
New York, NY 10010-2917
(212) 353-8280 Fax (212) 979-8447

EDR: Environmental Data Resources
(The Sanborn Library, LLC)


APPENDIX G- HISTORICAL SANBORN MAPS 1950


CLIENT: Broadway Housing Communities

SITE: 414 West 155th Street
New York, NY 10032

ATC PROJECT #: 015.26789.0002

SCALE: Not to Scale

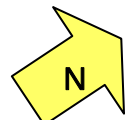

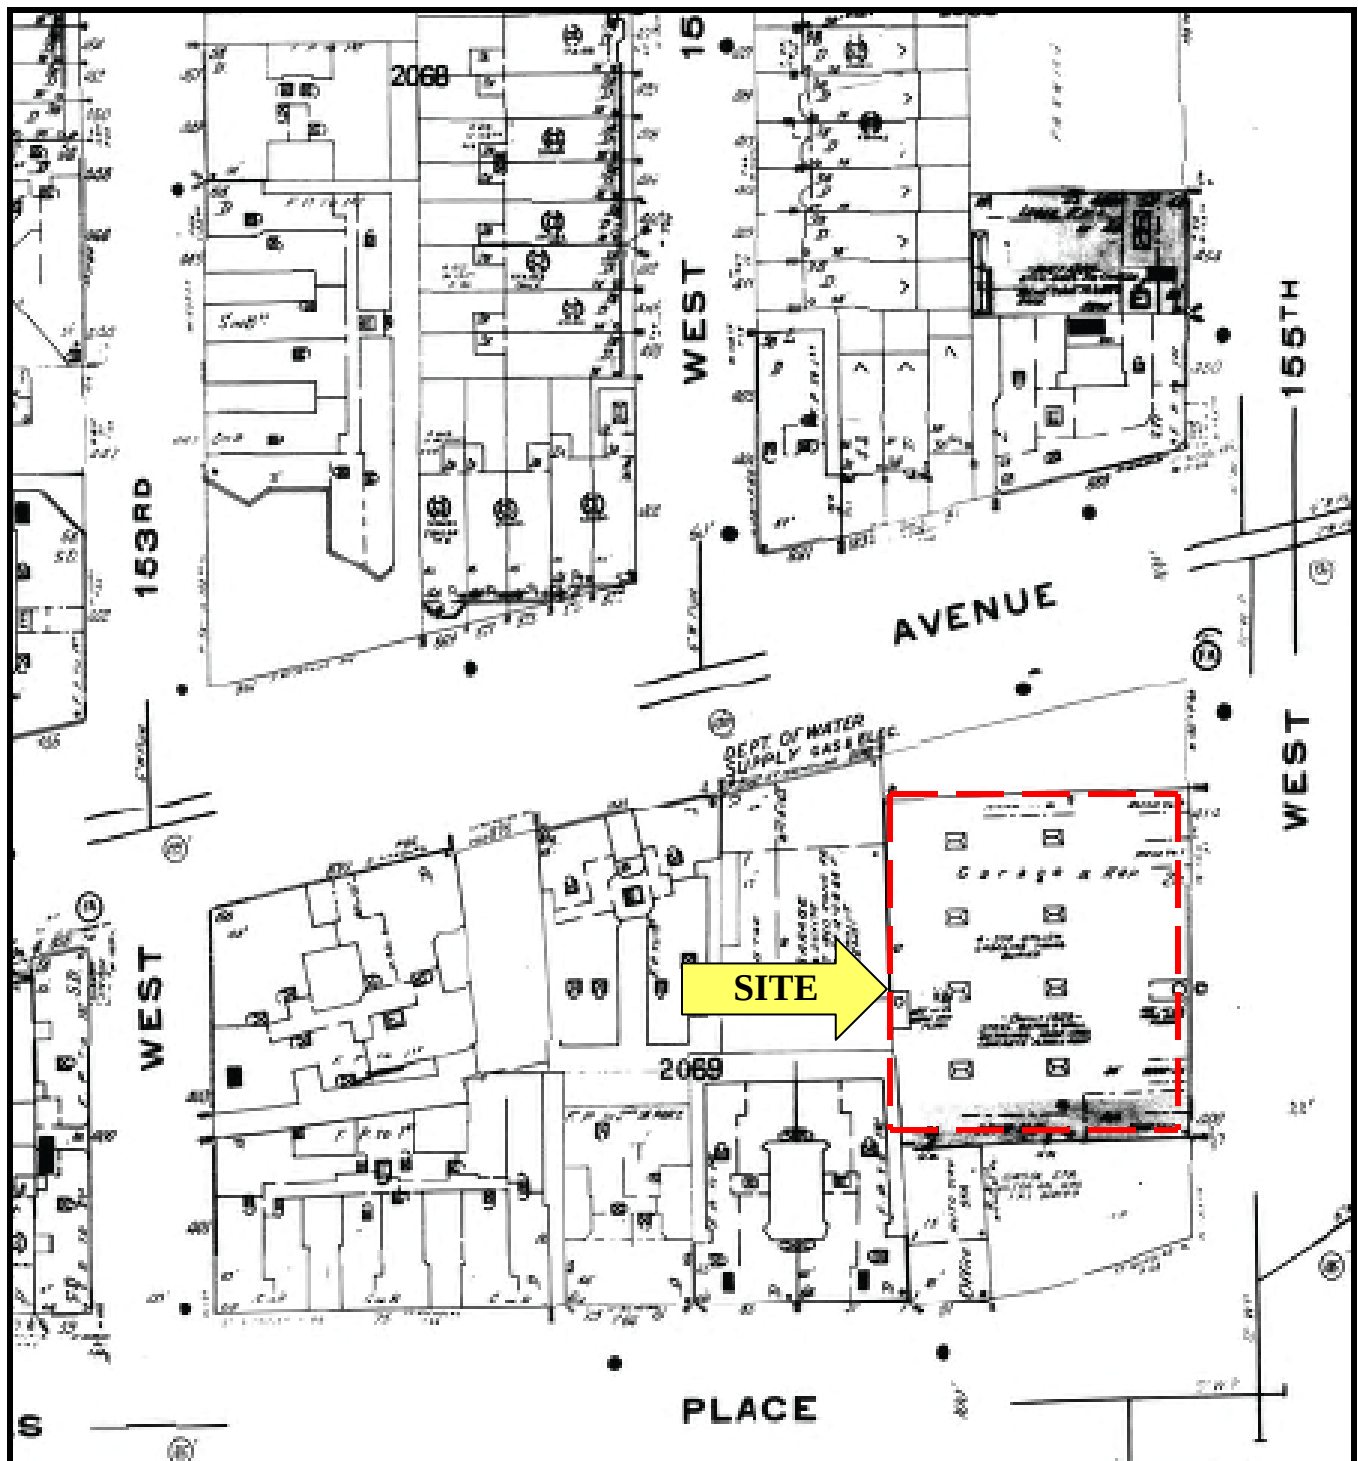



104 East 25th Street, 10th Floor
New York, NY 10010-2917
(212) 353-8280 Fax (212) 979-8447

EDR: Environmental Data Resources
(The Sanborn Library, LLC)

APPENDIX G- HISTORICAL SANBORN MAPS 1968

CLIENT: Broadway Housing Communities
SITE: 414 West 155th Street
New York, NY 10032
ATC PROJECT #: 015.26789.0002
SCALE: Not to Scale

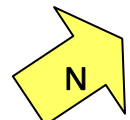

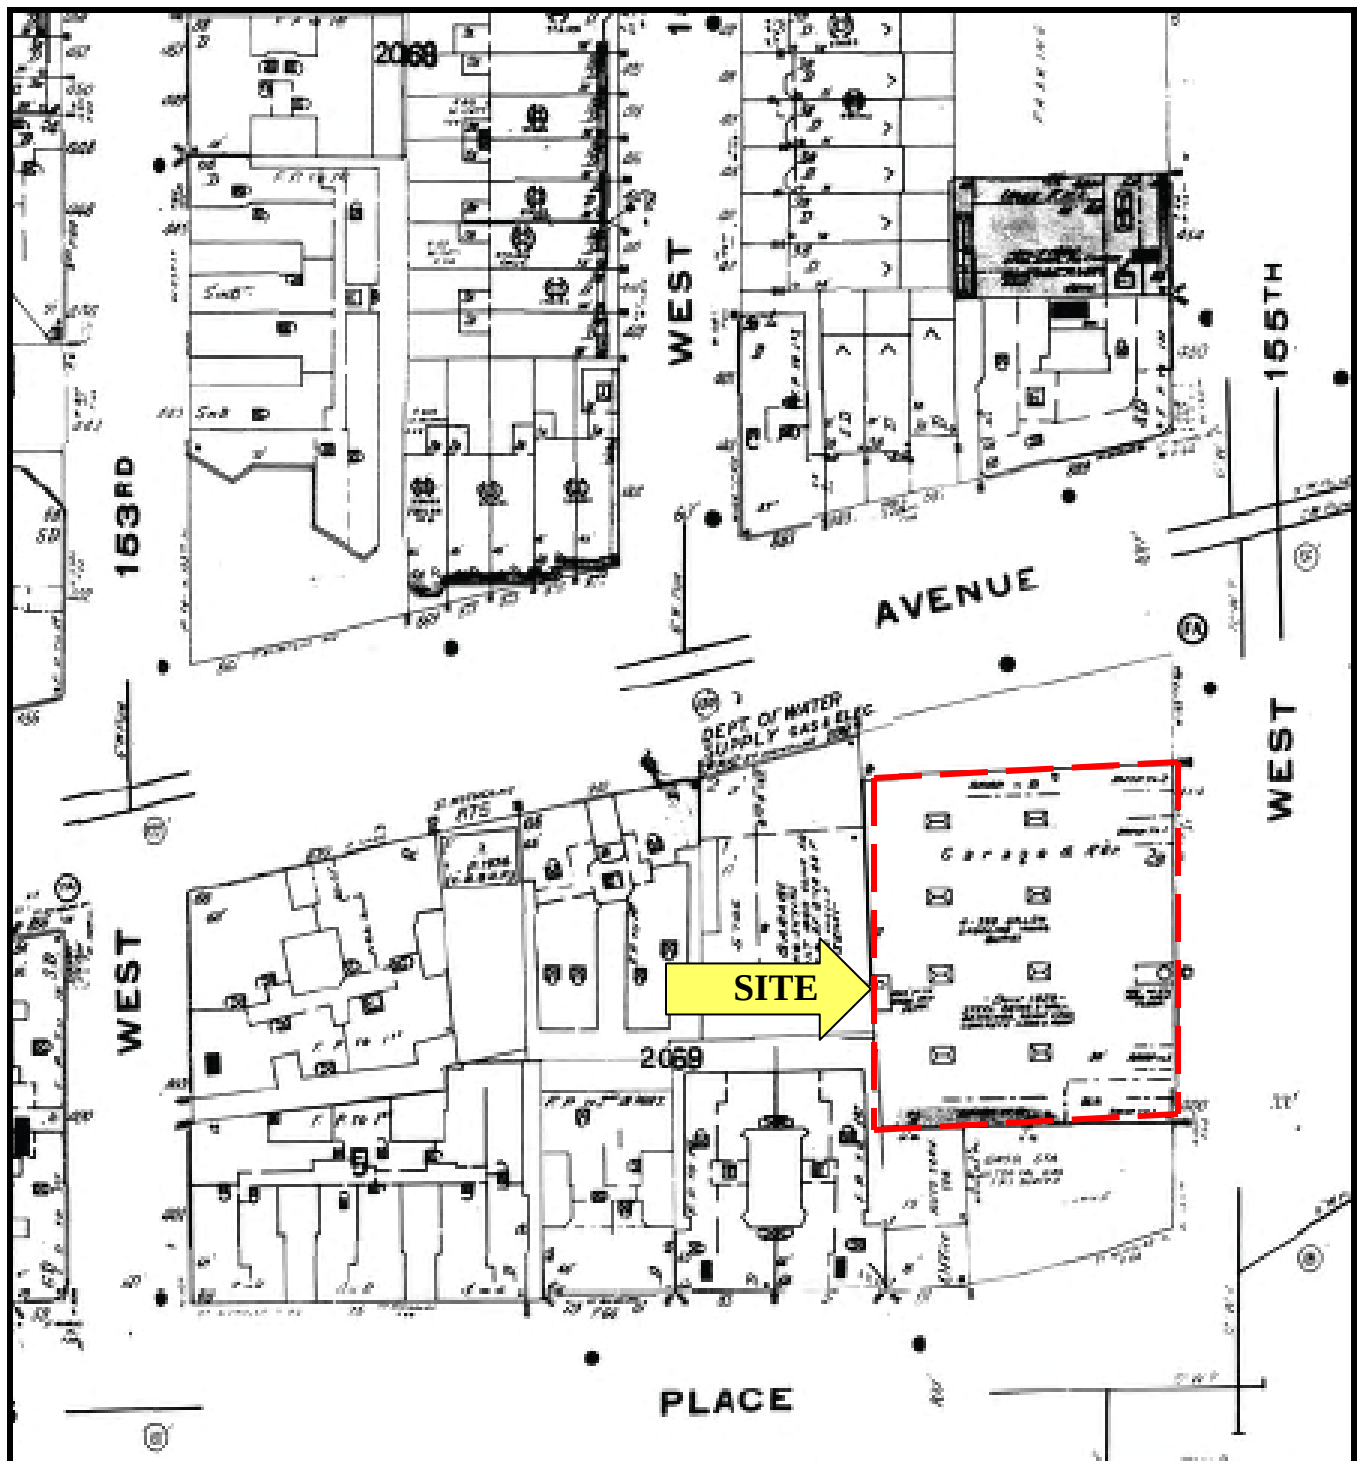



ASSOCIATES INC.
104 East 25th Street, 10th Floor
New York, NY 10010-2917
(212) 353-8280 Fax (212) 979-8447

EDR: Environmental Data Resources
(The Sanborn Library, LLC)

APPENDIX G- HISTORICAL SANBORN MAPS 1976

CLIENT: Broadway Housing Communities
SITE: 414 West 155th Street
New York, NY 10032
ATC PROJECT #: 015.26789.0002
SCALE: Not to Scale

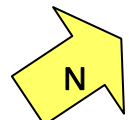

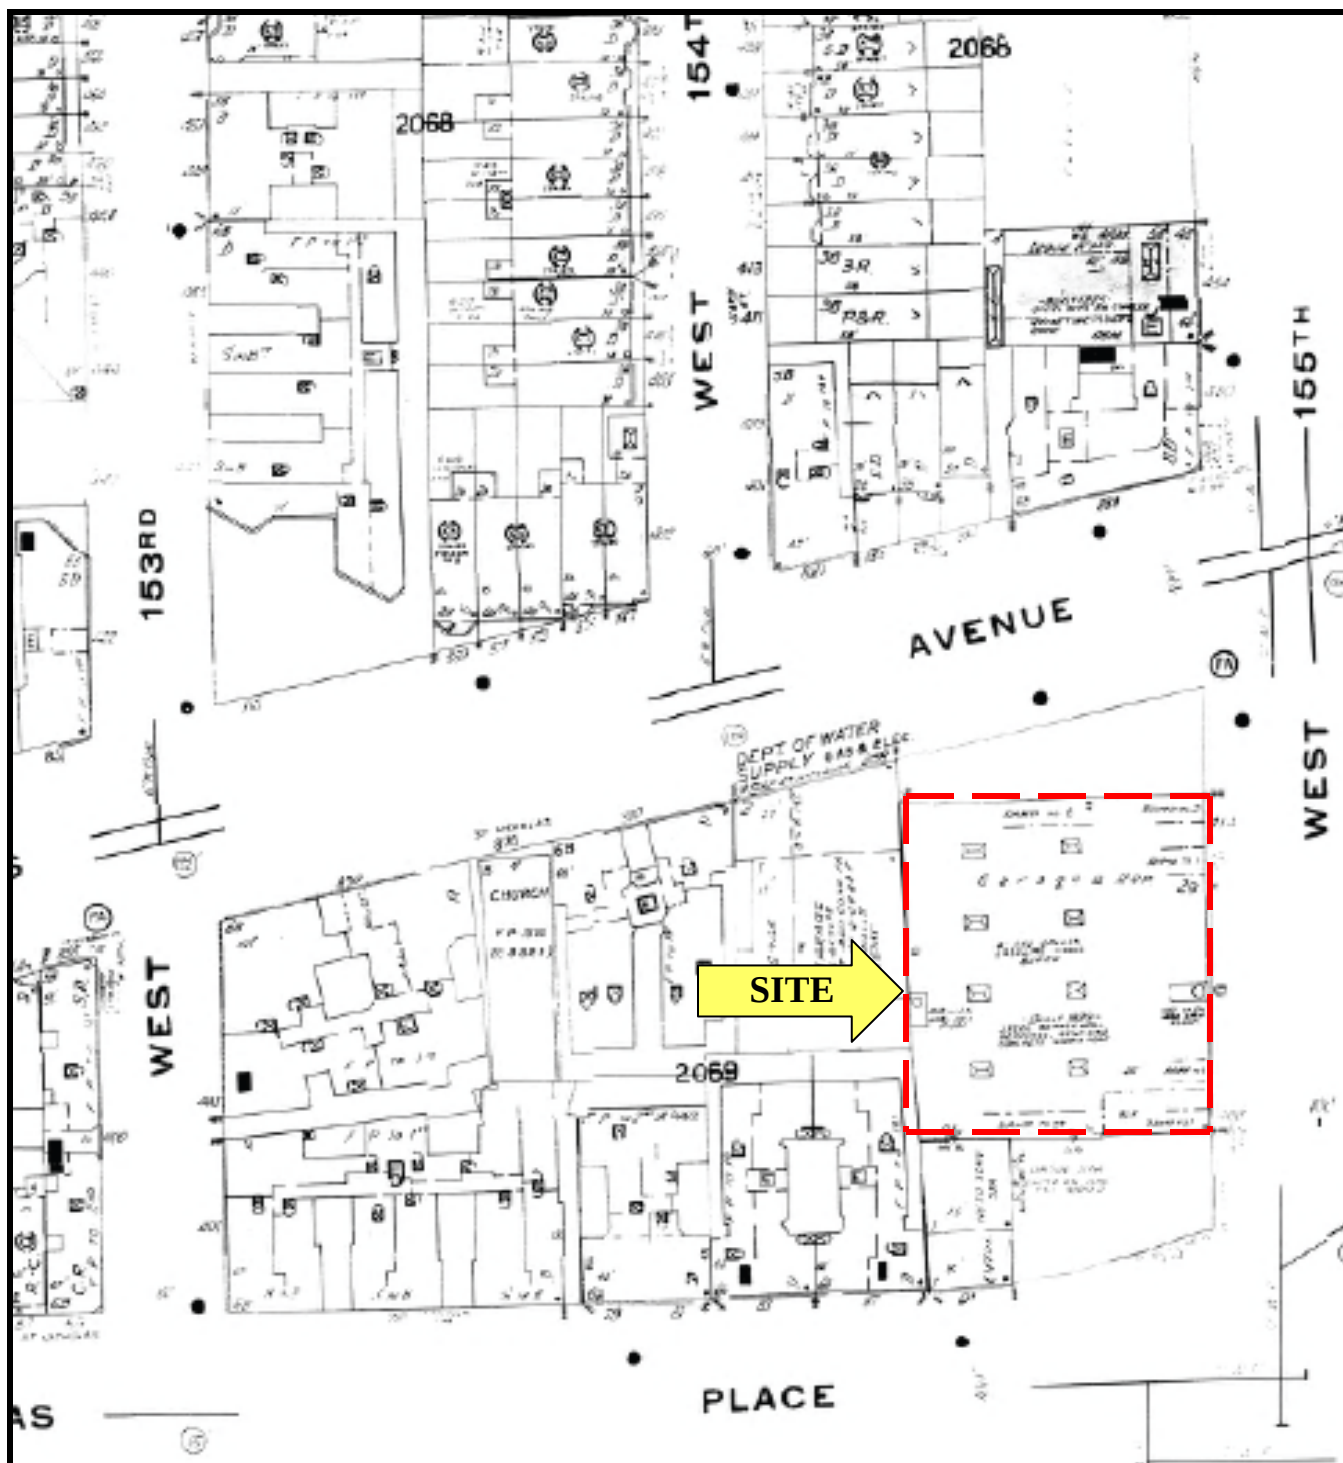


104 East 25th Street, 10th Floor
New York, NY 10010-2917
(212) 353-8280 Fax (212) 979-8447

EDR: Environmental Data Resources
(The Sanborn Library, LLC)

APPENDIX G- HISTORICAL SANBORN MAPS 1981

CLIENT: Broadway Housing Communities
SITE: 414 West 155th Street
New York, NY 10032
ATC PROJECT #: 015.26789.0002
SCALE: Not to Scale



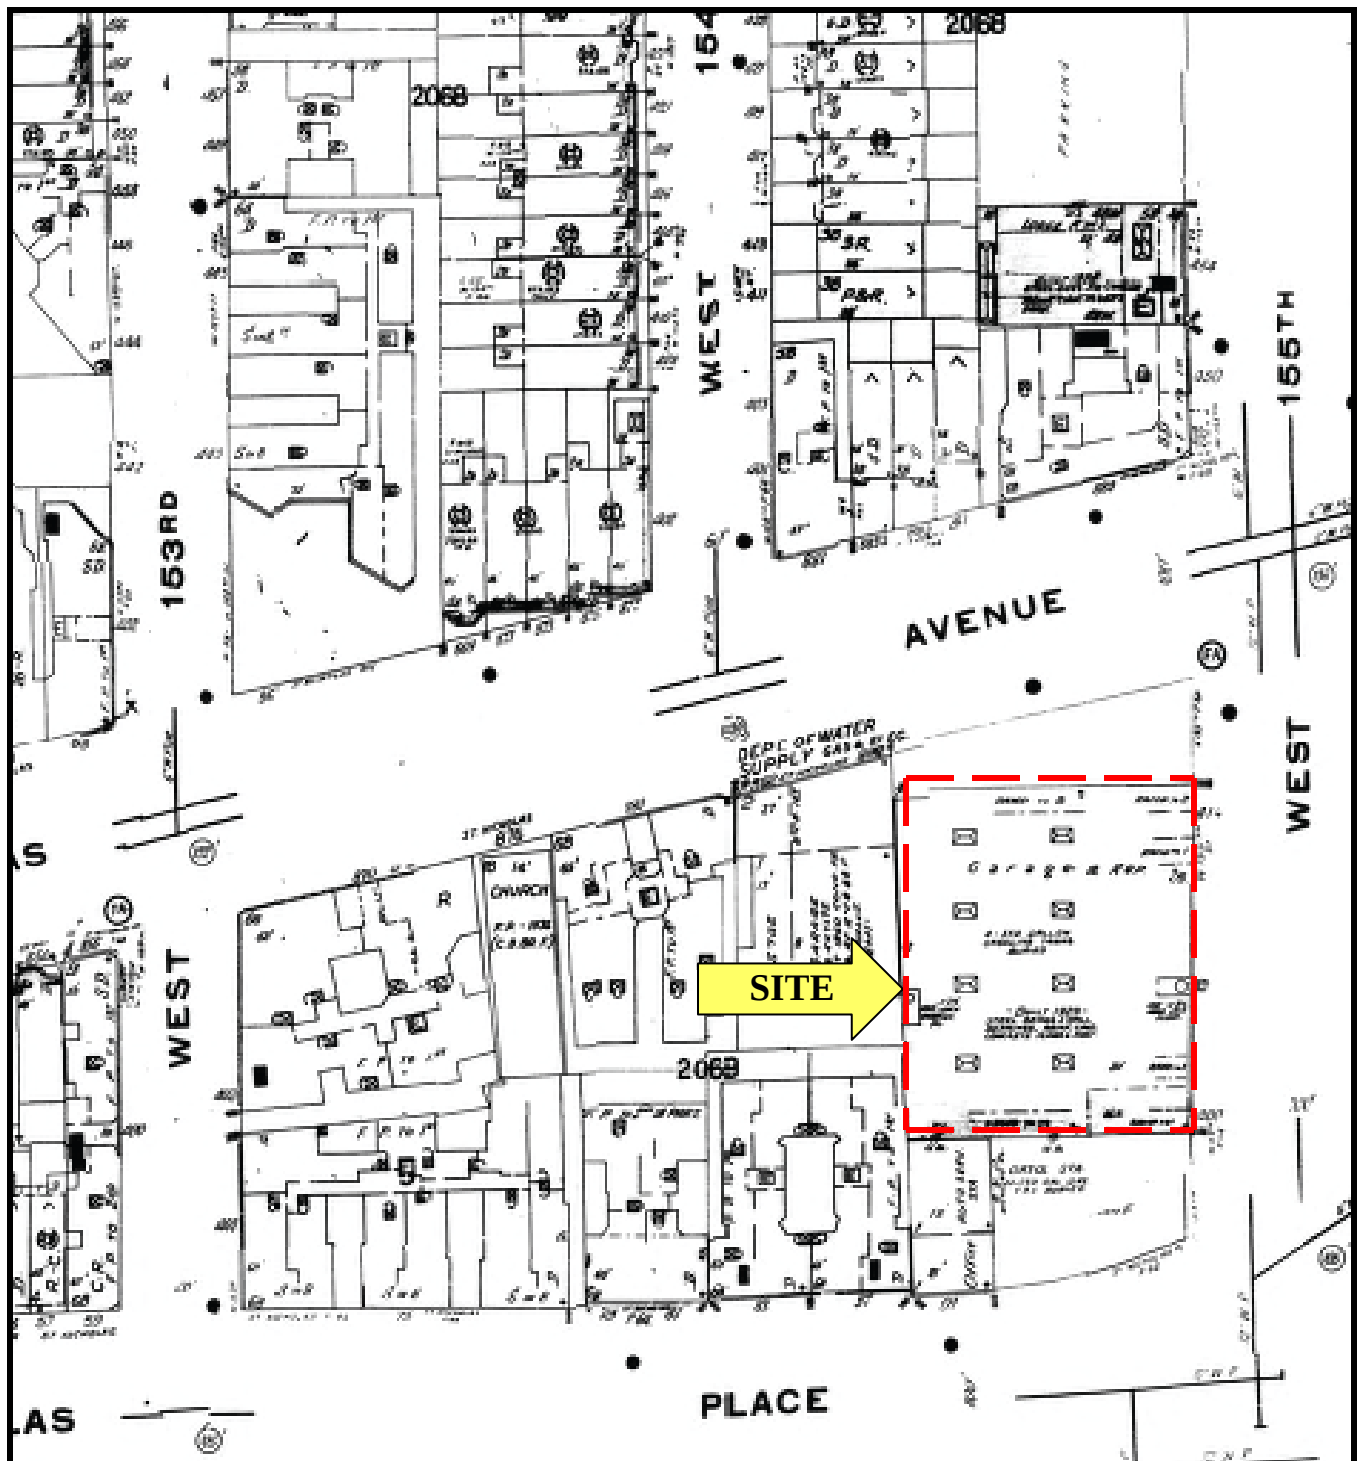

104 East 25th Street, 10th Floor
New York, NY 10010-2917
(212) 353-8280 Fax (212) 979-8447

EDR: Environmental Data Resources
(The Sanborn Library, LLC)


APPENDIX G- HISTORICAL SANBORN MAPS 1986


CLIENT: Broadway Housing Communities

SITE: 414 West 155th Street
New York, NY 10032

ATC PROJECT #: 015.26789.0002

SCALE: Not to Scale

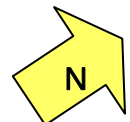

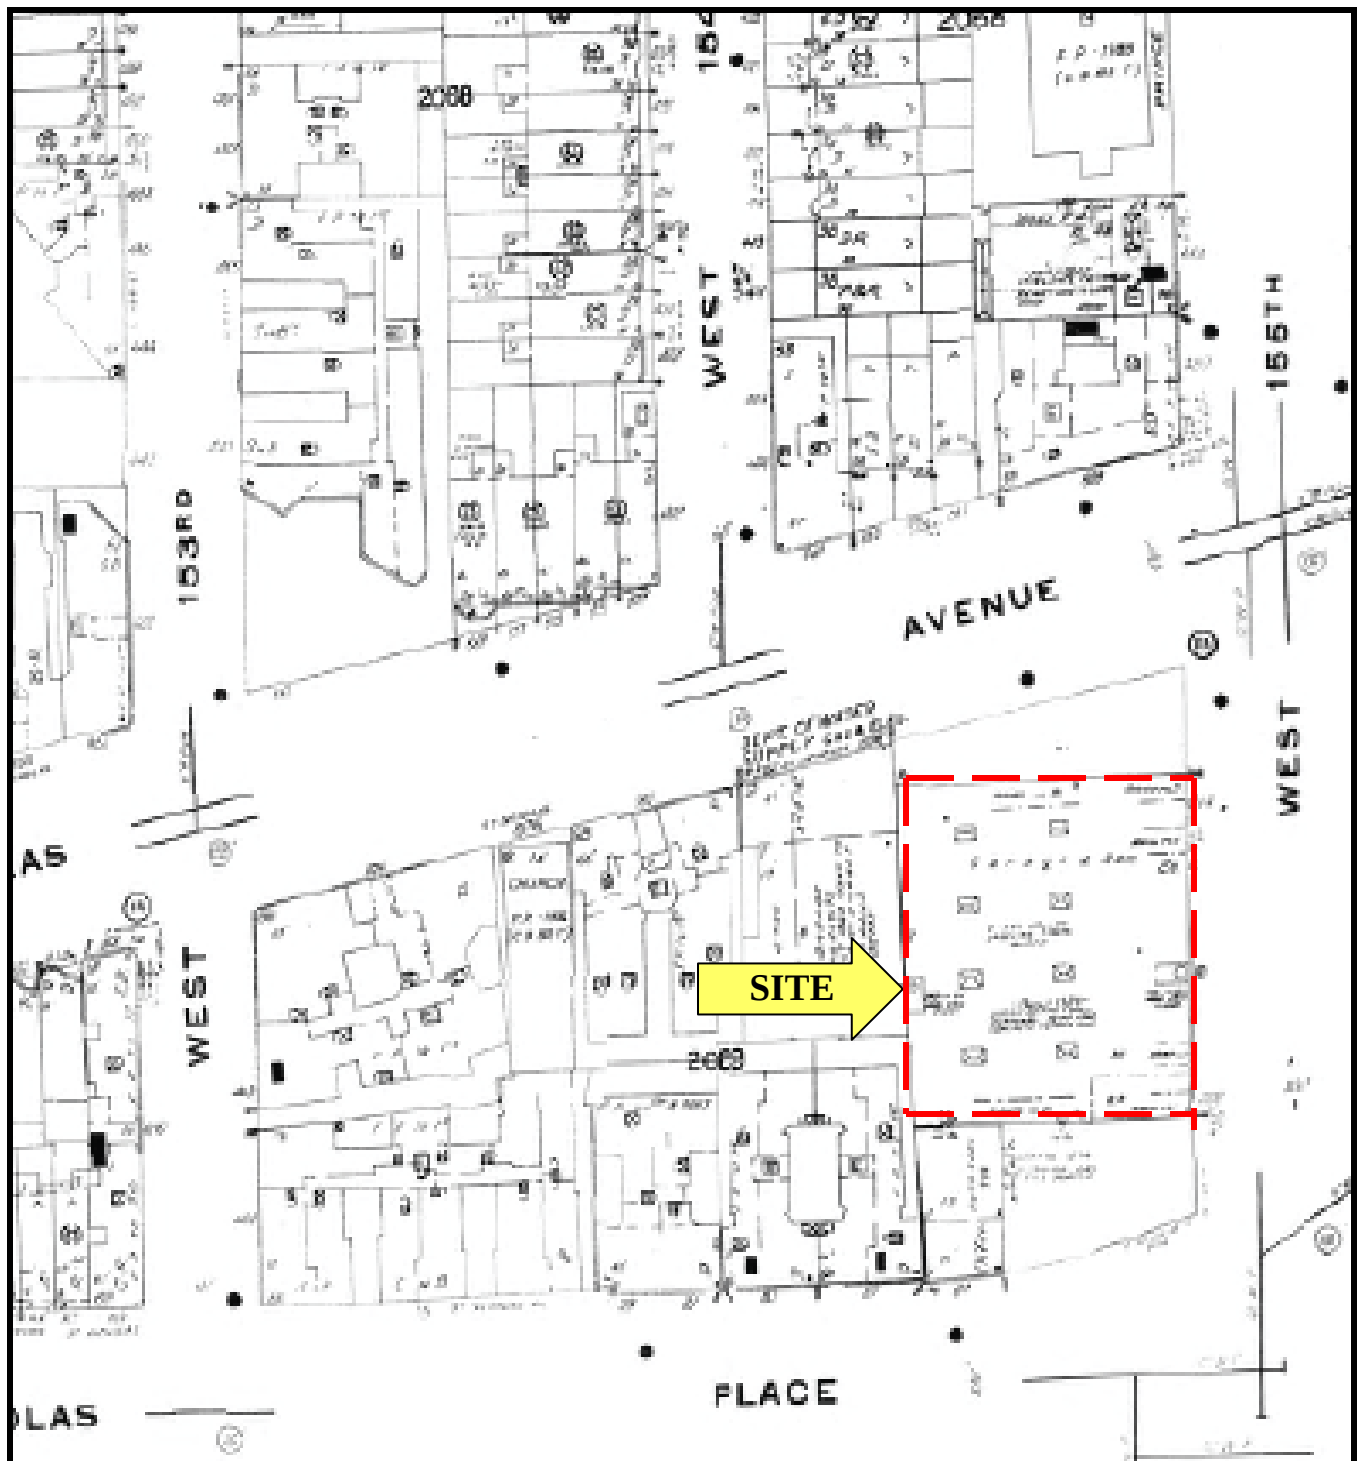

104 East 25th Street, 10th Floor
New York, NY 10010-2917
(212) 353-8280 Fax (212) 979-8447

EDR: Environmental Data Resources
(The Sanborn Library, LLC)


APPENDIX G- HISTORICAL SANBORN MAPS 1911


CLIENT: Broadway Housing Communities

SITE: 414 West 155th Street
New York, NY 10032

ATC PROJECT #: 015.26789.0002

SCALE: Not to Scale

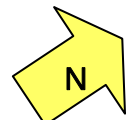

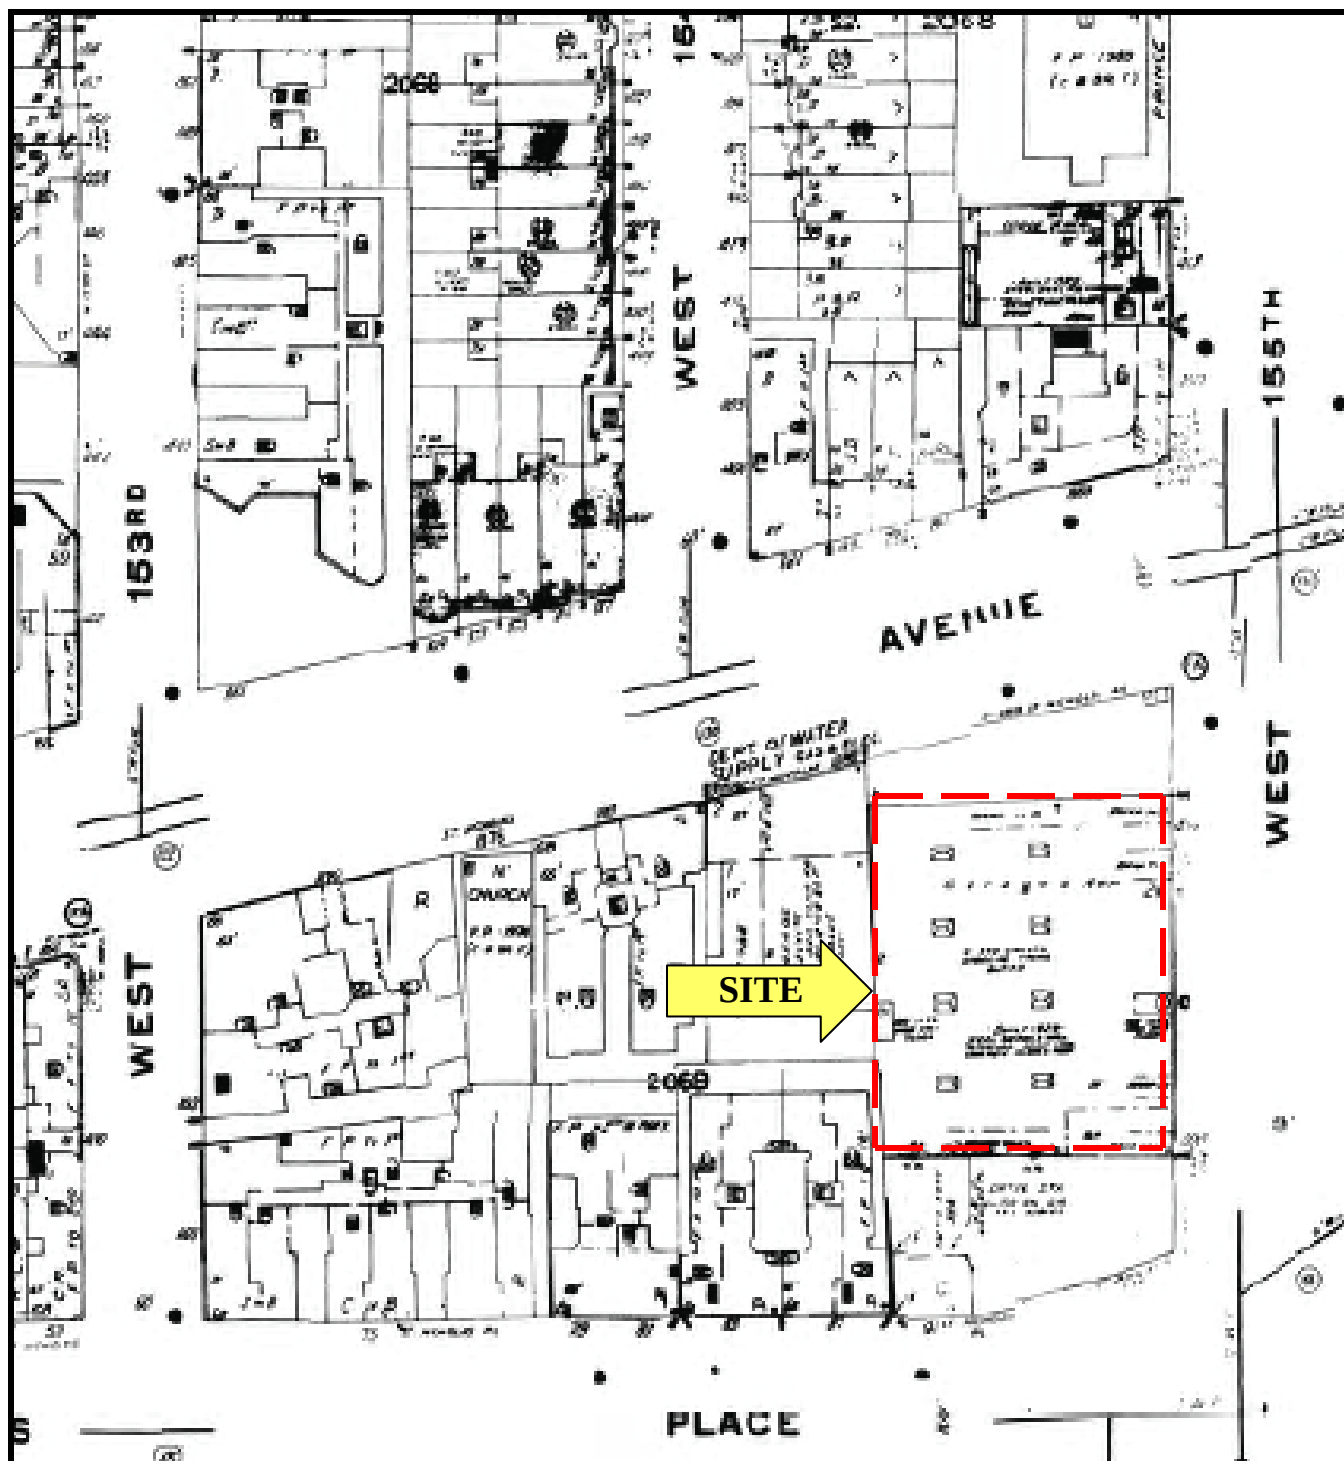

ASSOCIATES INC.
104 East 25th Street, 10th Floor
New York, NY 10010-2917
(212) 353-8280 Fax (212) 979-8447

EDR: Environmental Data Resources
(The Sanborn Library, LLC)

APPENDIX G- HISTORICAL SANBORN MAPS 1996

CLIENT: Broadway Housing Communities
SITE: 414 West 155th Street
New York, NY 10032
ATC PROJECT #: 015.26789.0002
SCALE: Not to Scale





EDR® Environmental
Data Resources Inc

The EDR-City Directory *Abstract*

**414 West 155th Street
414 West 155th Street
New York, NY 10032**

Inquiry Number: 2077001.4

Tuesday, November 13, 2007

The Standard in Environmental Risk Information

**440 Wheelers Farms Road
Milford, Connecticut 06461**

Nationwide Customer Service

Telephone: 1-800-352-0050
Fax: 1-800-231-6802
Internet: www.edrnet.com

EDR City Directory Abstract

Environmental Data Resources, Inc.'s (EDR) City Directory Abstract is a screening report designed to assist environmental professionals in evaluating potential liability on a target property resulting from past activities. EDR's City Directory Abstract includes a search and abstract of available city directory data. For each address, the directory lists the name of the corresponding occupant at five year intervals.

Thank you for your business.

Please contact EDR at 1-800-352-0050
with any questions or comments.

Disclaimer - Copyright and Trademark Notice

This Report contains certain information obtained from a variety of public and other sources reasonably available to Environmental Data Resources, Inc. It cannot be concluded from this Report that coverage information for the target and surrounding properties does not exist from other sources. **NO WARRANTY EXPRESSED OR IMPLIED, IS MADE WHATSOEVER IN CONNECTION WITH THIS REPORT. ENVIRONMENTAL DATA RESOURCES, INC. SPECIFICALLY DISCLAIMS THE MAKING OF ANY SUCH WARRANTIES, INCLUDING WITHOUT LIMITATION, MERCHANTABILITY OR FITNESS FOR A PARTICULAR USE OR PURPOSE. ALL RISK IS ASSUMED BY THE USER. IN NO EVENT SHALL ENVIRONMENTAL DATA RESOURCES, INC. BE LIABLE TO ANYONE, WHETHER ARISING OUT OF ERRORS OR OMISSIONS, NEGLIGENCE, ACCIDENT OR ANY OTHER CAUSE, FOR ANY LOSS OR DAMAGE, INCLUDING, WITHOUT LIMITATION, SPECIAL, INCIDENTAL, CONSEQUENTIAL, OR EXEMPLARY DAMAGES. ANY LIABILITY ON THE PART OF ENVIRONMENTAL DATA RESOURCES, INC. IS STRICTLY LIMITED TO A REFUND OF THE AMOUNT PAID FOR THIS REPORT.** Purchaser accepts this Report "AS IS". Any analyses, estimates, ratings, environmental risk levels or risk codes provided in this Report are provided for illustrative purposes only, and are not intended to provide, nor should they be interpreted as providing any facts regarding, or prediction or forecast of, any environmental risk for any property. Only a Phase I Environmental Site Assessment performed by an environmental professional can provide information regarding the environmental risk for any property. Additionally, the information provided in this Report is not to be construed as legal advice.

Copyright 2007 by Environmental Data Resources, Inc. All rights reserved. Reproduction in any media or format, in whole or in part, of any report or map of Environmental Data Resources, Inc. or its affiliates is prohibited without prior written permission.

EDR and its logos (including Sanborn and Sanborn Map) are trademarks of Environmental Data Resources, Inc. or its affiliates. All other trademarks used herein are the property of their respective owners.

SUMMARY

▪ ***City Directories:***

Business directories including city, cross reference and telephone directories were reviewed, if available, at approximately five year intervals for the years spanning 1920 through 2000. (These years are not necessarily inclusive.) A summary of the information obtained is provided in the text of this report.

This report compiles information by geocoding the subject properties (that is, plotting the latitude and longitude for such subject properties and obtaining data concerning properties within 100.32 Feet of the subject properties). There is no warranty or guarantee that geocoding will report or list all properties within the specified radius of the subject properties and any such warranty or guarantee is expressly disclaimed. Accordingly, some properties within the aforementioned radius and the information concerning those properties may not be referenced in this report.

Date EDR Searched Historical Sources: November 13, 2007

Target Property:

414 West 155th Street
New York, NY 10032

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1920	<u>**W 155TH**</u> CAMPBELL STEPH GARAGE (414)	R. L. Polk & Co.
1923	Address Not Listed in Research Source	R. L. Polk & Co.
1927	<u>**W 155TH**</u> SPEEDWAY AUTO EXCH CO (414)	New York Telephone
	<u>**W 155 ST**</u> SPEEDWAY AUTO EXCH CO (414)	New York Telephone
1931	Address Not Listed in Research Source	Manhattan and Bronx Directory Publishing Company Residential Directory
1934	<u>**W 155TH**</u> BIENSTOCK HARRY MGR STORES BLDG CO INC (414) BIENSTOCK IRVING SEC STORES BLDG CO INC (414) BIENSTOCK MORRIS PRES STORES BLDG CO INC (414) DAVIS BENJ HLPR STORES BUILDING CO INC (414) GADKE WALTER HLPR STORES BLDG CO INC (414) ONE HUNDRED FIFTY-FIFTH ST GARAGE INC (NY IRVING BIENANSTOCK (414) STORES BUILDING CO INC MORRIS BIENSTOCK PRES IRVING BIENSTO (414)	R. L. Polk & Co.
1938	Address Not Listed in Research Source	New York Telephone
1942	Address Not Listed in Research Source	New York Telephone
1947	Address Not Listed in Research Source	New York Telephone
1950	Address Not Listed in Research Source	New York Telephone
1956	<u>**W 155 ST**</u> CHRIS AUTO REPRS (414)	New York Telephone
1958	Address Not Listed in Research Source	New York Telephone
1963	Address Not Listed in Research Source	New York Telephone

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1968	Address Not Listed in Research Source	New York Telephone
1973	Address Not Listed in Research Source	New York Telephone
1978	Address Not Listed in Research Source	New York Telephone
1983	Address Not Listed in Research Source	New York Telephone
1988	Address Not Listed in Research Source	NYNEX Telephone
1993	<u>**W 155 ST**</u> DAN LEARY (414)	NYNEX Telephone
1998	Address Not Listed in Research Source	NYNEX Telephone
2000	Address Not Listed in Research Source	Cole Information Services

Adjoining Properties

SURROUNDING

Multiple Addresses
New York, NY 10032

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1920	<u>**W 155TH**</u> BARRY HMA H (408) DANNEMANN HY F PRES CONVENT GARAGE INC H (418) COOK RAYMOND E LAW CLK R (419) DEGENHARDT W CONTR (433)	R. L. Polk & Co.
1923	Address Not Listed in Research Source	R. L. Polk & Co.
1927	<u>**W 155TH**</u> BINGHAM JOS A CIGARS (425)	New York Telephone
	<u>**W 155 ST**</u> BINGHAM JOS A CIGARS (425)	New York Telephone
1931	<u>**W 155TH**</u> JOHNSON ANNS (411) JOHNSON JOHN (411) OHANLON CATHERINE (411) OHANLON JAS (411)	Manhattan and Bronx Directory Publishing Company Residential Directory

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1931	(continued)	
	SCHULTZ FRED (413)	
	KIRK THOM J (420)	
	KNIGHT FLORENCE K (420)	
	REGAN MARTHA C (420)	
	MULLINEAUX EDW H (435)	
	<u>**E 155 ST**</u>	Manhattan and Bronx Directory Publishing Company Residential Directory
	BONOMOLO FRANK (431)	
	CARMODY MARTHA (431)	
1934	<u>**W 155TH**</u>	R. L. Polk & Co.
	MCCARTHY DANL PORTER R (409)	
	BRENNEN FRANK SL SMN H (417)	
	BAUMGARTNER JOHANN M REG NURSE (419)	
1938	<u>**W 155 ST**</u>	New York Telephone
	POLO GROUNDS GARAGE INC (410)	
	FERGUSEN W L (411)	
1942	Address Not Listed in Research Source	New York Telephone
1947	Address Not Listed in Research Source	New York Telephone
1950	Address Not Listed in Research Source	New York Telephone
1956	Address Not Listed in Research Source	New York Telephone
1958	<u>**W 155 ST**</u>	New York Telephone
	PQUET MABEL C (422)	
	MILLIGAN MIC (435)	
1963	Address Not Listed in Research Source	New York Telephone
1968	Address Not Listed in Research Source	New York Telephone
1973	Address Not Listed in Research Source	New York Telephone
1978	Address Not Listed in Research Source	New York Telephone
1983	Address Not Listed in Research Source	New York Telephone
1988	Address Not Listed in Research Source	NYNEX Telephone
1993	Address Not Listed in Research Source	NYNEX Telephone

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1998	Address Not Listed in Research Source	NYNEX Telephone
2000	Address Not Listed in Research Source	Cole Information Services

APPENDIX H
PRIOR REPORTS
(NONE PROVIDED)

APPENDIX I
RESUMES



BEDIA SARAY

Project Manager

EDUCATION

- 1993, BS, Engineering, University of Cukurova, Turkey
- 2002, MS, Environmental Technology, NY Institute of Technology

PROFESSIONAL SUMMARY

Ms. Saray is a Project Manager at ATC's New York Environmental Division and has 5 years experience conducting Phase I Environmental Assessments and Transaction Screens, Indoor Air Quality Investigations, asbestos and lead abatement inspections and soil/groundwater testing. Ms. Saray has in-depth knowledge of regulatory guidelines and compliance requirements (ASTM, USEPA, NYDEC and local agencies). Prior to joining ATC, Ms. Saray provided engineering services regarding management of water, chemicals, and plant nutrition to the agricultural industry in Karaman, Turkey.

PROFESSIONAL CERTIFICATIONS

- NYS DOL Asbestos Inspector, Project Monitor and Air Technician (#02-040221)

PROFESSIONAL EXPERIENCE

- **Environmental Site Assessments / Jones Lang LaSalle / New York.** Project Manager. Managed the coordination and draft report preparation of Phase I environmental assessments for the sale and acquisition of commercial and residential properties. Project activities included asbestos and lead based paint surveys and Phase I ESA for each site performed according to ASTM 1527 and 40CFR.312 AAI screening and additional remedial investigation activities associated with volatile organic compounds in the soil and groundwater.
- **Environmental Site Assessments / Community Preservation Corporation / New York.** Project Manager. Managed the coordination and draft report preparation of Phase I environmental assessments for the sale and acquisition of commercial and residential properties. Project activities included asbestos and lead based paint surveys and Phase I ESA for each site performed according to ASTM 1527 and 40CFR.312 AAI screening and additional remedial investigation activities associated with volatile organic compounds in the soil and groundwater.
- **Environmental Site Assessments / LeFrak Organization / New York.** Project Manager. Managed the coordination and draft report preparation of Phase I environmental assessments for the sale and acquisition of commercial and residential properties. Project activities included asbestos and lead based paint surveys and Phase I ESA for each site performed according to ASTM 1527 and 40CFR.312 AAI screening and additional remedial investigation activities associated with volatile organic compounds in the soil and groundwater.
- **Indoor Air Quality Assessments / Jones Lang LaSalle / New York.** Project Manager. Managed the field operations for air quality investigations and



assessments in response to water intrusion and possible microbial contamination at financial institution's New York City headquarters. Project activities included sampling, survey, oversight of mold remediation contractor and post remediation sampling.

- **Indoor Air Quality Assessments / A.T. Kearney / New York.** Project Manager. Managed the field operations for air quality investigations and assessments in response to water intrusion and possible microbial contamination. Project activities included sampling, survey, managed contractor selection process, oversight of mold remediation contractor and post remediation sampling.
- **Indoor Air Quality Assessments / Murray Hill Properties / New York.** Project Manager. Managed the field operations for bi-annual pro-active air quality investigations and assessments as part of due diligence and building maintenance. Project activities include visual observations and reporting.



MATTHEW MANKOVICH

Senior Project Manager

EDUCATION

1999 B.S., Natural Science, University of Pittsburgh at Johnstown

PROFESSIONAL REGISTRATION

- Current OSHA Approved Hazardous Waste Operations Health and Safety Training (40 Hrs and 8 Hr Annual Refreshers)
- Long Island Rail Road (LIRR) Safety Training, 2004

PROFESSIONAL SUMMARY

Mr. Mankovich is a Senior Project Manager with more than six (6) years of broad-based professional experience in environmental services, including site assessments, investigations, and remediation for private and public sector clients. Technical experience includes site assessments and investigations, remedial investigation, environmental management and compliance, and due diligence support.

PROFESSIONAL EXPERIENCE

- **Environmental Services / NYC School Construction Authority / New York.** Senior Environmental Scientist – Responsible for project management and/or preparation of Phase I Environmental Site Assessments (ESAs), Phase II Environmental Site Investigations (ESIs) and other environmental assessments and investigations. The properties include industrial facilities, educational and commercial properties. The projects were conducted in accordance with current ASTM and NYCSCA standards to investigate the potential for on-site or off-site environmental concerns for liability and suitability for use as a school. Responsibilities include site reconnaissance, local and county agency interviews, geological and hydrological data review, historical data review, State and Federal database reviews, and report preparation, soil, groundwater, indoor air quality and soil gas investigations, UST/AST investigations, environmental oversight, and report preparation.
- **Phase I and II Environmental Site Assessments / NYC Transit Authority / New York -- Number 7 Subway Extension — Hudson Yards Rezoning and Development Program.** Environmental Scientist. Prepared Phase I ESAs and Phase II ESIs in accordance with current ASTM and client standards. Phase II ESI included collection of soil and groundwater samples for laboratory analysis. Results and interpretations were used to prepare EIS Chapter.
- **Phase I Environmental Site Assessments / NYC Department of Economic**

Development Corporation / New York. Environmental Scientist – Prepared Phase I ESAs in accordance with current ASTM and client standards. Results and interpretations were used to prepare EIS Chapter for the Stapleton Waterfront Development Plan EIS.

- **Phase I and II Environmental Site Assessments / NYC Department of Design and Construction / New York.** Senior Environmental Scientist – Phase I Environmental Site Assessments (ESAs), Phase II Environmental Site Investigations (ESIs) and other environmental assessments and investigations in accordance with current ASTM and client standards.
- **Phase I and II Environmental Site Assessments and NEPA Surveys, New York and New Jersey. Verizon, T-Mobile, Sprint and private clients.** Environmental Scientist. Performed Phase I ESAs and Phase II ESIs in accordance with current ASTM standards for industrial facilities, and commercial and residential properties and NEPA Surveys.
- **Construction Testing and Inspection Services, Pittsburgh, Pennsylvania. Public and Private clients.** Field Technician/Project Manager. Provided on-site inspection and construction documentation for commercial and residential development projects throughout Western Pennsylvania. Responsibilities include: coordination between contractor and client to ensure the project is on schedule; specification review for compliance enforcement; field testing of soil, concrete, asphalt, masonry, & steel; soil compaction and inspection; proofrolling inspection; data collection, field logs, data reduction and interpretation.

APPENDIX J
RECORDS OF COMMUNICATION

DEPARTMENT OF HOUSING AND BUILDINGS

BOROUGH OF **MANHATTAN**, CITY OF NEW YORKNo. **40818**Date **February 10, 1953**

CERTIFICATE OF OCCUPANCY

(Standard form adopted by the Board of Standards and Appeals and issued pursuant to Section 646 of the New York Charter, and Sections C.26-181.0 to C.26-187.0 inclusive Administrative Code 2.1.3.1. to 2.1.3.7. Building Code.)

This certificate supersedes C. O. No.

To the owner or owners of the building or premises:

THIS CERTIFIES that the ~~new~~-altered-~~existing~~-building-premises located at**91-99 St. Nicholas Place**Block **2069** Lot **20**

, conforms substantially to the approved plans and specifications, and to the requirements of the building code and all other laws and ordinances, and of the rules and regulations of the Board of Standards and Appeals, applicable to a building of its class and kind at the time the permit was issued; and

CERTIFIES FURTHER that, any provisions of Section 646F of the New York Charter have been complied with as certified by a report of the Fire Commissioner to the Borough Superintendent.

~~NEW~~ Alt. No.— **797-1951**Construction classification— **Class 1 fireproof**Occupancy classification— **Commercial Bldg.** Height **1** stories, **15.5** feet.Date of completion— **February 10, 1953** Located in **Business & Residence** Use District.**B** Area **1½** Height Zone at time of issuance of permit **876-1952**

This certificate is issued subject to the limitations hereinafter specified and to the following resolutions of the Board of Standards and Appeals: (Calendar numbers to be inserted here)

1190-27-52

PERMISSIBLE USE AND OCCUPANCY

STORY	LIVE LOADS Lbs. per Sq. Ft.	PERSONS ACCOMMODATED			USE
		MALE	FEMALE	TOTAL	
1st story	on ground	2		2	Gasoline Service Station.
					Gasoline tank installed approved by Fire Department April 17, 1952.
					Fuel Oil installation approved by Fire Department February 4, 1953.

**NO CHANGES OF USE OR OCCUPANCY NOT CONSISTENT WITH THIS CERTIFICATE SHALL
BE MADE UNLESS FIRST APPROVED BY THE BOROUGH SUPERINTENDENT**

Unless an approval for the same has been obtained from the Borough Superintendent, no change or rearrangement in the structural parts of the building, or affecting the light and ventilation of any part thereof, or in the exit facilities, shall be made; no enlargement, whether by extending on any side or by increasing in height shall be made; nor shall the building be moved from one location or position to another; nor shall there be any reduction or diminution of the area of the lot or plot on which the building is located.

The building or any part thereof shall not be used for any purpose other than that for which it is certified.

The superimposed, uniformly distributed loads, or concentrated loads producing the same stresses in the construction in any story shall not exceed the live loads specified on reverse side; the number of persons of either sex in any story shall not exceed that specified when sex is indicated, nor shall the aggregate number of persons in any story exceed the specified total; and the use to which any story may be put shall be restricted to that fixed by this certificate except as specifically stated.

This certificate does not in any way relieve the owner or owners or any other person or persons in possession or control of the building, or any part thereof from obtaining such other permits, licenses or approvals as may be prescribed by law for the uses or purposes for which the building is designed or intended; nor from obtaining the special certificates required for the use and operation of elevators; nor from the installation of fire alarm systems where required by law; nor from complying with any lawful order for additional fire extinguishing appliances under the discretionary powers of the fire commissioner; nor from complying with any lawful order issued with the object of maintaining the building in a safe or lawful condition; nor from complying with any authorized direction to remove encroachments into a public highway or other public place, whether attached to or part of the building or not.

If this certificate is marked "Temporary", it is applicable only to those parts of the building indicated on its face, and certifies to the legal use and occupancy of only such parts of the building; it is subject to all the provisions and conditions applying to a final or permanent certificate; it is not applicable to any building under the jurisdiction of the Housing Division unless it is also approved and endorsed by them, and it must be replaced by a full certificate at the date of expiration.

If this certificate is for an existing building, erected prior to March 14, 1916, it has been duly inspected and it has been found to have been occupied or arranged to be occupied prior to March 14, 1916, as noted on the reverse side, and that on information and belief, since that date there has been no alteration or conversion to a use that changed its classification as defined in the Building Code, or that would necessitate compliance with some special requirement or with the State Labor Law or any other law or ordinance; that there are no notices of violations or orders pending in the Department of Housing and Buildings at this time; that Section 646F of the New York City Charter has been complied with as certified by a report of the Fire Commissioner to the Borough Superintendent, and that, so long as the building is not altered, except by permission of the Borough Superintendent, the existing use and occupancy may be continued.

"§ 646 F. No certificate of occupancy shall be issued for any building, structure, enclosure, place or premises wherein containers for combustibles, chemicals, explosives, inflammables and other dangerous substances, articles, compounds or mixtures are stored, or wherein automatic or other fire alarm systems or fire extinguishing equipment are required by law to be or are installed, until the fire commissioner has tested and inspected and has certified his approval in writing of the installation of such containers, systems or equipment to the Borough Superintendent of the borough in which the installation has been made. Such approval shall be recorded on the certificate of occupancy."

Additional copies of this certificate will be furnished to persons having an interest in the building or premises, upon payment of a fee of fifty cents per copy.

HVC CERTIFICATE OF OCCUPANCY No. 15260 1929

New York May 16, 1929.

known as 91-99, St. Nicholas Place-404-414 West, 155th Street
154th front

CERTIFIES FURTHER that the building is of **fireproof** construction within the meaning of the building code and may be used and occupied as a **business** building as hereinafter qualified, in a **residence and business** district under the building zone resolution, subject to all the privileges, requirements, limitations, and conditions prescribed by law or as hereinafter specified.

This certificate is issued to Stores Building Corp. Inc.,
463-7th Avenue, City

, for the owner of owners.

The superimposed, uniformly distributed loads, or their equivalent concentrated loads in any story shall not exceed the live loads specified above; the number of persons of either sex in any story shall not exceed that specified when sex is indicated, nor shall the aggregate number of persons in any story exceed the specified total; and the use to which any story may be put shall be restricted to that fixed by this certificate except as specifically stated.

The building or any part thereof shall not be used for any purpose other than that for which it is certified.

Unless specifically stated above, the building or any part thereof, if certified as a public building, shall not be used as a building in which persons are harbored to receive medical, charitable or other care or treatment, such as a hospital, asylum, etc., or in which persons are held or detained under legal restraint, such as a police station, jail, etc.; nor shall it be used as a motion picture theatre as defined in section 30, chapter 3, Code of Ordinances; nor as a theatre or opera house or other building intended to be used for theatrical or operatic purposes, or for public entertainment of any kind, for the accommodation of more than 300 persons.

Unless specifically stated above, the building or any part thereof, if certified as a residence building, shall not be used as a tenement house as defined in the tenement house law; nor shall it be used as any form of residence building having more than 15 sleeping rooms; nor shall it be used as a lodging house within the meaning of Sec. 1305 of the Greater New York Charter.

Unless specifically stated above, the building or any part thereof, if certified as a business building, shall not be used as a garage, motor vehicle repair shop or oil selling station as defined in section 1, chapter 10, Code of Ordinances; nor shall it be used for the generation or compression of acetylene; nor as a factory building as defined in the labor law; nor as a grain elevator; nor as a coal pocket.

Except as otherwise noted above, the building, or any part thereof, if located elsewhere than in an unrestricted district, shall not be used for any of the purposes enumerated in paragraph (a) of section 4 of the building zone resolution; nor for any trade, industry or use that is noxious or offensive by reason of the emission of odor, dust, smoke, gas or noise; nor for any kind of manufacturing not already prohibited, except that, if located in a business district, not more than twenty-five per cent. of the total floor space may be so used, or space equal to the area of the lot in any case.

Except as otherwise noted above, the building, if certified as a garage, may not be used for more than five cars on any portion of a street between two intersecting streets, in which portion there exists an exit from or an entrance to a public school, or in which portion there exists any hospital maintained as a charitable institution; and in no case within a distance of 200 feet from the nearest exit from or entrance to a public school; nor within two hundred feet of any hospital maintained as a charitable institution.

If the building has, at any time previous to the issuance of this certificate, been the subject of an appeal to the board of appeals or of a petition to the board of standards and appeals resulting in modification or variation of law or any lawful requirement, the construction and arrangement of the building as specified in the resolution granting such modification or variation, must be maintained, and all conditions imposed by either board must be observed.

No change or re-arrangement in the structural parts of the building, or affecting the lighting or ventilation of any part thereof, or in the exit facilities, shall be made; no enlargement, whether by extending on any side or by increasing in height shall be made; nor shall the building be moved from one location or position to another; nor shall there be any reduction or diminution of the area of the lot or plot on which the building is located, until an approval of the same has been obtained from the superintendent of buildings.

This certificate supersedes each and every previously issued certificate of occupancy for this building or any part thereof, and each and every such previously issued certificate shall be null and void; and this certificate in turn becomes null and void upon the issuance of any new lawful certificate.

This certificate does not in any way relieve the owner or owners, or any other person or persons in possession or control of the building, or any part thereof, from obtaining such other permits or licenses as may be prescribed by law for the uses or purposes for which the building is designed or intended; nor from complying with any lawful order issued with the object of maintaining the building in a safe or lawful condition; nor from complying with any authorized direction to remove encroachments into a public highway or other public place, whether attached to or part of the building or not.

This certificate does not authorize the use or operation of any elevator in the building without the special certificate required by section 563 of the building code.

If the building is or is required to be equipped with standpipes or other fire extinguishing or gas shut off appliances, this certificate is not complete until such standpipes or other appliances have been inspected by the fire department (or by the Tenement House Department, in the case of a gas shut off in a tenement house) and approved in writing, either in a separate certificate or by endorsement upon this certificate. (Space for such endorsement is provided on page 4 of this certificate.)

If this certificate is marked "Temporary," it is applicable only to those parts of the building indicated on its face, and certifies to the legal use and occupancy of only such parts of the building; it is subject to all the provisions and conditions applying to a final or permanent certificate; it is not applicable to a tenement house unless also approved by the tenement house commissioner; and it must be replaced by a full certificate as soon as the entire building is completed according to law and ready for occupancy.

The word "class" as used in this certificate refers to the classification of buildings in the building code (section 70).

This certificate is issued in accordance with the provisions of section 411-a of the Greater New York Charter and of section 5 of chapter 3 (Building Code) of the Code of Ordinances of the City of New York.

Examined. *cb*

[Signature]
Superintendent of Buildings, Borough of Manhattan.

Additional copies of this certificate will be issued, upon written request, to persons having a proprietary interest in the building.

New York State Department of Environmental Conservation
Regional Enforcement Coordinator, Region 2
7-40 21ST Street, Long Island City, NY 11101-5407
Phone: (718) 482-4507 • FAX: (718) 482-6729
Website: www.dec.state.ny.us



Alexander B. Grannis
Commissioner

November 27, 2007

FOIL # R2-07-1919

Bedia Saray/ATC Associates, Inc
212-353-8280
Fax 212-979-8447

RE: 3 Sites in Manhattan: - 414 W 155th St
- 89-91 St Nicholas Place 8805013 & 9503535
- 886 St Nicholas Ave 9710796 & 9504500

Dear Ms. Saray:

We are in receipt of your Foil request for the above referenced site. The Foil identification number assigned is R2-07-1919.

If for any reason you need to contact us again please use that number. When the programs are done gathering the files/information this office will contact you.

Please expect our response within 20 days from the date of this letter.

Sincerely yours,

Fawzy I. Abdelsadek, Ph.D., P.E.
Regional Enforcement Coordinator

New York State Department of Environmental Conservation
Regional Enforcement Coordinator, Region 2, Regional Direction
47-40 21st Street, Long Island City, NY 11101-5407
Phone: (718) 482-4507 • FAX: (718) 482-6729
Website: www.dec.state.ny.us



Alexander B
Grannis
Commissioner

Date: December 11, 2007

FOIL # R2-07-1919

Bedia Saray/ATC Associates, Inc
212-353-8280
Fax 212-979-8447

Re: 3 Sites in Manhattan: - 414 W 155th St
- 89-91 St Nicholas Place 8805013 & 9503535
- 886 St Nicholas Ave 9710796 & 9504500

Dear Ms. Saray:

:
NYSDEC/Region 2 has reviewed your request for the above referenced records under New York State's Freedom of Information Law (FOIL). Please note that most of our records are filed by number under the names of individuals or corporations. We have no way of locating or retrieving records if they are filed under names or addresses other than those you have provided.

If no records have been located, this does not necessarily mean, and should not be interpreted to mean that there have never been any violations, complaints, claims, investigations or inquiries involving those names or addresses. We cannot make any representations as to whether there are or have been any such violations, complaints, claims, investigations or inquiries.

☒ Attached are (3) pages free copy of the records located for the names and/or addresses you provided.

Thank you for your request. If additional information is needed, please call Gloria Silva/FOIL Secretary at (718) 482-4507, or fax your response to me.

Sincerely yours,

Fawzy I Abdelsadek, Ph.D., P.E.
Regional Enforcement Coordinator

Attachment (3) Pages

cc: Records Access Office

R2-07-1919

New York State Department of Environmental Conservation
Division of Solid & Hazardous Materials

**Acute, Non-Acute and Total Hazardous Waste Shipped per Calendar Month**

Search Criteria: Generator RCRA ID = NYR000011643 Shipped To: 01/01/1900 Through: 01/01/2099


GENERATOR ID: NYR000011643
NAME: GETTY PETROLEUM CORP
LOCATION ADDRESS: 89-91 ST NICHOLAS PL
NEW YORK, NY 10032-8004

MAILING ADDRESS: 89-91 ST NICHOLAS PL
NEW YORK, NY 10032-8004

DETAILS:

Month - Year	Acute (kg)	Non-Acute (kg)	Total (kg)
Aug-1995	0.00	624.00	624.00
Dec-2001	0.00	340.36	340.36
Jan-2006	0.00	645.45	645.45

New York State Department of Environmental Conservation
Regional Enforcement Coordinator, Region 2, Regional Direction
47-40 21ST Street, Long Island City, NY 11101-5407
Phone: (718) 482-4507 • FAX: (718) 482-6729
Website: www.dec.state.ny.us

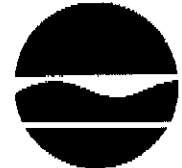

Alexander B
Grannis
Commissioner

Date: December 11, 2007

FOIL # R2-07-1919

Bedia Saray/ATC Associates, Inc
212-353-8280
Fax 212-979-8447

Re: 3 Sites in Manhattan: - 414 W 155th St
- 89-91 St Nicholas Place 8805013 & 9503535
- 886 St Nicholas Ave 9710796 & 9504500

Dear Ms. Saray:

NYSDEC/Region 2 has reviewed your request for the above referenced records under New York State's Freedom of Information Law (FOIL). Please note that most of our records are filed by number under the names of individuals or corporations. We have no way of locating or retrieving records if they are filed under names or addresses other than those you have provided.

If no records have been located, this does not necessarily mean, and should not be interpreted to mean that there have never been any violations, complaints, claims, investigations or inquiries involving those names or addresses. We cannot make any representations as to whether there are or have been any such violations, complaints, claims, investigations or inquiries.

☒ Attached are (3) pages free copy of the records located for the names and/or addresses you provided.

Thank you for your request. If additional information is needed, please call Gloria Silva/FOIL Secretary at (718) 482-4507, or fax your response to me.

Sincerely yours,

Fawzy I Abdelsadek, Ph.D., P.E.
Regional Enforcement Coordinator

Attachment (3) Pages

cc: Records Access Office

New York State Department of Environmental Conservation
Division of Solid & Hazardous Materials

R2-07-1919

**Acute, Non-Acute and Total Hazardous Waste Shipped per Calendar Month**

Search Criteria: Generator RCRA ID = NYR000011643 Shipped To: 01/01/1900 Through: 01/01/2099

GENERATOR ID: NYR000011643
NAME: GETTY PETROLEUM CORP
LOCATION ADDRESS: 89-91 ST NICHOLAS PL
NEW YORK, NY 10032-8004

MAILING ADDRESS: 89-91 ST NICHOLAS PL
NEW YORK, NY 10032-8004

DETAILS:

Month - Year	Acute (kg)	Non-Acute (kg)	Total (kg)
Aug-1995	0.00	624.00	624.00
Dec-2001	0.00	340.36	340.36
Sep-2006	0.00	545.45	545.45
Total	0.00	1,509.81	1,509.81



INSPECTION REPORT

SEARCH CRITERIA: Generator is 'NYR000011643'.

GEN / OFFEROR ID: NYR000011643

NAME: GETTY PETROLEUM CORP

LOCATION: 89-91 ST NICHOLAS PL

NEW YORK, NY 10032-8004

MAILING ADDRESS: 89-91 ST NICHOLAS PL
NEW YORK, NY 10032-8004

GEN / OFFER SHIP DATE	PAGE #	LINE #	TSDF / REC REC'D DATE	TRANS #1 RCRA ID	TSDF RCRA ID	CONTAINER # TYPE	TOTAL QTY	UNIT WT / VOL	WASTE CODE(S)	HANDLING CODE	MGMT CODE
MANIFEST NO:	060078423	1	09/21/2006	NYD04917829	CDX480000000	4 DF	1200	lbs	D001	B	H141
MANIFEST NO:	NYG3195549	1	01/02/2002	NYD07744426	NYD07744426	2 DM	90	gal	D001	B	
MANIFEST NO:	MAG2629280	1	08/22/1995	MAD03832225	MAD0534526	3 DM	165	gal	D001	B	

C 6T978

Please print or type. (Form designed for use on elite (12-pitch) typewriter.)

Form Approved, OMB No. 2050-0039

UNIFORM HAZARDOUS WASTE MANIFEST		1. Generator ID Number NYR000011643	2. Page 1 of 1	3. Emergency Response Phone 1800-424-9300	4. Manifest Tracking Number 000078423 JJK
5. Generator's Name and Mailing Address Getty's Service Station 99 Nicholas Place New York, New York Generator's Phone: 212 694-0240		Generator's Site Address (if different than mailing address) SAME			
6. Transporter 1 Company Name Radiac Research Corp.		U.S. EPA ID Number NYD049178296			
7. Transporter 2 Company Name		U.S. EPA ID Number			
8. Designated Facility Name and Site Address C.R.I. Environment Inc. 75 RUE-DU-PROGRESS STREET Ottawa-Du-Lac, Q.C. JOP 1B0 Facility's Phone: 450-763-5541		U.S. EPA ID Number C0X980000000 Canadian Provincial 1144102543			
9a. HM	9b. U.S. DOT Description (including Proper Shipping Name, Hazard Class, ID Number, and Packing Group (if any))	10. Containers No. Type		11. Total Quantity	12. Unit Wt./Vol.
X	1. Waste Flammable Liquid, nos, 3, UN1993, II (Gasoline Tank Bottoms) ERG#128	04	DF	1200	P
	2.				
	3.				
	4.				
13. Waste Codes D001 B					
14. Special Handling Instructions and Additional Information 3) LPC Primary Exporter's EPA Notice No. 181/06					
15. GENERATOR'S/OFFEROR'S CERTIFICATION: I hereby declare that the contents of this consignment are fully and accurately described above by the proper shipping name, and are classified, packaged, marked and labeled/placarded, and are in all respects in proper condition for transport according to applicable international and national governmental regulations. If export shipment and I am the Primary Exporter, I certify that the contents of this consignment conform to the terms of the attached EPA Acknowledgment of Consent. I certify that the waste minimization statement identified in 40 CFR 262.27(a) (if I am a large quantity generator) or (b) (if I am a small quantity generator) is true.					
Generator's/Officer's Printed/Typed Name RAGAIL ROSA		Signature Ragail Rosa		Month Day Year 9 15 06	
16. International Shipments ☐ Import to U.S. Transporter signature (for exports only) <i>John VE</i>		☒ Export from U.S. Port of entry/exit: CHAMPLAIN NY Date leaving U.S.: 9/20/06			
17. Transporter Acknowledgment of Receipt of Materials Transporter 1 Printed/Typed Name ED McCANNIE		Signature ED McCANNIE		Month Day Year 09 05 06	
Transporter 2 Printed/Typed Name		Signature		Month Day Year	
18. Discrepancy					
18a. Discrepancy Indication Space ☐ Quantity ☐ Type ☐ Residue ☐ Partial Rejection ☐ Full Rejection					
Manifest Reference Number:					
18b. Alternate Facility (or Generator) U.S. EPA ID Number					
Facility's Phone:					
18c. Signature of Alternate Facility (or Generator) Month Day Year					
19. Hazardous Waste Report Management Method Codes (i.e., codes for hazardous waste treatment, disposal, and recycling systems)					
1.	2.	3.	4.		
20. Designated Facility Owner or Operator: Certification of receipt of hazardous materials covered by the manifest except as noted in item 18a. Printed/Typed Name Loring Rust					
Signature Loring Rust					
Month Day Year 09 01 06					



104 East 25th Street
New York, NY 10010
Telephone: 212-353-8280
Facsimile: 212-979-8447

November 13, 2007

NYSDEC Region 2 Office
1 Hunters Point Plaza
47-40 21st Street
Long Island City, NY 11101

RE: Freedom of Information Law (FOIL) request
414 West 155th Street, New York, NY
89-91 St Nicholas Place, New York, NY (LTANKS IDs: 8805013 & 9503535)
886 St Nicholas Avenue, New York, NY (LTANKS IDs: 9710796 & 9504500)

Attn Foil Officer:

ATC Associates Inc. (ATC) is requesting to review any records available with respect to the above-mentioned properties. These records can include any registered underground or aboveground storage tanks, petroleum leaks and or spills, the storage or production of hazardous materials, etc. Please notify me once these records, if any, have been located.

Sincerely,

ATC Associates Inc.

A handwritten signature in black ink, appearing to read 'B. Saray', written in a cursive style.

Bedia Saray
Project Manager



104 East 25th Street
Tenth Floor
New York, NY 10010
Telephone: 212-353-8280
Facsimile: 212-979-8447

November 13, 2007

Ms. Rena Bryant
Secretary of the Health Department
NYC Department of Health
125 Worth Street
Room 604A - Box 31
New York, New York 10013
(212) 295-5383 (tel)
(212) 788-4315 (fax)

Sent-by-fax

Re: Freedom of Information Law Request
414 West 155th Street
New York, NY
(Block 2069, Lot 21)

Dear Ms. Bryant:

Pursuant to the Freedom of Information Act, please forward available non-identifying records regarding cases of reported lead poisoning, any information regarding USTs, spill records, remediation sites, dump sites, storage of hazardous material, and hazardous material activities to us as soon as possible.

Please let me know if there are any costs associated with this request prior to processing same. Your response can either be faxed or mailed to us at the fax number and/or location identified above. If you have any questions, please call me at (212) 353-8280, extension 330.

Sincerely,

ATC Associates Inc.

A handwritten signature in black ink, appearing to read 'B. Saray', written in a cursive style.

Bedia Saray
Project Manager



FIRE DEPARTMENT - CITY OF NEW YORK
Public Records Unit / Tanks Section

9 MetroTech Center
Brooklyn, New York 11201-3857
(718) 999-2441 or 2442



Tank Request Form

SECTION A

CUSTOMER INFORMATION

Please print your address and contact telephone number.

OFFICE USE ONLY

Cashier / Search No. _____

Name Bedia Saray; ATC Associates, Inc.

Address 104 E. 25th Street, 10th Floor

State New York, NY Zip Code 10010

Telephone Number (212) 353-8280 x330

Processing may take time, please choose one option below:

I will wait for it ☐ I will it pick-up ☐ Mail it to my address ☒

Note: Please make sure you complete this form and attach all required documents. Enclose a check or money order (made payable to the NYC Fire Department) and a self-addressed envelope (with postal stamp). Mail checks or money orders directly to the address and unit listed above. **DO NOT MAIL CASH.** Cash payments can only be made in person and accepted by our Cashiers Office (9am -3pm).

SECTION B

PLEASE PRINT THE ADDRESS TO BE SEARCHED.

House Number 414 Street Name West 155th Street, New York, NY

Borough (Block: 2069, Lot: 21)

CUSTOMER - PLEASE READ THE INFORMATION BELOW.

A CERTIFIED REPORT WILL BE MAILED TO THE ADDRESS YOU HAVE PROVIDED WITHIN **TEN (10) BUSINESS DAYS AFTER DATE SUBMITTED**. COMPUTER PRINTOUTS WILL BE PROVIDED ONLY UPON REQUEST.

After you have received the certified report, you may request a certified computer printouts and/or a copy of any related record for an additional fee of \$0.25 (cents) / per page. The fee for individual copies can only be determined after this search has been completed and you have received the related report. All payments are non-refundable.

Note: All listed tank information come from records, which exist in the FDNY District Office Folders and computer files. Also, please be advised that this search will not include records manually kept by Fire or Engine Companies, unless a summons for "Failure to Comply" was issued.

SECTION C

FUEL (HEATING) OIL TANKS - FEE \$10.00 / PER REPORT

If you would like to obtain a certified report, please complete this section by checking one or more boxes from the selection below.

☒ ITEM 1 - THE TOTAL AMOUNT AND SIZE OF EXISTING FUEL OIL / HEATING TANKS (includes installation date)

☒ ITEM 2 - THE TOTAL AMOUNT AND SIZE OF REMOVED OR SEALED FUEL OIL / HEATING TANKS

☐ ITEM 3 - OTHER: _____

For Office Use Only - Do not write in this section.

Searched By: _____ Date: ____/____/____

(PLEASE SEE OTHER SIDE OF FORM)

NEW YORK CITY DEPARTMENT OF ENVIRONMENTAL PROTECTION

Application for Records, Article 6 - New York State Public Officers Law, Freedom of Information Law

Complete Part I of this form. Please refer to instruction sheet for assistance in completing this form. If responsive records are located, you will be notified and informed of the required payment. Advance payment is required in check or money order payable to the City of New York before documents will be released. Send the complete application to the Records Access Officer at NYC DEP, Bureau of Legal Affairs, 59-17 Junction Blvd., 19th Fl., Flushing, NY 11373 or fax to (718) 595-6543

PART I. APPLICATION - Check Bureau(s) known or believed to have the record(s):

☐ Executive	☒ Asbestos	☒ Office of Environmental Planning and Assessment	☐ Water Records
☐ General Counsel	☒ Hazardous Materials	☐ Bureau of Wastewater Treatment	☐ Sewer Records
☐ Agency Chief Contracting Office	☐ Air & Noise	☒ Sewer discharge violations	☐ Bureau of Water Supply
☐ Bureau of Customer Services (Water Bills)	☒ Environmental Control Board	☐ Bureau of Water and Sewer Operations	☒ Water Quality
☒ Bureau of Environmental Compliance	☒ Bureau of Environmental Engineering		☐ DEP Police

I hereby apply to ☐ inspect or ☒ receive copies of the following records (use additional sheets as needed and attach):
Please forward all available information regarding USTs, spill records, remediation sites, dumpsites, storage of hazardous materials, hazardous material activities, etc as pertains to the following address:
414 West 155th Street
New York, NY (Block: 2069, Lot: 21)

Name: Bedia Saray Phone: (212) 353-8280 E-Mail: _____
 Firm: ATC Associates Inc.
 Address: 104 E. 25th Street, NY, NY 10010
 Signature: B. Saray Date: 11/13/07

PART II. DISPOSITION OF REQUEST (TO BE COMPLETED BY THE DEPARTMENT)

☐ APPROVED ☐ APPROVED IN PART - - To arrange for access to the records, please contact:

(Department Representative)

(Bureau)

(Phone No.)

Number of Pages: _____

x\$.25 per page = Cost: _____

☐ DENIED ☐ DENIED IN PART - - for reason(s) checked: References are to Sec. 87 of the Public Officers Law.

☐ Exempt: State/Fed. Statute (2(a))

☐ Exempt: Law Enforcement (2(e))

☐ Invasion of personal privacy (2(b))

☐ Inter/Intra-agency material (2(g))

☐ Competitive position injury (2(d))

☐ (Other) _____

Brief Description of records not subject to disclosure _____

A denial, in whole or in part, may be appealed within 30 days by writing to the NYCDEP FOIL Appeals Officer, 59-17 Junction Blvd., 19th Fl., Flushing, NY 11373

☐ UNAVAILABLE - - for reason(s) checked:

☐ Not described in sufficient detail

☐ Not maintained by this Department

☐ After search, no records responsive to request located

☐ (Other) _____

LOG NO.: _____

(Department Representative)

(Bureau)

(Date)

☐ Fee Waived

☐ Check/M.O. received

☐ Check/M.O. requested

DOC# 050303

APPENDIX K
LABORATORY REPORTS
(NOT USED)

APPENDIX L
OTHER SUPPORTING DOCUMENTATION



CURRENT OWNERSHIP REPORT

CLIENT INFORMATION

Client:	ATC Associates Inc (NY-New York)	Report Date:	11/16/2007
Client No.:	12021	Index Date:	11/14/2007
Address:	104 East 25th St. 8th Floor New York, NY 10010	Order ID:	711-200-1-2935
Contact:	Bedia Saray	Client Ref.:	414 West 155th Street
Phone:	212-353-8280	PO Number:	N/A
Delivery:	bedia.saray@atcassociates.com		

CURRENT OWNER INFORMATION

Current Owner of Record:	Gargage Estates Co
Current Site Address:	414 West 155th Street New York, NY 10032
County of Research:	NEW YORK

LEGAL DESCRIPTION

ALL THAT CERTAIN PLOT, PIECE OR PARCEL OF LAND WITH THE BUILDINGS AND IMPROVEMENTS THEREON ERECTED, SITUATE, LYING AND BEING IN THE BOROUGH OF MANHATTAN, CITY AND STATE OF NEW JERSEY, BEING MORE FULLY DESCRIBED IN VOLUME 1508, PAGE 2172 IN THE DEED RECORDS OF NEW YORK COUNTY, NEW JERSEY.

NOTE: Ameristar does not represent that the above legal description, acreage, or square footage calculations are correct. We have taken this information directly from a document recorded at the courthouse.

TAX INFORMATION

PARCEL IDENTIFICATION NUMBER:	Block 2069 Lot 21
<u>TAX VALUE INFORMATION</u>	<u>SPECIAL COMMENTS</u>
Total Value:	None

DISCLAIMER: This report contains information obtained from public records, and being that our company is not the primary provider of such, Ameristar cannot and will not, for the fee charged, be an insurer or guarantor of the accuracy or reliability of said information. Ameristar does not guarantee or warrant the accuracy, timeliness, completeness, currentness, merchantability or fitness for a particular purpose of services provided. Further, Ameristar's sole liability is limited to the cost of this report only. Ameristar is not liable to user for any loss or injury arising out of or caused, in whole or in part, by Ameristar's acts or omissions, whether negligent or otherwise, in procuring, compiling, collecting, interpreting, reporting, communicating, or delivering the services or information contained herein. THIS REPORT IS NOT AN ABSTRACT, OPINION OF TITLE, TITLE COMMITMENT NOR GUARANTEE, OR TITLE INSURANCE POLICY.

DEED / CURRENT OWNERSHIP INFORMATION**BARGAIN AND SALE DEED:**

DATED: 12/03/1988
GRANTOR: Garage Estates, Inc., a corporation
GRANTEE: Garage Estates Company
VOLUME: 1508 **PAGE:** 2172

ENVIRONMENTAL LIEN INFORMATION

**NONE FOUND OF RECORD.*

GENERAL ENCUMBRANCES INFORMATION

**NONE FOUND OF RECORD.*

REEL 150862172

THIS INDENTURE, made the 22 day of December, nineteen hundred and eighty-eight BETWEEN GARAGE ESTATES, INC., a corporation organized and existing under and by virtue of the Laws of the State of New York, with its principal office c/o Kooperstein, 160 East 48th Street, Borough of Manhattan, City and State of New York,

party of the first part, and GARAGE ESTATES COMPANY, with its office c/o Kooperstein, 160 East 48th Street, Borough of Manhattan, City and State of New York

party of the second part,

WITNESSETH, that the party of the first part, in consideration of ten dollars and other valuable consideration paid by the party of the second part, does hereby grant and release unto the party of the second part, the heirs or successors and assigns of the party of the second part forever,

ALL that certain plot, piece or parcel of land, with the buildings and improvements thereon erected, situate, lying and being in the Borough of Manhattan, City and State of New York, bounded and described as follows:

BEGINNING at a point on the Southerly side of 155th Street distant 45 feet Westerly from the corner formed by the intersection of the Southerly side of 155th Street with the Westerly side of St. Nicholas Place; thence Westerly along the Southerly side of 155th Street 154 feet 3-3/4 inches to the Easterly line of the land of the Mayor, Alderman and Commonalty of the City of New York, commonly known as land of the Croton Aqueduct; thence Southerly along said line belonging to the City of New York, 144 feet 3 inches; thence Easterly 154 feet 3-3/4 inches; thence Northerly and forming a line at right angles with the Southerly side of 155th Street, approximately 137 feet to the point or place of BEGINNING; being the said several dimensions more or less.

Said premises being known and designated as Nos. 404-414 West 155th Street New York City and being the same premises as were conveyed by H. Casabianca, Inc. to Garage Estates, Inc. by deed dated February 28, 1956 and recorded on March 6, 1956 in the Office of the City Register, County of New York in Liber 4956 of Conveyances, Pages 267 and 268.

SUBJECT to any state of facts an accurate survey may show provided the same does not render the title unmarketable.

SUBJECT to existing leases and tenancies.

SUBJECT to covenants, restrictions and easements, if any, contained in prior instruments of record, provided they do not prohibit erection, maintenance and present use of existing structure.

TAX MAP
DESIGNATION

Dist.

Sec.

BL.

Lot(s):

TOGETHER with all right, title and interest, if any, of the party of the first part in and to any streets and roads abutting the above described premises to the center lines thereof; TOGETHER with the appurtenances and all the estate and rights of the party of the first part in and to said premises; TO HAVE AND TO HOLD the premises herein granted unto the party of the second part, the heirs or successors and assigns of the party of the second part forever.

AND the party of the first part, in compliance with Section 13 of the Lien Law, covenants that the party of the first part will receive the consideration for this conveyance and will hold the right to receive such consideration as a trust fund to be applied first for the purpose of paying the cost of the improvement and will apply the same first to the payment of the cost of the improvement before using any part of the total of the same for any other purpose.

The word "party" shall be construed as if it read "parties" whenever the sense of this indenture so requires.

IN WITNESS WHEREOF, the party of the first part has duly executed this deed the day and year first above written.

IN PRESENCE OF:

[Signature]
SEAL
1953
NEW YORK

GARAGE ESTATES, INC.

By

[Signature]

President

REEL 1508 PG 2172

THIS INDENTURE, made the 21 day of December, nineteen hundred and eighty-eight
BETWEEN GARAGE ESTATES, INC., a corporation organized and existing
under and by virtue of the Laws of the State of New York, with its
principal office c/o Kooperstein, 160 East 48th Street, Borough of
Manhattan, City and State of New York,

party of the first part, and GARAGE ESTATES COMPANY, with its office c/o Kooper-
stein, 160 East 48th Street, Borough of Manhattan, City and State
of New York

party of the second part,

WITNESSETH, that the party of the first part, in consideration of ten dollars and other valuable consideration
paid by the party of the second part, does hereby grant and release unto the party of the second part, the heirs
or successors and assigns of the party of the second part forever,

ALL that certain plot, piece or parcel of land, with the buildings and improvements thereon erected, situate,
lying and being in the Borough of Manhattan, City and State of New York,
bounded and described as follows:

BEGINNING at a point on the Southerly side of 155th Street distant
45 feet Westerly from the corner formed by the intersection of the
Southerly side of 155th Street with the Westerly side of St. Nicholas
Place; thence Westerly along the Southerly side of 155th Street 154
feet 3-3/4 inches to the Easterly line of the land of the Mayor,
Alderman and Commonalty of the City of New York, commonly known as
land of the Croton Aqueduct; thence Southerly along said line belong-
ing to the City of New York, 144 feet 3 inches; thence Easterly 154
feet 3-3/4 inches; thence Northerly and forming a line at right
angles with the Southerly side of 155th Street, approximately 137
feet to the point or place of BEGINNING; being the said several
dimensions more or less.

Said premises being known and designated as Nos. 404-414 West 155th
Street New York City and being the same premises as were conveyed by
H. Casabianca, Inc. to Garage Estates, Inc. by deed dated February
28, 1956 and recorded on March 6, 1956 in the Office of the City
Register, County of New York in Liber 4956 of Conveyances, Pages 267
and 268.

SUBJECT to any state of facts an accurate survey may show provided
the same does not render the title unmarketable.

SUBJECT to existing leases and tenancies.

SUBJECT to covenants, restrictions and easements, if any, contained
in prior instruments of record, provided they do not prohibit erection
maintenance and present use of existing structure.

TAX MAP
DESIGNATION

Dist.

Sec.

Blk.

Lot(s):

TOGETHER with all right, title and interest, if any, of the party of the first part in and to any streets and
roads abutting the above described premises to the center lines thereof; TOGETHER with the appurtenances
and all the estate and rights of the party of the first part in and to said premises; TO HAVE AND TO
HOLD the premises herein granted unto the party of the second part, the heirs or successors and assigns of
the party of the second part forever.

AND the party of the first part, in compliance with Section 13 of the Lien Law, covenants that the party of
the first part will receive the consideration for this conveyance and will hold the right to receive such consid-
eration as a trust fund to be applied first for the purpose of paying the cost of the improvement and will apply
the same first to the payment of the cost of the improvement before using any part of the total of the same for
any other purpose.

The word "party" shall be construed as if it read "parties" whenever the sense of this indenture so requires.

IN WITNESS WHEREOF, the party of the first part has duly executed this deed the day and year first above
written.


IN WITNESS OF:

GARAGE ESTATES, INC.

By

E. H. Klein

President

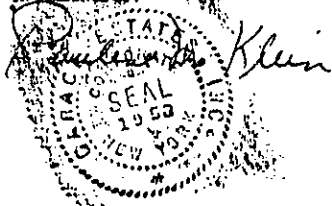

APPENDIX M
TERMINOLOGY

TERMINOLOGY

The following provides definitions and descriptions of certain terms that may be used in this report. Italics indicate terms that are defined by ASTM Standard Practice E 1527-05. The Standard Practice should be referenced for further detail (such as the precise wording), related definitions or additional explanation regarding the meaning of terms.

recognized environmental condition(s) (REC) - the presence or likely presence of any *hazardous substances* or *petroleum products* on a *property* under conditions that indicate an existing release, a past release, or a *material threat* of a release of any *hazardous substances* or *petroleum products* into structures on the *property* or into the ground, ground water, or surface water of the *property*. The term includes *hazardous substances* or *petroleum products* even under conditions in compliance with laws. The term is not intended to include *de minimis* conditions.

de minimis conditions – are conditions that generally do not present a threat to human health or the environment and that generally would not be the subject of an enforcement action if brought to the attention of appropriate governmental agencies. Conditions determined to be *de minimis* are not *recognized environmental conditions*.

historical recognized environmental condition(s) (HREC) - environmental condition which in the past would have been considered a *recognized environmental condition*, but which may or may not be considered a *recognized environmental condition* currently. The final decision rests with the *environmental professional* and will be influenced by the current impact of the *historical recognized environmental condition* on the *property*. If a past release of any *hazardous substances* or *petroleum products* has occurred in connection with the property and has been remediated, with such remediation accepted by the responsible regulatory agency (for example, as evidenced by the issuance of a no further action letter or equivalent), this condition shall be considered a *historical recognized environmental condition*.

material threat – a physically observable or *obvious* threat which is reasonably likely to lead to a release that, in the opinion of the *environmental professional*, is threatening and might result in impact to public health or the environment. An example might include an aboveground storage tank system that contains a *hazardous substance* and which shows evidence of damage such that it may cause or contribute to tank integrity failure with a release of contents to the environment.

threat to human health or the environment – a substantial risk of harm to public health or the environment resulting from the presence or likely presence of an existing release, a past release, or a *material threat* of a release of any *hazardous substances* or *petroleum products* into structures on the *property* or into the ground, ground water, or surface water of the *property*. An example might include a release of a *hazardous substance* in concentrations exceeding applicable governmental agency standards under conditions that could reasonably and foreseeably result in substantial exposure to humans or substantial damage to natural resources. The risk of that exposure or damage would represent a threat to human health or the environment.

generally would not be the subject of an enforcement action – the likelihood that an environmental condition would not be subject to enforcement action if brought to the attention of appropriate governmental agencies. If the circumstances suggest an enforcement action would be less likely than not, then the condition is considered to be generally not the likely the subject of an enforcement action.